

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus SAS: Docket No. FAA-2022-0464; Project Identifier MCAI-2021-01290-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by June 2, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Airbus SAS Model A350-941 and -1041 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 22, Auto Flight.

(e) Unsafe Condition

This AD was prompted by a report of inadvertent auto flight system (AFS) altitude changes on the flight control unit (FCU); an investigation revealed that, depending on the ring selection, failure of the ALT knob on the FCU could change the target altitude. The FAA is issuing this AD to address erroneous target altitude during descent, climb, or go-around, which could result in an unexpected vertical trajectory deviation and loss of correct situational awareness that could potentially result in uncontrolled impact with the ground.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2021-0260, dated November 18, 2021 (EASA AD 2021-0260).

(h) Exceptions to EASA AD 2021-0260

(1) Where EASA AD 2021-0260 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where paragraph (1) of EASA AD 2021-0260 specifies to “inform all flight crews, and

thereafter, operate the aeroplane accordingly,” this AD does not require those actions as those actions are already required by existing FAA operating regulations.

(3) The “Remarks” section of EASA AD 2021-0260 does not apply to this AD.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(j) Related Information

(1) For information about EASA AD 2021-0260, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0464.

(2) For more information about this AD, contact Dan Rodina, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3225; email dan.rodina@faa.gov.

Issued on April 11, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-08219 Filed 4-15-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2022-0463; Project Identifier MCAI-2021-00895-T]

RIN 2120-AA64**Airworthiness Directives; Airbus SAS Airplanes**

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus SAS Model A318, A319, A320, and A321 series airplanes. This proposed AD was prompted by a report that damage (including delamination of work deck, and corroded and cracked retainer blocks) was found during inspection of certain galleys. This proposed AD would require repetitive inspections of certain galleys for corrosion of trolley retainer aluminum blocks and delamination of the upper panel of the trolley compartment, and applicable corrective action, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. This proposed AD would also limit the installation of affected parts under certain conditions. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by June 2, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For EASA material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this material on the EASA website at <https://ad.easa.europa.eu>. You may view this

material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0463.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0463; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email vladimir.ulyanov@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-0463; Project Identifier MCAI-2021-00895-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM

contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email vladimir.ulyanov@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2021-0183R1, dated September 20, 2021 (EASA AD 2021-0183R1) (also referred to as the MCAI), to correct an unsafe condition for all Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N airplanes; Model A320-211, -212, -214, -215, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX airplanes. Model A320-215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

This proposed AD was prompted by a report that damage (including delamination of the work deck, and corroded and cracked retainer blocks) was found during inspection of certain galleys. The FAA is proposing this AD to detect and correct damage that could affect the galley’s capability to hold the trolley under emergency landing loads, which could lead to trolley detachment, possibly resulting in blocking of an escape path during an emergency exit. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

EASA AD 2021-0183R1 specifies procedures for repetitive general visual inspections of certain galleys for

discrepancies including corrosion of trolley retainer aluminum blocks and delamination of upper panel of trolley compartment, and corrective action. Corrective actions include repeating the inspection at an earlier interval, repairing the trolley compartment upper panel, and limiting trolley weight. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

These products have been approved by the aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of these same type designs.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2021-0183R1 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD. This proposed AD would also limit the installation of affected parts under certain conditions.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2021-0183R1 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2021-0183R1 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2021-0183R1 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is

not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2021–0183R1. Service information required by EASA AD 2021–0183R1 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No.

FAA–2022–0463 after the FAA final rule is published.

Interim Action

The FAA considers this proposed AD interim action. If final action is later identified, the FAA might consider further rulemaking then.

Costs of Compliance

The FAA estimates that this proposed AD would affect 1,425 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
2 work-hours × \$85 per hour = \$170 per galley, per inspection cycle.	\$0	\$170 per inspection cycle	\$242,250 per inspection cycle.

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need these on-condition actions:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
1 work-hour × \$85 per hour = \$85 per galley	Minimal	\$85

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus SAS: Docket No. FAA–2022–0463; Project Identifier MCAI–2021–00895–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by June 2, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Airbus SAS Model airplanes identified in paragraphs (c)(1) through (4) of this AD, certificated in any category.

(1) Model A318–111, –112, –121, and –122 airplanes.

(2) Model A319–111, –112, –113, –114, –115, –131, –132, –133, –151N, –153N, and –171N airplanes.

(3) Model A320–211, –212, –214, –216, –231, –232, –233, –251N, –252N, –253N, –271N, –272N, and –273N airplanes.

(4) Model A321–111, –112, –131, –211, –212, –213, –231, –232, –251N, –251NX, –252N, –252NX, –253N, –253NX, –271N, –271NX, –272N, and –272NX airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

(e) Unsafe Condition

This AD was prompted by a report that damage (including delamination of work deck, and corroded and cracked retainer blocks) was found during inspection of certain galleys. The FAA is issuing this AD to detect and correct damage that could affect the galley’s capability to hold the trolley under emergency landing loads, which could lead to trolley detachment, possibly resulting in blocking of an escape path during an emergency exit.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation

Safety Agency (EASA) EASA AD 2021–0183R1, dated September 20, 2021 (EASA AD 2021–0183R1).

(h) Exceptions to EASA AD 2021–0183R1

(1) Where EASA AD 2021–0183R1 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where EASA AD 2021–0183R1 refers to “18 August 2021,” this AD requires using the effective date of this AD.

(3) The “Remarks” section of EASA AD 2021–0183R1 does not apply to this AD.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2021–0183R1 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph(s) (j)(2) and (i) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(k) Related Information

(1) For EASA AD 2021–0183R1, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet

www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0463.

(2) For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3229; email vladimir.ulyanov@faa.gov.

Issued on April 11, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–08220 Filed 4–15–22; 8:45 am]

BILLING CODE 4910–13–P

ENVIRONMENTAL PROTECTION AGENCY

40 CFR Part 52

[EPA–R01–OAR–2022–0112; FRL–9734–01–R1]

Air Plan Approval; New Hampshire; Rules for Particulate Emissions From Open Sources, Sand and Gravel and Related Sources

AGENCY: Environmental Protection Agency (EPA).

ACTION: Proposed rule.

SUMMARY: The Environmental Protection Agency (EPA) is proposing to approve State Implementation Plan (SIP) revisions of New Hampshire Code of Administrative Rules Chapters Env-A 1000 and Env-A 2800 submitted by the State of New Hampshire on January 8, 2020, and August 19, 2021, respectively. Env-A 1000 establishes requirements for open burning, fugitive dust, and firefighter instruction and training activities. Env-A 2800 sets particulate matter (PM), visible emissions (VE), and fugitive dust standards for sand and gravel sources, non-metallic mineral processing plants, and cement and concrete sources. This action is being taken under the Clean Air Act.

DATES: Written comments must be received on or before May 18, 2022.

ADDRESSES: Submit your comments, identified by Docket ID No. EPA–R01–OAR–2022–0112 at <https://www.regulations.gov>, or via email to maiti.pujarini@epa.gov. For comments submitted at [Regulations.gov](https://www.regulations.gov), follow the online instructions for submitting comments. Once submitted, comments

cannot be edited or removed from [Regulations.gov](https://www.regulations.gov). For either manner of submission, the EPA may publish any comment received to its public docket. Do not submit electronically any information you consider to be Confidential Business Information (CBI) or other information whose disclosure is restricted by statute. Multimedia submissions (audio, video, etc.) must be accompanied by a written comment. The written comment is considered the official comment and should include discussion of all points you wish to make. The EPA will generally not consider comments or comment contents located outside of the primary submission (*i.e.* on the web, cloud, or other file sharing system). For additional submission methods, please contact the person identified in the **FOR FURTHER INFORMATION CONTACT** section. For the full EPA public comment policy, information about CBI or multimedia submissions, and general guidance on making effective comments, please visit <https://www2.epa.gov/dockets/commenting-epa-dockets>. Publicly available docket materials are available at <https://www.regulations.gov> or at the U.S. Environmental Protection Agency, EPA Region 1 Regional Office, Air and Radiation Division, 5 Post Office Square—Suite 100, Boston, MA. EPA requests that if at all possible, you contact the contact listed in the **FOR FURTHER INFORMATION CONTACT** section to schedule your inspection. The Regional Office’s official hours of business are Monday through Friday, 8:30 a.m. to 4:30 p.m., excluding legal holidays and facility closures due to COVID–19.

FOR FURTHER INFORMATION CONTACT: Pujarini Maiti, Air Quality Planning Unit, Air Programs Branch (Mail Code OEP05–02), U.S. Environmental Protection Agency, Region 1, 5 Post Office Square, Suite 100, Boston, Massachusetts, 02109–3912; (617) 918–1625; maiti.pujarini@epa.gov.

SUPPLEMENTARY INFORMATION: Throughout this document whenever “we,” “us,” or “our” is used, we mean EPA.

Table of Contents

- I. Background and Purpose
- II. EPA’s Evaluation of New Hampshire’s SIP Revisions
- III. Proposed Action
- IV. Incorporation by Reference
- V. Statutory and Executive Order Reviews

I. Background and Purpose

On January 8, 2020, the New Hampshire Department of Environmental Services (NH DES) submitted a revision of New Hampshire Code of Administrative Rules Chapter