

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by:
 ■ a. Removing Airworthiness Directive AD 2021–19–08, Amendment 39–21726 (86 FR 49915, September 7, 2021); and
 ■ b. Adding the following new airworthiness directive:

Robinson Helicopter Company: Docket No. FAA–2022–0872; Project Identifier AD–2022–00431–R.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) action by August 29, 2022.

(b) Affected ADs

This AD replaces AD 2021–19–08, Amendment 39–21726 (86 FR 49915, September 7, 2021) (AD 2021–19–08).

(c) Applicability

This AD applies to the following Robinson Helicopter Company (Robinson) helicopters, certificated in any category:

- (1) Robinson Model R44 and R44 II helicopters with a tail rotor blade (blade) part number (P/N) C029–3 with serial number (S/N) 9410 through 9909 inclusive, installed;
 (2) Robinson Model R44 and R44 II helicopters with a blade P/N C029–3 with S/N 9910 through 10659 inclusive, installed; and
 (3) Robinson Model R66 helicopters with a blade P/N F029–1 with S/N 2410 through 2589 inclusive, installed.

(d) Subject

Joint Aircraft System Component (JASC) Code: 6410, Tail Rotor Blades.

(e) Unsafe Condition

This AD was prompted by reports of cracked blades. The FAA is issuing this AD to detect and prevent cracks in the affected blades. The unsafe condition, if not addressed, could result in reduced controllability and subsequent loss of control of the helicopter.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

- (1) Before further flight after the effective date of this AD and thereafter before each flight, check each blade at the leading edge for a crack. This action may be performed by the owner/operator (pilot) holding at least a

private pilot certificate and must be entered into the aircraft records showing compliance with this AD in accordance with 14 CFR 43.9(a) and 14 CFR 91.417(a)(2)(v). The record must be maintained as required by 14 CFR 91.417, 121.380, or 135.439.

- (2) If there is any crack, before further flight, remove the blade from service.

(3) For helicopters identified in paragraph (c)(1) of this AD, within 3 months after September 22, 2021 (the effective date of AD 2021–19–08) remove from service any blade identified in paragraph (c)(1) of this AD.

(4) For helicopters identified in paragraphs (c)(2) and (3) of this AD, within 6 months after the effective date of this AD, remove from service any blade identified in paragraph (c)(2) or (3) of this AD, as applicable to your model helicopter.

(5) For helicopters identified in paragraph (c)(1) of this AD, as of September 22, 2021 (the effective date of AD 2021–19–08), do not install a blade identified in paragraph (c)(1) of this AD on any helicopter.

(6) For helicopters identified in paragraphs (c)(2) and (3) of this AD, as of the effective date of this AD, do not install a blade identified in paragraph (c)(2) or (3) of this AD, as applicable to your model helicopter, on any helicopter.

(h) Special Flight Permits

Special flight permits are prohibited.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-REQUESTS@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) AMOCs approved previously for AD 2021–19–08 are approved as AMOCs for the corresponding requirements in paragraph (g) of this AD.

(j) Related Information

For more information about this AD, contact James Guo, Aerospace Engineer, Airframe Section, Los Angeles ACO Branch, Compliance & Airworthiness Division, FAA, 3960 Paramount Blvd., Lakewood, CA 90712; telephone (562) 627–5357; email james.guo@faa.gov.

Issued on July 7, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–14830 Filed 7–12–22; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2022–0873; Project Identifier MCAI–2022–00060–T]

RIN 2120–AA64

Airworthiness Directives; Embraer S.A. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Embraer S.A. Model EMB–545 and EMB–550 airplanes. This proposed AD was prompted by a report that there is a possibility of the shoulder belt getting stuck during flight due to a step between the divan shroud chamfer and the sideledge panel. This proposed AD would require installing, on the right- and left-hand side divan, a protective fairing covering on the divan shroud and the sideledge panel, as specified in an Agência Nacional de Aviação Civil (ANAC) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 29, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202–493–2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact National Civil Aviation Agency (ANAC), Aeronautical Products Certification Branch (GGCP), Rua Dr. Orlando Feirabend Filho, 230—Centro Empresarial Aquarius—Torre B—Andares 14 a 18, Parque Residencial Aquarius, CEP 12.246–190—São José dos Campos—SP, Brazil; telephone 55 (12) 3203–6600; email pac@anac.gov.br; internet www.anac.gov.br/en/. You may find this material on the ANAC website

at <https://sistemas.anac.gov.br/certificacao/DA/DAE.asp>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0873.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0873; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Ho-Joon Lim, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206–231–3405; email ho-joon.lim@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2022–0873; Project Identifier MCAI–2022–00060–T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Ho-Joon Lim, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206–231–3405; email ho-joon.lim@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

ANAC, which is the aviation authority for Brazil, has issued ANAC AD 2021–11–01R1, effective January 21, 2022 (ANAC AD 2021–11–01R1) (also referred to as the MCAI), to correct an unsafe condition for certain Embraer S.A. Model EMB–545 and EMB–550 airplanes.

This proposed AD was prompted by a report that there is a possibility of the shoulder belt getting stuck during flight due to a step between the divan shroud chamfer and the sideedge panel. This set up may interfere with the correct kinematics of the shoulder belt during its retraction. The FAA is proposing this AD to address the possibility of a stuck shoulder belt during flight, which could affect the shoulder belt release during turbulence or an emergency landing situation and result in injury to passengers and the flightcrew. See the MCAI for additional background information.

Related Service Information Under 1 CFR Part 51

ANAC AD 2021–11–01R1 specifies procedures for installing, on the right- and left-hand side divan, a protective fairing covering on the divan shroud and the sideedge panel. This material is

reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

These products have been approved by the aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of these same type designs.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in ANAC AD 2021–11–01R1 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate ANAC AD 2021–11–01R1 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with ANAC AD 2021–11–01R1 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Service information required by ANAC AD 2021–11–01R1 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0873 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this proposed AD would affect 63 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 14 work-hours × \$85 per hour = Up to \$1,190	\$400	Up to \$1,590	Up to \$100,170.

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators. The FAA does not control warranty coverage for affected operators. As a result, the FAA has included all known costs in the cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Embraer S.A.: Docket No. FAA-2022-0873; Project Identifier MCAI-2022-00060-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by August 29, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Embraer S.A. Model EMB-545 and EMB-550 airplanes, certificated in any category, as identified in paragraph (a)(2) of Agência Nacional de Aviação Civil (ANAC) AD 2021-11-01R1, effective January 21, 2022 (ANAC AD 2021-11-01R1).

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

(e) Unsafe Condition

This AD was prompted by a report that there is a possibility of the shoulder belt getting stuck during flight due to a step between the divan shroud chamfer and the sideedge panel. This set up may interfere with the correct kinematics of the shoulder belt during its retraction. The FAA is issuing this AD to address the possibility of a stuck shoulder belt during flight, which could affect the shoulder belt release during turbulence or an emergency landing situation and result in injury to passengers and the flightcrew.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, ANAC AD 2021-11-01R1.

(h) Exceptions to ANAC AD 2021-11-01R1

(1) Where ANAC AD 2021-11-01R1 refers to its effective date, this AD requires using the effective date of this AD.

(2) The requirements specified in paragraph (b)(1) of ANAC AD 2021-11-01R1 do not apply to this AD.

(3) Where paragraph (b)(2) of ANAC AD 2021-11-01R1 specifies that it applies to certain airplanes, replace the text "airplanes identified in paragraph (a)(2) of this [ANAC] AD, and which are not listed in the paragraph (a)(1) of this [ANAC] AD," with "airplanes identified in paragraph (a)(2) of this [ANAC] AD."

(4) The "Alternative method of compliance (AMOC)" section of ANAC AD 2021-11-01R1 does not apply to this AD.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or ANAC; or ANAC's authorized Designee. If approved by the ANAC Designee, the approval must include the Designee's authorized signature.

(j) Related Information

(1) For ANAC AD 2021-11-01R1, contact National Civil Aviation Agency (ANAC), Aeronautical Products Certification Branch (GGCP), Rua Dr. Orlando Feirabend Filho, 230—Centro Empresarial Aquarius—Torre B—Andares 14 a 18, Parque Residencial Aquarius, CEP 12.246-190—São José dos Campos—SP, Brazil; telephone 55 (12) 3203-6600; email pac@anac.gov.br; internet www.anac.gov.br/en/. You may find this ANAC AD on the ANAC website at <https://sistemas.anac.gov.br/certificacao/DA/DAE.asp>. You may view this material at the FAA, Airworthiness Products Section,

Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0873.

(2) For more information about this AD, contact Ho-Joon Lim, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3405; email ho-joon.lim@faa.gov.

Issued on July 7, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-14867 Filed 7-12-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2022-0824; Airspace Docket No. 21-ASO-33]

RIN 2120-AA66

Proposed Amendment and Revocation of Area Navigation (RNAV) Routes; Southeastern and Northeastern United States

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking.

SUMMARY: This action proposes to amend Area Navigation (RNAV) route Q-81 to realign a portion of the route to improve traffic flows, and to remove Canadian RNAV route Q-947 at the request of NavCanada. These changes would support the Northeast Corridor Atlantic Coast Route Project.

DATES: Comments must be received on or before August 12, 2022.

ADDRESSES: Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE, West Building Ground Floor, Room W12-140, Washington, DC 20590; telephone: 1 (800) 647-5527 or (202) 366-9826. You must identify FAA Docket No. FAA-2022-0824; Airspace Docket No. 21-ASO-33 at the beginning of your comments. You may also submit comments through the internet at <http://www.regulations.gov>.

FAA Order JO 7400.11F, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at http://www.faa.gov/air_traffic/publications/. For further information, you can contact the Rules and Regulations Group, Federal Aviation

Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783.

FOR FURTHER INFORMATION CONTACT: Paul Gallant, Rules and Regulations Group, Office of Policy, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; telephone: (202) 267-8783.

SUPPLEMENTARY INFORMATION:

Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of the airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it expands the availability of RNAV routes in the National Airspace System, increases airspace capacity, and reduces complexity in high air traffic volume areas.

Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (FAA Docket No. FAA-2022-0824; Airspace Docket No. 21-ASO-33) and be submitted in triplicate to the Docket Management Facility (see **ADDRESSES** section for address and phone number). You may also submit comments through the internet at <http://www.regulations.gov>.

Commenters wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to FAA Docket No. FAA-2022-0824; Airspace Docket No. 21-ASO-33." The postcard will be date/time stamped and returned to the commenter.

All communications received on or before the specified comment closing date will be considered before taking action on the proposed rule. The proposal contained in this action may be changed in light of comments received. All comments submitted will be available for examination in the public docket both before and after the comment closing date. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

Availability of NPRM

An electronic copy of this document may be downloaded through the internet at <https://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's web page at https://www.faa.gov/air_traffic/publications/airspace_amendments/. You may review the public docket containing the proposal, any comments received and any final disposition in person in the Dockets Office (see **ADDRESSES** section for address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. An informal docket may also be examined during normal business hours at the office of the Eastern Service Center, Federal Aviation Administration, Room 210, 1701 Columbia Ave., College Park, GA 30337.

Availability and Summary of Documents for Incorporation by Reference

This document proposes to amend FAA Order JO 7400.11F, Airspace Designations and Reporting Points, issued August 10, 2021, and effective September 15, 2021. FAA Order JO 7400.11F is publicly available as listed in the **ADDRESSES** section of this proposed rule. FAA Order JO 7400.11F lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.

The Proposal

The FAA is proposing an amendment to 14 CFR part 71 to modify Q-81 in the southeastern United States, and removing Canadian route Q-947 in the northeastern United States.

Q-81: Q-81 currently extends from the TUNSL, FL., waypoint (WP), to the HONID, GA, WP. This proposal would amend the current route segments between the FIPES, OG, WP and the FARLU, FL, WP, by removing the THMPR, FL, WP and the LEEHI, FL, WP, and inserting the ZEILR, FL, Fix, and the PIKKR, OG, WP. The effect of this change would be to realign the track