

*fr.inspection@nara.gov*, or go to:  
[www.archives.gov/federal-register/cfr/ibr-locations.html](http://www.archives.gov/federal-register/cfr/ibr-locations.html).

Issued on January 27, 2023.

**Christina Underwood,**

*Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2023-03138 Filed 2-14-23; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2023-0165; Project Identifier MCAI-2022-01003-T]

RIN 2120-AA64

#### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2019-24-13, which applies to certain Airbus SAS Model A318 series airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2019-24-13 requires repetitive high-frequency eddy current (HFEC) inspections for cracking of a stiffener of a certain lateral window frame, and applicable related investigative and corrective actions, as applicable. Since the FAA issued AD 2019-24-13, it was determined that certain inspection times need to be revised. This proposed AD would retain the requirements of AD 2019-24-13, with amended compliance times, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by April 3, 2023.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to [regulations.gov](http://regulations.gov). Follow the instructions for submitting comments.
- **Fax:** 202-493-2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room

W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

**AD Docket:** You may examine the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2023-0165; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

**Material Incorporated by Reference:**

• For EASA material that is proposed for IBR in this NPRM, you may contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADS@easa.europa.eu](mailto:ADS@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this material on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu). It is also available at [regulations.gov](http://regulations.gov) under Docket No. FAA-2023-0165.

• You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**FOR FURTHER INFORMATION CONTACT:** Dan Rodina, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3225; email [Dan.Rodina@faa.gov](mailto:Dan.Rodina@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2023-0165; Project Identifier MCAI-2022-01003-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](http://regulations.gov), including any personal information you provide. The agency

will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Dan Rodina, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3225; email [Dan.Rodina@faa.gov](mailto:Dan.Rodina@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Background

The FAA issued AD 2019-24-13, Amendment 39-21002 (84 FR 71788, December 30, 2019) (AD 2019-24-13), for certain Airbus SAS Model A318 series airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2019-24-13 was prompted by an MCAI originated by EASA, which is the Technical Agent for the Member States of the European Union. EASA issued AD 2019-0067R1, dated September 11, 2019 (EASA AD 2019-0067R1), to correct an unsafe condition.

AD 2019-24-13 requires repetitive HFEC inspections for cracking of a stiffener of a certain lateral window frame, and rework, repair, or replacement of the lateral window frame, as applicable, as specified in EASA AD 2019-0067R1. The FAA issued AD 2019-24-13 to address cracking of the horizontal upper stiffener of the lateral window frame, which could reduce the structural integrity of the fuselage.

**Actions Since AD 2019–24–13 Was Issued**

Since the FAA issued AD 2019–24–13, EASA superseded EASA AD 2019–0067R1 and issued EASA AD 2022–0151, dated July 26, 2022 (EASA AD 2022–0151) (also referred to as the MCAI), to correct an unsafe condition on certain Airbus SAS Model A318 series airplanes; Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –215, –216, –231, –232, and –233 airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes. Model A320–215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this proposed AD therefore does not include those airplanes in the applicability. The MCAI states that several occurrences were reported where, during a maintenance check, cracks were found in the horizontal upper stiffener of the lateral window frame at the frame 4 upper attachment. Since EASA AD 2019–0067R1 was issued, it was determined that the embodiment of Airbus production modification (mod) 161229 does not provide any benefit versus the pre-mod 161229 configuration, and Airbus issued revised service information to remove the credit and higher inspection threshold for post-mod 161229 airplanes. In addition, based on new calculations, the inspection interval was increased. The unsafe condition, if not addressed, could reduce the structural integrity of the fuselage.

The FAA is proposing this AD to address cracking of the horizontal upper stiffener of the lateral window frame, which could reduce the structural integrity of the fuselage. You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–0165.

**Explanation of Retained Requirements**

Although this proposed AD does not explicitly restate the requirements of AD 2019–24–13, this proposed AD would retain the requirements of AD 2019–24–13. Those requirements are referenced in EASA AD 2022–0151, which, in turn, is referenced in paragraph (g) of this proposed AD.

**Related Service Information Under 1 CFR Part 51**

EASA AD 2022–0151 specifies procedures for repetitive HFEC inspections of the horizontal upper stiffener of the lateral window frame on the right-hand (RH) and left-hand (LH) sides for any cracking and applicable related investigative and corrective actions. Related investigative and corrective actions include repair, replacement, and rework. EASA AD 2022–0151 also specifies reporting to Airbus if any discrepancies (cracking) are found during the inspections.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

**FAA’s Determination**

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements in This NPRM**

This proposed AD would require accomplishing the actions specified in

EASA AD 2022–0151 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

**Explanation of Required Compliance Information**

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022–0151 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2022–0151 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2022–0151 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2022–0151. Service information required by EASA AD 2022–0151 for compliance will be available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–0165 after the FAA final rule is published.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 1,528 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Retained actions from AD 2019–24–13 .....	9 work-hours × \$85 per hour = \$765 .....	\$0	\$765	\$987,615
New proposed actions .....	6 work-hours × \$85 per hour = \$510 .....	\$0	\$510	\$779,280

The FAA estimates the following costs to do any necessary on-condition rework, replacement, or reporting that

would be required based on the results of any required actions. The FAA has no way of determining the number of

aircraft that might need these on-condition actions:

ESTIMATED COSTS OF ON-CONDITION ACTIONS \*

Labor cost	Parts cost	Cost per product
Up to 543 work-hours × \$85 per hour = \$46,155 .....	Up to \$107,370 .....	\$153,525

\* The FAA has received no definitive data on which to base the cost estimates for the on-condition repairs specified in this proposed AD.

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all known costs in the cost estimate.

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to take approximately 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. All responses to this collection of information are mandatory. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to: Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177-1524.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce.

This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by:
  - a. Removing Airworthiness Directive (AD) 2019-24-13, Amendment 39-21002 (84 FR 71788, December 30, 2019); and
  - b. Adding the following new AD:

**Airbus SAS:** Docket No. FAA-2023-0165; Project Identifier MCAI-2022-01003-T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by April 3, 2023.

**(b) Affected ADs**

This AD replaces AD 2019-24-13, Amendment 39-21002 (84 FR 71788, December 30, 2019).

**(c) Applicability**

This AD applies to Airbus SAS airplanes identified in paragraphs (c)(1) through (4) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2022-0151, dated July 26, 2022 (EASA AD 2022-0151).

- (1) Model A318-111, -112, -121, and -122 airplanes.
- (2) Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes.
- (3) Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes.
- (4) Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Unsafe Condition**

This AD was prompted by a report that during a maintenance check, cracks were found in the horizontal upper stiffener of the lateral window frame at the frame 4 upper attachment, and a determination that certain compliance times need to be revised. The FAA is issuing this AD to address cracking of the horizontal upper stiffener of the lateral window frame. The unsafe condition, if not addressed, could reduce the structural integrity of the fuselage.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Requirements**

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2022-0151.

**(h) Exceptions to EASA AD 2022-0151**

- (1) Where EASA AD 2022-0151 refers to its effective date, this AD requires using the effective date of this AD.
- (2) This AD does not adopt the “Remarks” section of EASA AD 2022-0151.
- (3) Paragraph (7) of EASA AD 2022-0151 specifies to report inspection results to Airbus within a certain compliance time. For this AD, report inspection results at the applicable time specified in paragraph (h)(3)(i) or (ii) of this AD.
  - (i) If the inspection was done on or after the effective date of this AD: Submit the report within 90 days after the inspection.
  - (ii) If the inspection was done before the effective date of this AD: Submit the report

within 90 days after the effective date of this AD.

(4) Where EASA AD 2022–0151 specifies to perform corrective actions if “discrepancies are detected, as identified in the inspection SB,” for this AD perform corrective actions if cracking is detected.

(5) Where paragraph (2) of EASA AD 2022–0151 specifies to “accomplish the applicable corrective action(s)” if discrepancies are detected, for this AD if any cracking is detected and the stiffener has already been reworked, or if any cracking is not removed after a third rework of the horizontal upper stiffener, the cracking must be repaired before further flight using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov).

(i) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(ii) AMOCs approved previously for AD 2019–24–13 are approved as AMOCs for the corresponding provisions of EASA AD 2022–0151 that are required by paragraph (g) of this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph (i)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (j) Additional Information

For more information about this AD, contact Dan Rodina, Aerospace Engineer,

Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206–231–3225; email [Dan.Rodina@faa.gov](mailto:Dan.Rodina@faa.gov).

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2022–0151, dated July 26, 2022.

(ii) [Reserved]

(3) For EASA AD 2022–0151, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); website [easa.europa.eu](http://easa.europa.eu). You may find this EASA AD on the EASA website at [ad.easa.europa.eu](http://ad.easa.europa.eu).

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov), or go to: [www.archives.gov/federal-register/cfr/ibr-locations.html](http://www.archives.gov/federal-register/cfr/ibr-locations.html).

Issued on February 9, 2023.

**Christina Underwood,**

*Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2023–03141 Filed 2–14–23; 8:45 am]

**BILLING CODE 4910–13–P**

## SOCIAL SECURITY ADMINISTRATION

### 20 CFR Part 416

[Docket No. SSA–2021–0014]

RIN 0960–AI60

#### Omitting Food From In-Kind Support and Maintenance Calculations

**AGENCY:** Social Security Administration.  
**ACTION:** Notice of Proposed Rulemaking.

**SUMMARY:** We propose to update our regulations to remove food from the calculation of In-Kind Support and Maintenance (ISM). We also propose to add conforming language to our definition of income, excluding food from the ISM calculation. Accordingly, Supplemental Security Income (SSI) applicants and recipients would no longer need to provide information about their food expenses for us to consider in our ISM calculations. We expect that these changes will simplify our rules, making them less

cumbersome to administer and easier for the public to understand and follow. These simplifications would make it easier for SSI applicants and recipients to comply with our program requirements, which would save time for both them and us, and improve the equitable treatment of food assistance within the SSI program. The proposed rule also includes other, minor revisions to the regulations related to income, including clarifying our longstanding position that income may be received “constructively” (we will define this term below).

**DATES:** To ensure that your comments are considered, we must receive them no later than April 17, 2023.

**ADDRESSES:** You may submit comments by any one of three methods—internet, fax, or mail. Do not submit the same comments multiple times or by more than one method. Regardless of which method you choose, please state that your comments refer to Docket No. SSA–2021–0014 so that we may associate your comments with the correct regulation.

*Caution:* You should be careful to include in your comments only information that you wish to make publicly available. We strongly urge you not to include in your comments any personal information, such as Social Security numbers or medical information.

1. *Internet:* We strongly recommend that you submit your comments via the internet. Please visit the Federal eRulemaking portal at <https://www.regulations.gov>. Use the “search” function to find docket number SSA–2021–0014. The system will issue a tracking number to confirm your submission. You will not be able to view your comment immediately because we must post each comment manually. It may take up to one week for your comment to be viewable.

2. *Fax:* Fax comments to 1–833–410–1631.

3. *Mail:* Mail your comments to the Office of Regulations and Reports Clearance, Social Security Administration, 6401 Security Boulevard, 3rd Floor (East) Altmeyer Building, Baltimore, Maryland 21235–6401.

Comments are available for public viewing on the Federal eRulemaking portal at <https://www.regulations.gov> or in person, during regular business hours, by arranging with the contact person identified below.

**FOR FURTHER INFORMATION CONTACT:** Tamara Levingston, Office of Income Security Programs, 6401 Security Blvd., Robert M. Ball Building, Suite 2512B,