

Rules and Regulations

Federal Register

Vol. 90, No. 64

Friday, April 4, 2025

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2025–0337; Project Identifier MCAI–2023–01016–R; Amendment 39–22980; AD 2025–05–08]

RIN 2120–AA64

Airworthiness Directives; Airbus Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Airbus Helicopters Model AS332L1 and EC225LP helicopters. This AD was prompted by a determination of a possible interference of the hoist operator's helmet cord with the toggle switch of the hoist cable cut control. This AD requires replacing, or modifying and re-identifying, certain hoist shear toggle switch supports, and prohibits installing certain hoist shear toggle switch supports, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective April 21, 2025.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of April 21, 2025.

The FAA must receive comments on this AD by May 19, 2025.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.
- *Fax:* (202) 493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2025–0337; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADS@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website at ad.easa.europa.eu.

- You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Parkway, Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2025–0337.

FOR FURTHER INFORMATION CONTACT:

Evan Weaver, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (817) 521–5771; email: evan.p.weaver@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2025–0337; Project Identifier MCAI–2023–01016–R” at the beginning of your comments. The most helpful comments reference a specific portion of the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](https://www.regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Evan Weaver, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (817) 521–5771; email: evan.p.weaver@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2023–0172, dated September 20, 2023 (EASA AD 2023–0172) (also referred to as the MCAI), to correct an unsafe condition on Airbus Helicopters Model AS 332 L1 helicopters, serial numbers (S/Ns) 2218, 2221, 2341, 2950, and 2956; and Model EC 225 LP helicopters, S/Ns 2666, 2673, and 2759. The MCAI states it was determined that the hoist operator's helmet cord can entangle with the toggle switch of the hoist cable cut control, which is located on the cabin wall in front of the right-hand main sliding door. The MCAI further states this condition could lead to unintentional activation of the hoist cable cutter

during a hoist operation, which could lead to an in-flight release of the hoisted external load.

The FAA is issuing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA–2025–0337.

Material Incorporated by Reference Under 1 CFR Part 51

The FAA reviewed EASA AD 2023–0172, which requires, for Model AS 332 L1 helicopters, replacing an affected hoist shear toggle switch support with a serviceable hoist shear toggle switch support, and for Model EC 225 LP helicopters, modifying and re-identifying an affected hoist shear toggle switch support. After replacement or modification and re-identification, as applicable, EASA AD 2023–0172 also prohibits installing an affected part as defined within on any helicopter.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA's Determination

These products have been approved by the aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this AD after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

AD Requirements

This AD requires accomplishing the actions specified in EASA AD 2023–0172, described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, EASA AD 2023–0172 is incorporated by reference in this AD. This AD requires compliance with EASA AD 2023–0172 in its entirety through that incorporation, except for

any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in EASA AD 2023–0172 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2023–0172. Material required by EASA AD 2023–0172 for compliance will be available at *regulations.gov* under Docket No. FAA–2025–0337 after this AD is published.

Justification for Immediate Adoption and Determination of the Effective Date

Section 553(b) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for "good cause," finds that those procedures are "impracticable, unnecessary, or contrary to the public interest." Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

There are currently no helicopters with these type certificates and serial numbers on the U.S. Registry. Accordingly, notice and opportunity for prior public comment are unnecessary, pursuant to 5 U.S.C. 553(b). In addition, for the foregoing reason, the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days.

Regulatory Flexibility Act

The requirements of the Regulatory Flexibility Act (RFA) do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without prior notice and comment, RFA analysis is not required.

Costs of Compliance

There are no costs of compliance with this AD because there are currently no helicopters with these type certificates and serial numbers on the U.S. Registry.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of

the FAA Administrator. Subtitle VII: Aviation Programs describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(f), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2025–05–08 Airbus Helicopters:

Amendment 39–22980; Docket No. FAA–2025–0337; Project Identifier MCAI–2023–01016–R.

(a) Effective Date

This airworthiness directive (AD) is effective April 21, 2025.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus Helicopters Model AS332L1 and EC225LP helicopters, certificated in any category, as identified in European Union Aviation Safety Agency AD 2023–0172, dated September 20, 2023 (EASA AD 2023–0172).

(d) Subject

Joint Aircraft System Component (JASC) Code 2500, Cabin equipment/furnishings.

(e) Unsafe Condition

This AD was prompted by a determination of a possible interference of the hoist operator's helmet cord with the toggle switch of the hoist cable cut control. The FAA is issuing this AD to improve the protection of the toggle switch. The unsafe condition, if not addressed, could result in unintentional activation of the hoist cable cutter during a hoist operation and subsequent in-flight release of the hoisted external load.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Except as specified in paragraphs (h) and (i) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2023–0172.

(h) Exceptions to EASA AD 2023–0172

(1) Where EASA AD 2023–0172 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where the material referenced in EASA AD 2023–0172 specifies discarding parts, this AD requires removing those parts from service.

(3) This AD does not adopt the “Remarks” section of EASA AD 2023–0172.

(i) No Reporting Requirement

Although the material referenced in EASA AD 2023–0172 specifies to submit certain information to the manufacturer, this AD does not require that action.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(k) Additional Information

For more information about this AD, contact Evan Weaver, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (817) 521–5771; email: evan.p.weaver@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2023–0172, dated September 20, 2023.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADS@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Parkway, Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on March 3, 2025.

Steven W. Thompson,

Acting Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2025–05796 Filed 4–3–25; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2024–2411; Project Identifier MCAI–2023–00874–R; Amendment 39–22981; AD 2025–05–09]

RIN 2120–AA64

Airworthiness Directives; Airbus Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Airbus Helicopters Model SA330J helicopters. This AD was prompted by the determination that new or more restrictive airworthiness limitations are necessary. This AD requires revising the existing maintenance records by

incorporating new or more restrictive airworthiness limitations, as specified in a European Union Aviation Safety Agency (EASA) AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective May 9, 2025.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of May 9, 2025.

ADDRESSES:

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA–2024–2411; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the EASA AD, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

Material Incorporated by Reference:

- For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; phone: +49 221 8999 000; email: ADS@easa.europa.eu; website: easa.europa.eu. You may find the EASA material on the EASA website at ad.easa.europa.eu.

- You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Parkway, Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. It is also available at regulations.gov under Docket No. FAA–2024–2411.

FOR FURTHER INFORMATION CONTACT:

Adam Hein, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: (316) 946–4116; email: Adam.Hein@faa.gov.

SUPPLEMENTARY INFORMATION:**Background**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Airbus Helicopters Model SA330J helicopters. The NPRM published in the **Federal Register** on October 24, 2024 (89 FR 84836). The NPRM was prompted by EASA AD 2023–0146, dated July 14, 2023 (EASA AD 2023–0146), issued by EASA, which is the Technical Agent for the Member States of the European Union. EASA advises that airworthiness limitations and certification maintenance instructions are identified as mandatory