as a condition to SBA's guarantee of Participating Securities and for as long as you own Earmarked Assets.

* * * * * *

(9) Failure to meet investment requirements. You fail to make the amount of Equity Capital Investments required for Participating Securities (§ 107.1500(b)(4)), if applicable to you.

Kelly Loeffler,

Administrator.

[FR Doc. 2025-12584 Filed 7-3-25; 8:45 am]

BILLING CODE 8026-09-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2025-1354; Project Identifier MCAI-2025-00012-T]

RIN 2120-AA64

Airworthiness Directives; ATR—GIE Avions de Transport Régional Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking

(NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain ATR—GIE Avions de Transport Régional Model ATR42–500 and ATR72 airplanes. This proposed AD was prompted by an investigation indicating that an erroneous monitoring of the travel limitation unit (TLU) could occur when the airplane is flying above a certain speed as a result of the logic input from either air data computer (ADC) 1 or ADC2 input. This proposed AD would require modifying airplanes by installing one or two relays and associated wiring, and testing of the TLU monitoring logic. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 21,

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to regulations.gov. Follow the instructions for submitting comments.
 - Fax: 202-493-2251.
- Mail: U.S. Department of

Transportation, Docket Operations, M—30, West Building Ground Floor, Room

W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA–2025–1354; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:
• For European Union Aviation
Safety Agency (EASA) material
identified in this proposed AD, contact
EASA, Konrad-Adenauer-Ufer 3, 50668
Cologne, Germany; telephone +49 221
8999 000; email ADs@easa.europa.eu.
You may find this material on the EASA
website at ad.easa.europa.eu. It is also
available at regulations.gov under
Docket No. FAA-2025-1354.

• You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

FOR FURTHER INFORMATION CONTACT:

Jonathan Duong, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516–228–7362; email: 9-AVS-AIR-BACO-COS@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the ADDRESSES section. Include "Docket No. FAA-2025-1354; Project Identifier MCAI-2025-00012-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Ionathan Duong. Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-362; email: 9-AVS-AIR-BACO-COS@faa.gov. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2025-0004, dated January 7, 2025 (EASA AD 2025-0004) (also referred to as the MCAI), to correct an unsafe condition for certain ATR—GIE Avions de Transport Régional Model ATR42-400, ATR42-500, ATR72–101, ATR72–102, ATR72– 201, ATR72-202, ATR72-211, ATR72-212, and ATR72-212A airplanes. Model ATR42-400 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this proposed AD therefore does not include those airplanes in the applicability. The MCAI states that an ATR internal review of the TLU new avionics suite design identified an erroneous behavior of core processing module (CPM) 2, hosting the data concentration application (DCA) 2, that might affect the TLU command, monitoring, and indication. Further investigation results indicated that an erroneous monitoring of the TLU could occur when the airplane is flying above a certain speed due to the logic input from either ADC1 or ADC2 input.

The FAA is proposing this ÅD to address erroneous behavior of CPM 2, hosting the DCA 2, that could affect the TLU command, monitoring, and indication. This condition, if not corrected, could result in the rudder deflection not being limited at high

airplane speed, which, if combined with a large rudder pedal input, could lead to the loss of control of the airplane.

You may examine the MCAÎ in the AD docket at *regulations.gov* under Docket No. FAA–2025–1354.

Material Incorporated by Reference Under 1 CFR Part 51

EASA AD 2025-0004 specifies procedures for modifying airplanes by installing one or two relays and associated wiring. EASA AD 2025-0004 also specifies procedures for an operational test of the TLU monitoring logic after the modification, a functional test of the rudder travel limiter unit, and obtaining and following instructions to correct any failed test. For airplanes on which a previous revision of the applicable service information has been accomplished, EASA AD 2025-0004 specifies accomplishing "Additional Work," which consists of a functional test of the rudder travel limiter unit. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA's Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2025–0004 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2025–0004 by

reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2025-0004 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2025-0004 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2025-0004. Material required by EASA AD 2025-0004 for compliance will be available at regulations.gov under Docket No. FAA-2025-1354 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 43 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 15 work-hours × \$85 per hour = \$1,275	Up to \$2,889	Up to \$4,164	Up to \$179,052.

The FAA has received no definitive data on which to base the cost estimates for the on-condition actions specified in this proposed AD.

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a "significant regulatory action" under Executive Order 12866,

- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39 AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

ATR—GIE Avions de Transport Régional: Docket No. FAA-2025-1354; Project Identifier MCAI-2025-00012-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by August 21,

(b) Affected ADs

None.

(c) Applicability

This AD applies to the ATR—GIE Avions de Transport Régional airplanes identified in paragraphs (c)(1) and (2) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2025-0004, dated January 7, 2025 (EASA AD 2025-0004).

- (1) ATR42-500 airplanes.
- (2) ATR72–101, –102, –201, –202, –211, –212, and –212A airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight Controls.

(e) Unsafe Condition

This AD was prompted by an investigation indicating that an erroneous monitoring of the travel limitation unit (TLU) could occur when the airplane is flying above a certain speed as a result of the logic input from either air data computer (ADC) 1 or ADC2 input. The FAA is issuing this AD to address this condition, which if not detected and corrected, could result in the rudder deflection not being limited at high airplane speed, which, if combined with a large rudder pedal input, could lead to the loss of control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2025-0004.

(h) Exceptions to EASA AD 2025-0004

- (1) Where EASA AD 2025-0004 refers to its effective date, this AD requires using the effective date of this AD.
- (2) This AD does not adopt the "Remarks" section of EASA AD 2025-0004.
- (3) Paragraph (1) of EASA AD 2025-0004 applies to all airplanes except for airplanes identified in paragraph (4) of EASA AD 2025-0004.
- (4) Where paragraph (4) of EASA AD 2025-0004 specifies "the additional work", for this AD, replace that text with "the functional test of the rudder Travel Limiter Unit".
- (5) Where paragraph (3) of EASA AD 2025-0004 specifies "as required by paragraph (2) of this AD", for this AD, replace that text with "as required by paragraphs (2) and (4) of this AD"

(i) Additional AD Provisions

The following provisions also apply to this

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD and email to: AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or ATR—GIE Avions de Transport Régional's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(i) Additional Information

For more information about this AD, contact Jonathan Duong, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7362; email: 9-AVS-AIR-BACO-COS@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2025-0004, dated January 7, 2025.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA. visit www.archives.gov/federal-register/cfr/ ibr-locations or email fr.inspection@nara.gov.

Issued on July 1, 2025.

Steven W. Thompson,

Acting Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2025-12563 Filed 7-3-25; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2025-1355; Project Identifier AD-2025-00016-A]

RIN 2120-AA64

Airworthiness Directives; Honda Aircraft Company LLC Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking

(NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Honda Aircraft Company LLC (Honda) Model HA-420 airplanes. This proposed AD was prompted by the discovery of a gap between the trailing edge wing nut plates and leading edge aileron balance weights being less than the minimum required clearance. This proposed AD would require replacing the affected left and right aileron fixed balance weights with reduced geometry fixed balance weights. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 21, 2025.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to regulations.gov. Follow the instructions for submitting comments.
 - Fax: (202) 493-2251.
- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA-2025-1355; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

 For Honda Aircraft Company material identified in this proposed AD, contact Honda, 6430 Ballinger Road, Greensboro, NC 27410; phone: (336) 662-0246; website: hondajet.com.