

# Proposed Rules

Federal Register

Vol. 85, No. 154

Monday, August 10, 2020

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2020-0680; Product Identifier 2020-NM-079-AD]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2016-25-29, which applies to certain The Boeing Company Model 767-200 and -300 series airplanes. AD 2016-25-29 requires replacing the cargo compartment insulation blankets on the left and right sides with new insulation blankets that incorporate fire stops. Since the FAA issued AD 2016-25-29, it was determined that an incorrect part number was specified for certain insulation blankets, and the FAA has determined that additional insulation blankets need to be replaced and that additional airplanes are subject to the unsafe condition. This proposed AD would continue to require the actions in AD 2016-25-29 for certain airplanes. This proposed AD would also add airplanes to the applicability and would require a general visual inspection of the replacement insulation blankets to determine if the blankets are in serviceable condition and correctly installed, and applicable on-condition actions. For certain airplanes, this AD would also require an inspection to determine the insulation blanket part number installed; replacement of additional insulation blankets; and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by September 24, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0680.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0680; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Julie Linn, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3584; email: [Julie.Linn@faa.gov](mailto:Julie.Linn@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or

arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2020-0680; Product Identifier 2020-NM-079-AD” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this proposed AD.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to the person identified in the **FOR FURTHER INFORMATION CONTACT** section. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Discussion

The FAA issued AD 2016-25-29, Amendment 39-18755 (81 FR 94956, December 27, 2016) (“AD 2016-25-29”), for certain The Boeing Company Model 767-200 and -300 series airplanes. AD 2016-25-29 requires replacing the cargo compartment

insulation blankets on the left and right sides with new insulation blankets that incorporate fire stops. AD 2016–25–29 resulted from a report of a fire in the bilge area of the cargo compartment that burned through the insulation blankets that were intended to prevent smoke from migrating behind the cargo compartment sidewall liners and upward into the main cabin. The FAA issued AD 2016–25–29 to address a fire in the bilge area of the cargo compartment burning through the insulation blankets and consequently allowing smoke to migrate behind the cargo compartment sidewall liners and upward into the main cabin.

#### Actions Since AD 2016–25–29 Was Issued

Since the FAA issued AD 2016–25–29, it was determined that an incorrect part number was specified for certain insulation blankets. Based on those findings, the FAA determined that certain insulation blankets that were replaced, as required by AD 2016–25–29, must be replaced with those having the improved design. In addition, the FAA determined that additional insulation blankets need to be replaced and that additional airplanes are subject to the unsafe condition.

#### Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Special Attention Service Bulletin 767–25–0550, Revision 1, dated December 4, 2019. The service information describes procedures for replacing cargo compartment insulation blankets between stringers 29 and 33, on the left and right sides, with new insulation blankets that incorporate fire stops; an inspection to determine the insulation blanket part number installed between stringers 29 and 33, on the left and right sides; a general visual inspection of the replacement insulation blankets between stringers 29 and 33, on the left and right sides to determine if the blankets are in serviceable condition and correctly installed; and applicable on-condition actions. On-condition actions include repair, replacement, and correction of insulation blanket installations.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination

The FAA is proposing this AD because the agency evaluated all the relevant information and determined the unsafe condition described

previously is likely to exist or develop in other products of the same type design.

#### Proposed AD Requirements

Although this proposed AD does not explicitly restate the requirements of AD 2016–25–29, this proposed AD would retain certain of the requirements of AD 2016–25–29. Those requirements are referenced in the service information identified previously, which, in turn, is referenced in paragraph (g) of this proposed AD. This proposed AD would add airplanes to the applicability. This proposed AD would also require accomplishment of the actions identified as “RC” (required for compliance) in the Accomplishment Instructions of Boeing Special Attention Service Bulletin 767–25–0550, Revision 1, dated December 4, 2019, described previously.

For information on the procedures and compliance times, see this service information at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0680.

#### Costs of Compliance

The FAA estimates that this proposed AD affects 329 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

#### ESTIMATED COSTS FOR REQUIRED ACTIONS

| Action                                              | Labor cost                                           | Parts cost           | Cost per product     | Cost on U.S. operators |
|-----------------------------------------------------|------------------------------------------------------|----------------------|----------------------|------------------------|
| Replacement (retained actions from AD 2016–25–29).  | Up to 54 work-hours × \$85 per hour = Up to \$4,590. | * .....              | Up to \$4,590 .....  | Up to \$1,510,110.     |
| Inspections and replacements (new proposed action). | Up to 62 work-hour × \$85 per hour = Up to \$5,270.  | Up to \$35,900 ..... | Up to \$41,170 ..... | Up to \$13,944,530.    |

\* The FAA has received no definitive data that would enable providing parts cost estimates for the retained actions specified in this proposed AD.

The FAA has received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all available costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of

the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

The FAA has determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative,

on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by removing Airworthiness Directive (AD) 2016–25–29, Amendment 39–18755 (81 FR 94956, December 27, 2016), and adding the following new AD:

**The Boeing Company:** Docket No. FAA–2020–0680; Product Identifier 2020–NM–079–AD.

#### (a) Comments Due Date

The FAA must receive comments on this AD action by September 24, 2020.

#### (b) Affected ADs

This AD replaces AD 2016–25–29, Amendment 39–18755 (81 FR 94956, December 27, 2016) (“AD 2016–25–29”).

#### (c) Applicability

This AD applies to The Boeing Company Model 767–200, –300, –300F, and –400ER series airplanes, certificated in any category, as identified in Boeing Special Attention Service Bulletin 767–25–0550, Revision 1, dated December 4, 2019.

#### (d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

#### (e) Unsafe Condition

This AD was prompted by a report of a fire in the bilge area of the cargo compartment that burned through the insulation blankets that were intended to prevent smoke from migrating behind the cargo compartment sidewall liners and upward into the main cabin. The FAA is issuing this AD to address a fire in the bilge area of the cargo compartment, which if not contained could lead to a possible smoke and fire event in the passenger compartment.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in

paragraph 1.E., “Compliance,” of Boeing Special Attention Service Bulletin 767–25–0550, Revision 1, dated December 4, 2019, do all applicable actions identified as “RC” (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Service Bulletin 767–25–0550, Revision 1, dated December 4, 2019.

#### (h) Exception to Service Information Specifications

Where Boeing Special Attention Service Bulletin 767–25–0550, Revision 1, dated December 4, 2019, uses the phrase “the Revision 1 date of this service bulletin,” this AD requires using “the effective date of this AD.”

#### (i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved previously for AD 2016–25–29 are approved as AMOCs for the corresponding provisions of Boeing Special Attention Service Bulletin 767–25–0550, Revision 1, dated December 4, 2019, that are required by paragraph (g) of this AD.

(5) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (i)(5)(i) and (ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

#### (j) Related Information

(1) For more information about this AD, contact Julie Linn, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3584; email: Julie.Linn@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued on July 29, 2020.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020–17362 Filed 8–7–20; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF HEALTH AND HUMAN SERVICES

### Food and Drug Administration

#### 21 CFR Part 112

[Docket No. FDA–2020–N–1119]

### Request for Information and Comments on Consumption of Certain Uncommon Produce Commodities in the United States; Establishment of a Public Docket

**AGENCY:** Food and Drug Administration, HHS.

**ACTION:** Notification; establishment of docket; request for comments.

**SUMMARY:** The Food and Drug Administration (FDA, the Agency, or we) is opening a docket to receive information and comments related to certain produce commodities with no or low reported consumption in the database relied on to create the list of rarely consumed raw commodities that are exempt from the Standards for the Growing, Harvesting, Packing, and Holding of Produce for Human Consumption regulation. FDA intends to use the information to consider whether any of these commodities should be added to the rarely consumed raw list.

**DATES:** Submit either electronic or written comments by November 9, 2020.

**ADDRESSES:** You may submit comments as follows. Please note that late, untimely filed comments will not be