

Proposed Rules

Federal Register

Vol. 86, No. 129

Friday, July 9, 2021

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2021-0498; Project Identifier 2019-SW-072-AD]

RIN 2120-AA64

Airworthiness Directives; Hélicoptères Guimbal Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for Hélicoptères Guimbal Model Cabri G2 helicopters with any metal bushing installed on the main rotor (M/R) swashplate guide bellcrank. This proposed AD was prompted by a report of cracks discovered on the M/R scissor link during scheduled maintenance on several helicopters. This proposed AD would require removing all metal bushings from service, visually inspecting the lug bore area and depending on the inspection results, removing certain parts from service and installing certain part-numbered plastic bushings. This proposed AD would also prohibit installing any metal bushing on any helicopter. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 23, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Hélicoptères Guimbal, Basile Ginel, 1070, rue du Lieutenant Parayre, Aéroport d'Aix-en-Provence, 13290 Les Milles, France; telephone 33-04-42-39-10-88; email basile.ginel@guimbal.com; web <https://www.guimbal.com>. You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0498; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the European Union Aviation Safety Agency (EASA) AD, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT: Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Mail Stop: Room 410, Westbury, NY 11590; telephone (516) 228-7330; email andrea.jimenez@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0498; Project Identifier 2019-SW-072-AD" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the

following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Westbury, NY 11590; telephone (516) 228-7330; email andrea.jimenez@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2019-0185, dated July 30, 2019 (EASA AD 2019-0185), to correct an unsafe condition for Hélicoptères Guimbal Model Cabri G2 helicopters. EASA advises that during scheduled maintenance on several helicopters, cracks were found on the M/R scissor link due to corrosion. EASA states this corrosion was caused by stress induced by the mounting of the metal bushing inside the lug hole. EASA further states metal bushings are also installed on the M/R swashplate guide bellcrank, where similar cracking may occur. This condition, if not addressed,

could result in failure of the M/R swashplate guide bellcrank and reduced control of the helicopter. Accordingly, EASA AD 2019–0185 requires replacing any part-numbered metal bushing with plastic bushing part number (P/N) HG22–1001. EASA AD 2019–0185 also prohibits installing any part-numbered metal bushing on the M/R swashplate guide bellcrank other than P/N HG22–1001 on any helicopter.

FAA's Determination

These helicopters have been approved by EASA and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the European Union, EASA has notified the FAA about the unsafe condition described in its AD. The FAA is proposing this AD after evaluating all known relevant information and determining that the unsafe condition described previously is likely to exist or develop on other helicopters of the same type designs.

Related Service Information

The FAA reviewed Guimbal Service Bulletin SB 17–003, Revision D, dated August 27, 2019 (SB 17–003 Rev D). This service information specifies disconnecting the bellcrank installed on the swashplate guide by removing the bolts that connect the bellcrank to the swashplate guide, removing any existing bushings, and visually inspecting the lug bore area for corrosion or cracks. This service information also specifies if there is any corrosion or cracks, reporting the information to HG support, installing the new plastic bushings, reinstalling the bellcrank, applying a specified torque, and installing cotter pins.

Other Related Service Information

The FAA also reviewed Guimbal Service Bulletin SB 17–003, Revision C, dated July 12, 2019 (SB 17–003 Rev C). SB 17–003 Rev C specifies the same procedures as SB 17–003 Rev D, except SB 17–003 Rev D updates the reference to EASA AD 2019–0185.

Proposed AD Requirements in This NPRM

This proposed AD would require, within 50 hours time-in-service or 2 months, whichever occurs first after the effective date of this AD, disconnecting the bellcrank from the swashplate guide, removing each bolt and using a certain tool, removing certain parts from service. This proposed AD would also require visually inspecting the lug bore area for corrosion and cracks and depending on the inspection results, removing certain parts from service, or

repairing the area using an FAA-approved method, installing certain part-numbered plastic bushings, coating the area with a compound, reinstalling certain parts, applying a specified torque, and installing cotter pins.

Differences Between This Proposed AD and the EASA AD

EASA AD 2019–0185 applies to all Model Cabri G2 helicopters, whereas this proposed AD would only apply to Model Cabri G2 helicopters with any metal bushings installed and without HG modification 16–009. The service information required by the EASA AD requires contacting Hélicoptères Guimbal for corrective actions when corrosion or cracks are found in the lug bore area whereas this AD requires removing the swashplate guide from service or repairing it using an FAA-approved method.

Costs of Compliance

The FAA estimates that this proposed AD would affect 32 helicopters of U.S. Registry. The FAA estimates that operators may incur the following costs in order to comply with this proposed AD. Labor costs are estimated at \$85 per work-hour.

Disconnecting the bellcrank, removing each metal bushing and visually inspecting for corrosion and cracks would take about 0.5 work-hours for an estimated cost of \$43 per inspection cycle.

Installing each plastic bushing, coating with compound, re-installing the bellcrank, and applying torque would take about 0.5 work-hours and parts would cost about \$10 for an estimated cost of \$53 per helicopter.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Hélicoptères Guimbal: Docket No. FAA–2021–0498; Project Identifier 2019–SW–072–AD.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by August 23, 2021.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Hélicoptères Guimbal (HG) Model Cabri G2 helicopters, certificated in any category, with any metal bushings installed on the main rotor (M/R) swashplate guide bellcrank and without plastic bushing part number HG22–1001 or HG modification 16–009.

(d) Subject

Joint Aircraft Service Component (JASC) Code: 6700, Rotorcraft Flight Control.

(e) Unsafe Condition

This AD was prompted by a report of cracks on the M/R scissor link. The FAA is issuing this AD to replace the metal bushings installed on the M/R swashplate guide bellcrank with plastic bushings. The unsafe condition, if not addressed, could result in failure of the M/R swashplate guide bellcrank and reduced control of the helicopter.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) Within 50 hours time-in-service (TIS) or 2 months, whichever occurs first after the effective date of this AD:

(i) Disconnect the bellcrank from the swashplate guide by removing each bolt and, ensuring that the bellcrank remains attached to the flight control rod, remove each metal bushing from service using a bushing disassembly tool.

(ii) Visually inspect the lug bore area for any corrosion and any cracks. If there is any corrosion or any cracks, before further flight, remove the swashplate guide from service or repair it using an FAA-approved method. If there is no corrosion and no cracks, install plastic bushing part number HG22–1001, coat plastic bushing with isolation compound, re-install the bellcrank, torque each bolt to 7.5 Nm–9 Nm (5.5 ft-lbs–6.6 ft-lbs), and install cotter pins.

(2) As of the effective date of this AD, do not install any metal bushing on any helicopter.

(h) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (i)(1) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(i) Related Information

(1) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Westbury, NY 11590; telephone (516) 228–7330; email andrea.jimenez@faa.gov.

(2) Guimbal Service Bulletin SB 17–003, Revision C, dated July 12, 2019, which is not incorporated by reference, contains additional information about the subject of this AD. For service information identified in this AD, contact Hélicoptères Guimbal, Basile Ginel, 1070, rue du Lieutenant Parayre,

Aérodrome d'Aix-en-Provence, 13290 Les Milles, France; telephone 33–04–42–39–10–88; email basile.ginel@guimbal.com; web <https://www.guimbal.com>. You may view this referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110.

(3) The subject of this AD is addressed in European Union Aviation Safety Agency (EASA) AD 2019–0185, dated July 30, 2019. You may view the EASA AD on the internet at <https://www.regulations.gov> in Docket No. FAA–2021–0498.

Issued on June 10, 2021.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–14495 Filed 7–8–21; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2021–0560; Project Identifier MCAI–2021–00192–T]

RIN 2120–AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model BD–700–1A10 and BD–700–1A11 airplanes. This proposed AD was prompted by reports that the sliding bushings in the forward engine mount system were missing. This proposed AD would require an inspection (gap check) of the front and aft engine mounts to verify the proper installation of the sliding bushings, and repair if necessary. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by August 23, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor,

Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email thd.crj@aero.bombardier.com; internet <https://www.bombardier.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0560; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7362; fax 516–794–5531; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2021–0560; Project Identifier MCAI–2021–00192–T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.