

(k) Related Information

(1) For information about TCCA AD CF-2021-01, contact TCCA, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888-663-3639; email *AD-CN@tc.gc.ca*; internet <https://tc.canada.ca/en/aviation>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0696.

(2) For more information about this AD, contact Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7362; fax 516-794-5531; email *9-avs-nyaco-cos@faa.gov*.

Issued on August 18, 2021.

Ross Landes,

Deputy Director for Regulatory Operations, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021-18226 Filed 8-24-21; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2021-0695; Project Identifier MCAI-2021-00096-R]

RIN 2120-AA64

Airworthiness Directives; Leonardo S.p.a. Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Leonardo S.p.a. Model A109E helicopters. This proposed AD was prompted by reports that certain tail rotor gearbox assemblies were installed on Model A109E helicopters and those parts are not approved for installation on that helicopter model. Because those assemblies are not part of the type design for Model A109E helicopters, there are no overhaul or life limits included in the applicable maintenance manuals. This proposed AD would require replacement of each affected tail rotor gearbox assembly with a serviceable part, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The

FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by October 12, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For EASA material that is proposed for IBR in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email *ADs@easa.europa.eu*; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. The EASA material is also available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0695.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0695; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the EASA AD, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228-7330; email *andrea.jimenez@faa.gov*.

SUPPLEMENTARY INFORMATION:**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send

your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2021-0695; Project Identifier MCAI-2021-00096-R” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228-7330; email *andrea.jimenez@faa.gov*. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2021-0031, dated January 22, 2021 (EASA AD 2021-0031), to correct an unsafe condition for Leonardo S.p.A., formerly Finmeccanica S.p.A., AgustaWestland S.p.A., and Agusta S.p.A., Model A109E helicopters, all serial numbers up to 11160 inclusive.

This proposed AD was prompted by reports that certain tail rotor gearbox assemblies were installed on Model A109E helicopters and those parts are not approved for installation on that helicopter model. During revisions to the Model A109E technical publications it was noted that the 90-degree tail rotor gearbox assembly, part number (P/N) 109-0440-01-115, is included in the illustrated parts catalog (IPC) for helicopters with serial numbers (S/N) up to and including S/N 11160. The IPC incorrectly identifies this part number as a replacement part for P/N 109-0440-01-119 or P/N 109-0440-01-121.

The FAA is proposing this AD to address installation of tail rotor gearbox assembly P/N 109-0440-01-115 that is not approved for installation on Model A109E helicopters. Because P/N 109-0440-01-115 is not part of the type design for Model A109E helicopters, there are no overhaul or life limits included in the applicable maintenance manuals. If a tail rotor gearbox is not properly maintained it could fail, resulting in reduced control of the helicopter. See EASA AD 2021-0031 for additional background information.

Related Service Information Under 1 CFR Part 51

EASA AD 2021-0031 requires replacement of a tail rotor gearbox assembly P/N 109-0440-01-115 with a serviceable part. EASA AD 2021-0031 also prohibits installation of tail rotor gearbox assembly P/N 109-0440-01-

115 on any Leonardo S.p.A. Model A109E helicopter.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

These helicopters have been approved by EASA and are approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the European Union, EASA has notified the FAA about the unsafe condition described in its AD. The FAA is proposing this AD after evaluating all known relevant information and determining that the unsafe condition described previously is likely to exist or develop on other helicopters of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2021-0031, described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA)

ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2021-0031 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2021-0031 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2021-0031 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2021-0031. Service information required by EASA AD 2021-0031 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0695 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 70 helicopters of U.S. Registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement	12 work-hours × \$85 per hour = \$1,020	\$82,500	\$83,520	\$5,846,400

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under

that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and

responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Leonardo S.p.a.: Docket No. FAA–2021–0695; Project Identifier MCAI–2021–00096–R.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by October 12, 2021.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Leonardo S.p.a. Model A109E helicopters, certificated in any category, with an affected part as identified in European Union Aviation Safety Agency (EASA) AD 2021–0031, dated January 22, 2021 (EASA AD 2021–0031) installed.

(d) Subject

Joint Aircraft Service Component (JASC) Code: 6520, Tail Rotor Gearbox.

(e) Unsafe Condition

This AD was prompted by reports that certain tail rotor gearbox assemblies were installed on Model A109E helicopters and those parts are not approved for installation on that helicopter model. Because tail rotor gearbox assembly part number (P/N) 109–0440–01–115 is not part of the type design for Model A109E helicopters, there are no overhaul or life limits included in the applicable maintenance manuals. The FAA is issuing this AD to address installation of tail rotor gearbox assembly P/N 109–0440–01–115 on Model A109E helicopters that do not have overhaul or life limits for that part. If a tail rotor gearbox is not properly maintained it could fail, resulting in reduced control of the helicopter.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2021–0031.

(h) Exceptions to EASA AD 2021–0031

(1) Where EASA AD 2021–0031 requires compliance in terms of flight hours, this AD requires using hours time-in-service.

(2) Where EASA AD 2021–0031 requires compliance from its effective date, this AD requires using the effective date of this AD.

(3) This AD does not require the “Remarks” section of EASA AD 2021–0031.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2021–0031 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(k) Related Information

(1) For EASA AD 2021–0031, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0695.

(2) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228–7330; email andrea.jimenez@faa.gov.

Issued on August 18, 2021.

Ross Landes,

Deputy Director for Regulatory Operations, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–18257 Filed 8–24–21; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF THE TREASURY

Alcohol and Tobacco Tax and Trade Bureau

27 CFR Part 5

[Docket No. TTB–2021–0008; Notice No. 205]

RIN 1513–AC61

Proposed Addition of Singani to the Standards of Identity for Distilled Spirits

AGENCY: Alcohol and Tobacco Tax and Trade Bureau, Treasury.

ACTION: Notice of proposed rulemaking.

SUMMARY: The Alcohol and Tobacco Tax and Trade Bureau (TTB) proposes to amend the regulations that set forth the standards of identity for distilled spirits to include Singani as a type of brandy that is a distinctive product of Bolivia. This proposal follows a joint petition submitted by the Plurinational State of Bolivia and Singani 63, Inc., and subsequent discussions with the Office of the United States Trade Representative. TTB invites comments on this proposed amendment to its regulations, including comments on its proposal to authorize a minimum bottling proof of 35 percent alcohol by volume (or 70° proof) for Singani.

DATES: Comments must be received on or before October 25, 2021.

ADDRESSES: You may electronically submit comments to TTB on this proposal, and view copies of this document, its supporting materials, and any comments TTB receives on it within Docket No. TTB–2021–0008 as posted at <https://www.regulations.gov>. A direct link to that docket is available on the TTB website at <https://www.ttb.gov/distilled-spirits/notices-of-proposed-rulemaking> under Notice No. 205. Alternatively, you may submit comments via postal mail to the Director, Regulations and Ruling Division, Alcohol and Tobacco Tax and Trade Bureau, 1310 G Street NW, Box 12, Washington, DC 20005. Please see the Public Participation section of this document for further information on the comments requested regarding this proposal and on the submission, confidentiality, and public disclosure of comments.

FOR FURTHER INFORMATION CONTACT:

Trevar D. Kolodny, Regulations and Rulings Division, Alcohol and Tobacco Tax and Trade Bureau, 1310 G Street NW, Box 12, Washington, DC 20005; telephone 202–453–2226.

SUPPLEMENTARY INFORMATION: