

Rules and Regulations

Federal Register

Vol. 88, No. 241

Monday, December 18, 2023

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2023–2229; Project Identifier MCAI–2023–00736–T; Amendment 39–22617; AD 2023–24–01]

RIN 2120–AA64

Airworthiness Directives; Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Airbus Canada Limited Partnership Model BD–500–1A10 and BD–500–1A11 airplanes. This AD was prompted by a reported interference between the pilot valve fittings and their mating holes in the rear spar of the center wing box (CWB). This AD requires replacing the pilot valve fittings, as specified in a Transport Canada AD, which is incorporated by reference. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective January 2, 2024.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of January 2, 2024.

The FAA must receive comments on this AD by February 1, 2024.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–

30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–2229; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For material incorporated by reference in this AD, contact Transport Canada, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888–663–3639; email TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca. You may find this material on the Transport Canada website at tc.canada.ca/en/aviation.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2023–2229.

FOR FURTHER INFORMATION CONTACT:

Gabriel Kim, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516–228–7300; email: 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written data, views, or arguments about this final rule. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2023–2229; Project Identifier MCAI–2023–00736–T” at the beginning of your comments. The most helpful comments reference a specific portion of the final rule, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this final rule because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](https://www.regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this final rule.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this AD contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this AD, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this AD. Submissions containing CBI should be sent to Gabriel Kim, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516–228–7300; email: 9-avs-nyaco-cos@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

Transport Canada, which is the aviation authority for Canada, has issued Transport Canada AD CF–2023–39, dated June 6, 2023 (Transport Canada AD CF–2023–39) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus Canada Limited Partnership Model BD–500–1A10 and BD–500–1A11 airplanes. The MCAI states that an interference condition was found during airplane manufacturing between the pilot valve fittings and their mating holes in the rear spar of the CWB. The interference condition could damage the fitting and result in the fitting’s failure under induced fatigue. Fitting failure could lead to a failure of its shroud attachment and subsequent fuel leak into the area

behind the rear spar and into the landing gear bay. Such significant fuel leak, combined with a potential ignition source such as a failure of a bleed duct or a failure of wires/connectors in these areas, could create a fire hazard on the airplane.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA-2023-2229.

Related Service Information Under 1 CFR Part 51

Transport Canada AD CF-2023-39 specifies procedures for replacing the pilot valve fittings with redesigned fittings. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with this State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this AD after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Requirements of This AD

This AD requires accomplishing the actions specified in Transport Canada

AD CF-2023-39 described previously, except for any differences identified as exceptions in the regulatory text of this AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, Transport Canada AD CF-2023-39 is incorporated by reference in this AD. This AD requires compliance with Transport Canada AD CF-2023-39 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Service information required by Transport Canada AD CF-2023-39 for compliance will be available at *regulations.gov* under Docket No. FAA-2023-2229 after this AD is published.

FAA’s Justification and Determination of the Effective Date

Section 553(b)(3)(B) of the Administrative Procedure Act (APA) (5 U.S.C. 551 *et seq.*) authorizes agencies to dispense with notice and comment procedures for rules when the agency, for “good cause,” finds that those procedures are “impracticable,

unnecessary, or contrary to the public interest.” Under this section, an agency, upon finding good cause, may issue a final rule without providing notice and seeking comment prior to issuance. Further, section 553(d) of the APA authorizes agencies to make rules effective in less than thirty days, upon a finding of good cause.

There are currently no domestic operators of these products. Accordingly, notice and opportunity for prior public comment are unnecessary, pursuant to 5 U.S.C. 553(b)(3)(B). In addition, for the forgoing reason(s), the FAA finds that good cause exists pursuant to 5 U.S.C. 553(d) for making this amendment effective in less than 30 days.

Regulatory Flexibility Act (RFA)

The requirements of the RFA do not apply when an agency finds good cause pursuant to 5 U.S.C. 553 to adopt a rule without prior notice and comment. Because the FAA has determined that it has good cause to adopt this rule without notice and comment, RFA analysis is not required.

Costs of Compliance

Currently, there are no affected U.S.-registered airplanes. If an affected airplane is imported and placed on the U.S. Register in the future, the FAA provides the following cost estimates to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product
30 work-hours × \$85 per hour = \$2,550	\$7,549	\$10,099

According to the manufacturer, some or all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all known costs in the cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in

Subtitle VII, Part A, Subpart III, section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national

government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866, and
- (2) Will not affect intrastate aviation in Alaska.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2023–24–01 Airbus Canada Limited Partnership (Type Certificate Previously Held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.): Amendment 39–22617; Docket No. FAA–2023–2229; Project Identifier MCAI–2023–00736–T.

(a) Effective Date

This airworthiness directive (AD) is effective January 2, 2024.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus Canada Limited Partnership (Type Certificate previously held by C Series Aircraft Limited Partnership (CSALP); Bombardier, Inc.) Model BD–500–1A10 and BD–500–1A11 airplanes, certificated in any category, as identified in Transport Canada AD CF–2023–39, dated June 6, 2023 (Transport Canada AD CF–2023–39).

(d) Subject

Air Transport Association (ATA) of America Code 28, Fuel.

(e) Unsafe Condition

This AD was prompted by a reported interference between the pilot valve fittings and their mating holes in the rear spar of the center wing box. The FAA is issuing this AD to address fitting failure, which could lead to a failure of its shroud attachment and subsequent fuel leak into the area behind the rear spar and into the landing gear bay. Such significant fuel leak, combined with a potential ignition source such as a failure of a bleed duct or a failure of wires/connectors in these areas, could create a fire hazard on the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, Transport Canada AD CF–2023–39.

(h) Exception to Transport Canada AD CF–2023–39

Where Transport Canada AD CF–2023–39 refers to its effective date, this AD requires using the effective date of this AD.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or Transport Canada; or Airbus Canada Limited Partnership's Transport Canada Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Additional Information

(1) For more information about this AD, contact Gabriel Kim, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516–228–7300; email: 9-avs-nyaco-cos@faa.gov.

(2) For Airbus Canada Limited Partnership service information identified in this AD that is not incorporated by reference, contact Airbus Canada Limited Partnership, 13100 Henri-Fabre Boulevard, Mirabel, Québec J7N 3C6, Canada; telephone 450–476–7676; email a220_a220world.airbus.com. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Transport Canada AD CF–2023–39, dated June 6, 2023.

(ii) [Reserved]

(3) For Transport Canada AD CF–2023–39, contact Transport Canada, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888–663–3639; email TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca; website tc.canada.ca/en/aviation.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the

availability of this material at the FAA, call 206–231–3195.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on November 29, 2023.

Ross Landes,

Deputy Director for Regulatory Operations, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2023–27677 Filed 12–15–23; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. **FAA–2023–1496**; Project Identifier **MCAI–2022–01059–T**; Amendment **39–22619**; AD **2023–24–03**]

RIN 2120–AA64

Airworthiness Directives; MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all MHI RJ Aviation ULC Model CL–600–2B19 (Regional Jet Series 100 & 440); CL–600–2C10 (Regional Jet Series 700, 701, & 702); CL–600–2C11 (Regional Jet Series 550); CL–600–2D15 (Regional Jet Series 705); CL–600–2D24 (Regional Jet Series 900); and CL–600–2E25 (Regional Jet Series 1000) airplanes. This AD was prompted by a determination that aircraft maintenance manual (AMM) tasks and certification maintenance requirement (CMR) tasks are necessary. This AD requires revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive AMM and CMR tasks. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective January 22, 2024.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of January 22, 2024.

ADDRESSES:

AD Docket: You may examine the AD docket at regulations.gov under Docket No. **FAA–2023–1496**; or in person at Docket Operations between 9 a.m. and