ENCLOSURE 3

// Signed 2/5/99 //

MEMORANDUM

SUBJECT: Interim-Final Guidance for RCRA Corrective Action Environmental Indicators

FROM: Elizabeth Cotsworth, Acting Director
Office of Solid Waste

TO: RCRA Senior Policy Managers
Regions I-X

The RCRA corrective action program and achievement of its Government Performance Results Act (GPRA) goals are of highest priority for the national RCRA program. The RCRA program is using two Environmental Indicators (EI) to measure program performance for GPRA purposes: (1) Current Human Exposures Under Control (CA725), and (2) Migration of Contaminated Groundwater Under Control (CA750).

With this memorandum I am transmitting revised guidance on how to determine if a facility has met the RCRA corrective action Environmental Indicators (EI). This Interim-Final guidance will replace the existing EI guidance (from 1994 and 1995) and will remain the working guidance for at least one year. The Interim-Final guidance is similar to the earlier guidance but has been modified to facilitate more consistent determinations (across regions and states) and to be more explicit with regard to the minimum level of documentation required to ensure that the determinations will be verifiable.

This guidance has been developed with the cooperation and input of representatives from all ten EPA regions and at least one state from each region. The guidance is in the form of questions to be answered in making an EI determination. The questions and answer options express the minimum criteria for EI determinations and are not to be modified for regional, state or site-specific conditions. The "Rationale" portion of the forms can be filled in to explain unique situations to any length necessary. While the signed hard-copies of these forms should reside in the facility's administrative files, these forms should also be kept in electronic format that can be posted on an "EI database" web site to be developed by the Office of Solid Waste in the near future. The "EI database" will help communicate successes and provide examples for overcoming barriers to progress.

Thank you for your assistance with this important effort. If you have any questions, please call Bob Hall or Henry Schuver of my staff at (703) 308-8432 or 308-8656 respectively.

Attachment

ENCLOSURE 4

Facilities on the RCRA GPRA Cleanup Baseline

Most of these facilities were identified in the early 1990's when EPA and the states were prioritizing their corrective action workload, and were identified as facilities where early cleanup progress would be appropriate. Today, many of these facilities have already made substantial progress in their cleanup efforts. Some of these facilities have met the environmental indicator (EI) measures and at some of these facilities cleanup is complete. Many of the facilities that have not yet met the EI measures have still made substantial progress by stabilizing the problems or in some cases beginning final remedies. Some percentage of these facilities have not yet been assessed by EPA or the states for EI determinations. When assessed, it may be determined that some of these facilities currently meet EI measures. EPA will be focusing resources on meeting the environmental indicators for the facilities on this Baseline. The company names found on this list are the current facility owners. There may be companies on this baseline that are the current property owner but did not cause the contamination. There may also be cases where the former owners have entered an agreement to be responsible for cleanup. Unfortunately, the database is unable to track and identify these instances.

Human Exposure Environmental Indicator CA725 (Status Code)	**Groundwater Environmental Indicator CA750 (Status Code)**
YE - "Current Human Exposures Under Control" has been verified.	**YE** - Yes, "Migration of Contaminated Groundwater Under Control" has been verified.
NO - "Current Human Exposures" are NOT "Under Control."	**NO** - Unacceptable migration of contaminated groundwater is observed or expected.
IN - More information is needed to make a determination.	**IN** - More Information is needed to make a determination.
No Status - No status has been recorded for this facility.	**No Status** - No status has been recorded for this facility.

Under Control for Both EIs	**Under Control for Only CA725 (Human)**	**Under Control for Only CA750 (Groundwater)**
1325	324	17

Report Generated: 10/18/2005

Date Range: 10/01/1980 - 09/30/2005

Sorted by facility name

National

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

1714 of 1714 Facilities on the RCRA GPRA Baseline

Facility Name	Facility ID	Dept.	Address	Human	Groundwater
1990 BAY ROAD	CAT000611350		1990 BAY ROAD EAST PALO ALTO, CA, 94303	YE	YE
3D INVESTMENT, INC	NED986368728		I80 ALDA INTERCHANGE ALDA, NE, 68810	YE	YE
3M CO	ILD054236443		22614 RTE 84 N CORDOVA, IL, 61242	YE	YE
3M COLUMBIA	MOD054950670		5400 RT B COLUMBIA, MO, 65202	YE	YE
3M COMPANY DECATUR	ALD004023164		1400 STATE DOCKS ROAD DECATUR, AL, 35601	YE	YE
914TH AIRLIFT WING (AFRC)	NY0570024273	US Air Force	KIRKBRIDGE DR NIAGARA FALLS, NY, 143045001	YE	YE
A-CUBED CORP	PAD000765651		MYOMA RD MARS, PA, 16046	YE	YE
AAD DISTRIBUTION & DRY CLEANING SERVICES	CAD981397417		2306 E THIRTY EIGHTH ST VERNON, CA, 90058-1627	YE	IN
ABB INC PRODUCT SUPPORT	PAD082957127		231 THEOBOLD AVE GREENSBURG, PA, 15601	YE	YE
ABBOTT LABORATORIES	ILD055409940		1400 SHERIDAN RD D72N NORTH CHICAGO, IL, 60064	YE	YE
ABBOTT LABORATORIES WICHITA	KSD981495567		6765 S RIDGE WICHITA, KS, 67277	YE	YE
ACCELLENT COLLEGEVILLE	PAD002344463		200 WEST 7TH AVE TRAPPE, PA, 19426	YE	YE
ACCESS BUSINESS GROUP LLC	MID006026793		7575 E FULTON RD ADA, MI, 49355	YE	YE
ACME FILL CORPORATION	CAD041835695		950 WATERBIRD WAY MARTINEZ, CA, 94553	YE	YE
ACME RIVET & MACHINE CORP	CTD001701168		400 MIDDLE ST BRISTOL, CT, 06010	YE	YE
ACTION MFG CO PLANT 5	PAD096844311		500 BAILEYS CROSSROADS ATGLEN, PA, 19310	YE	IN
ADCOM WIRE CO	FLD053105821		925 N LANE AVE JACKSONVILLE, FL, 322540	YE	NO
ADHESIVES RESEARCH INC	PAD003010345		400 SEAKS RUN RD GLEN ROCK, PA, 17327	YE	YE
ADVANCED ENVIRONMENTAL TECHNICAL SVCS	PAD064375470		1050 W 11TH AVE COATESVILLE, PA, 19320	YE	YE
AERO JET - MISSILE AND SPACES PROPULSION	CAD000030494		PO BOX 13222 HIGHWAY 50 SACRAMENTO, CA, 958136000	YE	NO
AEROJET - GENERAL CORPORATION	ARD091688283		HWY 274 5M E. WALTON ROAD E, EAST CAMDEN, AR, 71711	YE	NO STATUS
AEROJET AZUSA	CAD079622569		1100 W HOLLYVALE ST AZUSA, CA, 917020296	YE	YE
AEROJET ORDNANCE CHINO FACILITY	CAD981457302		END OF WOODVIEW RD CHINO, CA, 91708	IN	YE
AFBCA/DD-MCCLELLAN	CA4570024337	US Air Force	3411 OLSON STREET MCCLELLAN, CA, 95652	YE	NO
AFG INDUSTRIES INC., GREENLAND PLANT	TND037909348		600 AFG ROAD CHURCH HILL, TN, 37642	YE	YE
AGC CHEMICALS AMERICAS INC.	NJD001787944		229 EAST 22ND STREET BAYONNE, NJ, 07002	YE	NO
AGENCY REALTY & MORTGAGE CO INC	RID002042216		477 CHURCH ST RTE 91 CHARLESTOWN, RI, 02894	YE	YE
AGROMAC - LOCKWOOD CORPORATION	NED044101442		220759 HIGHWAY 92 GERING, NE, 69341	YE	YE
AHLSTROM DEXTER	CTD983895137		CANAL BANK RD WINDSOR LOCKS, CT, 06096	YE	YE
AHLSTROM DEXTER MAIN PLANT	CTD983871914		CANAL BANK RD WINDSOR LOCKS, CT, 06096	YE	YE
AID CORPORATION THE	GAD003292885		250 LAUREL HEIGHTS DR CLAYTON, GA, 30525	YE	YE
AIR FORCE BASE CONV AGENCY EAKER AFB	AR8571924473	US Air Force	A809 ATLANTA ST BLYTHEVILLE, AR, 72315	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

AIR FORCE PLANT 6	GA8570024606	US Air Force	86 SOUTH COBB DRIVE REM3 ZONE 0446, MARIETTA, GA, 300640446	YE	NO
AIR PRODUCTS & CHEMICALS ESM	PAD069778967		SR1019 & SR1020 TAMAQUA, PA, 18252	YE	YE
AIRCO WELDING PROD CHESTER WIRE PLANT	WVD980554760		RTE 2 2 MILES SO OF CHESTER CHESTER, WV, 26034	YE	YE
AK STEEL CORP	OHD058842501		530 N SECOND ST CAMBRIDGE, OH, 43725	YE	YE
AK STEEL CORP - MANSFIELD WORKS	OHD004157418		913 BOWMAN ST MANSFIELD, OH, 449010247	YE	NO STATUS
AK STEEL CORPORATION - ZANESVILLE WORKS	OHD004281598		1724 LINDEN AVENUE ZANESVILLE, OH, 43701	YE	YE
AK STEEL INC	PAD004325254		210 PITTSBURGH RD BUTLER, PA, 16003	YE	YE
AKZO CHEMICALS INC	DED980551667		SCHOOLHOUSE RD DELAWARE CITY, DE, 19706	YE	IN
AKZO NOBEL FUNCTIONAL CHEMICALS LLC	ALD008161176		13440 HIGHWAY 43 NORTH AXIS, AL, 36505	YE	YE
AKZO NOBEL POLYMER CHEMICALS LLC	NYD043815158		2153 LOCKPORT-OLCOTT RD BURT, NY, 14028	YE	YE
ALABAMA PLATING COMPANY, INC.	ALD004022448		HWY 231 VINCENT, AL, 35178	IN	IN
ALABAMA STATE PORT AUTHORITY	ALD058221326		3 OLD WATER STREET MOBILE, AL, 36604	YE	IN
ALASKA RAILROAD CORP	AKD981767403		327 W SHIP CREEK ANCHORAGE, AK, 99501	IN	IN
ALBEMARLE CORP ORANGEBURG PLT	SCD043384072		725 CANNON BRIDGE RD ORANGEBURG, SC, 29115	YE	YE
ALBEMARLE CORPORATION SOUTH PLANT	ARD052528809		2270 HIGHWAY 79S MAGNOLIA, AR, 71753	YE	YE
ALBEMARLE CORPORATION WEST PLANT	ARD982558561		1550 HWY 371S MAGNOLIA, AR, 71753	YE	NO STATUS
ALCOA EXTRUSIONS INC	PAD096262522		53 POTTSVILLE ST CRESSONA, PA, 17929	YE	YE
ALCOA INC	PAD003026663		1700 FRUITVILLE PIKE REAR LANCASTER, PA, 17601	YE	YE
ALCOA INC WARRICK OPERATIONS	IND006366819		HIGHWAY 66 NEWBURGH, IN, 47630	YE	YE
ALCOA INC. MASSENA OPERATIONS	NYD002232304		PARK AVE. EAST MASSENA, NY, 13662	YE	YE
ALCOA, INC	NCD003162542		HIGHWAY 740 BADIN, NC, 28009	YE	YE
ALDAN INDS INC	PAD980551840		115 WOODBINE LN DANVILLE, PA, 17821	YE	YE
ALLEGHENY LUDLUM VANDERGRIFT	PAD004378501		130 LINCOLN AVE VANDERGRIFT, PA, 15690	YE	YE
ALLIANT TECHSYSTEMS PROVING GROUNDS	MND081138604		23100 SUGARBUSH ROAD NW ELK RIVER, MN, 55330	YE	YE
ALLIED MATERIALS CORPORATION	OKD007192719		ALLIED ROAD ALLIED ROAD, STROUD, OK, 74079	YE	YE
ALLVAC LATROBE	PAD057629479		ROUTE 981 LATROBE, PA, 15650	YE	YE
ALON USA LP	TXD008013468		200 REFINERY RD BIG SPRING, TX, 79720	YE	YE
ALSIDE INC	OHD004163549		3773 STATE RD CUYAHOGA FALLS, OH, 44223	YE	IN
ALTERNATE ENERGY RESOURCES INC	GAD033582461		2730 WALDEN DR AUGUSTA, GA, 30904	IN	NO
ALTON STEEL INC	ILD006280606		5 CUT ST ALTON, IL, 62002	YE	YE
AMAX METALS RECOVERY INC	LAD058472721		3607 ENGLISH TURN ROAD BRAITHWAITE, LA, 70040	YE	YE
AMERCORD INC	GAD008966400		INDUSTRIAL BLVD LUMBER CITY, GA, 315490458	YE	IN
AMERICAN AIRLINES - MCI M & E BASE	MOD043935048		9200 NW 112TH ST KANSAS CITY, MO, 64153	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

AMERICAN CANDLE CO	NYD000233510		1033 KINGS HWY SAUGERTIES, NY, 12477	YE	YE
AMERICAN COLOR & CHEMICAL LLC	PAD003047792		MT VERNON ST LOCK HAVEN, PA, 17745	YE	YE
AMERICAN CYANAMID CO	NJD002173276		E MAIN ST BRIDGEWATER, NJ, 08807	YE	YE
AMERICAN HOIST & DERRICK CO	MED001108463		143 FORE ST PORTLAND, ME, 04101	YE	YE
AMERICAN METALS CORP	OHD004528873		1000 CROCKER ROAD WESTLAKE, OH, 44125	YE	YE
AMERICAN NICKELOID CO	PAD002399285		131 CHERRY ST WALNUTPORT, PA, 18088	YE	YE
AMERICAN RECOVERY CO INC	MDD074923392		1901 BIRCH ST BALTIMORE, MD, 21226	YE	YE
AMERICAN REFINING GROUP	PAD001604693		77 N KENDALL AVE BRADFORD, PA, 16701	YE	IN
AMERICAN STANDARD INC	NJD002366441		KLOCKNER RD TRENTON, NJ, 08619	YE	YE
AMERICAN WOOD - DIVISION OF POWE TIMBER	MSD021019914		HIGHWAY 15 NORTH RICHTON, MS, 39476	YE	YE
AMETEK INC US GAUGE DIV	PAD002342236		900 CLYMER AVE SELLERSVILLE, PA, 18960	YE	YE
AMLAND CORP/CHRYSLER-ROCKWELL INTL	IND981091515		13240 MCKINLEY AVE MISHAWAKA, IN, 46544	YE	NO
AMMUNITION ACCESSORIES INC CCI	IDD009066481		2299 SNAKE RIVER AVENUE LEWISTON, ID, 83501	YE	YE
AMOCO PIPELINE TANK FARM	WYD991301086		1MI N AMOCO CASPER REFINERY CASPER, WY, 82601	YE	YE
AMOCO, RIVERFRONT PROPERTY	ILD980503106		301 EVANS AVE RIVERFRONT WOOD RIVER, IL, 62095	YE	YE
AMOCO, WOOD RIVER RFNRY	ILD980700967		301 EVANS AVE P O BOX 65, WOOD RIVER, IL, 62095	YE	YE
AMPHENOL CORP BENDIX CONNECTOR DIV	NYD981133184		RIVER ST SIDNEY, NY, 13838	YE	YE
ANACOMP INC	CAD051612802		305 SOQUEL WY AND 307 N PASTORIA AVE TSDF PT, SUNNYVALE, CA, 94086	YE	YE
ANCHOR LAMINA AMERICA INC	MID006017966		3650 S DERENZY RD BELLAIRE, MI, 49615	YE	YE
ANDREW WILLGOOS TURBINE LABORATORY	CTD000845131		PENT ROAD EAST HARTFORD, CT, 06108	YE	YE
ANNISTON ARMY DEPOT	AL3210020027	US Army	7 FRANKFORD AVE AMSTA-AN-RKC ANNISTON, AL, 362014199	YE	IN
AOC LLC	IND980502074		2552 INDUSTRIAL DR VALPARAISO, IN, 46383	YE	YE
APPALACHIAN POWER CO	WVD980554588		US ROUTE 60 EAST GLASGOW, WV, 250860110	YE	YE
APPALACHIAN TIMBER SERVICE	WVD063461958		525 EAST STONEWALL STREET SUTTON, WV, 26601	YE	YE
APPROVED OIL SERVICES INC	COD060627262		5390 E 72ND AVE COMMERCE CITY, CO, 80022	YE	YE
ARCH CHEMICALS INC	KYD006396246		2450 OLIN ROAD BRANDENBURG, KY, 40108	YE	YE
ARCH CHEMICALS, INC.	NYD002220804		100 MCKEE ROAD ROCHESTER, NY, 14611	NO STATUS	YE
ARCH WOOD PROTECTION	GAD000821934		1579 KOPPERS ROAD CONLEY, GA, 30288	YE	YE
ARCH WOOD PROTECTION	IND000781609		2852 RAYSTONE DR VALPARAISO, IN, 46383	YE	YE
ARGONNE NATIONAL LABORATORY	IL3890008946	Dept. of Energy	9700 S CASS AVE BLDG 3 ARGONNE, IL, 60439	YE	YE
ARISTECH CHEM CORP	NJD001724988		1711 W ELIZABETH AVE LINDEN, NJ, 07036	YE	YE
ARIZONA CHEMICAL	GAD003299526		1401 E. HILL AVE VALDOSTA, GA, 31601	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

ARIZONA CHEMICAL	OHD004209094		875 HARGER ST DOVER, OH, 44622	YE	YE
ARIZONA CHEMICAL CO INC	FLD004065926		2 EVERITT AVE PANAMA CITY, FL, 324020	YE	YE
ARKANSAS ARMY NATIONAL GUARD (CJTR)	ARD982552739	US Army	CAMP J.T. ROBINSON DCSEN-E BOX 5 BUILDING 1301, NORTH LITTLE ROCK, AR, 72199	YE	YE
ARKEMA INC	ALD000827154		13755 US HWY 43 AXIS, AL, 365050099	YE	YE
ARKEMA INC	KYD006370159		4444 INDUSTRIAL PKWY CALVERT CITY, KY, 42029	YE	NO
ARKEMA INC	KYD006373922		2316 HIGHLAND AVENUE CARROLLTON, KY, 41008	YE	YE
ARKEMA INC	MID005363114		17168 W JEFFERSON AVE RIVERVIEW, MI, 48192	YE	YE
ARKEMA INC	NYD002218436		3289 GENESEE ST RTE 63 PIFFARD, NY, 14533	YE	YE
ARNOLD ENG DEVELOPMENT CENTER/SDE	TN8570024044	US Air Force	ARNOLD AIR FORCE BASE TULLAHOMA, TN, 37389-1228	YE	YE
ARSYNCO INC	NJD044688935		13TH ST - FOOT OF CARLSTADT, NJ, 07072	YE	YE
ARTEVA SPECIALTIES S.A.R.L. D/B/A KOSA	NCD041043811		7401 STATESVILLE BLVD SALISBURY, NC, 28147	YE	YE
ARVIN MERITOR INC	IND000810903		505 INDUSTRIAL DR NORTH VERNON, IN, 47265	YE	YE
ASARCO LLC - GLOBE PLANT	COD007063530		495 E 51ST AVE DENVER, CO, 80216	YE	YE
ASF-KEYSTONE	OHD017497587		20455 LAKE PARK BLVD SMITH TOWNSHIP, OH, 44601	YE	YE
ASHLAND CHEMICAL CO	CAD066562521		8610 ENTERPRISE DR NEWARK, CA, 945603315	YE	YE
ASHLAND CHEMICAL CO	MID047173653		1800 GLENROSE AVE LANSING, MI, 48915	YE	YE
ASHLAND CHEMICAL CO	CAD091933895		291 W ADAMS ST COLTON, CA, 92324	YE	YE
ASHLAND CHEMICAL INC	FLD067230771		5125 W HANNA AVE TAMPA, FL, 336840	YE	YE
ASHLAND CHEMICAL INC	WID053689196		1033 N HAWLEY ROAD MILWAUKEE, WI, 53208	YE	YE
ASHLAND CHEMICAL INC	FLD079859492		1645 N MCDUFF AVE JACKSONVILLE, FL, 322050	YE	YE
ASHLAND CHEMICAL, ASHLAND OIL	ILD980700538		8500 WILLOW SPRINGS RD WILLOW SPRINGS, IL, 604801223	YE	YE
ASHLAND DISTRIBUTION CO	IND016621476		1817 W INDIANA AVE SOUTH BEND, IN, 46613	YE	YE
ASHLAND DISTRIBUTION CO	OHD000723973		200 DARROW RD AKRON, OH, 44305	YE	YE
ASHLAND DISTRIBUTION CO	KSD057889313		5420 SPEAKER RD KANSAS CITY, KS, 66106	YE	YE
ASHLAND DISTRIBUTION CO	MOD031005341		7710 POLK ST ST LOUIS, MO, 63111	YE	YE
ASHLAND DISTRIBUTION CO DIVISION OF ASHL	FLD059861344		200 NE 181ST STREET MIAMI, FL, 331621081	YE	YE
ASHLAND DISTRIBUTION COMPANY	CAD044061422		10505 SOUTH PAINTER AVENUE SANTA FE SPRINGS, CA, 90670	YE	YE
ASHLAND DISTRIBUTION COMPANY	GAD066465824		4550 NE EXPRESSWAY DORAVILLE, GA, 30340	YE	NO
ASHLAND DISTRIBUTION COMPANY	GAD041007063		400 TELFAIR ROAD SAVANNAH, GA, 31401	YE	YE
ASHLAND DISTRIBUTION COMPANY	TND095058541		5263 NATIONAL DRIVE KNOXVILLE, TN, 37914	YE	YE
ASHLAND DISTRIBUTION COMPANY	TND048319644		2351 CHANNEL AVENUE MEMPHIS, TN, 38113	YE	YE
ASHLAND SPECIALTY CHEMICAL CO	ILD043369446		142ND & PAXTON AVE CALUMET CITY, IL, 60409	YE	YE
ATK ELKTON LLC	MDD003067121		55 THIOKOL RD ELKTON, MD, 219220241	YE	IN

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

ATK THIOKOL PROPULSION - BACCHUS	UTD001705029		5000 SOUTH HIGHWAY 111 MAGNA, UT, 84044	YE	IN
ATKEMIX TEN INC	KYD006372197		6100 CAMPGROUND ROAD LOUISVILLE, KY, 40216	YE	NO
ATLANTC WOOD INDUSTRIES, INC.	GAD084914787		OXNARD DRIVE PORT WENTWORTH, GA, 31407	YE	YE
ATLANTIC COAST ENVIRONMENTAL INC	DED000796300		225 STATE COLLEGE RD DOVER, DE, 19901	YE	YE
ATLANTIC RESEARCH CORPORATION	VAD023741705		5945 WELLINGTON ROAD GAINESVILLE, VA, 20155	YE	YE
ATLANTIC STEEL CO	GAD003326477		1365 MECASLIN ST NW ATLANTA, GA, 30318	YE	YE
ATOFINA CHEMICALS INC	NJD052788528		SOUTH ST HOLMDEL, NJ, 07733	YE	YE
AUBREY MANUFACTURING INC	ILD005238159		6709 S MAIN ST UNION, IL, 60180	YE	YE
AUBURN UNIVERSITY	ALD000826958		971 CAMP AUBURN ROAD AUBURN UNIVERSITY, AL, 368495317	YE	YE
AUSTIN POWDER CO	OHD004293775		430 POWDER PLANT RD MCARTHUR, OH, 456510317	YE	YE
AUTOLIV ASP INC	COD005127279		34501 E QUINCY AVE AURORA, CO, 80015	YE	YE
AVERY DENNISON CORP FASSON ROLL DIV	PAD053277752		35 PENN AM DR QUAKERTOWN, PA, 18951	YE	YE
B A S F CORP	VAD990710642		RTE 60 EAST WILLIAMSBURG, VA, 23187	YE	YE
BAKER PERFORMANCE CHEMICALS INC	TXD047872890		410 HILLMONT ODESSA, TX, 79764	YE	YE
BALDWIN POLE & PILING CO INC	ALD031490501		1101 HWY 31 NORTH BAY MINETTE, AL, 36507	YE	YE
BALL & SOCKET MFG CO	CTD001167493		493 W MAIN ST CHESHIRE, CT, 06410	YE	YE
BARKSDALE AFB	LA9571924050	US Air Force	334 DAVIS AVE W, STE 208 2 CES/CEV, BARKSDALE AFB, LA, 71110	YE	YE
BARNES AEROSPACE WINDSOR DIV	CTD001148303		169 KENNEDY ROAD WINDSOR, CT, 06095	YE	YE
BARON BLAKESLEE	ORD061483384		5920 NE 87TH PORTLAND, OR, 97220-1314	YE	YE
BASE TRANSITION TEAM - FT CHAFFEE	AR9210020187	US Army	BLDG 2033 1ST AVE BARLING, AR, 72923	YE	YE
BASF CORP	MID048223986		471 HOWARD AVE HOLLAND, MI, 49423	YE	NO STATUS
BASF CORP	MID064197742		1609 BIDDLE AVE WYANDOTTE, MI, 48192	YE	YE
BASF CORPORATION	LAD040776809		8404 RIVER ROAD GEISMAR, LA, 70734	YE	YE
BASIC CHEMICALS CO LLC	KSD007482029		6200 S RIDGE RD WICHITA, KS, 67215	YE	YE
BASIC CHEMICALS CO LLC	LAD092681824		8318 ASHLAND RD GEISMAR, LA, 70734	YE	YE
BASS PLATING CO THE	CTD001145671		82 OLD WINDSOR ROAD BLOOMFIELD, CT, 06002	YE	YE
BATES SUSAN INC	CTD080848666		212 MIDDLESEX AVE RTE 9A CHESTER, CT, 06412	YE	YE
BATTERY PARK INDUSTRIES INC	FLD043860451		12801 US HWY 441 N ALACHUA, FL, 326150	YE	YE
BAYER CORP	TXD084972777		8701 PARK PLACE BLVD HOUSTON, TX, 77017	YE	YE
BAYER CORP	VAD003379062		807 SOUTH SHADY AVE DAMASCUS, VA, 24236	YE	YE
BAYER CROPSCIENCE	MOD056389828		8400 HAWTHORN RD KANSAS CITY, MO, 64120	YE	YE
BAYER CROPSCIENCE LP	MID080358351		1740 WHITEHALL RD MUSKEGON, MI, 49445	YE	YE
BAYER CROPSCIENCE LP	WVD005005509		RTE 25 & INTERSTATE 64 INSTITUTE, WV, 25112	YE	IN
BAYER MATERIAL SCIENCE LLC	TXD058260977		8500 W BAY RD BAYTOWN, TX, 77520	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

BAYER MATERIAL SCIENCE LLC	WVD056866312		STATE ROUTE 2 NATRIUIM, WV, 26155	YE	YE
BEALE AIR FORCE BASE	CA7570024508	US Air Force	9 CES/CEVP 6601 B STREET BEALE AFB, CA, 95903	YE	NO
BEAZER EAST /KOPPERS INC	ALD004009403		1415 LOUISVILLE ST MONTGOMERY, AL, 36104	YE	YE
BEAZER EAST INC	ILD000819946		1555 N MARION ST CARBONDALE, IL, 62901	YE	IN
BEAZER EAST INC	OHD004198784		1359 LOGAN AVE YOUNGSTOWN, OH, 44505	YE	IN
BEAZER EAST INC	MOD007146517		6740 STADIUM DR KANSAS CITY, MO, 64129	YE	YE
BEAZER EAST INC & KOPPERS INC	ALD000771949		2134 KOPPERS DRIVE DOLOMITE, AL, 35061	YE	YE
BEAZER EAST INC-PORT NEWARK	NJD000542282		MARITIME & TYLER PORT NEWARK, NJ, 15219	YE	YE
BEAZER-COLLIER	WVD980707178		RD 1 CROSSCREEK DISTRICT COLLIERS, WV, 26035	YE	YE
BEDFORD MATERIALS CO INC	PAD057631889		7676 ALLEGHENY RD MANNS CHOICE, PA, 15550	YE	YE
BEHLEN MFG CO	NED007268790		4025 E 23RD STREET COLUMBUS, NE, 68601	YE	NO
BELL AEROSPACE TEXTRON	NYD002106276		9812 NIAGARA FALLS BLVD WHEATFIELD, NY, 14150	YE	YE
BELL HELICOPTER TEXTRON INC	TXD980626006		600 E HURST BLVD HURST, TX, 76053	YE	YE
BENTON CREOSOTING WORKS	LAD008056632		6695 HWY 3 BENTON, LA, 71006	YE	YE
BERKLEY PRODUCTS CO INC	PAD003003894		405 S 7TH ST AKRON, PA, 17501	NO STATUS	NO STATUS
BETHLEHEM STEEL CORPORATION	NYD002134880		2600 HAMBURG TURNPIKE LACKAWANNA, NY, 14218	NO STATUS	NO STATUS
BETTIS ATOMIC POWER LAB	PA0890090004	Dept. of Energy	814 PITTSBURGH MCKEESPORT BLVD WEST MIFFLIN, PA, 151220109	YE	YE
BFI DAVIS JUNCTION	ILD980700751		8902 N RTE 251 DAVIS JUNCTION, IL, 61020	YE	YE
BFI MISSOURI CITY LANDFILL	MOD000624452		8501 STILLHOUSE RD LIBERTY, MO, 64068	YE	NO
BIG WEST OF CALIFORNIA LLC	CAD099457087		6451 ROSEDALE HIGHWAY BAKERSFIELD, CA, 93308	YE	YE
BIGARD OIL & MFG INC	ILD009033341		RR 6 NEWTON, IL, 62448	YE	YE
BINGHAM & TAYLOR	VAD003064490		NALLE PL CULPEPER, VA, 22701	YE	YE
BKK LANDFILL SITE	CAD067786749		2210 S AZUSA AVE WEST COVINA, CA, 91792	IN	NO
BLACK & DECKER	PAD003001732		1801 SOUTH 12TH ST ALLENTOWN, PA, 18103	YE	NO STATUS
BLACKHAWK FOUNDRY & MACHINE CO	IAD005264049		323 S CLARK ST DAVENPORT, IA, 528023527	YE	YE
BLACKMAN UHLER CHEMICAL CO	GAD042125146		1010 GLASS FACTORY AVE AUGUSTA, GA, 30901	YE	YE
BLACKMAN UHLER CHEMICAL DIV OF SYNALLOY	SCD003349065		2155 W CROFT CIRCLE DR SPARTANBURG, SC, 29302	YE	YE
BLUE BIRD BODY COMPANY	GAD980729974		402 BLUE BIRD BLVD. FORT VALLEY, GA, 31030	YE	YE
BLUE COW INC	MID060197662		33 STATE ST MIDDLEVILLE, MI, 49333	YE	YE
BLUE GRASS ARMY DEPOT LEXINGTON	KY0210020509	US Army	HALEY RD LEXINGTON, KY, 40511	YE	YE
BLUE GRASS ARMY DEPOT, RICHMOND	KY8213820105	US Army	2091 KINGSTON HWY RICHMOND, KY, 40475	YE	YE
BN PARADISE TIE PLANT	MTD000716787		HWY 200 BN TIE PLANT RD SW OF PARADISE, PARADISE, MT, 59856	YE	YE
BOEING A&M DEVELOPMENTAL CENTER	WAD093639946		9725 E MARGINAL WAY S SEATTLE, WA, 98108	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

BOEING CO SSFL ETEC AREA I V	CAD000629972	TOP OF WOOLSEY CANYON RD HWMF SIMI VALLEY, CA, 93063	YE	IN
BOEING EVERETT	WAD041585464	3003 W CASINO RD EVERETT, WA, 98204	YE	IN
BOEING OF PORTLAND	ORD054964481	19000 NE SANDY BLVD PORTLAND, OR, 97230	YE	YE
BOEING PLANT 2	WAD009256819	7755 E MARGINAL WAY S SEATTLE, WA, 98108	NO	NO
BOEING RENTON	WAD009262171	800 N 6TH ST RENTON, WA, 98055	YE	IN
BON L MANUFACTURING COMPANY	GAD003273224	25 BONNELL ST. NEWNAN, GA, 30263	YE	YE
BORICUA WOOD PROCESSING INC	PRD090564477	RD 865 KM 5.5 TOA BAJA, PR, 00759	YE	YE
BOSTIK FINDLEY INC	MAD001039767	211 BOSTON ST MIDDLETON, MA, 01949	YE	YE
BOULDEN INC T/A DIRT MAGNET	MDD980550198	895 NOTTINGHAM ROAD CECIL, MD, 21921	YE	YE
BOUTIN LORETTA	CTD001165760	1981 E MAIN ST WATERBURY, CT, 06705	YE	YE
BOVANO INC	CTD001179316	830 MAIN STREET CHESHIRE, CT, 06410	YE	YE
BOYERTOWN SANITARY DISPOS	PAD048603005	300 MERKEL RD GILBERTSVILLE, PA, 19525	YE	YE
BP AMOCO CHEMICAL COMPANY	OHD042157644	1900 FORT AMANDA ROAD LIMA, OH, 45804	YE	YE
BP OIL INC	PAD071612683	4100 POST RD MARCUS HOOK, PA, 19061	YE	YE
BP PRODUCTS NORTH AMERICA - TOLEDO REFIN	OHD005057542	4001 CEDAR POINT RD OREGON, OH, 43616	YE	YE
BP PRODUCTS NORTH AMERICA INC	IND074375585	2815 INDIANAPOLIS BLVD WHITING, IN, 46394	YE	YE
BP PRODUCTS NORTH AMERICA INC	MOD007161425	1000 N STERLING SUGAR CREEK, MO, 64054	YE	YE
BP PRODUCTS NORTH AMERICA, INC.	WYD007064447	1707 WEST YELLOWSTONE HWY CASPER, WY, 82601	YE	YE
BRADFORD ELECTRONICS INC	PAD046762258	550 HIGH ST BRADFORD, PA, 167010798	YE	YE
BRC RUBBER	IND005081526	589 US 33 S CHURUBUSCO, IN, 46723	YE	YE
BRENNTAG GREAT LAKES LLC	WID023350192	N59 W14706 BOBOLINK AVE MENOMONEE FALLS, WI, 53051	YE	NO STATUS
BRENNTAG SOUTHEAST INC GREENSBORO	NCD003471158	2 HCI BLVD GREENSBORO, NC, 27409	YE	YE
BRIDGEPORT DISPOSAL, LLC	NJD053288239	2858 ROUTE 322 BRIDGEPORT, NJ, 08014	YE	YE
BRIDGEPORT HARBOR STATION	CTD000638627	10 HENRY STREET BRIDGEPORT, CT, 06604	YE	YE
BRISTOL MYERS SQUIBB MANUFACTURING CO.	PRD090021056	STATE ROAD #3 KM 77.5 PO BOX 609, HUMACAO, PR, 00791	YE	YE
BRISTOL SANITARY LANDFILL	CTD000790725	LAKE AVE BRISTOL, CT, 06010	YE	IN
BROSKI BROTHERS INC	MOT300010972	39TH BELMONT KANSAS CITY, MO, 64129	YE	YE
BROWN AND BRYANT SHAFTER FAC	CAD009531823	135 COMMERCIAL DR SHAFTER, CA, 93263	YE	YE
BROWNING FERRIS INC SOLLEY ROAD LANDFILL	MDD000797365	7890 SOLLEY RD GLEN BURNIE, MD, 210600000	YE	YE
BRUSH WELLMAN INC ELMORE PLANT	OHD004212999	14710 W PORTAGE RIVER S RD ELMORE, OH, 43416	YE	IN
BUCKEYE PRODUCTS CORP	MID005044813	410 E BEECHER ST ADRIAN, MI, 49221	YE	IN
BUFFALO COLOR CORPORATION	NYD080335052	LEE ST BUFFALO, NY, 14210	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

BURLINGTON BASKET CO-PLANT NO. 2	IAD000678037		1404-1418 W MT PLEASANT ST WEST BURLINGTON, IA, 52655	YE	YE
BURLINGTON ENVIRONMENTAL INC	WAD000812917		2001 W GARFIELD ST E SIDE OF B SEATTLE, WA, 98119-3100	YE	YE
BURLINGTON ENVIRONMENTAL INC GEORGE	WAD000812909		734 S LUCILE ST SEATTLE, WA, 98108	YE	IN
BURLINGTON ENVIRONMENTAL INC TACOMA	WAD020257945		1701 E ALEXANDER AVE TACOMA, WA, 98421-4106	YE	NO
BURLINGTON ENVIRONMENTAL WASHOUGAL	WAD092300250		625 S 32ND ST WASHOUGAL, WA, 98671	YE	IN
BURLINGTON NORTHERN SANTA FE CORPORATION	TXD000778621		HWY 36 N @ AVE E SOMERVILLE, TX, 77879	YE	YE
BURLINGTON NORTHERN SANTA FE HOBSON YARD	NED000822767		801 WEST O STREET LINCOLN, NE, 68528	YE	YE
BURLINGTON NORTHERN SANTA FE RAILROAD	IAD000688572		1801 NW BURLINGTON AVE BURLINGTON, IA, 52601	YE	NO STATUS
BURNHAM FOUNDRY LLC	OHD004282158		2345 LICKING RD ZANESVILLE, OH, 43702	YE	YE
BWX TECHNOLOGIES, INC.	VAD046960449		1570 MT. ATHOS RD. LYNCHBURG, VA, 24504	YE	YE
C & D TECHNOLOGIES INC	PAD056771405		82 E MAIN ST LEOLA, PA, 17540	YE	YE
C R R A	CTD991288960		25 PENT RD WALLINGFORD, CT, 06492	YE	YE
CABOT CORP	ILD042075333		700 E RTE 36 TUSCOLA, IL, 61953	YE	YE
CABOT PERFORMANCE MATERIALS	PAD014512388		BEAVER RUN RD REVERE, PA, 18953	YE	YE
CABOT SUPERMETALS	PAD002335545		COUNTY LINE RD BOYERTOWN, PA, 195121608	YE	YE
CALDWELL SYS INC	NCD086871282		MT HERMON RD LENOIR, NC, 28645	YE	IN
CALGON CARBON CORP	PAD000736942		200 NEVILLE RD PITTSBURGH, PA, 15108	YE	YE
CALGON CARBON CORPORATION	KYD005009923		US RT 23 SOUTH CATLETTSBURG, KY, 41129	YE	YE
CAMERON YAKIMA INC	WAD009477175		1414 S 1ST ST YAKIMA, WA, 98901-1729	YE	YE
CAMP NAVAJO, AZ ARMY NAT`L GUARD	AZ7213820635	US Army	I-40, EXIT 185 BELLEMONT, AZ, 86015	YE	IN
CANNON AIR FORCE BASE NEW MEXICO	NM7572124454	US Air Force	100 S DL INGRAM BLVD STE 100 CANNON AIR FORCE BASE, NM, 881035214	YE	YE
CARE TAKER SITE OFFICE, MARE ISLAND	CA7170024775	US Navy	WEST END OF TENNESSEE STREET VALLEJO, CA, 94592	YE	NO
CARIBBEAN PETROLEUM REFINING	PRD000632182		ROAD 28 KM 2.0 LUCHETTI INDUSTRIAL PARK, BAYAMON, PR, 00961	YE	NO STATUS
CARIBE GENERAL ELECTRIC PRODUCT JUANA DI	PRD090282757		CARR 149 KM 67 JUAN DIAZ PLANT, JUANA DIAZ, PR, 00665	YE	YE
CARLISLE SYNTEC INC	PAD069784049		1295 RITNER HWY CARLISLE, PA, 17013	YE	NO STATUS
CAROLINA PLATING WORKS INC	SCD003351996		1101 W BLUE RIDGE DR GREENVILLE, SC, 29609	YE	YE
CAROLINA SOLITE	NCD003152642		12423 OLD AQUADALE ROAD NORWOOD, NC, 28128	YE	YE
CARPENTER TECHNOLOGY CORP	PAD002344315		101 W BERN ST READING, PA, 19601	YE	YE
CASCADE POLE & LUMBER CO TACOMA	WAD008958357		1640 E MARC ST TACOMA, WA, 98421-2939	YE	YE
CASMALIA HAZ. WASTE MANAGEMENT FACILITY	CAD020748125		3401 NTU ROAD CASMALIA, CA, 93429	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

CASTLE AFB	CA3570024551	US Air Force	4500 N HOSPITAL RD ATWATER, CA, 95301	YE	YE
CATERPILLAR INC	ILD052664604		901 W WASHINGTON ST EAST PEORIA, IL, 61630	YE	YE
CAVENHAM FOREST INDUSTRIES INC	OKD010327948		W REDWOOD AVE .25M W SALLISAW, OK, 74955	YE	YE
CAVENHAM FOREST INDUSTRIES, INC.	ALD057226904		SOUTH END HERBERT ST MOBILE, AL, 36652	YE	YE
CAVENHAM FOREST INDUSTRIES, INC.	MSD057226961		CREOSOTE ROAD GULFPORT, MS, 39501	YE	YE
CCSWA LANCHESTER STABILIZED DISPOSAL	PAD980550545		7224 DIVISION HWY NARVON, PA, 17555	YE	NO STATUS
CECOS INTERNATIONAL INC	NYD080336241		NIAGARA FALLS BLVD NIAGARA FALLS, NY, 14304	YE	YE
CECOS INTERNATIONAL INC	OHD087433744		5092 ABER RD WILLIAMSBURG, OH, 45176	YE	YE
CECOS INTL, INC. CALCASIEU FACILITY	LAD000618256		918 WILLOW SPRINGS RD WESTLAKE, LA, 70669	YE	YE
CEDAR CHEMICAL	ARD990660649		49 PHILLIPS RD 311 W HELENA, AR, 72342	NO STATUS	NO STATUS
CEE ASSOC	CTD044121697		80 PICKETT DISTRICT RD NEW MILFORD, CT, 06776	YE	IN
CELANESE ACETATE LLC	SCD003159928		2850 CHERRY RD ROCK HILL, SC, 29730	YE	YE
CELANESE LTD	TXD007376700		US HIGHWAY 60 W 5 MI W OF PAMPA, TX, 79065	YE	YE
CELANESE LTD	TXD078432457		9502 BAYPORT BLVD PASADENA, TX, 77507	YE	YE
CELANESE LTD	TXD069450278		1901 CLARKWOOD RD CORPUS CHRISTI, TX, 78409	YE	YE
CEMEX INC	PAD083965897		2001 PORTLAND PARK WAMPUM, PA, 161579109	YE	YE
CENTURY BRASS FORMERLY KNOWN AS	CTR000003012		73 HAMILTON AVE WATERBURY, CT, 06706	YE	YE
CENTURY BRASS PRODS NEW MILFORD PLT	CTD000847707		12 SCOVILL ST NEW MILFORD, CT, 06776	YE	YE
CENTURY BRASS PRODUCTS INC	CTD060008307		SILVER ST WATERBURY, CT, 06702	YE	YE
CENTURY FOREST INDUSTRIES INC	TXD990706517		HIGHWAY 103 LUFKIN, TX, 75904	YE	NO STATUS
CHAIN BIKE CORP	PAD053061909		200 CASCADE DR ALLENTOWN, PA, 18103	YE	YE
CHALMETTE REFINING, L.L.C	LAD008179707		500 WEST ST. BERNARD HWY. CHALMETTE, LA, 70043	YE	YE
CHARLESTON NAVAL COMPLEX	SC0170022560	US Navy	1330 KILO ST BLDG 1824 CHARLESTON, SC, 29408	YE	YE
CHEM TECHNOLOGY LABS INC	CAD008275885		12150 S ALAMEDA ST (SEE MAP) LYNWOOD, CA, 90262	YE	NO
CHEM WASTE MGMT BAKERSFIELD	CAT000624056		27001 ROUND MOUNTAIN RD BAKERSFIELD, CA, 93308	YE	YE
CHEMETCO	ILD048843809		3754 CHEMETCO LN HARTFORD, IL, 62048	NO STATUS	NO STATUS
CHEMICAL LEAMAN TANK LINES INC	PAD000414441		1700 RIVER ROAD CROYDON, PA, 19020	YE	YE
CHEMICAL SPECIALITIES, INC.	NCD048467427		5910 PHARR MILL ROAD HARRISBURG, NC, 28075	YE	YE
CHEMICAL SPECIALTIES INC	GAD980843155		1219 OLD CLYATTVILLE RD VALDOSTA, GA, 31601	YE	YE
CHEMICAL WASTE MANAGEMENT	ALD000622464		HWY 17 NORTH MILE MARKER 163, EMELLE, AL, 35459	YE	YE
CHEMICAL WASTE MANAGEMENT OF T	ORD089452353		17629 CEDAR SPRINGS LN ARLINGTON, OR, 97812	YE	YE
CHEMICAL WASTE MGMT INC	KSD070902952		8808 N 127TH E VALLEY CENTER, KS, 67147	YE	YE
CHEMICAL WASTE MNGMT INC	CAT000646117		35251 OLD SKYLINE RD KETTLEMAN CITY, CA, 93239	YE	YE
CHEMTRONICS INC	NCD095459392		180 OLD BEE TREE RD SWANNANOA, NC, 28778	YE	NO
CHEMTURA CORP	NJD002165561		1000 CONVERY BLVD PERTH AMBOY, NJ, 08861	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

CHEMTURA CORPORATION	LAD065470916	471 HWY 3142 TAFT, LA, 70057	YE	YE
CHEMTURA CORPORATION	TXD049213127	710 BUSSEY RD MARSHALL, TX, 75670	YE	YE
CHEMWOOD TREATMENT CO INC	HID981424138	2024 N KING ST HONOLULU, HI, 96819	YE	YE
CHEROKEE - FORMER BORDEN FACILITY	NCD001725464	HWY 11 N KINSTON, NC, 28501	YE	YE
CHEROKEE COLUMBUS REAL ESTATE, LLC	NYD000691865	108-112 N MAIN ST BAINBRIDGE, NY, 137331213	YE	YE
CHESAPEAKE FINISHED METALS, INC.	MDD069380657	6754 SANTA BARBARA CT ELKRIDGE, MD, 21075	YE	YE
CHEVRON CHEMICAL CO	IAD005173992	6103 ORTHOWAY FORT MADISON, IA, 52627	YE	YE
CHEVRON CHEMICAL CO	NJD002171593	800 METUCHEN RD SOUTH PLAINFIELD, NJ, 07080	YE	YE
CHEVRON CHEMICAL CO (CHEVRON USA)	CAD043237486	940 HENSLEY ST RICHMOND, CA, 94804	YE	YE
CHEVRON EL SEGUNDO REFINERY	CAD008336901	324 W EL SEGUNDO BLVD EL SEGUNDO, CA, 90245	YE	YE
CHEVRON ENVIRONMENTAL MGMT CO	OHD004254132	5000 ST RT 128 HOOVEN, OH, 45033	YE	YE
CHEVRON ENVIRONMENTAL SVCS	ILD041518861	301 W 2ND ST -A LOCKPORT, IL, 60441	YE	YE
CHEVRON PHILLIPS CHEMICAL P R CORE INC	PRD991291972	STATE RD 710 KM 1.3 LAS MAREAS WARD, GUAYAMA, PR, 00784	YE	YE
CHEVRON PRODUCTS CO HAWAII REFINERY	HIT160010005	91-480 MALAKOLE STREET KAPOLEI, HI, 96707	YE	YE
CHEVRON PRODUCTS COMPANY	MSD054179403	250 INDUSTRIAL ROAD PASCAGOULA, MS, 39581	YE	IN
CHEVRON PRODUCTS COMPANY	NJD081982902	1200 STATE STREET PERTH AMBOY, NJ, 08861	YE	NO STATUS
CHEVRON PRODUCTS COMPANY	UTD092029768	2351 NORTH 100 WEST SALT LAKE CITY, UT, 84116	YE	YE
CHEVRON USA INC RICHMOND REFINERY	CAD009114919	841 CHEVRON WAY RICHMOND, CA, 948010627	YE	YE
CHEVRONTEXACO CORPORATION	TXD007378995	315 S GRAND ST AMARILLO, TX, 79104	YE	YE
CIBA GEIGY CORP	RID001194323	180 MILL ST CRANSTON, RI, 02905	YE	YE
CIBA SPECIALTY CHEMICALS	MED001037126	55 CROWLEY RD LEWISTON, ME, 04240	YE	YE
CIBA SPECIALTY CHEMICALS CORP MCINTOSH	ALD001221902	CIBA ROAD OFF HIGHWAY 43 MCINTOSH, AL, 36553	YE	YE
CID RECYCLING & DISPOSAL FAC	ILD010284248	138TH & I-94 P O BOX 1309, CALUMET CITY, IL, 60409	YE	YE
CITGO PETROLEUM CORPORATION	LAD008080350	4401 LOUISIANA HWY 108 LAKE CHARLES, LA, 70602	YE	IN
CLARIANT CORPORATION	NJD001213453	00-09 FAIR LAWN AVE FAIR LAWN, NJ, 07410	YE	YE
CLARIANT CORPORATION - MOUNT HOLLY EAST	NCD001810365	11701 MOUNT HOLLY ROAD CHARLOTTE, NC, 28214	YE	YE
CLARIANT LSM MISSOURI INC	MOD095038329	2460 W BENNETT ST SPRINGFIELD, MO, 65807	YE	YE
CLEAN CARE CORP	WAD980738512	1510 TAYLOR WY TACOMA, WA, 98421-4127	YE	NO
CLEAN HARBORS BATON ROUGE LLC	LAD010395127	13351 SCENIC HWY BATON ROUGE, LA, 70807	YE	YE
CLEAN HARBORS COFFEYVILLE LLC	KSD981506025	N HWY 169 COFFEYVILLE, KS, 67337	YE	YE
CLEAN HARBORS DEER PARK LP	TXD055141378	2027 BATTLEGROUND RD LA PORTE, TX, 77571	YE	YE
CLEAN HARBORS KANSAS LLC	KSD007246846	2549 N NEW YORK WICHITA, KS, 672194322	YE	IN
CLEAN HARBORS OF BRAINTREE INC	MAD053452637	1 HILL AVE BRAINTREE, MA, 02184	YE	YE

CLEAN HARBORS OF CT INC	CTD000604488	51 BRODERICK ROAD BRISTOL, CT, 06010	YE	YE
CLEAN HARBORS OF NATICK INC	MAD980523203	10 MERCER RD NATICK, MA, 01760	YE	YE
CLEAN HARBORS SAN JOSE LLC	CAD059494310	1021 BERRYESSA ROAD SAN JOSE, CA, 95133	YE	YE
CLEAN HARBORS SVCS INC	ILD000608471	11800 S STONY ISLAND AVE CHICAGO, IL, 60617	YE	YE
CLEAN HARBORS WESTMORLAND LLC	CAD000633164	5295 S GARVEY RD WESTMORLAND, CA, 92281	YE	YE
COASTAL EAGLE POINT OIL COMPANY	NJD990753162	ROUTE 130 & I-295 WESTVILLE, NJ, 08093	YE	NO STATUS
COASTAL PLAINS TREATING CO INC	GAD981015449	RT 2 BOX 418 TIFTON, GA, 31794	YE	YE
COASTAL WAREHOUSE LLC	NCD070430178	NC RT 32 S OLD HERTFORD RD, EDENTON, NC, 27932	YE	YE
COATING SYSTEMS INC	NHD056331077	55 CROWN ST NASHUA, NH, 03060	YE	YE
COFFEYVILLE RESOURCES REFINING & MARKETI	KSD007138605	N LINDEN ST COFFEYVILLE, KS, 67337	YE	YE
COFFEYVILLE RESOURCES TERMINAL LLC	KSD007134695	.25 MN ON HWY 183 PHILLIPSBURG, KS, 67661	NO STATUS	NO STATUS
COINCO INC DBA MORCO	PAD056882822	125 HIGH ST COCHRANTON, PA, 16314	YE	YE
COL FIN SPECIALTY STEEL CORP	PAD000737031	100 FRONT ST NEW BRIGHTON, PA, 15066	YE	YE
COLFAX TREATING CO LLC, ALEXANDRIA	LAD069524981	3600 KOPPERS ST ALEXANDRIA, LA, 71302	IN	YE
COLFAX TREATING COMPANY, LLC	LAD008184616	74 WADLEY ROAD PINEVILLE, LA, 71360	YE	YE
COLLIS INC	IAD047303771	2005 S 19TH ST CLINTON, IA, 52732	YE	IN
COLLIS INC	KYD057591133	1101 W PARK RD ELIZABETHTOWN, KY, 42701	YE	YE
COLO DEPT OF TRANS - HQ COMPLEX	COD980952097	4201 E ARKANSAS AVE DENVER, CO, 802223406	YE	YE
COLONIAL BRONZE CO	CTD058508722	511 WINSTED RD TORRINGTON, CT, 06790	YE	NO STATUS
COLTSVILLE HERITAGE PARK INC	CTD001157106	140 HUYSHOPE AVE HARTFORD, CT, 06106	YE	NO STATUS
COLUMBIA HELICOPTERS INC	ORD009673609	14452 ARNDT RD NE AURORA, OR, 97002	YE	YE
COLUMBIA MFG INC	MAD001115609	1 CYCLE ST WESTFIELD, MA, 01085	NO STATUS	NO STATUS
COMBUSTION ENGINEERING	CTD001159557	2000 DAY HILL ROAD CEP 880-1406 WINDSOR, CT, 06095	YE	YE
COMMONWEALTH OIL REFINING CO., INC.	PRD091017228	ROAD 127 KM.17.3 PENUELAS, PR, 00624750	YE	YE
CONGOLEUM CORP	PAD002343200	4401 RIDGE RD TRAINER, PA, 19061	YE	IN
CONN-SELMER INC	AZT000612135	1310 W FAIRWAY DR NOGALES, AZ, 85621	YE	YE
CONN-SELMER INC	OHD004153854	34199 CURTIS BLVD EASTLAKE, OH, 44095	YE	YE
CONOCO PHILLIPS CO ALLIANCE REFINERY	LAD056024391	15551 HWY 23 S BELLE CHASSE, LA, 70037	YE	YE
CONOCOPHILLIPS CO FERNDALE REFINERY	WAD009250366	3901 UNICK RD FERNDALE, WA, 98248	YE	YE
CONOCOPHILLIPS CO SAN FRANCISCO REFINERY	CAD009108705	1380 SAN PABLO AVE. RODEO, CA, 94572	YE	YE
CONOCOPHILLIPS CO. LAR, CARSON PLANT	CAD980881676	1520 E SEPULVEDA BLVD. CARSON, CA, 90745	YE	NO
CONOCOPHILLIPS COMPANY	TXD048210645	HIGHWAY 35 & FM 524 OLD OCEAN, TX, 77463	YE	YE
CONOCOPHILLIPS COMPANY	TXD980626774	W SPUR 119 BORGER, TX, 79007	YE	IN
CONOCOPHILLIPS LAR, WILMINGTON PLANT	CAD008237679	1660 WEST ANAHEIM STREET WILMINGTON, CA, 90744	YE	NO

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

CONOCOPHILLIPS REFINERY/TECHNOLOGY SITE	OKD007233836	1000 SOUTH PINE STREET PONCA CITY, OK, 74601	YE	YE
CONRAIL MEADVILLE CAR REPAIR FACILITY	PAD000799916	10677 MCHENRY ST MEADVILLE, PA, 16355	YE	YE
CONSOLIDATED RCYL CO INC/CARSON'S TRANPR	IND098958283	11210 SOLOMAN RD TELL CITY INDUSTRIAL PK, TROY, IN, 47588	YE	YE
CONTINENTAL CEMENT CO LLC	MOD054018288	10107 HWY 79 HANNIBAL, MO, 63401	YE	YE
CONTINENTAL TEVES INC	VAD030341077	13456 LOVERS LN CULPEPER, VA, 22701	YE	YE
COOK COMPOSITES & POLYMERS CO	MOD086787371	1412 KNOX ST NORTH KANSAS CITY, MO, 64116	YE	YE
COOK COMPOSITES & POLYMERS CO	WID980615439	340 RAILROAD ST SAUKVILLE, WI, 53080	YE	YE
COOK COMPOSITES AND POLYMERS	TXD000807875	2434 HOLMES ROAD HOUSTON, TX, 77051	YE	YE
COOK COMPOSITES AND POLYMERS CO. - CH	VAD055046049	920 TIGHTSQUEEZE INDUSTRIAL RD CHATHAM, VA, 641416389	YE	YE
COOPER AL OPERATION, COOPER TOOLS INC	ALD079127635	2125 2ND AVE SW CULLMAN, AL, 35055	YE	YE
COOPER INDS INC	VAD023717853	RT 660 EARLYSVILLE, VA, 22936	YE	YE
CORBIN RUSSWIN INC	CTD052541695	225 EPISCOPAL ROAD BERLIN, CT, 06037	YE	YE
CORNING INC	IND005557244	AIRPORT RD BLUFFTON, IN, 46714	YE	YE
COZINCO	COD094154671	100 W LEAD STREET SALIDA, CO, 81201	YE	YE
CP CHEMICALS INC	NJD002141950	ARBOR ST SEWAREN, NJ, 07024	YE	NO STATUS
CRITERION CATALYSTS & TECHNOLOGIES, LP	CAD008344228	1001 N TODD AVE. AZUSA, CA, 90702	YE	YE
CROMPTON CORP PETROLIA PLANT	PAD004388500	100 SONNEBORN LN PETROLIA, PA, 16050	YE	YE
CROMPTON MFG CO INC	CTD001449826	280 ELM STREET NAUGATUCK, CT, 06770	YE	YE
CROMPTON MFG CO INC - NORTH PLANT	WVD980552384	1000 MORGANTOWN IND PARK PLANT 1, MORGANTOWN, WV, 26501	YE	IN
CROMPTON MFG CO INC - SOUTH PLANT	WVD061776977	1000 MORGANTOWN IND PARK PLANT 2, MORGANTOWN, WV, 26501	YE	IN
CROWN CORK & SEAL CO USA INC	NED007263353	4133 SOUTH 72ND OMAHA, NE, 68127	YE	YE
CROWN CORK AND SEAL COMPANY INC.	CAD062062435	8201 WOODLEY VAN NUYS, CA, 91406	YE	YE
CSX TRANSP INC	VAD003121977	4005 CHARLES CITY RD RICHMOND, VA, 23231	YE	YE
CSX TRANSPORTATION INC	GAD991275900	1100 W HAMILTON AVE WAYCROSS, GA, 32202	YE	YE
CT RESOURCE RECOVERY AUTH	CTD000604546	866 RIVER RD SHELTON, CT, 06484	YE	YE
CT YANKEE ATOMIC POWER	CTD042306720	362 INJUN HOLLOW ROAD EAST HAMPTON, CT, 06424	YE	YE
CURTIS METALS	NED058808908	HWY 81 S , CURTIS, NE, 69025	YE	YE
CURWOOD INC (NEW LONDON)	WID006144737	718 HIGH ST NEW LONDON, WI, 54961	YE	YE
CWM CHEMICAL SERVICES, LLC	NYD049836679	BALMER ROAD MODEL CITY, NY, 14107	YE	YE
CYCLECHEM,INC.	NJD002200046	SOUTH FIRST STREET ELIZABETH, NJ, 07206	YE	NO STATUS

CYN OIL CORP D/B/A CYN ENVIRONMNTL SERV	MAD082303777		1771 WASHINGTON ST STOUGHTON, MA, 02072	YE	YE
CYRO INDUSTRIES	MED040249096		1796 MAIN STREET SANFORD, ME, 04073	YE	YE
CYTEC ENGINEERED MATERIALS INC	MDD003075942		1300 REVOLUTION ST HAVRE DE GRACE, MD, 210780000	YE	YE
CYTEC INDUSTRIES INC	OHD004341509		1405 GREENE ST MARIETTA, OH, 45750	YE	YE
CYTEC INDUSTRIES INC - WARNERS	NJD002173144		4900 TREMLEY POINT RD LINDEN, NJ, 07036	YE	YE
CYTEC INDUSTRIES INC.	WVD004341491		#1 HEILMAN AVENUE WILLOW ISLAND, WV, 26134	YE	IN
CYTEC INDUSTRIES, INC.	LAD008175390		10800 RIVER ROAD WAGGAMAN, LA, 70094	YE	YE
DAK AMERICAS, LLC	NCD047369046		3500 DANIELS ROAD NE LELAND, NC, 28451	YE	YE
DAKOTA GASIFICATION COMPANY	NDD000690594		420 COUNTY ROAD 26 BEULAH, ND, 585230000	YE	YE
DAL TILE INTL	PAD002347003		1000 CANNON AVE LANSDALE, PA, 19446	YE	YE
DAMAR INC	GAD003275971		823 DAMAR RD NE MARIETTA, GA, 30062	YE	YE
DANA CORP	OHD005039730		5278 US 24 ANTWERP, OH, 45813	YE	NO STATUS
DANA CORPORATION	MID980499735		2001 SANFORD ST MUSKEGON HEIGHTS, MI, 49444	YE	YE
DANBURY LANDFILL	CTD000841163		PLUMTREES RD DANBURY, CT, 06810	YE	YE
DASSAULT FALCON JET- WILMINGTON CORP.	DED011028438		191 NORTH DUPONT HWY NEW CASTLE, DE, 19720	YE	YE
DAVIS PIPE	TND066723263		250 BIRCH STREET BLOUNTVILLE, TN, 37617	YE	YE
DEARBORN REFINING CO	MID005510805		3901 WYOMING ST. DEARBORN, MI, 48120	NO STATUS	YE
DECATUR CO/FORMER ITT-UP	GAD048708572		DECATUR CO INDUSTRIAL PK BAINBRIDGE, GA, 31717	YE	YE
DEFENSE DIST. DEPOT SAN JOAQUIN - SHARPE	CA8210020832	US Army	700 EAST ROTH ROAD LATHROP, CA, 95331	YE	YE
DEFENSE DIST. DEPOT SAN JOAQUIN - TRACY	CA4971520834	US Army	25600 SOUTH CHRISMAN ROAD TRACY, CA, 95376	YE	YE
DEGUSSA GOLDSCHMIDT CHEMICAL	WID094361458		900 S PALM ST JANESVILLE, WI, 535471018	YE	YE
DEGUSSA INITIATORS LLC	OHD046202602		555 GARDEN ST ELYRIA, OH, 44035	YE	YE
DELEK REFINING LTD	TXD007333800		1702 E COMMERCE ST TYLER, TX, 75702	YE	YE
DELPHI AUTOMOTIVE SYS NEEDMORE RD OPS	OHD045557766		3100 NEEDMORE ROAD DAYTON, OH, 45414	YE	YE
DELPHI AUTOMOTIVE SYSTEMS	MID017079625		2100 BURLINGAME SW WYOMING, MI, 49509	YE	IN
DELPHI AUTOMOTIVE SYSTEMS LLC	MID005356647		2926 DAVISON RD FLINT, MI, 48556	YE	IN
DELPHI ENERGY & CHASSIS	OHD052151701		480 N DIXIE DRIVE VANDALIA, OH, 453771042	YE	YE
DELPHI PACKARD ELECTRIC SYSTEMS	MSD065462517		1001 INDUSTRIAL PARK DRIVE CLINTON, MS, 36056	YE	YE
DELTA AIRLINES INC.	GAD006924872		1775 AVIATION BLVD. ATLANTA, GA, 30320	YE	YE
DELTA CHEMICALS INC PROD	PAD088915822		WORTHINGTON RD WORTHINGTON, PA, 16262	YE	YE
DELTA RUBBER CO A SUB OF N N INC	CTD046238630		39 WAUREGAN ROAD DANIELSON, CT, 062390300	YE	YE
DELTECH CORPORATION	LAD008188583		11911 SCENIC HIGHWAY BATON ROUGE, LA, 70807	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

DEMENNO / KERDOON	CAT080013352		2000 NORTH ALEMEDA STREET COMPTON, CA, 90222	YE	NO
DEMMER PROPERTIES LLC	MID005380134		1600 N LARCH ST LANSING, MI, 48906	YE	IN
DEPARTMENT OF THE AIR FORCE	NJ2571824018	US Air Force	2403 VANDENBERG AV. MC GUIRE AFB, NJ, 08641	YE	NO STATUS
DEPT OF THE ARMY / FORT CARSON	CO2210020150	US Army	1638 ELWELL ST BLDG 6236 FORT CARSON, CO, 80913	IN	NO
DESERET CHEMICAL DEPOT	UT5210090002	US Army	PO BOX 250 STOCKTON, UT, 84071	YE	YE
DETD LLC	MID004508628		1000 GENERAL DR PLYMOUTH, MI, 48170	YE	YE
DETROIT DIESEL CORPORATION	MID005356803		13400 OUTER DRIVE WEST DETROIT, MI, 48239	YE	YE
DIAMOND HARD CHROME INC	OHD987040334		6110 GRAND AVE CLEVELAND, OH, 44104	YE	IN
DIAMOND SHAMROCK REFINING AND MARKETING	TXD990709966		301 LEROY ST THREE RIVERS, TX, 78071	YE	YE
DIGITAL EQUIPMENT CORP	PRD000706333		RD 368 KM 24 SABANA GRANDE, PR, 00747	YE	YE
DIXIE METALS CORP	LAD055792097		HWY 531 E AT CITY LIMITS HEFLIN, LA, 71039	YE	YE
DIXON TICONDEROGA CO DEER LAKE	PAD041250242		2 MI N OF INTERSECTION RT 61 & RT 895 ON LEFT, DEER LAKE, PA, 17961	YE	YE
DMB SARASOTA I L P	FLD083200998		6000 FRUITVILLE RD SARASOTA, FL, 342326499	YE	YE
DOE RUN CO - RESOURCE RECYCLING	MOD059200089		HWY KK BOSS, MO, 65440	YE	YE
DOE/WSRC SAVANNAH RIVER SITE	SC1890008989	Dept. of Energy	HWY 125 JACKSON, SC, 29801	YE	NO
DOLAN WOHLERS CORP	NJD002155448		429 ROCKAWAY VALLEY RD BOONTON TWP, NJ, 07005	YE	YE
DONHAM CRAFT INC	CTD001450006		15 EAST WATERBURY ROAD NAUGATUCK, CT, 06770	YE	YE
DOVER INDUSTRIES REMEDIATION	COD005548037		5601-1/2 N 71ST ST LONGMONT, CO, 805038698	YE	YE
DOW CHEMICAL ALLYNS POINT	CTD001159730		1761 ROUTE 12 GALES FERRY, CT, 06335	YE	YE
DOW CORNING	MID000809632		3901 S SAGINAW ROAD MIDLAND, MI, 48686	YE	YE
DRACKETT INC	PAD003038544		RTE 447 EAST STROUDSBURG, PA, 18301	YE	YE
DRIFT RIVER TERMINAL COOK INLET PIPELINE	AKD000641811		ANCHORAGE APPROX 90 MI SW OF ANCHORAGE, DRIFT RIVER, AK, 99600	YE	YE
DSC LTD TRENTON PLANT	MID017422304		1491 WEST JEFFERSON TRENTON, MI, 48183	NO STATUS	NO STATUS
DSM CHEMICALS NORTH AMERICA, INC.	GAD051011609		#1 COLUMBIA NITROGEN ROAD AUGUSTA, GA, 30901	YE	NO
DSM NUTRITIONAL PRODUCTS INC.	NJD042321042		205 MACKS ISLAND DRIVE BELVIDERE, NJ, 07823	YE	YE
DSM PHARMACEUTICALS, INC.	NCD047373766		5900 NW GREENVILLE BLVD. GREENVILLE, NC, 27834	YE	YE
DU PONT E I DE NEMOURS & CO INC	IAD005272398		801 35TH ST FORT MADISON, IA, 52627	YE	YE
DU PONT E I DE NEMOURS AND CO	IND005174354		5215 KENNEDY AVE EAST CHICAGO, IN, 46312	YE	YE
DUCOMMUN AEROSTRUCTURES	CAD093245645		4001 EL MIRAGE ROAD ADELANTO, CA, 92301	YE	IN
DUDLEY LAUNDRY COMPANY	NED035093178		126 N 3RD NORFOLK, NE, 68701	YE	YE
DUGWAY PROVING GROUND	UT3750211259	US Army	COMMANDER, U.S. ARMY DUGWAY PROVING GROUND, DUGWAY, UT, 84022	YE	YE
DULUTH AIR NATIONAL GUARD BASE	MND000773341		4680 VIPER STREET DULUTH, MN, 558116033	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

DUOLITE INTERNATIONAL	CAD990792335	800 CHESTNUT ST REDWOOD CITY, CA, 94063	YE	YE
DUPONT CHAMBERS WORKS	NJD002385730	RT 130 DEEPWATER, NJ, 08023	YE	YE
DUPONT CIRCLEVILLE PLANT	OHD004287322	800 DUPONT ROAD CIRCLEVILLE, OH, 43113	YE	YE
DUPONT E I DE NEMOURS & CO POMPTON LAKES	NJD002173946	2000 CANNONBALL RD POMPTON LAKES, NJ, 074421797	NO STATUS	YE
DUPONT EXPERIMENTAL STATION	DED003930807	ROUTE 141 WILMINGTON, DE, 198800249	YE	YE
DUPONT PHOTOMASKS INC	CTD001184324	4 FINANCE DRIVE DANBURY, CT, 06810	YE	YE
DUPONT POTOMAC RIVER WORKS	WVD041952714	US RTE 11 FALLING WATERS, WV, 25419	YE	YE
DUPONT REPAUNO PLANT	NJD002373819	200 N. REPAUNO AVE. GIBBSTOWN, NJ, 08027	YE	YE
DUPONT SPRUANCE PLANT	VAD009305137	5401 JEFFERSON DAVIS HIGHWAY RICHMOND, VA, 23234	YE	YE
DUPONT-MOBILE	ALD093179315	12650 HIGHWAY 43 AXIS, AL, 36505	YE	YE
DUREZ CORPORATION	NYD002103216	PACKARD RD NIAGARA FALLS, NY, 14304	YE	YE
DUREZ CORPORATION	OHD990747859	13717 ST RT 68 SOUTH KENTON, OH, 43326	YE	YE
DYMON INC	KSD067952994	3401 KANSAS AVE KANSAS CITY, KS, 66106	YE	YE
DYNO NOBEL INC	COD075754663	7800 N MOORE RD LITTLETON, CO, 80125	YE	YE
DYNO NOBEL INC	NYD000799122	ULSTER AVE ULSTER PARK, NY, 12487	YE	YE
DYNO NOBEL INC	CTD058509712	660 HOPMEADOW STREET SIMSBURY, CT, 06070	YE	YE
E I DU PONT DE NEMOURS AND COMPANY	TXD008079212	12501 STRANG RD LA PORTE, TX, 77571	YE	IN
E I DUPONT DE NEMOURS & CO INC	PAD003038056	PATTERSON BLVD TOWANDA, PA, 18848	YE	YE
E I DUPONT DENEMOURS & CO INC	DED042263764	RTE 896 BUILDING 200 GLASGOW SITE, NEWARK, DE, 19702	YE	YE
E. I. DU PONT DE NEMOURS & CO INC	TND003331766	4501 N. ACCESS ROAD CHATTANOOGA, TN, 37415	YE	YE
E. I. DU PONT DE NEMOURS AND COMPANY.	WVD045875291	8480 DUPONT ROAD WASHINGTON, WV, 26181	YE	YE
E. I. DUPONT DE NEMOURS & CO	CAD009151671	6000 BRIDGEHEAD ROAD OAKLEY, CA, 94561	YE	YE
E. I. DUPONT DE NEMOURS AND COMPANY	WVD005012851	901 WEST DUPONT AVENUE BELLE, WV, 25015	YE	YE
EAGLE PICHER TECHNOLOGIES LLC	COD048126726	3820 S HANCOCK EXPWY COLORADO SPRINGS, CO, 80911	YE	YE
EAGLE-PICHER TECHNOLOGIES LLC	MOD046740148	C & PORTER ST JOPLIN, MO, 648020047	YE	YE
EAGLEBROOK INC	OHD000724088	17877 ST CLAIR AVE CLEVELAND, OH, 44110	YE	YE
EAST CHICAGO WATERWAYS MGMT DIST	IND082547803	3500 INDIANAPOLIS BLVD EAST CHICAGO, IN, 46312	YE	NO
EAST COAST ENVIRONMENTAL SERVICES	CTD089631956	454 QUINNIPIAC AVE NEW HAVEN, CT, 06513	YE	IN
EAST PENN MFG CO	PAD002330165	DEKA RD LYON STATION, PA, 19536	YE	YE
EASTMAN CHEMICAL COMPANY	TXD007330202	STATE HWY 149 @ KODAK BLVD LONGVIEW, TX, 75603	YE	YE
EASTMAN CHEMICAL COMPANY, ARKANSAS OPER.	ARD089234884	2800 GAP RD BATESVILLE, AR, 72501	YE	YE
EASTMAN CHEMICAL COMPANY, TENNESSEE OPER	TND003376928	EASTMAN ROAD KINGSPORT, TN, 37662	YE	YE
EASTMAN KODAK	NYD980592497	1669 LAKE AVE ROCHESTER, NY, 14652	NO STATUS	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

EASTON UTILITIES COMM MUNI ELECT UTIL	MDD980555668		219 NORTH WASHINGTON STREET EASTON, MD, 21601	YE	YE
EATON CORP	NED065133167		4200 HWY 30 E KEARNEY, NE, 68848	YE	YE
EATON DBA SORENSEN PARK PLAZA	NED007286198		6600 N 72ND ST OMAHA, NE, 68122	YE	YE
ECC CORP	MAD001138726		156 PRINCETON ST HOLDEN, MA, 01520	YE	YE
ECOLOGICAL SERVICES INC	OHD980795264		6201 S PLEASANT DR EAST PALESTINE, OH, 44413	YE	YE
EDGEWATER STEEL CO	PAD074966789		300 COLLEGE AVE OAKMONT, PA, 15139	YE	YE
EDMUNO OPTICS	PAD002334373		601 MONTGOMERY AVE PENNSBURG, PA, 18073	YE	NO STATUS
EDWARD C LEVY CO PLANT 3	MID000809665		100 W WESTFIELD RD ECORSE, MI, 48229	YE	YE
EDWARD C LEVY CO PLT 6	MID094549425		13950 MELON RD DETROIT, MI, 48217	YE	YE
EDWARDS AIR FORCE BASE	CA1570024504	US Air Force	5 EAST POPSON AVENUE BLDG. 2650A, EDWARDS AFB, CA, 93524	YE	YE
EDWARDS OIL SERVICES INC	MID088754668		530 S. ROUGE DETROIT, MI, 48217	YE	YE
EI DUPONT DE NEMOURS & CO INC	NJD002444024		250 CHEESEQUAKE RD PARLIN, NJ, 08859	YE	NO STATUS
ELECTRIC BOAT CORP SHIPYARD	CTD001147842		75 EASTERN POINT ROAD GROTON, CT, 06340	YE	YE
ELECTRIC BOAT CORPORATION - MIDWAY FACIL	CTD018668269		DEPOT ROAD GROTON, CT, 06340	YE	YE
ELECTRONIC PARTS SPECIALTY CO	NJD002361665		COLES AVE LUMBERTON, NJ, 08048	YE	YE
ELEMENTIS PIGMENTS INC	PAD002391548		1525 WOOD AVE EASTON, PA, 180423186	YE	NO STATUS
ELF ATOCHEM NORTH AMERICA, INC	PAD002290823		2375 STATE RD BENSALEM, PA, 19020	YE	IN
ELI LILLY AND CO CLINTON LABS	IND072040348		10500 S SR 63 CLINTON, IN, 478420099	YE	YE
ELI LILLY AND CO TIPPECANOE LABS	IND006050967		1650 LILLY RD LAFAYETTE, IN, 47909	YE	YE
ELISKIM INC.	SCD003342938		SC 81 S AND TRUE TEMPER RD ANDERSON, SC, 29624	YE	YE
EMD CHEMICALS INC	OHD086438538		2909 HIGHLAND AVE CINICINNATI, OH, 45212	YE	NO STATUS
EMERALD RECYCLING	WAD058367152		1500 AIRPORT WY S SEATTLE, WA, 98134	YE	YE
EMHART IND INC	NHD000845768		77L WEBSTER ST JAFFREY, NH, 03452	YE	YE
EMPIRE SPECIALTY STEEL INC	NYD030215529		90 WILLOWBROOK AVE DUNKIRK, NY, 140480152	NO STATUS	YE
ENCYCLE TEXAS INC	TXD008117186		5500 UP RIVER RD CORPUS CHRISTI, TX, 78407	YE	YE
ENGELHARD CORP	OHD004203519		120 PINE ST ELYRIA, OH, 44035	YE	YE
ENGELHARD IND DIV PLAINVILLE	MAD001190644		RTE 152 PLAINVILLE, MA, 02762	YE	NO STATUS
ENGLAND AIR FORCE BASE	LA9572124452	US Air Force	6911 ARNOLD DR ALEXANDRIA, LA, 71303	YE	YE
ENSIGN-BICKFORD CO	ILD980700710		HIGHWAY 3 N WOLF LAKE, IL, 62998	YE	YE
ENTERPRISE RECOVERY SYSTEM, INC.	MSD000693176		ROUTE 5 BOX 287 BYHALIA, MS, 38611	YE	NO
ENVIRITE CORP	CTD093616613		OLD WATERBURY RD THOMASTON, CT, 06787	YE	YE
ENVIRONMENTAL COMPLIANCE CORP	MAD062179890		441 R CANTON ST STOUGHTON, MA, 02072	YE	YE
ENVIRONMENTAL PROCESSING SERVICES	OHD000608588		416 LEO ST DAYTON, OH, 45404	YE	NO STATUS
ENVIRONMENTAL WASTE RESOURCES INC	ILD087157251		SOUTH BROADWAY ST & REED RD COAL CITY, IL, 60416	YE	YE

ENVIROSAFE SERVICES OF OHIO INC	OHD045243706	876 OTTER CREEK ROAD OREGON, OH, 43616	YE	IN
ENVIROTROL INC BEAVER FALLS	PAD980707087	24TH & 31ST ST BEAVER FALLS, PA, 151430061	YE	YE
EPC EASTSIDE DSPL FARM	CAD030384267	SEC 24&30 T28S R28-29E MDBM BAKERSFIELD, CA, 93301	YE	YE
EPEC POLYMERS, INC.	NJD001890300	45 RIVER RD FLEMINGTON, NJ, 08822	YE	YE
EQ RESOURCE RECOVERY INC	MID060975844	36345 VAN BORN RD ROMULUS, MI, 48174	YE	YE
EQUILON ENTERPRISES LLC	ILD080012305	900 S CENTRAL AVE P O BOX 76, ROXANA, IL, 62084	YE	YE
EQUILON ENTERPRISES LLC	TXD026896290	2700 S GRANDVIEW AVE ODESSA, TX, 79766	YE	YE
EQUILON ENTERPRISES, LA REFINERY	CAD041520644	2101 EAST PACIFIC COAST HWY WILMINGTON, CA, 90744	YE	NO
EQUISTAR CHEMICALS LP	IAD045372836	3400 ANAMOSA RD HWY 30 W CLINTON, IA, 52732	YE	YE
EQUISTAR CHEMICALS LP	TXD058275769	8280 SHELDON RD BLDG 1 CHANNELVIEW, TX, 77530	YE	YE
EQUISTAR CHEMICALS LP	ILD048296180	8805 N TABLER RD MORRIS, IL, 60450	YE	YE
EQUISTAR CHEMICALS-TUSCOLA	ILD005078126	625 E RTE 36 TUSCOLA, IL, 61953	YE	NO STATUS
ESAB WELDING & CUTTING PRODUCTS	SCD005574967	411 S EBENEZER RD FLORENCE, SC, 29501	YE	YE
ESSROC CEMENT CORP	IND005081542	SR25S 3084 W CR225S LOGANSPORT, IN, 46947	YE	YE
ETHYL CORP BATON ROUGE PL	LAD079460895	GULF STATES RD ID895 BATON ROUGE, LA, 70801	YE	YE
ETHYL CORPORATION	TXD008096158	1000 N SOUTH ST PASADENA, TX, 77503	YE	YE
EVERGREEN LANDFILL	OHD068111327	2625 E BROADWAY NORTHWOOD, OH, 43619	YE	YE
EXIDE CORP	PAD990753089	SPRING VALLEY RD & NOLAN ST BOX 14294, READING, PA, 19612	IN	IN
EXIDE GROUP INC	FLD080677347	2640 CAPITOLA ST JACKSONVILLE, FL, 322090	YE	YE
EXIDE SAN FRANCISCO SERV CTR	CAD046000931	286 LAWRENCE AVE SOUTH SAN FRANCISCO, CA, 94080	YE	YE
EXIDE TECHNOLOGIES	CAD097854541	2700 S. INDIANA STREET LOS ANGELES, CA, 90023	YE	NO
EXIDE TECHNOLOGIES	FLD000608083	3521 YOCAM DIAMOND DR TAMPA, FL, 336190	YE	NO
EXIDE TECHNOLOGIES	TXD006451090	7471 S 5TH ST FRISCO, TX, 75034	YE	YE
EXIDE TECHNOLOGIES	GAD070330576	3639 JOY ROAD COLUMBUS, GA, 31906	NO	NO
EXIDE TECHNOLOGIES - CANON HOLLOW PLANT	MOD030712822	CANON HOLLOW RD FOREST CITY, MO, 64451	YE	YE
EXIDE TECHNOLOGIES BATON ROUGE SMELTER	LAD008184137	2400 BROOKLAWN DR , BATON ROUGE, LA, 70807	YE	YE
EXLINE INC	KSD007127327	3256 E COUNTRY CLUB RD SALINA, KS, 67401	YE	YE
EXPERT MANAGEMENT	PAD071203046	2 RIVER RD TAMAQUA, PA, 18252	YE	YE
EXPERT MANAGEMENT INC	MOD077887909	3078 COUNTY RD 180 JOPLIN, MO, 64801	YE	YE
EXXON BAYWAY REFINING CO	NJD062037031	1400 PARK AVE LINDEN, NJ, 070361610	YE	YE
EXXON MOBIL CORPORATION	TXD000782698	2800 DECKER DR BAYTOWN, TX, 77520	YE	YE
EXXONMOBIL BATON ROUGE REFINERY	LAD062662887	4045 SCENIC HIGHWAY BATON ROUGE, LA, 70805	YE	YE
EXXONMOBIL BR PLASTICS PLANT	LAD000778381	11675 SCOTLAND ZACHARY HWY SCOTLANDVILLE, LA, 70807	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

EXXONMOBIL OIL CORP TORRANCE REFINERY	CAD008354052		3700 W 190TH STREET TORRANCE, CA, 90504	YE	NO
EXXONMOBIL OIL CORPORATION	TXD990797714		1795 BURT BEAUMONT, TX, 77001	YE	YE
EXXONMOBIL PORT MOBIL TERMINAL	NYD000824516		ARTHUR KILL RD STATEN ISLAND, NY, 10309	YE	YE
F M C CORP - SPECIALTY CHEM DIV	WVD005005079		3200 MACCORKLE AVE SOUTH CHARLESTON, WV, 25303	YE	YE
FAGERDALA USA	ILD006536239		605 12TH ST MENDOTA, IL, 61342	YE	YE
FAIRCHILD REPUBLIC CO	NYD079818555		CONKLIN ST FARMINGDALE, NY, 11735	YE	YE
FANSTEEL INTERCAST	ILD000672139		21 N CHURCH ST ADDISON, IL, 60101	YE	YE
FARIA THOMAS G CORP	CTD043038744		385 NORWICH NEW LONDON TPK UNCASVILLE, CT, 06382	YE	IN
FEDERAL MOGUL CORPORATION	VAD054039961		300 INDUSTRIAL PARK DRIVE BLACKSBURG, VA, 24060	YE	YE
FEDERAL MOGUL FRICTION PRODUCTS	VAD003070976		2410 PAPERMILL ROAD WINCHESTER, VA, 22601	YE	YE
FEDERAL PACIFIC ELECTRIC CO	GAD041011099		HWY 292 EAST TRACT "B" 2803 NORTH ST EAST, VIDALIA, GA, 30474	YE	YE
FEDERATED METALS CORP	IND005444104		2330 INDIANAPOLIS BLVD WHITING, IN, 46394	YE	IN
FEDERATED METALS CORP	NJD079320495		150 SAINT CHARLES ST NEWARK, NJ, 07101	YE	YE
FENSKE LANDFILL	MID072589328		2637 WILSON SW GRAND RAPIDS, MI, 49504	YE	NO STATUS
FERMILAB	IL6890030046	Dept. of Energy	WILSON RD P O BOX 500, BATAVIA, IL, 60510	YE	YE
FERNANDINA BEACH CONTAINERBOARD MILL	FLD004056230		N 8TH ST FERNANDINA BEACH, FL, 320340	YE	YE
FERNWOOD INDUSTRIES, L.L.C.	MSD008183519		1047 FERNWOOD ROAD FERNWOOD, MS, 39635	YE	YE
FHWA CFLHD MATERIALS LABORATORY	CO4690090010	Dept. of Trans.	DNV FED CTR - 6TH AVE BLDG 52 DENVER, CO, 80225	YE	YE
FIBERDYNE INC	IAR000003145		2816 W 1ST ST CEDAR FALLS, IA, 50613	YE	YE
FIBERDYNE INC	IAR000003152		29582 HWY 57 NEW HARTFORD, IA, 50660	YE	YE
FIRESTONE FIBERS & TEXTILES	VAD003112588		105 WINSTON CHURCHILL DR HOPEWELL, VA, 23860	YE	YE
FIRESTONE INDUSTRIAL PRODUCTS CO	IND006418263		1700 FIRESTONE BLVD NOBLESVILLE, IN, 46060	YE	YE
FIRST CHEMICAL CORPORATION	MSD033417031		1001 INDUSTRIAL ROAD PASCAGOULA, MS, 39581	YE	YE
FISHER SCIENTIFIC	NJD052207982		755 STATE HWY RTE 202 SOMERVILLE, NJ, 08876	YE	YE
FISHER SCIENTIFIC CHEMICAL DIVISION	NJD004362059		1 REAGENT LANE FAIR LAWN, NJ, 074102802	YE	YE
FLEET AND INDUSTRIAL SUPPLY CTR	CA4170090027	US Navy	250 EXECUTIVE WAY BLDG 3211C OAKLAND, CA, 946255000	YE	YE
FLINT HILLS RESOURCES LP	TXD088474663		2825 SUNTIDE RD CORPUS CHRISTI, TX, 78409	YE	YE
FLORIDA DOT FAIRBANKS BORROW PIT	FLD980799050		8000 NE 51ST ST FAIRBANKS, FL, 326090	YE	YE
FLORIDA FENCE POST	FLD004107017		5251 SR 64 W ONA, FL, 338650	YE	YE
FLORIDA SOLITE CO	FLD004059085		STATE ROAD 209A GREEN COVE SPRINGS, FL, 320430	YE	IN
FLORIDA TILE	FLD004091583		1 SIKES BLVD LAKELAND, FL, 338020	YE	YE
FLORIDA TILE INDUSTRIES INC.	KYD045735305		1247 ALTON RD LAWRENCEBURG, KY, 40342	YE	YE

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

FLYING J PETROLEUMS INC WILLISTON REFINE	NDT390010049		1 MI E. OF WILLISTON HWY 1804 SW 1/4 SEC 19 T154N R100W, WILLISTON, ND, 58801	YE	YE
FMC CORP AGRI CHEM GROUP	CAD000629998		2501 S SUNLAND AVE FRESNO, CA, 93725	YE	NO
FMC CORPORATION	MDD003071875		1701 E. PATAPSCO AVE. BALTIMORE, MD, 21226	YE	YE
FMC CORPORATION	NYD002126845		100 NIAGARA STREET MIDDLEPORT, NY, 14105	NO STATUS	NO STATUS
FMC CORPORATION - LITHIUM DIVISION	NCD000771964		1115 BESSEMERCITY/KINGSMTN HWY BESSEMER CITY, NC, 28016	YE	YE
FMC IDAHO LLC	IDD070929518		3 MILES W HIGHWAY 30 POCATELLO, ID, 83202	YE	YE
FORD MOTOR CO	CAD041330077		1000 FORD RD NEWPORT BEACH, CA, 926588900	YE	IN
FORDYCE WOOD PRESERVERS INC	ARD006511810		200 COLLEGE FORDYCE, AR, 71742	YE	YE
FOREMOST MCKESSON INC CHEM DIV	CAD060395753		9005 SORENSON AVE SANTA FE SPRINGS, CA, 90670	YE	NO
FORESTVILLE IND PLATING CO INC	CTD001152545		811 QUEEN ST SOUTHINGTON, CT, 06489	YE	YE
FORMER APPLIANCE PARK EAST FACILITY	MDD046279311		ROBERT FULTON DR COLUMBIA, MD, 21046	YE	YE
FORMER BLACK & DECKER (US) INC FACILITY	NYD002221919		STATE ST BROCKPORT, NY, 14420	YE	YE
FORMER DELPHI HARRISON THERMAL SYS	OHD000817577		3600 DRYDEN RD MORAINE, OH, 45439	YE	YE
FORMER FARMLAND IND NITROGEN PLT	KSD007128507		1608 N 1400 RD LAWRENCE, KS, 66046	YE	YE
FORMER SK WELLMAN SITE / EGBERT CORP	OHD055829022		200 EGBERT ROAD BEDFORD, OH, 44146	YE	NO STATUS
FORMER TELEDYNE MONARCH RUBBER PANT 1	OHD068901610		10 LINCOLN PK HARTVILLE, OH, 44682	YE	YE
FORMER TEXACO CASPER REFINERY	WYD088677943		75 EVANS STREET EVANSVILLE, WY, 82636	YE	YE
FORMER TREATED WOOD PRODUCTS FACILITY	LAD008077315		235 POST PLANT ROAD DERIDDER, LA, 70634	YE	YE
FORMER WEAREVER FACILITY	OHD041081548		1089 EASTERN AVE CHILLICOTHE, OH, 45601	YE	YE
FORMER WKI FACILITY - REMEDIATION	OHD045205424		359 STATE AVE NW MASSILLON, OH, 44647	YE	YE
FORMOSA PLASTICS CORP LA	LAD041224932		GULF STATES RD BATON ROUGE, LA, 70805	YE	IN
FORMOSA PLASTICS CORPORATION TEXAS	TXT490011293		201 FORMOSA DR POINT COMFORT, TX, 77978	YE	IN
FORT BENNING	GA3210020084	US Army	USAIC-DFEL-EMD BLDG.6 RM. 310 FORT BENNING, GA, 31905	YE	YE
FORT DODGE ANIMAL HEALTH	IAD005275540		2000 ROCKFORD RD CHARLES CITY, IA, 50616	YE	YE
FORT HUNTER LIGGETT	CA8210020436	US Army	FORT HUNTER LIGGETT ATTN: AFRC-FMH-DSS-E, JOLON, CA, 93928	YE	YE
FORT RECOVERY IND INC	OHD005046149		2440 STATE RTE 49 FORT RECOVERY, OH, 45846	YE	YE
FORT STEWART	GA9210020872	US Army	1157 ITALY STREET FORT STEWART, GA, 31314	YE	YE
FREESCALE SEMICONDUCTOR INC	AZD009004177		5005 E MCDOWELL RD SITE IGWTP PHOENIX, AZ, 85008	YE	YE
FRONTIER REFINING INC.	WYD051843613		2700 E. 5TH STREET CHEYENNE, WY, 82007	IN	NO
FRONTLINE MFG INC	IND005130695		300 SCHOOL ST LEESBURG, IN, 46538	YE	NO
FRUEHAUF CORP	PAD004338646		RTE #119 N UNIONTOWN, PA, 15401	YE	YE

FUELS AND CHEMICALS, INC.	ALD980559850		COUNTRY ROAD 14 COALING, AL, 35449	YE	YE
FULTON FINANCIAL REALTY CORP	PAD082434747		1695 STATE ST EAST PETERSBURG, PA, 17520	YE	YE
G A R ELECTROFORMING DIV ELECTRO INC	CTD064834914		11 AUGUSTA DR DANBURY, CT, 06810	YE	YE
G E AIRCRAFT ENGINES	VTD001075894		270 WINDCREST ROAD NORTH CLARENDON, VT, 05759	YE	YE
G E MEDICAL SYSTEMS ELECTRIC AVE FACILIT	WID086686003		4855 W ELECTRIC AVE WEST MILWAUKEE, WI, 53219	YE	YE
G R O W S LANDFILL	PAD000429589		1000 NEW FORD MILL RD MORRISVILLE, PA, 19067	YE	YE
G T E OPERATIONS SUPPORT INC	MED058951047		228 NORTHEAST RD RTE 35 STANDISH, ME, 04084	YE	YE
GALLADE CHEMICAL INC	CAD029363876		1230 E ST GERTRUDE PL SANTA ANA, CA, 927073094	YE	NO
GALVESTON ENVIRONMENTAL SERVICES INC	TXD980628028		6038 FM 517 RD E SAN LEON, TX, 77539	YE	YE
GE AIRCRAFT ENGINES	OHD000817312	US Air Force	1 NEUMANN WAY CINCINNATI, OH, 45215	YE	IN
GE CONSUMER AND INDUSTRIAL	KYD006387021		APPLIANCE PARK LOUISVILLE, KY, 40225	YE	NO
GE ELECTROMATERIALS	OHD004302428		1350 S SECOND ST COSHOCTON, OH, 43812	YE	YE
GE LIGHTING LLC BRIDGEVILLE GLASS	PAD060682622		540 MAYER ST BRIDGEVILLE, PA, 15017	YE	YE
GE PLASTICS MT VERNON INC	IND006376362		1 LEXAN LN MOUNT VERNON, IN, 47620	YE	YE
GE PUERTO RICO INVESTMENT INC	PRD090492109		STATE RD 3 KM 122.9 PATILLAS PLANT, PATILLAS, PR, 00723	YE	NO STATUS
GE SILICONES	NYD002080034		260 HUDSON RIVER ROAD WATERFORD, NY, 12188	YE	YE
GE SILICONES WV, L.L.C.	WVD004325353		3500 SOUTH STATE ROUTE 2 FRIENDLY, WV, 26146	YE	YE
GENERAL CHEMICAL BAY POINT WORKS	CAD009142290		501 NICHOLS RD PITTSBURG, CA, 94565	YE	NO
GENERAL CHEMICAL CORP DEL VALLEY WORKS N	PAD990823742		6300 PHILADELPHIA PIKE MARCUS HOOK, PA, 19601	YE	IN
GENERAL CHEMICAL CORPORATION	DED154576698		6300 PHILADELPHIA PIKE CLAYMONT, DE, 197032712	YE	IN
GENERAL COMPONENTS INC	FLD004088258		7425 124TH AVE N LARGO, FL, 337730	YE	YE
GENERAL DATA CO	CTD072142052		400 CAPTAIN NEVILLE DR WATERBURY, CT, 06705	YE	NO STATUS
GENERAL DYNAMICS ARMAMENT & TECH PRODUCT	VTD002083434		128 LAKESIDE AVE BURLINGTON, VT, 054014985	YE	YE
GENERAL DYNAMICS MAIN PLANT	NED043534635		4300 INDUSTRIAL AVE LINCOLN, NE, 68504	YE	YE
GENERAL ELECTRIC - HORNELL	NYD000632471		EDISON DR HORNELL, NY, 14843	YE	YE
GENERAL ELECTRIC AVIATION DIV	WAD009278706		220 S DAWSON ST SEATTLE, WA, 98108	IN	YE
GENERAL ELECTRIC CO	MAD002084093		100 WOODLAWN AVE PITTSFIELD, MA, 01201	NO	NO
GENERAL ELECTRIC CO	PAD003026903		PLEASURE RD LANCASTER, PA, 19406	YE	YE
GENERAL ELECTRIC CO	NYD002231272		W GENESEE RD AUBURN, NY, 13021	YE	NO STATUS
GENERAL ELECTRIC CO WASTE WATER FACL	CTD000842492		WOODFORD AVE & WOODLAND ST PLAINVILLE, CT, 06062	YE	YE
GENERAL ELECTRIC CO.	NYD093256063		381 BROADWAY FORT EDWARD, NY, 12828	YE	NO STATUS
GENERAL ELECTRIC CO. WINCHESTER LAMP PLA	VAD070360219		125 APPLE VALLEY ROAD WINCHESTER, VA, 22602-240	YE	YE

GENERAL ELECTRIC COMPANY	GAD003308145		1935 REDMOND CIRCLE ROME, GA, 30165	YE	YE
GENERAL ELECTRIC COMPANY	WVD088911854		RT. 892 - DUPONT ROAD WASHINGTON, WV, 26181	YE	YE
GENERAL ELECTRIC COMPANY	NYD002084135		BLDG 273-1029 1 RIVER RD, SCHENECTADY, NY, 12345	YE	YE
GENERAL ELECTRIC COMPANY - HUDSON FALLS	NYD002080075		1 JOHN STREET HUDSON FALLS, NY, 12839	YE	NO STATUS
GENERAL ELECTRIC FLATIRON FACILITY	CAT000622357		234 E MAIN ST ONTARIO, CA, 91761	YE	YE
GENERAL ENVIRONMENTAL MANAGEMENT	OHD004178612		2655 TRANSPORT ROAD CLEVELAND, OH, 44115	YE	NO STATUS
GENERAL MOTORS CORP	IND980503825		2900 S SCATTERFIELD RD ANDERSON, IN, 46013	YE	YE
GENERAL MOTORS CORP DELCO CHASSIS DIV	CTD018625632		780 JAMES P CASEY RD BRISTOL, CT, 06010	YE	YE
GENERAL MOTORS CORP.	NJD002186690		1016 WEST EDGAR ROAD LINDEN, NJ, 07036	YE	YE
GENERAL MOTORS CORPORATION	MID005356712		902 E LEITH ST FLINT, MI, 48550	YE	YE
GENERAL MOTORS CORPORATION	MID005356860		1245 E COLDWATER RD FLINT, MI, 48505	YE	YE
GENERAL MOTORS CORPORATION	MID005356902		2100 S OPDYKE RD PONTIAC, MI, 48341	YE	YE
GENERAL MOTORS CORPORATION	MID041793340		1629 N WASHINGTON AVE SAGINAW, MI, 48605	YE	YE
GENERAL MOTORS MORAINE ASSEMBLY	OHD041063074		2601 W STROOP RD MORAINE, OH, 45439	YE	YE
GENERAL SERVICES ADMIN	CO5670990105	General Services Agency	DEN FED CENTER - BLDG41 LAKEWOOD, CO, 80225	YE	YE
GENERAL SERVICES ADMINISTRATION	DC8470090004	General Services Agency	2ND & M STS SW WASHINGTON, DC, 20407	YE	YE
GENEVA STEEL LLC	UTD009086133		10 SOUTH GENEVA ROAD VINEYARD, UT, 84058	YE	IN
GENICOM CORP	VAD003132438		1 SOLUTIONS WAY WAYNESBORO, VA, 229801999	YE	YE
GENRAD INC	MAD001441054		41 MAIN ST BOLTON, MA, 01740	YE	YE
GEORGIA GULF CHEMICAL & VINYL, LLC	LAD057117434		26100 LA HIGHWAY 405 SOUTH PLAQUEMINE, LA, 70764	YE	IN
GEORGIA GULF LAKE CHARELES, LLC	LAD086478047		1600 VCM PLANT ROAD WESTLAKE, LA, 70669	YE	YE
GETS GLOBAL SIGNALING LLC	MOD000298398		2712 S DILLINGHAM RD GRAIN VALLEY, MO, 64029	YE	YE
GIANT CEMENT COMPANY	SCD003351699		654 JUDGE ST HARLEYVILLE, SC, 29448	YE	YE
GIANT REFINING CO - BLOOMFIELD	NMD089416416		#50 CTY RD 4990 OR SULLIVAN RD BLOOMFIELD, NM, 87413	YE	IN
GIANT REFINING CO. - CINIZA REFINERY	NMD000333211		INTERSTATE 40, EXIT 39 - 17 MILES EAST OF GALLUP, NM, JAMESTOWN, NM, 87347	YE	YE
GIANT RESOURCE RECOVERY, INC	VAD098443443		RTE. 652 ARVONIA, VA, 23004	YE	YE
GIANT YORKTOWN,INC.	VAD050990357		2201 GOODWIN NECK ROAD GRAFTON, VA, 23692	YE	IN
GIBSON ENVIRONMENTAL INC	CAD980883177		END OF COMMERCIAL DR DEADEND HWY 58 AND GIBSON, BAKERSFIELD, CA, 93308	YE	YE
GILBERT & BENNETT MFG CORP	CTD001162775		1 N MAIN ST GEORGETOWN, CT, 06829	YE	NO
GLATFELTER, PH CO SPRING GROVE MILL	PAD003003407		228 S MAIN ST SPRING GROVE, PA, 17362	YE	NO STATUS

GM LORDSTOWN COMPLEX	OHD020632998	2300 HALLOCK-YOUNG ROAD LORDSTOWN TOWNSHIP, OH, 444811406	YE	YE
GM METAL FABRICATING DIV	MID005356886	220 E COLUMBIA AVE PONTIAC, MI, 48340	YE	YE
GM POWERTRAIN	OHD005050273	26427 ST RTE 281 E DEFIANCE, OH, 43512	YE	YE
GM POWERTRAIN	VAD091222588	11032 TIDEWATER TR FREDERICKSBURG, VA, 22408	YE	YE
GMC MORAINE ENGINE PLANT GMPTG	OHD980569388	4100 SPRINGBORO PIKE MORAINE, OH, 45439	YE	YE
GMC SERVICE PARTS OPERATION PLANT #50	WVD044145209	891 AUTO PARTS PLACE MARTINSBURG, WV, 25401	YE	YE
GOLD MILLS INC PENN DYE & FIN	PAD002377703	1 PENN DYE ST PINE GROVE, PA, 17963	YE	YE
GOODRICH CORPORATION	KYD006370167	2468 INDUSTRIAL RD CALVERT CITY, KY, 42029	YE	YE
GRACE DAVISON WR GRACE & CO CONN.	MDD001710227	5500 CHEMICAL RD BALTIMORE, MD, 212261698	YE	YE
GRACE WR & CO	MDD074933961	7500 GRACE DR COLUMBIA, MD, 210440000	YE	YE
GRANGER LAND DEVELOPMENT CO	MID082771700	8500 W GRAND RIVER AVE GRAND LEDGE, MI, 48837	YE	YE
GRANT CTY LDFL	IND000715094	SR 18 & CR 700 E MARION, IN, 46952	YE	YE
GREAT LAKES CHEM CORP-CENTRAL PLT	ARD043195429	2226 HAYNESVILLE HWY EL DORADO, AR, 717317020	YE	YE
GREAT LAKES CHEMICAL CORPORATION	WVD005005087	200 PICKENS ROAD NITRO, WV, 25143	YE	YE
GREDE FOUNDRIES, INC., GREDE PERM CAST	KYD093903862	NEW LAIR ROAD CYNTHIANA, KY, 41031	YE	YE
GREEN RIVER STEEL CORPORATION	KYD062951801	4701 U.S. 60 EAST OWENSBORO, KY, 42303	YE	YE
GRIFFIN PIPE PRODUCTS	NJD003951985	1100 W FRONT ST FLORENCE, NJ, 085181015	YE	YE
GTE COMMUNICATIONS SYSTEMS CORPORATION	ALD050166750	13000 S MEMORIAL PKWY HUNTSVILLE, AL, 35803	YE	YE
GUIDE CORP	IND980700801	2915 DR MARTIN LUTHER KING JR ANDERSON, IN, 460164849	YE	YE
GULF CHEMICAL & METALLURGICAL CORPORATIO	TXD074195678	302 MIDWAY RD FREEPORT, TX, 77542	YE	YE
GULF COAST RECYCLING, INC.	FLD004092839	1901 N. 66TH STREET TAMPA, FL, 336192995	YE	YE
GULF OIL CORP GULF ADHESIVES & RESINS	PAD014304976	632 N CANNON AVE LANSDALE, PA, 19446	YE	YE
GULF STATES STEEL	ALD004014973	174 26TH ST SOUTH GADSDEN, AL, 35904	NO	IN
GULFSTREAM AEROSPACE CORPORATION	GAD061022216	500 GULFSTREAM ROAD SAVANNAH, GA, 31407	YE	YE
HACCO INC	WID006075352	110 HOPKINS DR RANDOLPH, WI, 53956	YE	YE
HALLMACK, DIVISION OF NUTONE, INC.	KYD081017667	US HWY 127 & TAPP RD HARRODSBURG, KY, 40330	YE	NO
HAMILTON SUNDSTRAND (MACTEC)	COD007057995	2480 W 70TH AVE DENVER, CO, 80221	YE	YE
HAMILTON SUNDSTRAND CORP A UTC COMPANY	CTD001145341	1 HAMILTON RD MAILSTOP HWF WINDSOR LOCKS, CT, 06096	YE	IN
HAMPSHIRE CHEMICAL CORPORATION	NHD048724173	2 EAST SPIT BROOK RD NASHUA, NH, 03061	YE	YE
HANDY & HARMAN	CTD018656819	1770 KINGS HIGHWAY FAIRFIELD, CT, 06430	YE	IN
HARCROS CHEMICALS INC	KST210010062	5200 SPEAKER RD KANSAS CITY, KS, 66106	YE	YE
HARLEY DAVIDSON MOTOR CO	PAD001643691	1425 EDEN RD YORK, PA, 17402	YE	NO STATUS

HARPER LEADER INC	CTD001166008		1046 S MAIN ST WATERBURY, CT, 06706	YE	NO
HAUER CUSTOM MFG INC	PAD097153399		447 OLD SWEDE RD DOUGLASSVILLE, PA, 195181239	YE	YE
HAWAIIAN WESTERN STEEL LIMITED	HID981581788		91-150 HANUA ST KAPOLEI, HI, 96707	YE	YE
HAWAIIAN WESTERN STEEL WASTEPI	HID982516775		MALAKOLE RD AND HANUA ST EWA BEACH, HI, 96706	YE	YE
HAYNES INTERNATIONAL INC	IND984867481		2000 W DEFENBAUGH ST KOKOMO, IN, 46902	YE	YE
HEARTLAND CEMENT	KSD980739999		1765 LIMESTONE LN INDEPENDENCE, KS, 67301	YE	IN
HELENA CHEMICAL COMPANY	ARD030414494		101 MLK DRIVE WEST HELENA, AR, 72390	YE	NO STATUS
HENKEL SURFACE TECHNOLOGIES	CAD009152364		37899 NILES BLVD FREMONT, CA, 94536	YE	YE
HENKEL SURFACE TECHNOLOGIES	MID058723867		322 W MAIN ST MORENCI, MI, 49256	YE	YE
HENRY CLAY(7TH NORTH)SCR-NIAGARA MOHAWK	NYD000730382		HENRY CLAY BLVD LIVERPOOL, NY, 13088	YE	YE
HERCULES INC	NJD011136884		NECK RD BURLINGTON, NJ, 08016	YE	YE
HERCULES INC - HOPEWELL PLANT	VAD003121928		1111 HERCULES RD HOPEWELL, VA, 23860	YE	YE
HERCULES INCORPORATED	GAD004065520		2801 COOK STREET BRUNSWICK, GA, 31520	NO	NO
HERCULES INCORPORATED	NJD002521961		50 SO. MINISINK AVENUE PARLIN, NJ, 08859	YE	YE
HERCULES INCORPORATED	VAD003122165		27123 SHADY BROOK TRAIL COURTLAND, VA, 23837	YE	IN
HERCULES INCORPORATED/RESEARCH CENTER	DED001315647		500 HERCULES ROAD WILMINGTON, DE, 198081599	YE	IN
HERCULES/ CIBA	NYD002069748		89 LOWER WARREN STREET QUEENSBURY, NY, 12804	YE	YE
HERITAGE ENVIRONMENTAL SERVICES LLC	IND093219012		7901 W MORRIS ST INDIANAPOLIS, IN, 46231	YE	YE
HESS PURVIS TERMINAL	MSD079461406		5151 US HIGHWAY 11 PURVIS, MS, 39475	YE	YE
HEWLETT PACKARD	CAD009122532		1501 PAGE MILL ROAD PALO ALTO, CA, 94304	YE	YE
HEWLETT PACKARD	CAT000624866		1201 PINER ROAD REMEDIATION ACTIVITIES, SANTA ROSA, CA, 95401	IN	YE
HEWLETT PACKARD MFG DIV	CAD009122557		395 PAGE MILL RD PALO ALTO, CA, 94306	YE	YE
HEXION SPECIALTY CHEMICALS INC	LAD980622104		16122 RIVER ROAD, LOT #3 NORCO, LA, 70079	YE	YE
HODGE FOUNDRY INC	PAD004323796		42 LEECH RD GREENVILLE, PA, 16125	YE	YE
HOLCHEM DBA SERVICE CHEMICAL	CAT000612333		1341 E MAYWOOD ST SANTA ANA, CA, 92706	YE	NO
HOLLOMAN AIR FORCE BASE	NM6572124422	US Air Force	6 MI. W. OF ALAMOGORDO, NM ON US HW 70, HOLLOMAN AIR FORCE BASE, NM, 883308277	YE	YE
HOLTRACHEM MANUFACTURING CO	MED000242701		99 INDUSTRIAL WAY ORRINGTON, ME, 04474	NO	NO
HOLTRACHEM MFG CO LLC	NCD991278631		1 INDUSTRIAL DR RIEGELWOOD, NC, 28456	YE	IN
HONEYWELL BALTIMORE INNER HARBOR	MDD069396711		1000 WILLS ST BALTIMORE, MD, 212310000	YE	YE
HONEYWELL CRS	ALD031499833		1327 ERIE STREET BIRMINGHAM, AL, 35224	YE	YE
HONEYWELL FARMERS VALLEY PLANT	PAD046761763		45 ROUTE 446 SMETHPORT, PA, 16749	YE	YE
HONEYWELL INC PROCESS CONTROL DIV	PAD002386761		1100 VIRGINIA DR FRONT 2 STORY FORT WASHINGTON, PA, 19034	YE	YE

HONEYWELL INTERNATIONAL INC	MID099114704		7819 W JEFFERSON DETROIT, MI, 48209	YE	NO STATUS
HONEYWELL INTERNATIONAL INC.	NJD048794986		101 COLUMBIA ROAD MORRISTOWN, NJ, 07962	YE	YE
HONEYWELL INTERNATIONAL, INC. - HOPEWELL	VAD065385296		905 EAST RANDOLPH ROAD HOPEWELL, VA, 23860	YE	IN
HONEYWELL INTL INC	ILD006278170		2768 N RTE 45 RD P O BOX 430, METROPOLIS, IL, 629600430	YE	YE
HONEYWELL NYLON LLC CHESTERFIELD PLANT	VAD023690183		4101 BERMUDA HUNDRED RD CHESTER, VA, 23836	YE	IN
HONEYWELL SKINNER VALVE DIV	CTD001149582		95 EDGEWOOD AVE NEW BRITAIN, CT, 06051	YE	YE
HONEYWELL, INCORPORATED	FLD004104105		ATTN: TOM FIEDLER 13350 US HIGHWAY 19 NORTH, CLEARWATER, FL, 337647290	YE	YE
HOOD PACKAGING CORP (FRMR DOWLING BAG)	GAD981224942		910 RIVER ST VALDOSTA, GA, 31601	YE	YE
HOOVER CO - PLT 1	OHD004462131		101 E MAPLE ST NORTH CANTON, OH, 44720	YE	YE
HOUSTON ELECTRONICS DIV OAK CRYSTAL INC	PAD059951871		501 PINE ST KANE, PA, 16735	YE	NO STATUS
HOVENSA LLC	VID980536080		1 ESTATE HOPE CHRISTIANSTED, VI, 00820	YE	YE
HOWE FURNITURE CORP	CTD001162858		151 WOODWARD AVE NORWALK, CT, 06854	YE	NO STATUS
HQ 10TH MTN DIV & FORT DRUM	NY0214020281	US Army	85 FIRST ST W PUBLIC WORKS ENVIRONMENTAL DIV, FORT DRUM, NY, 136025097	YE	NO STATUS
HQ, FORT BRAGG GARRISON COMMAND (ABN)	NC8210020121	US Army	PUBLIC WORKS BUSINESS CENTER AFZA-PW, BUTNER ROAD, FORT BRAGG, NC, 28310	YE	YE
HSL INC	SCD065053217		183 ROLLING HILLS CIRCLE EASLEY, SC, 29640	YE	YE
HUKILL CHEMICAL CORPORATION	OHD001926740		7013 KRICK ROAD BEDFORD, OH, 44146	YE	YE
HUNT REFINING CO TUSCALOOSA REFINERY	ALD004009320		1855 FAIRLAWN ROAD TUSCALOOSA, AL, 35401	YE	YE
HUNTINGTON ALLOYS SPECIAL METALS CO.	KYD049465255		OLD US RT 23 BURNAUGH, KY, 41129	YE	YE
HUNTSMAN CORP	NJD002482602		MANTUA GROVE RD WEST DEPTFORD TWP, NJ, 08096	YE	YE
HUNTSMAN PETROCHEMICAL CORPORATION	TXD000820928		4241 SAVANNAH AVE GATE 24 PORT ARTHUR, TX, 77640	YE	YE
HUNTSMAN POLYMERS CORPORATION	TXD980626014		2400 S GRANDVIEW ST ODESSA, TX, 79766	YE	YE
HUXFORD POLE & TIMBER CO INC	ALD008185407		14200 HIGHWAY 21 NORTH HUXFORD, AL, 36543	YE	YE
HYATT - CLARK INDUSTRIES FORMER	NJD002457174		1300 RARITAN RD CLARK, NJ, 070661100	YE	YE
HYDRITE CHEMICAL CO	IAT200010593		2815 W C F & N DR WATERLOO, IA, 50703	YE	YE
HYDRITE CHEMICAL CO	WID000808824		114 N MAIN ST COTTAGE GROVE, WI, 53527	YE	NO STATUS
I T W WATERBURY BUCKLE PLASTIGLIDE	CTD001165703		952 S MAIN ST WATERBURY, CT, 06721	YE	YE
IBM CORP - ENDICOTT	NYD002233039		1701 NORTH ST ENDICOTT, NY, 13760	YE	YE
IBM CORP - KINGSTON	NYD001359694		300 ENTERPRISE DR KINGSTON, NY, 12401	YE	YE
IBM CORP - OWEGO	NYD986874501		1801 STATE RTE 17C OWEGO, NY, 13827	YE	YE
IBM CORP. THOMAS J WATSON RESEARCH CTR.	NYD084006741		1101 KITCHAWAN ROAD ROUTE 134, P.O.BOX 218, YORKTOWN HEIGHTS, NY, 10598	YE	YE

IBM CORPORATION	MND006161756	3605 HIGHWAY 52 NORTH DEPT KP8, ROCHESTER, MN, 55901	YE	YE
IBM CORPORATION	NYD080480734	2455 SOUTH ROAD POUGHKEEPSIE, NY, 126015400	YE	YE
IBM CORPORATION	VTD002084705	1000 RIVER ST ESSEX JUNCTION, VT, 05452	YE	YE
IBM CORPORATION	VAD064872575	9600 GODWIN DRIVE MANASSAS, VA, 20110	YE	YE
IBM EAST FISHKILL FACILITY	NYD000707901	2070 RTE 52 BLDG 309 HOPEWELL JUNCTION, NY, 12533	YE	YE
IBP, INC.	NED072892037	US 283 & PROSPECT RD LEXINGTON, NE, 68850	YE	YE
ICI AMERICAS INC	PAD000797928	RT 443 W OFF RT 309 TAMAQUA, PA, 18252	YE	IN
ILLIANA HEAT TREATING INC	ILR000007203	3109 E VORHEES ST DANVILLE, IL, 61832	YE	YE
INDSPEC CHEMICAL CORP	PAD004336731	133 MAIN ST PETROLIA, PA, 16050	YE	YE
INDUSTRIAL RECOVERY CAPITAL CO OF OHIO	OHD004495545	OAK AND NINTH STS MARYSVILLE, OH, 43040	YE	YE
INDUSTRIAL SERVICE CORP	MOD073027609	1633 MARSH AVE KANSAS CITY, MO, 64126	YE	YE
INDUSTRIAL SOLVENTS & CHEMICALS CO	PAD098732118	BOX 210 STEVEN ROAD YORK HAVEN, PA, 17370	NO STATUS	NO STATUS
INDUSTRIAL WASTES INC	PAD000621839	405 N STATE LINE RD DARLINGTON, PA, 16115	YE	YE
INGERSOLL RAND COMPANY	NCD041414772	501 SANFORD AVENUE MOCKSVILLE, NC, 27028	YE	YE
INGERSOLL-RAND SECURITY & SAFETY	COD082657420	3899 HANCOCK EXPWY SECURITY, CO, 80911	YE	YE
INMETCO INC	PAD087561015	ONE INMETCO DR ELLWOOD CITY, PA, 16117-0720	YE	YE
INMONT CORP - HAWTHORNE PLT	NJD002165371	150 WAGARAW RD HAWTHORNE, NJ, 07506	YE	NO STATUS
INNOVENE USA LLC	TXD000751172	HIGHWAY 185 6.5 MI S OF BLOOMI PORT LAVACA, TX, 77979	YE	YE
INTERFACEAR	MDD030320709	7364 BALTIMORE ANNAPOLIS BLVD GLEN BURNIE, MD, 21061	YE	YE
INTERMET RADFORD FOUNDRY	VAD010063006	1605 WEST MAIN STREET RADFORD, VA, 24141	YE	YE
INTERNAT'L MINERAL TECH DBA TETRA MICRO	NED000610550	71025 569TH AVE FAIRBURY, NE, 68352	YE	YE
INTERNATIONAL BUSINESS MACHINES CORP.	CAD990843989	5600 COTTLE ROAD SAN JOSE, CA, 951930001	YE	YE
INTERNATIONAL FLAVORS & FRAGRANCES INC.	NJD002194843	800 ROSE LANE UNION BEACH, NJ, 07735	YE	YE
INTERNATIONAL FUEL SYSTEMS INC	IND044587848	980 HURRICANE RD FRANKLIN, IN, 46131	YE	YE
INTERNATIONAL PAPER	MSD980600084	1633 SOUTH FIRST STREET WIGGINS, MS, 39577	YE	YE
INTERNATIONAL PAPER	VAD046979498	3400 DEEPWATER TERM RD RICHMOND, VA, 23234	YE	YE
INTERNATIONAL PAPER	TXD008077356	HWY 6 N @ SEBASTIAN RD NAVASOTA, TX, 77868	YE	YE
INTERNATIONAL PAPER CO	GAD003275252	1201 W LATHROP AVE SAVANNAH, GA, 31402	YE	YE
INTERNATIONAL PAPER JOPLIN TREATED WOOD	MOD007129935	2609 S RANGELINE RD JOPLIN, MO, 64804	YE	YE
INTERNATIONAL PAPER LONGVIEW	WAD010745917	10 INTERNATIONAL WAY LONGVIEW, WA, 98632	YE	YE
INTERNATIONAL PAPER- FRANKLIN MILL	VAD003112265	34040 UNION CAMP DRIVE FRANKLIN, VA, 23851	YE	IN
INTERNATIONAL SHOE CO	TXD008071227	CARSON & FINFEATHER BRYAN, TX, 77801	YE	IN

INTEVAC	CAT080010804	601 CALIFORNIA AVE PALO ALTO, CA, 943040883	YE	YE
INVISTA INC. MARTINSVILLE	VAD003114865	1000 DUPONT ROAD MARTINSVILLE, VA, 24112	YE	YE
INVISTA INC. WAYNESBORO	VAD003114832	400 DUPONT BLVD WAYNESBORO, VA, 22980	YE	YE
INVISTA SEAFORD PLANT	DED002348845	25876 DUPONT ROAD SEAFORD, DE, 19973	YE	YE
ISELI CO	CTD083343269	651 GREYSTONE ROAD TERRYVILLE, CT, 06786	YE	YE
ISG BURNS HARBOR LLC	IND003913423	250 W US HWY 12 BURNS HARBOR, IN, 463049745	YE	YE
ISG HENNEPIN INC	ILD000781591	RTE 71 HENNEPIN, IL, 61327	YE	YE
ISG INDIANA HARBOR INC	IND005462601	3001 DICKEY RD EAST CHICAGO, IN, 46312	NO STATUS	NO STATUS
ISG PLATE LLC COATESVILLE	PAD002326908	139 MODENA RD COATESVILLE, PA, 19320	YE	NO STATUS
ISG SPARROWS POINT PLANT	MDD053945432	5111 NORTH POINT BLVD SPARROWS POINT, MD, 212190000	YE	IN
ISG STEELTON LLC	PAD003026531	215 S FRONT ST STEELTON, PA, 17113	YE	YE
ISG TECUMSEH REDEVELOPMENT INC	PAD990824161	1805 E FOURTH ST BETHLEHEM, PA, 180167699	YE	NO STATUS
ISG WEIRTON INC.	WVD000068908	ROUTE #2 WEIRTON, WV, 26062	YE	IN
ISPAT INLAND INC IHW	IND005159199	3210 WATLING ST EAST CHICAGO, IN, 46312	YE	IN
ISU - CHEMICAL WASTE HANDLING FACILITY	IAT200010601	1916 N SCHOLL RD AMES, IA, 50014	YE	YE
IT CORPORATION - PANOCHE FACILITY	CAD000060012	2251 LAKE HERMAN ROAD BENICIA, CA, 94510	YE	YE
IT CORPORATION - VINE HILL COMPLEX	CAD982521460	896 WATERBIRD WAY MARTINEZ, CA, 94553	YE	YE
ITT INDUSTRIES NIGHT VISION	VAD003123072	7635 PLANTATION ROAD ROANOKE, VA, 24019	YE	YE
ITT INDUSTRIES NIGHT VISION	VAD980550909	7669 ENON DRIVE ROANOKE, VA, 24019	YE	YE
J AND M PLATING INC	ILD990783995	1711 SEMINARY ST ROCKFORD, IL, 61004	YE	YE
J M HUBER CORPORATION	TXD980874135	1110 PENN ST BORGER, TX, 79007	YE	YE
J&L SPECIALTY STEEL LLC	PAD004340444	1200 MIDLAND AVE MIDLAND, PA, 15659	YE	YE
J.H. BAXTER & COMPANY	CAD000625731	422 MILL STREET WEED, CA, 96094	YE	YE
JAMESTOWN PAINT CO	PAD004323788	108 MAIN ST JAMESTOWN, PA, 16134	YE	YE
JERSEY PLATING CO	NJD002202885	214 BIRCH ST BOONTON, NJ, 070051728	NO STATUS	NO STATUS
JOHN DEERE DES MOINES WORKS	IAD069624500	825 SW IRVINEDALE DR ANKENY, IA, 50021	YE	IN
JOHN DEERE WATERLOO WORKS-WESTFIELD AVE	IAD005289806	400 WESTFIELD AVE WATERLOO, IA, 507010270	YE	YE
JOHN SMITH SOLID WASTE SITE	CAD990665432	JOHN SMITH ROAD HOLLISTER, CA, 95023	YE	YE
JOHNSON CONTROLS INC	MID099124299	425 FRANK ST FOWLERVILLE, MI, 48836	YE	YE
JOHNSON CONTROLS, INC	DED002353092	700 NORTH BROAD STREET MIDDLETOWN, DE, 19709	YE	YE
JOHNSON MATTHEY INC	NJD000692194	PINEY HOLLOW RD WINSLOW, NJ, 08095	YE	YE
JOHNSTON COUNTY SCHOOL BOARD	NCD981476955	2323 CLEVELAND RD SMITHFIELD, NC, 27577	YE	YE
JONES ENVIRONMENTAL SERVICES (NORTH EAST	MAD047075734	263 HOWARD LOWELL, MA, 01852	YE	YE
KABA ILCO CORP.	NCD045646924	400 JEFFREYS ROAD ROCKY MOUNT, NC, 27802	YE	YE

KACC SPL PILE	WVD988766127		STATE ROUTE 20 RAVENSWOOD, WV, 26164	YE	YE
KAISER ALUMINUM & CHEMICAL CORP	FLD004106811		2420 OLD HWY 60 MULBERRY, FL, 338600	YE	YE
KAISER VENTURES, INC.	CAD008274938		13429 SAN BERNARDINO AVE FONTANA, CA, 92334	YE	IN
KAMAN AEROSPACE CORP	CTD001155225		OLD WINDSOR ROAD BLOOMFIELD, CT, 06002	YE	NO STATUS
KAMAN AEROSPACE CORPORATION	CTD065529158		100 SOUTH MAIN ST MOOSUP, CT, 06354	YE	NO
KANE MAGNETIC INTL	PAD043817444		700 ELK AVE KANE, PA, 16735	YE	YE
KANSAS ARMY AMMUN PLT	KS0213820467	US Army	23018 ROOKS RD PARSONS, KS, 67357	YE	YE
KANTHAL CORP	CTD001449602		119 WOOSTER STREET BETHEL, CT, 06801	YE	YE
KAPL, INC. - KNOLLS SITE	NY6890008992	Dept. of Energy	2401 RIVER ROAD NISKAYUNA, NY, 12309	YE	YE
KEARFOTT GUIDANCE & NAVIGATION CORPORATI	NJD002148484		1150 MCBRIDE AVENUE WEST PATERSON, NJ, 07424	YE	YE
KEARNEY-KPF	CAD981429715		1624 E ALPINE AVE STOCKTON, CA, 952052594	YE	YE
KEESLER AFB, 81 CES/CEV	MS2570024164	US Air Force	508 L STREET KEESLER AFB, MS, 395342115	YE	YE
KELLER LADDERS INC	VAD052356623		16174 INDUSTRIAL DR MILFORD, VA, 22514	YE	YE
KELLY RUN SANITATION INC	PAD004810222		RTE 51 ELIZABETH, PA, 15037	YE	YE
KELLY-SPRINGFIELD TIRE CO	MDD003060217		KELLY RD CUMBERLAND, MD, 21502	YE	YE
KELSEY HAYES	OHD052859170		2400 CHARLES ST PORTSMOUTH, OH, 45662	YE	YE
KENDRO LABORATORY PRODUCTS LP	CTD072115793		31 PECKS LANE NEWTOWN, CT, 06470	YE	YE
KENNAMETAL INC BEDFORD PLT	PAD004397683		CHALYBEATE SPRINGS RD BEDFORD, PA, 15522	YE	YE
KENTUCKY ELECTRIC STEEL LLC	KYD000207282		US 60 WEST ASHLAND, KY, 41102	YE	YE
KERR MCGEE	ILD020367561		2 WASHINGTON AVE MADISON, IL, 62060	YE	YE
KERR MCGEE CHEMICAL CORP	MOD007128978		2300 OAKLAND KANSAS CITY, MO, 64126	YE	YE
KERR MCGEE CHEMICAL LLC	NVD008290330		8000 W LAKE MEAD DR HENDERSON, NV, 890156619	YE	YE
KERR MCGEE CHEMICAL LLC	TXD057111403		155 BUCHANAN RD TEXARKANA, TX, 75501	YE	YE
KERR MCGEE CHEMICAL, LLC	MSD007025117		40034 KERR MCGEE RD. HAMILTON, MS, 39746	NO	YE
KERR MCGEE CHEMICAL, LLC-COLUMBUS	MSD990866329		2300 14TH AVE NORTH COLUMBUS, MS, 39701	YE	YE
KERR-MCGEE CHEMICAL CORP.	MSD081387730		HIGHWAY 11 SOUTH MERIDIAN, MS, 39304	YE	YE
KERR-MCGEE CHEMICAL LLC	MOD007129406		2800 W HIGH ST SPRINGFIELD, MO, 65803	YE	YE
KESTREL HAWK LF	WID076171008		1989 OAKES RD RACINE, WI, 53406	YE	YE
KEYSTONE CEMENT CO	PAD002389559		ROUTE 329 & 512 BATH, PA, 18014	YE	YE
KEYSTONE STEEL & WIRE CO	ILD000714881		7000 SW ADAMS ST-A PEORIA, IL, 61641	YE	YE
KHI INC	MID006020895		582 E LAKEWOOD BLVD HOLLAND, MI, 49424	YE	IN
KIK CUSTOM PRODUCTS INC	ILD005141726		1 W HEGELER LN DANVILLE, IL, 61832	YE	YE
KILGORE FLARES COMPANY LLC	TND981026594		KELLER RD TOONE, TN, 38381	YE	YE
KIMBERLY-CLARK BERKELY MILLS	NCD003151990		32 SMYTH AVE HENDERSONVILLE, NC, 287928503	YE	YE

KING MFG INC	NHD001090729		189 SQUANTUM RD JAFFREY, NH, 03452	YE	YE
KIRTLAND AFB	NM9570024423	US Air Force	2050 WYOMING BLVD ALBUQUERQUE, NM, 871185606	YE	IN
KM LIQUIDS TERMINALS LP	TXD026481523		906 CLINTON DR TERMINAL A GALENA PARK, TX, 77547	YE	YE
KOCH NITROGEN CO	KSD044625010		11559 US HWY 50 DODGE CITY, KS, 678011337	YE	IN
KOHLER CO	WID006073225		444 HIGHLAND DR KOHLER, WI, 53044	YE	NO STATUS
KOPPEL STEEL CORP	PAD000651752		6403 6TH AVE KOPPEL, PA, 16136	YE	YE
KOPPERS CO INC	PAD082245754		440 COLLEGE PARK DR MONROEVILLE, PA, 15146	YE	YE
KOPPERS CO INC-BRIDGEVILLE PLT	PAD063764898		MILLER RUN RD BRIDGEVILLE, PA, 15017	YE	YE
KOPPERS COMPANY INC	TXD008089021		INDUSTRIAL RD 1M S OF I-10 HOUSTON, TX, 77015	YE	YE
KOPPERS INC	ARD006344824		2201 EDMONDS ST N LITTLE ROCK, AR, 72117	YE	YE
KOPPERS INC	WID006179493		3185 S CNTY RD A SUPERIOR, WI, 54880	NO STATUS	NO STATUS
KOPPERS INC	COD007077175		465 W 56TH AVE DENVER, CO, 80216	YE	NO
KOPPERS INC WOODWARD PLANT	ALD085765808		1835 KOPPERS DRIVE DOLOMITE, AL, 350611123	YE	YE
KOPPERS INC.	VAD003125770		4020 KOPPERS RD SALEM, VA, 24153	YE	YE
KOPPERS INC.	WVD003080959		98 RAILROAD STREET GREEN SPRING, WV, 26722	YE	YE
KOPPERS INCORPORATED	WVD004336749		100 KOPPERS ROAD FOLLANSBEE, WV, 26037	YE	YE
KOPPERS INDUSTRIES INC	SCD003353026		280 KOPPERS ST FLORENCE, SC, 29503	YE	YE
KOPPERS, INC.	KYD006383392		198 FAIRGROUNDS RD GUTHRIE, KY, 42234	YE	YE
KOPPERS, INC.	MSD007027543		ONE KOPPERS DRIVE TIE PLANT, MS, 38960	YE	YE
KOSMOS CEMENT COMPANY	KYD024111981		15301 DIXIE HIGHWAY LOUISVILLE, KY, 40272	YE	YE
KRATON POLYMERS	OHD004343117		2982 WASHINGTON BLVD BELPRE, OH, 457140235	YE	YE
KS BEARINGS INC	IND052959640		1515 W MAIN ST GREENSBURG, IN, 47240	YE	NO
KURDZIEL IRON OF ROTHBURY INC	MID006025217		2625 W WINSTON RD ROTHBURY, MI, 49452	YE	YE
L 3 COMMUNICATIONS INTEGRATED SYSTEMS LP	TXD007365984		10001 JACK FINNEY BLVD GREENVILLE, TX, 75401	YE	YE
LACKS INDUSTRIES INC	MID006014666		1601 GALBRAITH AVE SE GRAND RAPIDS, MI, 49546	YE	NO STATUS
LACKS INDUSTRIES INC	MID080359433		6138 RIVERSIDE DRIVE SARANAC, MI, 48881	YE	YE
LAFARGE MIDWEST INC	MID005379607		1435 FORD AVE ALPENA, MI, 49707	YE	YE
LAFARGE NORTH AMERICA	OHD987048733		11435 CO RD 176 PAULDING, OH, 45879	YE	YE
LANCASTER METAL SCIENCE CORP	PAD980919005		826 N QUEEN ST LANCASTER, PA, 17603	YE	YE
LANGDALEFOREST PRODUCTS CO.	TND003493103		555 SOUTH MAIN STREET SWEETWATER, TN, 37874	YE	YE
LANIER CLOTHES (OXFORD INDUSTRIES)	GA0000233163		736 WOODBURY RD GREENVILLE, GA, 30222	YE	YE
LANXESS CORP	SCD048373468		1530 BUSHY PARK RD GOOSE CREEK, SC, 29445	YE	YE
LARAWAY RECYCLING & DISP FAC	ILD074411745		21101 W LARAWAY RD ELWOOD, IL, 60421	YE	YE
LAWRENCE BERKELEY NATIONAL LABORATORY	CA4890008986	Dept. of Energy	ONE CYCLOTRON ROAD BERKELEY, CA, 94720	YE	YE

LAWRENCE LIVERMORE LAB. SITE 300	CA2890090002	Dept. of Energy	CORRAL HOLLOW ROAD. TRACY, CA, 953760000	YE	YE
LAWRENCE LIVERMORE NATL. LAB	CA2890012584	Dept. of Energy	7000 EAST AVE. LIVERMORE, CA, 945509516	YE	YE
LBC HOUSTON LP	TXD000719286		11807 PORT RD SEABROOK, TX, 77586	YE	YE
LEAVENS AWARDS CO INC	MAD063913909		41 SUMMER ST ATTLEBORO, MA, 02703	YE	NO
LEE ENGINEERING & CONST (GC LEE SITE)	GA0000012914		LEE FARM RD DU PONT, GA, 31630	YE	YE
LEHIGHTON ELECTRONICS INC	PAD002399186		RTE 443 - RD # 1 LEHIGHTON, PA, 18235	YE	YE
LEMEAN PROPERTY HOLDINGS CORP	PAD045137247		8281 RT 873 SLATINGTON, PA, 18080	YE	YE
LENOX , INCORPORATED D/B/A LENOX CHINA	NJD002325074		TILTON ROAD POMONA, NJ, 08240	YE	YE
LIGHT METALS COLORING CO INC	CTD001162460		270 SPRING ST SOUTHINGTON, CT, 06489	YE	IN
LIGHTOLIER NORWICH	CTD000841130		40 WISCONSIN AVE NORWICH, CT, 06360	YE	IN
LIMA REFINERY	OHD005051826		1150 S METCALF ST LIMA, OH, 458041199	YE	YE
LION OIL COMPANY	ARD000021998		1000 MCHENRY EL DORADO, AR, 71730	YE	YE
LOCKHEAD MARTIN TACTICAL DEF	MND000823914		3333 PILOT KNOB RD EAGAN, MN, 55121	YE	YE
LOCKHEED MARTIN ELECTRONICS PARK	NYD059385120		497 ELECTRONICS PARK LIVERPOOL, NY, 13088	YE	YE
LOCKHEED MARTIN MFC	FLD060240207		5600 SAND LAKE ROAD ORLANDO, FL, 32819	YE	YE
LOCKHEED MARTIN MISSILES & FIRE CONTROL	ARD980621155		LEWIS ROAD HIGHLAND INDUSTRIAL PARK, CAMDEN, AR, 71701	YE	YE
LOCKHEED MARTIN MISSILES & FIRE CONTROL	FLD061993606		498 OAK ROAD OCALA, FL, 34472	YE	YE
LOCKHEED MARTIN SITE B-1	CAD045256187		1705 N VICTORY PLACE BURBANK, CA, 91505	YE	YE
LOCKHEED MARTIN SPACE SYSTEMS COMPANY	CAD009125535		1111 LOCKHEED MARTIN WAY SUNNYVALE, CA, 94089	YE	YE
LOCKHEED MARTIN WATERTON PLANT	COD001704790		12257 S WADSWORTH BLVD LITTLETON, CO, 80125	YE	YE
LONE STAR STEEL COMPANY	TXD007323397		6866 US HIGHWAY 259 S LONE STAR, TX, 75668	YE	YE
LORD CORP	PAD051129757		124 GRANT ST CAMBRIDGE SPRINGS, PA, 16403	YE	YE
LOS ANGELES CO AGRI COMM	CAD000626077		8841 E SLAUSON AVE PICO RIVERA, CA, 90660	YE	YE
LOUISIANA-PACIFIC CORP-LOCKHART	ALD095687786		HWY 55 LOCKHART, AL, 36455	YE	YE
LOUISVILLE ENVIRONMENTAL SERVICES	KYD079661146		15700 DIXIE HIGHWAY LOUISVILLE, KY, 40272	YE	YE
LUCENT TECHNOLOGIES	OKD007189111		7725 W. RENO AVE. OKLAHOMA CITY, OK, 73127	YE	IN
LWD, INC.	KYD088438817		2475 INDUSTRIAL PKWY CALVERT CITY, KY, 42029	YE	NO
LYONDELL CHEMICAL COMPANY	TXD083472266		2502 SHELDON RD CHANNELVIEW, TX, 77530	YE	YE
LYONDELL CITGO REFINING LP	TXD082688979		12000 LAWNDALE ST GATE 14 HOUSTON, TX, 77017	YE	YE
M E M C ELECTRONIC MATERIALS INC	MOD001700673		501 PEARL DR OFALLON, MO, 63366	YE	YE
M H RHODES	CTD001162114		139 MILL ROCK RD OLD SAYBROOK, CT, 06475	YE	YE
MACALLOY CORPORATION	SCD003360476		1800 PITTSBURG AVENUE NORTH CHARLESTON, SC, 29405	YE	NO

MACDERMID INC	CTD001164599		526 HUNTINGDON AVENUE WATERBURY, CT, 06708	YE	IN
MADEWELL & MADEWELL, INC.	OKD032963530		9400 N. CHOCTAW RD. JONES, OK, 73049	YE	YE
MAGELLAN PIPELINE COMPANY LP	COD076459601		15000 E SMITH RD AURORA, CO, 800112401	YE	YE
MAGNA CORP ACROLEIN PLT	CAT000618728		GOSFORD & PACHECO RDS BAKERSFIELD, CA, 93309	YE	YE
MALTA WINDOWS	OHD004290078		210 13TH ST MALTA, OH, 437589900	YE	YE
MANOR TIMBER COMPANY INC	GAD061921052		BLACK ANKEL RD ARGYLE, GA, 31623	YE	YE
MARATHON ASHLAND PETROLEUM LLC	ILD005476882		MARATHON AVE P O BOX 1200, ROBINSON, IL, 62454	YE	YE
MARATHON ASHLAND PETROLEUM, LLC	MND006162820		100 WEST THIRD AVE ST PAUL PARK, MN, 55071	YE	YE
MARATHON PETROLEUM LLC - LRD	LAD081999724		US HWY 61 @ MARATHON AVE. GARYVILLE, LA, 70051	YE	YE
MARINE CORPS AIR STATION, YUMA	AZ8170024493	US Marines	P.O. BOX 99110 YUMA, AZ, 853699110	YE	YE
MARINE CORPS BASE	NC6170022580	US Marines	BUILDING 1, PSC BOX 20004 CAMP LEJEUNE, NC, 285420004	YE	YE
MARINE CORPS LOGISTICS BASE, BARSTOW	CA8170090023	US Marines	COMMANDING OFFICER (B570) MCLB, BARSTOW, BOX 110570, BARSTOW, CA, 92311	YE	YE
MARISOL INCORPORATED	NJD002454544		125 FACTORY LANE MIDDLESEX, NJ, 08846	YE	YE
MARJOL BATTERY	PAD003041910		600 DELAWARE ST THROOP, PA, 18512	YE	YE
MARLEY COOLING TOWER CO THE	CAD009140120		150 N SINCLAIR AVE STOCKTON, CA, 95215	YE	YE
MARSHALL SPACE FLIGHT CENTER	AL1800013863	NASA	BLDG 4200 MARSHALL SPACE FLIGHT CTR, AL, 35812-1000	YE	IN
MARTIN ELECTRONICS INC	FLD047966593		SR 361A W PERRY, FL, 323470	YE	YE
MARTIN METAL FINISHING INC	CAD059794974		12150 S ALAMEDA ST (SEE MAP) LYNWOOD, CA, 90262	YE	NO
MASON CORPORATION	IND005460209		1049 US HWY 41 SCHERERVILLE, IN, 46375	YE	NO
MATHESON GAS PRODUCTS INC.	TND047002589		SCEPTER RD OFF HWY 70 NEW JOHNSONVILLE, TN, 37134	YE	YE
MATLACK INC	NJD043584101		RTE 322 SWEDESBORO, NJ, 08085	YE	NO STATUS
MAX ENVIRONMENTAL TECHNOLOGIES INC	PAD059087072		200 MAX DR BULGER, PA, 15019	YE	YE
MAX ENVIRONMENTAL YUKON FACILITY	PAD004835146		233 MAX LANE YUKON, PA, 15698	YE	YE
MCAS CHERRY POINT	NC1170027261	US Marines	NC HWY 101 @ US 70 WEST HAVELOCK, NC, 285330006	YE	YE
MCKESSON CHEM CO	CAD073934903		33950 7TH ST UNION CITY, CA, 94587	YE	YE
MCKESSON ENVIROSYSTEMS	NYD075806836		400 BEAR ST SYRACUSE, NY, 13204	YE	YE
MCLB ALBANY	GA7170023694	US Marines	814 RADFORD BLVD SUITE 20315 ALBANY, GA, 317040315	YE	YE
ME METAL FINISHING SILVEX	MED990813479		RTE 22 RFD 1 GORHAM, ME, 04038	YE	YE
MEAD STORAGE DEPOT	OHD043730209		1748 LANCASTER ROAD CHILLICOTHE, OH, 45601	YE	YE
MEAD WESTVACO SOUTH CAROLINA, LLC	LAD010390599		400 CROSBY RD DERIDDER, LA, 70634	YE	YE
MEDALLIC ART	CTD001265636		OLD RIDGEBURY RD DANBURY, CT, 06810	YE	NO STATUS
MERCK & CO INC	PAD002387926		770 SUMNEYTOWN PIKE WEST POINT, PA, 194860004	YE	YE
MERCK & CO INC	PAD003043353		100 AVENUE C RIVERSIDE, PA, 17868	YE	YE
MERCK & CO., INC.	GAD003324985		3517 RADIUM SPRINGS ROAD ALBANY, GA, 31705	YE	YE

MERCK & CO., INC.	NJD001317064		126 EAST LINCOLN AVENUE RAHWAY, NJ, 07065	YE	NO STATUS
MERCK & CO., INC.	VAD001705110		2778 SOUTH EAST SIDE HIGHWAY ELKTON, VA, 22827	YE	YE
MERCURY WASTE SOLUTIONS	NYD048148175		26 RAILROAD AVE ALBANY, NY, 12205	YE	YE
MERITOR HEAVY VEHICLE SYSTEMS	OHD004289450		444 HEBRON RD HEATH, OH, 43056	YE	YE
METAL FINISHING TECHNOLOGIES, INC.	CTD001154558		60 WOOSTER COURT FORESTVILLE, CT, 06010	YE	YE
METALWORKING LUBRICANTS	IND000646950		1509 S SENATE INDIANAPOLIS, IN, 46225	YE	IN
METRO LANDFILL & DEVELOPMENT	WID098547854		10712 S 124TH ST FRANKLIN, WI, 53132	YE	YE
METZELER AUTOMATIVE PROFILE SYSTEMS	IAD005136023		3200 MAIN ST KEOKUK, IA, 526328230	YE	YE
MI DEPT/NATURAL RESOURCES	MID980825632		1515 E ROBINSON LAKE RD ROSCOMMON, MI, 48653	YE	YE
MICHIGAN SEAMLESS TUBE LLC	MID082767591		400 MCMUNN ST SOUTH LYON, MI, 48178	YE	YE
MICHIGAN STATE UNIVERSITY	MID053343976		3885 JOLLY RD EAST LANSING, MI, 48824	YE	YE
MICRO CHEMICAL COMPANY, INC.	LAD008181927		3393 FRONT STREET HWY 15 NORTH, WINNSBORO, LA, 71295	YE	NO
MICROCHIP TECHNOLOGY INC	CAD009111444		1300 TERRA BELLA AVE MOUNTAIN VIEW, CA, 940431836	YE	YE
MICROTECH INC	CTD054476973		1425 HIGHLAND AVE CHESHIRE, CT, 06410	YE	IN
MILITARY OCEAN TERMINAL BAYONNE-FORMER	NJ0210022752	US Army	FOOT OF 32ND ST & ST HWY 169 (BAYONNE, NJ, 07002	YE	YE
MILLENNIUM INORGANIC CHEMS INC	MDD003093515		3901 FT ARMISTEAD RD BALTIMORE, MD, 21226	YE	YE
MILLENNIUM PETROCHEMICALS INC	TXD058276130		1350 MILLER CUT OFF RD LA PORTE, TX, 77571	YE	YE
MILLENNIUM RAIL INC	PAD990752321		ROUTE 22 & BERWIND DR HOLLIDAYSBURG, PA, 16648	IN	IN
MILLIKEN CHEMICAL-DEWEY PLANT	SCD069314045		1440 CAMPTON RD INMAN, SC, 29349	YE	NO
MINERAL KING MINERALS INC	CAD990769465		10585 INDUSTRY AVE HANFORD, CA, 93230	NO	IN
MINOT AIR FORCE BASE	ND4571924758	US Air Force	5 320 PEACEKEEPER PLACE MINOT AFB, ND, 587055006	YE	YE
MISSOURI PRESSED METALS INC	MOD073029936		1200 E BOONVILLE RD SEDALIA, MO, 65301	YE	YE
MIXON BROTHERS WOOD PRESERVING INC	OKD007336258		HWY 70W 1M N IDABELL IDABEL, OK, 74745	YE	YE
MODERN PLATING CORP	ILD005172325		701 S HANCOCK AVE FREEPORT, IL, 61032	YE	YE
MODINE MFG CO	MOD062439351		221 SUNSET DR CAMDENTON, MO, 65020	YE	IN
MOHEGAN TRIBE OF INDIANS	CTD001147875		67 SANDY DESERT RD UNCASVILLE, CT, 06382	YE	YE
MOLYCORP INC WASHINGTON PLT	PAD030068282		300 CALDWELL AVE WASHINGTON, PA, 15301	YE	IN
MONARCH TILE INC	TXD008041048		333 MARSHALL STREET MARSHALL, TX, 75670	YE	IN
MONSANTO COMPANY LULING	LAD001700756		12501M S RIVER RD LULING, LA, 70070	YE	YE
MONTVILLE STATION	CTD049181654		74 LATHROP RD UNCASVILLE, CT, 06382	YE	YE
MOODY AIR FORCE BASE	GA0570024109	US Air Force	BEMIS ROAD MOODY AFB, GA, 31699	YE	YE
MOOG COMPONENTS GROUP INC	NCD044438406		1995 HWY 141 MURPHY, NC, 28906	YE	NO
MORGAN AM&T PURE CARBON CO	PAD002103273		1118 E SECOND ST COUDERSPORT, PA, 16915	YE	YE
MORRO BAY POWER PLANT	CAT080011646		1290 EMBARCADERO ROAD MORRO BAY, CA, 93442	YE	YE

MORTON INTERNATIONAL A ROHM AND HAAS CO.	MSD008186587		5724 ELDER FERRY ROAD MOSS POINT, MS, 39563	YE	NO
MOTIVA - DELAWARE CITY REFINERY	DED002329738		4550 WRANGLE HILL ROAD DELAWARE CITY, DE, 19706	YE	IN
MOTIVA ENTERPRISES LLC	TXD008097529		2100 HOUSTON AVENUE PORT ARTHUR, TX, 77640	YE	YE
MOTIVA ENTERPRISES LLC	TXD980626022		E OF SPUR 136 GRIGSBY AVE & S PORT NECHES, TX, 77651	YE	YE
MOTIVA ENTERPRISES LLC-FAIRFAX TERMINAL	VAD093952935		3800 PICKETT RD FAIRFAX, VA, 220313606	YE	YE
MOTIVA ENTERPRISES LLC-NORCO	LAD008186579		15536 RIVER ROAD NORCO, LA, 70079	YE	YE
MOTOROLA, INC.	FLD056921471		8000 W. SUNRISE BLVD PLANTATION, FL, 333220000	YE	YE
MOULTRIE BRIDGEPORT WWTP	GAD991275710		MOULTRIE INDUSTRIAL PK MOULTRIE, GA, 31768	YE	YE
MOUNT JOY WIRE CORP	PAD003023371		1000 E MAIN ST MOUNT JOY, PA, 17552	YE	IN
MPM INC	WID988643169		509 S WISCONSIN AVE HWY 35 FREDERIC, WI, 54837	YE	YE
MT AIRY WOOD PRESERVING COMPANY INC	GAD041013657		1036 WELCOME HOME RD MT AIRY, GA, 39563	YE	NO
MURPHYS WASTE OIL SERVICES INC	MAD066588005		252 SALEM ST WOBURN, MA, 01801	YE	NO STATUS
MURRY CORPORATION OF MARYLAND	TXD053115978		2002 TILE FACTORY RD STE A PALESTINE, TX, 75801	YE	YE
N S I UNITED TECHNOLOGIES CORP	CTD089623318		NORDEN PL NORWALK, CT, 06855	YE	NO STATUS
NASA JSC WHITE SANDS TEST FACILITY	NM8800019434	NASA	12600 NASA ROAD LAS CRUCES, NM, 88012	YE	NO
NASA PLUM BROOK STATION	OH3800015379	NASA	6100 COLUMBUS AVE SANDUSKY, OH, 44870	YE	IN
NASHUA LABEL CORPORATION	NED045275260		3838 S 108TH ST OMAHA, NE, 681444951	YE	YE
NATIONAL CHROMIUM CO INC	CTD001160811		SENEXET RD PUTNAM, CT, 06260	YE	YE
NATIONAL ELECTRICAL CARBON PRODUCTS INC	PAD059282459		100 STOKES AVE EAST STROUDSBURG, PA, 18301	YE	YE
NATIONAL FORGE CO	PAD002101418		1 FRONT ST IRVINE, PA, 163290258	YE	YE
NATIONAL STANDARD NILES CITY COMPLEX	MID005069257		601 N 8TH ST NILES, MI, 49120	YE	YE
NATIONAL STEEL CORP - MIDWEST OPER	IND016584641		6300 US HWY 12 PORTAGE, IN, 46368	YE	YE
NAVAJO REFINING COMPANY	NMD048918817		501 E MAIN ARTESIA, NM, 88211	YE	IN
NAVAL ACTIVITY PUERTO RICO	PR2170027203	US Navy	NAVAL STATION ROOSEVELT RD RTE 3, CEIBA, PR, 00735	YE	YE
NAVAL AIR STATION BOCA CHICA	FL6170022952	US Navy	US 1 MILE MARKER 8 BLDG A4078, KEY WEST, FL, 330409001	YE	YE
NAVAL AIR STATION LEMOORE CALIFORNIA	CA3170024381	US Navy	700 AVENGER AVENUE LEMOORE, CA, 93246	YE	YE
NAVAL AIR WEAPONS STATION, CODE N45NCW	CA2170023152	US Navy	1 ADMINISTRATION CIRCLE CHINA LAKE, CA, 93555	YE	NO
NAVAL BASE VENTURA COUNTY PORT HUENEME	CA6170023323	US Navy	1000 23RD AVE PORT HUENEME, CA, 93043	YE	YE
NAVAL ORDNANCE STATION	KY5170024173	US Navy	180 ROCHESTER DR LOUISVILLE, KY, 402145001	YE	YE
NAVAL STATION SAN DIEGO	CA6170024289	US Navy	BLDG 3458 HARBOR DR SAN DIEGO, CA, 92136	YE	YE
NAVAL SUBMARINE BASE, KINGS BAY	GA4170090001	US Navy	1063 USS TENNESSEE AVENUE KINGS BAY, GA, 31547	YE	YE
NAVAL SUPPORT ACTIVITY MID-SOUTH	TN2170022600	US Navy	NAVY ROAD MILLINGTON, TN, 38054	YE	YE

NAVAL WEAPONS STATION S. B. DET. CONCORD	CA7170024528	US Navy	10 DELTA STREET CONCORD, CA, 94520	YE	YE
NAVAL WEAPONS STATION SEAL BEACH	CA0170024491	US Navy	800 SEAL BEACH BLVD. N45W SEAL BEACH, CA, 907405000	YE	NO
NCR CORPORATION	OHD001876267		CORRECTIVE ACT @ 800 COCHRAN CAMBRIDGE, OH, 43725	YE	YE
NCRA	KSD007145956		1391 IRON HORSE RD (B) MCPHERSON, KS, 674601404	YE	YE
NCTS SD DETACHMENT STOCKTON	CA2170024382	US Navy	305 FYFFE AVENUE STOCKTON, CA, 95203	YE	YE
NETOPTIX CORP	MAD065781197		660 MAIN ST STURBRIDGE, MA, 01566	YE	YE
NEVAMAR CO LLC	VAD044736213		721 WEST MAIN ST WAVERLY, VA, 23890	YE	YE
NEVILLE CHEMICAL CO	PAD004334157		2800 NEVILLE RD PITTSBURGH, PA, 15225	YE	IN
NEW HAVEN HARBOR STATION	CTD000844381		1 WATERFRONT ST NEW HAVEN, CT, 06512	YE	YE
NEWARK	CAD074644659		8333 ENTERPRISE DR. NEWARK, CA, 94560	YE	IN
NEWPORT CHEMICAL DEPOT	IN1210022272	US Army	SR 63 N OF US 36 NEWPORT, IN, 47966	YE	YE
NEWPORT NEWS SHIPBUILDING & DRY DOCK CO	VAD001307495		4101 WASHINGTON AVE NEWPORT NEWS, VA, 23607	YE	IN
NGK METALS CORP	PAD044540136		150 TUCKERTON RD READING, PA, 19612	YE	YE
NORTH & JUDD INC	CTD051320372		699 MIDDLE ST MIDDLETOWN, CT, 06457	YE	YE
NORTH BRANCH CHICAGO RIV RESERVIOR 29A	IL0000060392		110 PFINGSTEN RD NORTHBROOK, IL, 60062	YE	YE
NORTH STAR STEEL PENNSYLVANIA	PAD050917186		230 LOWER MARKET STREET MILTON, PA, 17847	YE	YE
NORTHEAST ENVIRONMENTAL SERVICES	NYD057770109		CANAL RD TOWN OF LENOX, NY, 13032	YE	YE
NORTHEAST PAINT & VARNISH CO INC	PAD002262020		7914 BRISTOL PIKE LEVITTOWN, PA, 19059	YE	YE
NORTHLAND ENVIRONMENTAL INC.	RID040098352		275 ALLENS AVE PROVIDENCE, RI, 02905	YE	YE
NORTHROP GRUMMAN CORP	NYD002047967		830 S OSTER BAY RD BETHPAGE, NY, 11714	NO STATUS	NO STATUS
NORTHROP GRUMMAN CORPORATION	FLD046771952		5000 U.S. 1 NORTH ST. AUGUSTINE, FL, 32095	YE	YE
NORTHSHORE MINING COMPANY	MND006449649		10 OUTER DRIVE SILVER BAY, MN, 55614	YE	IN
NORTHWEST INDUSTRIES	ORD009020835		125 34TH AVE SW ALBANY, OR, 97322	YE	YE
NORTHWEST PETROCHEMICAL CORP	WAD009624347		9056 N TEXAS RD NW PETRO ANACORTES, WA, 98221	YE	IN
NOVA CHEMICALS INC	MAD981887268		950 WORCESTER ST SPRINGFIELD, MA, 01151	YE	YE
NOVARTIS PHARMACEUTICALS CORPORATION	NJD002147023		59 ROUTE 10 EAST HANOVER, NJ, 07936	YE	YE
NOVEON KALAMA INC	WAD092899574		1296 NW 3RD ST KALAMA, WA, 98625-9799	YE	YE
NOVEON TEXTILE CHEMICAL,INC.	NCD003168168		8309 WILKINSON BLVD. CHARLOTTE, NC, 28214	YE	YE
NRG DEVON STATION	CTD000845248		700 NAUGATUCK AVENUE PO BOX 2218, DEVON, CT, 06460	YE	YE
NRG MIDDLETOWN STATION	CTD000845230		NRG MIDDLETOWN OPERATIONS 1866 RIVER ROAD, MIDDLETOWN, CT, 06457	YE	YE
NRG NORWALK HARBOR OP INC	CTD000845214		MANRESA ISLAND AVENUE SOUTH NORWALK, CT, 06854	YE	YE
NUCLEAR FUEL SERVICES, INC.	TND003095635		1205 BANNER HILL ROAD ERWIN, TN, 37650	YE	YE

NUCLEAR SOURCES AND SERVICES INC	TXD982560294		5709 ETHERIDGE ST HOUSTON, TX, 77087	YE	YE
NWIRP CALVERTON	NYD003995198		GRUMMAN BLVD CALVERTON, NY, 11933	YE	YE
O & G INDUSTRIES INC	CTD001180587		325 HANCOCK AVE BRIDGEPORT, CT, 06605	YE	NO STATUS
OCCIDENTAL CHEMICAL CORP	MID006014906		7601 OLD CHANNEL TRAIL MONTAGUE, MI, 49437	YE	YE
OCCIDENTAL CHEMICAL CORP	WVD005010277		301 W DUPONT AVE BELLE, WV, 25015	YE	YE
OCCIDENTAL CHEMICAL CORP MOBILE PLANT	ALD008163388		1300 JARVIS ROAD MOBILE, AL, 366141099	YE	YE
OCCIDENTAL CHEMICAL CORP MUSCLE SHOALS	ALD004019642		1000 NORTH WILSON DAM ROAD MUSCLE SHOALS, AL, 356611300	YE	YE
OCCIDENTAL CHEMICAL CORP.	DED003913266		1657 RIVER RD NEW CASTLE, DE, 197205194	YE	YE
OCCIDENTAL CHEMICAL CORPORATION	NYD000824482		4700 BUFFALO AVENUE NIAGARA FALLS, NY, 14302	YE	YE
OFFUTT AFB	NE8571924648	US Air Force	106 PEACEKEEPER DR STE 2N3 55 CES/ CEV, OFFUTT AFB, NE, 680113	YE	IN
OLIN CHLOR ALKALI PRODUCTS	TND003337292		1186 LOWER RIVER ROAD NW CHARLESTON, TN, 37310	YE	YE
OLIN CORP	ILD006271696		427 N SHAMROCK ST EAST ALTON, IL, 620241197	YE	YE
OLIN CORP	NYD002123461		2400 BUFFALO AVE NIAGARA FALLS, NY, 143020748	YE	YE
OLIN CORP CHLOR-ALKALI PROD MCINTOSH	ALD008188708		1638 INDUSTRIAL ROAD MCINTOSH, AL, 36553	YE	YE
OLIN CORPORATION	GAD040690737		2402 DOUG BARNARD PARKWAY AUGUSTA, GA, 309062139	YE	YE
OLIN CORPORATION, LAKE CHARLES	LAD008080681		960 I-10 WEST WESTLAKE, LA, 70602	YE	YE
OLIN HUNT SPECIALTY PRODUCTS INC	CAD009552944		4265 CHARTER STREET LOS ANGELES, CA, 90058	YE	IN
OMG AMERICAS INC	PAD014130439		TWO MILE RUN RD FRANKLIN, PA, 16323	YE	IN
OMNIUM	MOD042865816		1417 LOWER LAKE RD ST JOSEPH, MO, 64504	IN	IN
ONYX ENVIRONMENTAL SERVICES LLC	GAD096629282		5371 COOK ROAD MORROW, GA, 30260	YE	YE
ONYX ENVIRONMENTAL SERVICES, L. L. C.	CAD008302903		1704 W FIRST ST AZUSA, CA, 91702	YE	YE
ONYX ZION LANDFILL	ILD980700728		701 GREEN BAY RD ZION, IL, 60099	YE	YE
ORD MILITARY COMMUNITY	CA7210020676	US Army	HAZARDOUS WASTE OFFICE BLDG. 4495, JOE LLOYD WAY, MONTEREY, CA, 93944	NO	NO
OSRAM SYLVANIA INC	PAD980554570		816 LEXINGTON AVE WARREN, PA, 16365	YE	YE
OSRAM SYLVANIA IPRODUCTS NC	PAD003044609		HAWES ST TOWANDA, PA, 18848	YE	YE
OSRAM SYLVANIA PRODUCTS INC	KYD068339217		1000 TYRONE PIKE VERSAILLES, KY, 40383	YE	YE
OSRAM SYLVANIA PRODUCTS INC	PAD003046794		1 JACKSON ST WELLSBORO, PA, 16901	YE	YE
OUTOKUMPU COPPER FRANKLIN INC	KYD062969290		4720 BOWLING GREEN ROAD FRANKLIN, KY, 42134	YE	YE
OUTOKUMPU STAINLESS PIPE AVESTA POLARIT	FLD064675978		1101 NORTH MAIN STREET WILDWOOD, FL, 347859601	YE	YE
OWEN ELECTRIC STEEL COMPANY	SCD003353760		310 NEW STATE RD CAYCE, SC, 29171	YE	YE
OWENS CORNING ANDERSON	SCD003349982		4837 HWY 81 S STARR, SC, 29684	YE	YE
OWENS-CORNING FIBERGLAS CORP	OHD039992516		2790 COLUMBUS ROAD GRANVILLE, OH, 430231200	YE	YE

OXYCHEM CORPORATION	TXD982286932	HIGHWAY 361 3 MI E OF GREGORY, TX, 78359	YE	YE
P & R RAIL CAR SERVICE CORPORATION	MDD078288354	TRINCO INDUSTRIAL PARK ELKTON, MD, 21921	YE	IN
P P G INDUSTRIES CARIBE	PRD000692715	RTE 2 GUAYANILLA, PR, 00656	YE	YE
P R C PATTERSON INC	CAD083166728	13331 N HWY 33 PATTERSON, CA, 95363	YE	IN
PACIFIC FUNCTIONAL FLUIDS LLC	WAD027543032	2244 PORT OF TACOMA RD TACOMA, WA, 98421-3607	YE	YE
PACIFICORP	IDD000602631	2200 LESLIE AVE IDAHO FALLS, ID, 83402	YE	YE
PACSCI QUANTIC L L C	CAD981368392	2751 SAN JUAN RD HOLLISTER, CA, 95023	YE	NO
PARKER SOLVENTS COMPANY, INC.	ARD035565068	8909 MABLEVALE PIKE LITTLE ROCK, AR, 72209	YE	NO STATUS
PASADENA REFINING SYSTEM INC	TXD008091290	111 RED BLUFF RD PASADENA, TX, 77506	YE	YE
PECHINEY PLASTIC PACKAGING INC	IAD001818327	1500 E AURORA AVE DES MOINES, IA, 50313	YE	YE
PECHINEY ROLLED PRODUCTS LLC.	WVD009233297	CENTURY ROAD - SITE A RAVENSWOOD, WV, 26164	YE	YE
PECO ENERGY CO GOULD CHEMCLEAR	PAD000731026	JEFFREY ST & DELAWARE AVE CHESTER, PA, 19013	YE	YE
PENDLETON WOOLEN MILLS	WAD009035502	A ST & 17TH ST WASHOUGAL, WA, 98671	YE	YE
PENNSYLVANIA HOUSE INC	PAD003026762	137 N 10TH ST LEWISBURG, PA, 17837	YE	YE
PENNSYLVANIA TRANSFORMER TECHNOLOGY INC	PAD004339297	30 CURRY AVE CANONSBURG, PA, 15317	YE	IN
PENNZOIL QUAKER STATE CO	PAD004329835	260 ELM ST OIL CREEK, PA, 16301	YE	YE
PENRECO	PAD065626822	138 PETOLIA ST KARNS CITY, PA, 16041	YE	IN
PERMA FIX OF MICHIGAN INC	MID096963194	18550 ALLEN RD BROWNSTOWN TOWNSHIP, MI, 48192	YE	YE
PERMA-FIX ENVIRONMENTAL SERVICES, INC.	TND991279480	901 EAST BODLEY AVENUE MEMPHIS, TN, 38106	YE	YE
PERMA-FIX OF SOUTH GA INC	GAD093380814	1612 JAMES P RODGERS CIRCLE VALDOSTA, GA, 31601	YE	YE
PERMAPOST PRODUCTS COMPANY INC	ORD009041187	4066 SE TUALATIN VALLEY HWY HILLSBORO, OR, 97123-0100	YE	YE
PETRO CHEM SC	SCD044442333	2324 VERNSDALE RD ROCK HILL, SC, 29731	YE	YE
PETROWAX PA INC EMLENTON PLANT	PAD004337127	HILL ST EMLENTON, PA, 16373	YE	YE
PFIZER INC PARKE-DAVIS & CO	MID006013643	188 HOWARD AVE HOLLAND, MI, 49424	YE	YE
PHARMACIA & UPJOHN CARIBE INC	PRD090398074	ROAD NO. 2 KM 60.0 BARCELONETA, PR, 00617	YE	YE
PHARMACIA & UPJOHN CO	CTD000635896	410 SACKETT POINT RD NORTH HAVEN, CT, 06473	YE	YE
PHARMACIA & UPJOHN CO LLC	CTD001168533	41 STILES LANE NORTH HAVEN, CT, 06473	YE	YE
PHARMACIA & UPJOHN COMPANY LLC	MID000820381	7171 PORTAGE RD KALAMAZOO, MI, 49001	YE	YE
PHIBRO TECH INC	SCD070371885	2395 CAINS MILL RD SUMTER, SC, 29151	YE	YE
PHIBRO-TECH INC	ILD062480850	10 INDUSTRY AVE JOLIET, IL, 60435	YE	YE
PHIBRO-TECH, INC.	CAD008488025	8851 DICE ROAD SANTE FE SPRINGS, CA, 90670	YE	NO
PHILIPS DISPLAY COMPONENTS	NYD002246015	JOHNSTON ST SENECA FALLS, NY, 13148	YE	YE
PHILIPS LIGHTING COMPANY	KYD006395644	320 VAKSDAHL AVE DANVILLE, KY, 40422	YE	NO

PHILIPS SEMICONDUCTORS	CAD070466479		811 E ARQUES AVE MAIL STOP 39 SUNNYVALE, CA, 940883409	YE	YE
PHILLIPS PETROLEUM COMPANY	TXD091263558		300 W 6TH ST BORGER, TX, 79008	YE	YE
PHILLIPS PETROLEUM KC	KSD007162100		2029 FAIRFAX TRFWY KANSAS CITY, KS, 66115	YE	YE
PHOENIX GROUP/RAYMARK	PAD003015328		123 E STIEGEL ST MANHEIM, PA, 17545	YE	IN
PIERCE BIOTECHNOLOGY INC	ILD041539230		3747 N MERIDIAN RD ROCKFORD, IL, 61105	YE	YE
PINE BLUFF ARSENAL	AR0213820707	US Army	10020 KABRICH CIRCLE PINE BLUFF, AR, 71602	YE	YE
PINE HILLS RD LANDFILL	FLD984178095		SEC 6 TOWN 22 RANGE 29 ORLANDO, FL, 328090	YE	NO
PINE-BELT WOOD PRESERVING COMPANY	MSD991277195		HIGHWAY 15 SOUTH, I-59 LAUREL, MS, 39440	YE	YE
PINEWOOD SITE PS	SCD070375985		8430 CAMP MCBOYKIN ROAD RIMINI, SC, 29131	YE	YE
PIONEER AMERICAS LLC	WAD009242314		605 ALEXANDER AVE TACOMA, WA, 98421-4209	YE	NO
PITTSBURG POWER PLANT	CAT080011695		696 WEST TENTH STREET PITTSBURG, CA, 94565	YE	YE
PLAINVILLE PLATING CO INC	CTD001149459		21 FORESTVILLE AVENUE PLAINVILLE, CT, 06062	YE	NO
PLM PROPERTIES LLC	OHD097537609		2941 BAKER RD SPRINGFIELD, OH, 45504	YE	YE
POINT LOMA COMPLEX NAVAL SUBMARINE BASE	CA1170090020	US Navy	140 SYLVESTER RD BLDG 375 SAN DIEGO, CA, 92106	YE	YE
POLYONE CORPORATION	NJD043973122		1804 RIVER RD BURLINGTON, NJ, 08016	YE	YE
POST & LUMBER PRESERVING CO INC	FLD004061925		SR 12 AND POST PLANT RD QUINCY, FL, 323510	YE	YE
POWER ENGINEERING COMPANY	COD007060999		2525 S DELAWARE ST DENVER, CO, 802234400	YE	YE
POWER SEMICONDUCTORS INC	CTD002593416		90 MUNSON ST MILFORD, CT, 06460	NO	NO
PPG IND INC	PAD000650366		151 COLFAX ST SPRINGDALE, PA, 15144	YE	YE
PPG IND INC	PAD004336319		125 COLFAX ST SPRINGDALE, PA, 15144	YE	YE
PPG INDUSTRIES INC	LAD008086506		1300 PPG DR LAKE CHARLES, LA, 70601	YE	YE
PPG INDUSTRIES INC	OHD004198917		4829 FAIRLAND ROAD BARBERTON, OH, 442033913	YE	IN
PPG INDUSTRIES INC	WID059972935		10800 S 13TH ST OAK CREEK, WI, 53154	YE	YE
PPG INDUSTRIES NO 5 INCINERATOR	LAD981514441		1300 COLUMBIA SO RD WESTLAKE, LA, 70669	YE	YE
PPG INDUSTRIES OHIO INC	OHD004304689		559 PITTSBURGH ROAD CIRCLEVILLE, OH, 43113	YE	NO STATUS
PPG INDUSTRIES, INC.	WVD004336343		SR 2, MARSHALL COUNTY (SOUTH) NEW MARTINSVILLE, WV, 26155	YE	YE
PPL MARTINS CREEK SES	PAD987393212		6605 FOUL RIFT RD BANGOR, PA, 180134857	YE	YE
PRATT & WHITNEY	CTD000844399		COLT STREET EAST HARTFORD, CT, 06108	YE	YE
PRATT & WHITNEY	CTD990672081		400 MAIN STREET EAST HARTFORD, CT, 06108	YE	NO STATUS
PRATT & WHITNEY AIRCRAFT DIV U T C	CTD001449511		415 WASHINGTON AVE NORTH HAVEN, CT, 06473	YE	YE
PRATT & WHITNEY CPD	CTD000844332		45 NEWELL ST SOUTHINGTON, CT, 06489	YE	IN
PRATT & WHITNEY ROCKY HILL	CTD000844407		60 BELAMOSE AVE ROCKY HILL, CT, 06067	YE	YE

PRECISION FABRICATING & CLEANING CO. INC	FLD981471121		3975 EAST RAILROAD AVENUE COCOA, FL, 32926	YE	YE
PRIDE REFINING INC	TXD005964598		1209 N 4TH ST ABILENE, TX, 79601	YE	YE
PRIDE SOLVENTS & CHEMICAL CO INC	NYD057722258		88 LAMAR ST WEST BABYLON, NY, 11704	NO STATUS	NO STATUS
PROCTER & GAMBLE PAPER PRODUCTS CO	PAD014391874		OFF ROUTE 87 MEHOOPANY, PA, 18629	YE	YE
PRODUCTION ANODIZING CORPORATION	GAD003308335		INDUSTRIAL PARK ADEL, GA, 31620	YE	YE
PRODUCTION PLATED PLASTICS INC	MID047153077		9899 EAST D AVE RICHLAND, MI, 49083	YE	YE
PROTEX INDUSTRIES INC	COD007091200		1331 W EVANS AVE DENVER, CO, 80223	YE	YE
PRYM WILLIAM INC	CTD001140920		HARTFORD PIKE DAYVILLE, CT, 06241	YE	YE
PTO-UCC-DOW	WVD000739722		31350 1ST AVE. S. NITRO, WV, 25143	YE	YE
PUEBLO CHEMICAL DEPOT	CO8213820725	US Army	45825 HWY 96 E PUEBLO, CO, 810069330	NO	YE
PURDUE UNIVERSITY	IND072051394		201 AHLERS DR WEST LAFAYETTE, IN, 47906	YE	YE
PUTNAM TOWN OF MUNICIPAL LANDFILL	CTD991288622		RIVER RD PUTNAM, CT, 06260	YE	YE
QUAKER STATE OIL REFINERY	WVD057634776		1 MILE S ST RT 2 NEWELL, WV, 26050	YE	IN
QUALITY TECHNOLOGIES CORP.	CAD095984167		3400 HILLVIEW AVE PALO ALTO, CA, 94304	YE	YE
QUEBECOR WORLD ATGLEN INC	PAD051397768		4581 LOWER VALLEY RD ATGLEN, PA, 19310	YE	YE
QUEMETCO INC	IND000199653		7870 W MORRIS ST INDIANAPOLIS, IN, 46231	YE	YE
QUEMETCO, INC.	CAD066233966		720 S. 7TH AVENUE CITY OF INDUSTRY, CA, 91746	YE	YE
R AND D CHEMICAL CO	OHD080930050		TWP RD 235 MANSFIELD, OH, 44904	YE	YE
R V HOPKINS INC	IAD022096028		743 SCHMIDT RD DAVENPORT, IA, 52802	YE	YE
RADIATOR SPECIALTY COMPANY	NCD091245969		600 RADIATOR ROAD INDIAN TRAIL, NC, 28079	YE	YE
RADIO MATERIALS CORP	IND005477021		1095 E SUMMIT ATTICA, IN, 47918	YE	NO STATUS
RAILWAY MAINT PRODUCTS DIV	PAD004336814		900 FREEPORT ROAD ASPINWALL, PA, 15215	YE	YE
RAMP INDUSTRIES INC	COD980718985		1127 W 46TH AVE DENVER, CO, 802112302	YE	YE
RAYBESTOS PRODUCTS CO	IND006061477		1204 DARLINGTON AVE CRAWFORDSVILLE, IN, 47933	YE	NO STATUS
RAYTHEON AIRCRAFT COMPANY	COD007068646		6859 N FOOTHILLS HWY BOULDER, CO, 80302	YE	NO
RAYTHEON CO. - USAF PLANT 44	AZD009005422	US Air Force	1151 EAST HERMANS ROAD TUCSON, AZ, 85706	YE	YE
RAYTHEON COMPANY	TXD982759706		6410 US HIGHWAY 75 S SHERMAN, TX, 75090	YE	IN
RAYTHEON EW OPERATIONS	CAD001425206		6380 HOLLISTER AVENUE GOLETA, CA, 93117	YE	YE
RAYTHEON SYSTEMS CO	CAD057468944		500 SUPERIOR AVE NEWPORT BEACH, CA, 92663	YE	NO
RCL WIRING LP	MOD095046306		601 S MARSHALL SEDALIA, MO, 65301	YE	YE
REA MAGNET WIRE CO	IND004320032		3600 E PONTIAC ST FT WAYNE, IN, 46803	YE	YE
REALCO INC	NYD060545209		LINCOLN AVE - PO BOX 212 WATERVLIET, NY, 121890212	YE	YE
RECLAIMERS INC	IND984894527		6928 N 400 E BLDG 102 KENDALLVILLE, IN, 46755	YE	YE
REFINED METALS CORP	IND000718130		3700 S ARLINGTON AVE INDIANAPOLIS, IN, 46203	YE	YE

REFINED METALS CORPORATION	TND067690040		257 WEST MALLORY AVENUE MEMPHIS, TN, 38109	YE	YE
REICHHOLD INC	MID020087128		601 WOODWARD HTS BLVD FERNDALE, MI, 48220	YE	YE
REICHHOLD INC TACOMA	WAD009252891		3320 LINCOLN AVE TACOMA, WA, 98421	YE	YE
REICHHOLD, INC.	MSD001661719		11015 REICHHOLD ROAD GULFPORT, MS, 39506	YE	YE
REILLY INDUSTRIES, INC.	UTD009087644		2555 SOUTH INDUSTRIAL PARKWAY PROVO, UT, 84605	YE	IN
RELIABLE ELECTRO PLATING INC	MAD001209121		304 WEST MAIN ST NORTON, MA, 02712	YE	YE
RELIANCE TECHNICAL SVCS	CAD001938828		895 KIFER RD SUNNYVALE, CA, 94086	YE	YE
REMELT METALS INC	COD040708455		2350 S RARITAN ENGLEWOOD, CO, 801101073	YE	YE
REMINGTON ARMS CO INC	AR0000064311		2592 HWY AR 15 N (RACI) LONOKE, AR, 720869503	YE	YE
RENTOKIL INITIAL ENV SERVICES INC	ALD021257951		10565 HIGHWAY 43 N CREOLA, AL, 365254550	YE	YE
REPUBLIC ENVIRONMENTAL SYS OF PA	PAD085690592		2869 SANDSTONE DR HATFIELD, PA, 19440	YE	YE
REPUBLIC ENVIRONMENTAL SYSTEMS	OHD055522429		33 INDUSTRY DR SITE A, BEDFORD, OH, 44146	YE	IN
REPUBLIC TECHNOLOGIES INTERNATIONAL	OHD004228003		2633 8TH ST NE CANTON, OH, 44704	NO STATUS	NO STATUS
RESERVE ENVIRONMENTAL SERVICES INC	OHD980793384		4633 MIDDLE ROAD ASHTABULA, OH, 44004	YE	IN
RESOLUTION SPECIALTY MATERIALS LLC	CAD076180843		2801 LYNWOOD RD LYNWOOD, CA, 90262	YE	YE
RESOURCE RECOVERY OF AMERICA	FLD980602734		2300 US HWY 60 W MULBERRY, FL, 338600	YE	NO
REVERE SMELTING & REFINING CORPORATION	NYD030485288		65 BALLARD ROAD MIDDLETOWN, NY, 10941	YE	NO STATUS
REVLON CONSUMER PRODUCTS CORP.	NJD002520542		2121 ROUTE 27 EDISON, NJ, 08818	YE	YE
REYNOLDS METALS CO.	NYD002245967		194 COUNTY ROUTE 45 MASSENA, NY, 13662	YE	YE
REYNOLDS METALS COMPANY	ARD006354161		500 E REYNOLDS ROAD ARKADELPHIA, AR, 71923	YE	YE
RHO-CHEM CORP	CAD008364432		425 ISIS AVENUE INGLEWOOD, CA, 90301	NO	NO
RHODIA INC	IND001859032		2000 MICHIGAN ST HAMMOND, IN, 46320	YE	YE
RHODIA INC	WAD009282302		9229 E MARGINAL WY S RHODIA SEATTLE, WA, 98108	NO	YE
RHODIA INC	SCD003358389		2151 KING ST EXTENSION CHARLESTON, SC, 29415	YE	YE
RHODIA INC	PAD002336410		2300 S PENNSYLVANIA AVE MORRISVILLE, PA, 19067	YE	IN
RHODIA INC.	CAD053049490		100 MOCOCO ROAD MARTINEZ, CA, 94553	YE	YE
RICHLAND COUNTY LANDFILL	OHD000384248		CAIRNS RD OFF N MAIN & BOWMAN MANSFIELD, OH, 44903	YE	NO STATUS
RISDON AMS CORP	CTD001168558		15 OLD NEWTOWN ROAD DANBURY, CT, 06810	YE	NO
RIVER CEMENT CO SELMA PLANT	MOD050232560		1000 RIVER CEMENT RD SELMA PLANT, FESTUS, MO, 63028	YE	YE
RIVER RECYCLING INDUSTRIES INC	OHD004187035		4195 BRADLEY RD CLEVELAND, OH, 44109	YE	YE
RIVERBANK ARMY AMMUNITION PLANT	CA7210020759	US Army	5300 CLAUS ROAD RIVERBANK, CA, 95367	YE	YE
RMI TITANIUM CO SODIUM PLT	OHD000810242		600 E STATE RD ASHTABULA, OH, 44004	YE	YE
RMI TITANIUM COMPANY EXTRUSION PLANT	OHD980683544		1601 E 21ST ST ASHTABULA, OH, 44004	YE	YE
ROANOKE ELECTRIC STEEL CORPORATION	VAD003122553		102 WESTSIDE BOULEVARD, N. W. ROANOKE, VA, 24017	YE	IN

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

ROBINS AIR FORCE BASE	GA1570024330	US Air Force	455 BYRON STREET, SUITE 465 ROBINS AFB, GA, 31098	YE	YE
ROCKFORD POWER MACHINERY	ILD001756675		2401 11TH ST ROCKFORD, IL, 611047289	YE	YE
ROCKWOOL PLANT - PUEBLO	COD073405961		600 OLD SMELTER RD PUEBLO, CO, 810033341	YE	YE
ROCKY FLATS ENV TECH SITE-US DOE	CO7890010526	Dept. of Energy	10808 HWY 93 16 MILES NW OF DENVE R, GOLDEN, CO, 804038200	YE	YE
ROCKY MOUNTAIN ARSENAL - ARMY	CO5210020769	US Army	U S ARMY- 72ND AVE & QUEBEC ST COMMERCE CITY, CO, 80022	YE	YE
ROCKY MOUNTAIN STEEL MILLS	COD007057961		2100 S FREEWAY PUEBLO, CO, 81004	YE	YE
ROEBUCK DISPOSAL LLC	SCD981467616		301 RAILROAD STREET ROEBUCK, SC, 29376	YE	YE
ROGER CORP ELASTOMER COMPONENT	CTD018884833		730 WINDHAM ROAD SOUTH WINDHAM, CT, 06266	YE	YE
ROGERS CORP	CTD001141167		1 TECHNOLOGY DR ROGERS, CT, 06263	YE	YE
ROGERS DELINTED COTTONSEED CO	TXD980873160		US HIGHWAY 77 ROBSTOWN, TX, 78380	YE	IN
ROGERS PETRO CHEM INC	MND086113826		1MI FROM JCT MN HWY 4 & HWY 12 GROVE CITY, MN, 56243	YE	IN
ROHM & HAAS CO	PAD077883346		5000 RICHMOND ST PHILADELPHIA, PA, 19137	YE	NO STATUS
ROHM & HAAS CO SPRING HOUSE TECH CENTER	PAD075485995		727 NORRISTOWN RD SPRING HOUSE, PA, 19477	YE	YE
ROHM &HAAS CO	PAD002292068		200 RTE 413 BRISTOL, PA, 19007	YE	IN
ROHM AND HAAS CHEMICALS LLC	OHD000724138		2000 WEST ST CINCINNATI, OH, 45215	YE	YE
ROHM AND HAAS CHEMICALS LLC	OHD045566098		10 S ELECTRIC ST WEST ALEXANDRIA, OH, 45381	YE	YE
ROHM AND HAAS COMPANY	TND058660390		730 DALE AVENUE KNOXVILLE, TN, 37921	YE	YE
ROHM AND HAAS TEXAS INC	TXD065096273		1900 TIDAL RD DEER PARK, TX, 77536	YE	YE
ROLLS-ROYCE CORP	IND000806836		2355 S TIBBS AVE INDIANAPOLIS, IN, 46241	YE	YE
ROMIC ENVIRONMENTAL TECHNOLOGIES CORP.	CAD009452657		2081 BAY ROAD EAST PALO ALTO, CA, 94303	YE	NO
ROSEDALE LANSCAPE DEPOT	MDD981041601		8355 PULASKI HWY ROSEDALE, MD, 21237	YE	YE
ROSS INCINERATION SERVICES, INC.	OHD048415665		36790 GILES ROAD GRAFTON, OH, 440449586	YE	YE
ROY METAL FINISHING CO INC	SCD003341849		112 CONESTEE RD CONESTEE, SC, 29636	YE	YE
RUTHERFORD CHEMICALS LLC	NYD002014595		41 ARDEN HOUSE ROAD HARRIMAN, NY, 10926	YE	YE
S C M CORP-QUARANTINE SITE	MDD990759532		5901 QUARANTINE RD BALTIMORE, MD, 21226	YE	YE
S.D. WARREN COMPANY	MED042141408		89 CUMBERLAND STREET WESTBROOK, ME, 040981597	YE	YE
SAFETY KLEEN CORP 2-058-011	MDD000737395		12164 TECH RD SILVER SPRING, MD, 20904	YE	YE
SAFETY KLEEN CORP 2-180-01	PAD084872043		98 SECOND ST WILKES-BARRE, PA, 18705	YE	YE
SAFETY KLEEN CORPORATION 7-148	ORD092895481		11843 SE HWY 212 CLACKAMAS, OR, 97015	YE	YE
SAFETY KLEEN SYSTEMS CORP	CTD001156009		39 COMMUNITY AVE EXT PLAINFIELD, CT, 06374	YE	YE
SAFETY KLEEN SYSTEMS INC	CTD000845982		24 BRIXTON STREET WEST HARTFORD, CT, 06110	YE	YE
SAFETY KLEEN SYSTEMS INC	CTD980667927		11 TIPPING DR LOT 4 BRANFORD, CT, 06405	YE	YE

SAFETY KLEEN SYSTEMS INC	WID000668822	CORNER WAUKESHON & ELIZABETH SHAWANO, WI, 54166	YE	YE
SAFETY KLEEN SYSTEMS INC	VAD981043011	1200 W 100 ROAD CHESTER, VA, 23836	YE	YE
SAFETY KLEEN SYSTEMS INC	MID981000359	700 ZIMMERMAN RD MASON, MI, 48854	YE	YE
SAFETY KLEEN SYSTEMS INC LEXINGTON	SCD077995488	130A FRONTAGE RD LEXINGTON, SC, 29072	YE	YE
SAFETY-KLEEN CORP	ILD000805929	306 CAMPUS DR ARLINGTON HEIGHTS, IL, 60004	YE	YE
SAFETY-KLEEN CORP 1-183-08 OB	IDD000712026	514 E 45TH ST GARDEN CITY, ID, 83714	YE	YE
SAFETY-KLEEN CORP 1-183-28 POC	IDD991281270	2610 GARRETT WY POCATELLO, ID, 83201	YE	YE
SAFETY-KLEEN CORP 3-013-01 HAPEVILLE	GAD000823070	3440 LANG AVE HAPEVILLE, GA, 30354	YE	YE
SAFETY-KLEEN CORP 5-065-01	NED000687186	5150 S ELK DRIVE GRAND ISLAND, NE, 68803	YE	YE
SAFETY-KLEEN CORP CONGERS 2-118-01	NYD000708164	68 N HARRISON AVE CONGERS, NY, 109201946	YE	YE
SAFETY-KLEEN CORP. (4-075-01C1)	KYD000776724	1592 WOLOHAN DRIVE ASHLAND, KY, 41101	YE	YE
SAFETY-KLEEN CORPORATION-GURLEY	ALD000776807	201 SECTION LINE ST GURLEY, AL, 35748	YE	YE
SAFETY-KLEEN ENVIROSYSTEMS CO.	NJD002153922	600 DOREMUS AVENUE NEWARK, NJ, 07105	YE	YE
SAFETY-KLEEN OIL RECOVERY CO	IND077042034	601 RILEY RD EAST CHICAGO, IN, 46312	YE	YE
SAFETY-KLEEN SSYSTEM, INC.	CAD093459485	1000 S. I STREET REEDLEY, CA, 93654	YE	YE
SAFETY-KLEEN SYSTEMS INC	CAT000613893	10625 HICKSON ST UNIT A EL MONTE, CA, 91731	YE	YE
SAFETY-KLEEN SYSTEMS INC	CAT000613943	5750 COMMERCE BLVD ROHNERT PARK, CA, 94928	YE	YE
SAFETY-KLEEN SYSTEMS INC	CAT000613976	2120 SOUTH YALE SANTA ANA, CA, 92704	YE	YE
SAFETY-KLEEN SYSTEMS INC	GAD000776781	5217 AUGUST RD GARDEN CITY, GA, 31408	YE	YE
SAFETY-KLEEN SYSTEMS INC	ILD000805911	1500 E VILLA ST ELGIN, IL, 601208110	YE	YE
SAFETY-KLEEN SYSTEMS INC	KYD053348108	3700 LAGRANGE RD SMITHFIELD, KY, 40068	YE	YE
SAFETY-KLEEN SYSTEMS INC	MAD096287354	224 E MAIN ST WEST BROOKFIELD, MA, 01585	YE	YE
SAFETY-KLEEN SYSTEMS INC	MOD000669069	734 NW BYPASS 66 SPRINGFIELD, MO, 65802	YE	YE
SAFETY-KLEEN SYSTEMS INC	VTD000791699	23 WEST SECOND ST BARRE, VT, 05641	YE	YE
SAFETY-KLEEN SYSTEMS INC	PAD987266673	INDUSTRIAL PK RD, PO BOX 229 ATHENS, PA, 18810	YE	YE
SAFETY-KLEEN SYSTEMS INC	PAD086673407	1606 PITTSBURGH AVE ERIE, PA, 16505	YE	YE
SAFETY-KLEEN SYSTEMS INC	ILD093862811	14249 VFW RD PEKIN, IL, 61554	YE	YE
SAFETY-KLEEN SYSTEMS INC	GAD980842777	4800 S OLD PEACHTREE RD NORCROSS, GA, 30071	YE	YE
SAFETY-KLEEN SYSTEMS INC - MADISON	WID980896633	2325 DANIELS ST MADISON, WI, 53718	YE	YE
SAFETY-KLEEN SYSTEMS INC LA CROSSE	WID980896641	2109 WARD AVE LA CROSSE, WI, 54601	YE	YE
SAFETY-KLEEN SYSTEMS INC WAUKESHA	WID981097769	2200 S WEST AVE WAUKESHA, WI, 53189	YE	YE
SAFETY-KLEEN SYSTEMS INC.	OHD980587364	581 MILLIKEN DRIVE S.E. HEBRON, OH, 430259687	YE	YE
SAFETY-KLEEN SYSTEMS, INC.	MND000686170	1302 18TH STREET CLOQUET, MN, 55720	YE	YE
SAFETY-KLEEN SYSTEMS, INC.	NJD002182897	1200 SYLVAN STREET LINDEN, NJ, 07036	YE	NO STATUS
SAFT AMERICA, INC	GAD063152573	711 GIL HARBIN INDUSTRIAL BLVD VALDOSTA, GA, 31601	YE	YE

SALTIRE INDUSTRIAL INC	TND002591311		SCHRADER LANE DICKSON, TN, 37055	YE	YE
SANDERS LEAD COMPANY INC	ALD046481032		1 SANDERS ROAD TROY, AL, 36079	YE	YE
SANDIA NATIONAL LAB FOR THE U.S. D.O.E.	NM5890110518	Dept. of Energy	1515 EUBANK BLVD. SE ORG. 3124 / MS1117, ALBUQUERQUE, NM, 87106	YE	IN
SANITARY DASH MFG CO INC	CTD001153840		929 RIVERSIDE DR NORTH GROSVENORDALE, CT, 06255	YE	YE
SARTOMER CO INC	PAD042259374		610 S BOLMAR ST WEST CHESTER, PA, 19382	YE	YE
SC JOHNSON & SON INC (WAXDALE)	WID006091425		8311 16TH ST SITE A STURTEVANT, WI, 531771964	YE	YE
SCHENECTADY INTERNATIONAL INC	NYD002070100		CONGRESS ST SCHENECTADY, NY, 12303	YE	YE
SCHENECTADY INTERNATIONAL INC	NYD002070118		MAIN ST ROTTERDAM JUNCTION, NY, 12150	YE	YE
SCHERING CORPORATION - UNION	NJD001317601		1011 MORRIS AVENUE MAILSTOP U-13-1-19, UNION, NJ, 07083	YE	YE
SCHICK MFG INC	CTD052704335		10 LEIGHT ROAD MILFORD, CT, 06460	YE	IN
SCHRADER-BRIDGEPORT INTERNATIONAL, INC.	VAD082881970		205 FRAZIER ROAD ALTAVISTA, VA, 24517	YE	YE
SCOTTS COMPANY THE	OHD990834483		14111 SCOTTSLAWN ROAD MARYSVILLE, OH, 43041	YE	YE
SCOVILL FASTENERS INC.	GAD003480530		1802 SCOVILL DRIVE CLARKESVILLE, GA, 30523	YE	YE
SDI MANAGEMENT COMPANY	MED001096791		291 NORTH STREET SUITE 2 SACO, ME, 040720890	YE	YE
SEABOARD LUMBER	DED057123648		RT 18 WEST BRIDGEVILLE, DE, 19933	YE	YE
SEAGATE TECHNOLOGY (FORMERLY IMPRIMIS)	NED072901945		11615 I ST OMAHA, NE, 68137	YE	YE
SEAMAN TIMBER COMPANY INC	ALD034046730		1051 HWY 25 SOUTH MONTEVALLO, AL, 35115	YE	YE
SEASIDE PARK LANDFILL	CTD000651927		SEASIDE PARK BARNUM BLVD BRIDGEPORT, CT, 06604	YE	YE
SEASON ALL INDUSTRIES INC	PAD008964868		RTE 119 S AT INDIANA, PA, 15701	YE	NO STATUS
SECHAN LIMESTONE INDS INC	PAD002860377		2925 NEW CASTLE RD PORTERSVILLE, PA, 16051	YE	YE
SECO PRODUCTS	MOD068549492		OLD HWY 100 E WASHINGTON, MO, 63090	YE	YE
SEEKONK MFG CO INC	MAD001202258		PERRIN AVE SEEKONK, MA, 02771	YE	YE
SENSIENT COLORS INC	PAD002917466		2529 MAIN ST BIRDSBORO, PA, 19508	YE	YE
SEVERSTAL NORTH AMERICA INC	MID087738431		3001 MILLER RD DEARBORN, MI, 48120	YE	YE
SHELL CHEMICAL YABUCOA, INC.	PRD090074071		ROUTE 901, KM 2.7 CAMINO NUEVO, YABUCOA, PR, 00767	YE	YE
SHELL OIL COMPANY	TXD067285973		5900 HIGHWAY 225 DEER PARK, TX, 77536	YE	YE
SHELL OIL PRODUCTS US - CARSON TERMINAL	CAD066676123		20945 SOUTH WILMINGTON AVENUE CARSON, CA, 90810	YE	NO
SHELL OIL PRODUCTS US, MARTINEZ REFINERY	CAD009164021		3485 PACHECO BOULEVARD MARTINEZ, CA, 94553	YE	YE
SHELL OPUS PUGET SOUND REFINERY	WAD009276197		8505 S TEXAS RD ANACORTES, WA, 98221-9643	YE	YE
SHENANGO INC	PAD004337465		200 NEVILLE RD PITTSBURGH, PA, 15225	YE	IN
SHERWIN WILLIAMS CO	ILD005456439		11541 S CHAMPLAIN AVE CHICAGO, IL, 60628	YE	YE

SHERWIN WILLIAMS CO	KSD007163355		1700 W 4TH COFFEYVILLE, KS, 67337	YE	YE
SIBLEY CO	CTD001442417		95 BRIDGE ST HADDAM, CT, 064380068	YE	NO
SIEMENS ENERGY & AUTOMATION INC	SCD078065117		1320 OLD GEORGIA RD ROEBUCK, SC, 29376	YE	NO
SIERRA ARMY DEPOT	CA5210020843	US Army	COUNTY RD A-76 HERLONG, CA, 961135171	YE	YE
SIGNAL ENERGY HOLDINGS CORPORATION	GAD051011344		7982 HUEY RD DOUGLASVILLE, GA, 30134	YE	YE
SIKORSKY AIRCRAFT CORP	CTD001449735		1210 SOUTH AVE BRIDGEPORT, CT, 06604	YE	YE
SIKORSKY AIRCRAFT CORP	CTD001449784		6900 MAIN STREET PO BOX 9729 STRATFORD, CT, 066159129	YE	YE
SIMMONDS PRECISION CO - OPERATIVE IND	NJD096873500		100 OAKDALE RD CHESTER, NJ, 079302221	NO STATUS	NO STATUS
SINCLAIR KANSAS CITY TERMINAL	KSD091347898		3401 FAIRBANKS AVE KANSAS CITY, KS, 66106	YE	YE
SINCLAIR OIL CORP - CASPER REFINERY	WYD048743009		5700 EAST HIGHWAY 20/26 CASPER, WY, 82609	YE	YE
SINCLAIR OIL CORPORATION	WYD079959185		100 E. LINCOLN HWY SINCLAIR, WY, 82334	YE	YE
SINCLAIR OIL CORPORATION-TULSA REFINERY	OKD990750960		902 WEST 25TH STREET TULSA, OK, 74107	YE	YE
SINGER FURNITURE CO PLT 33 & 4	NCD000604322		904 VIRGINIA ST SW LENOIR, NC, 28645	YE	IN
SKF USA INC	PAD004344172		1000 LOGAN BLVD ALTOONA, PA, 166024096	YE	IN
SLOSS INDUSTRIES CORPORATION	ALD000828848		3500 35TH AVENUE NORTH BIRMINGHAM, AL, 352072918	YE	NO
SMR TECHNOLOGIES INC	WVD980555395		93 NETTIE FENWICK ROAD FENWICK, WV, 26202	YE	YE
SMURFIT STONE CONTAINER CORP	FLD982080129		1 EVERETT AVE PANAMA CITY, FL, 324020	YE	YE
SO-GREEN CORP	GAD991275124		HIGHLAND AVE TIFTON, GA, 31794	YE	YE
SOLAR TURBINES - KEARNY MESA FACILITY	CAT000626549		4200 RUFFIN ROAD SAN DIEGO, CA, 92123	YE	IN
SOLITE CORPORATION	VAD042755082		RTE 652 ARVONIA, VA, 23004	YE	IN
SOLUTIA INC	ALD004019048		702 CLYDESDALE AVENUE ANNISTON, AL, 36201	NO	YE
SOLUTIA INC	FLD071951966		3000 OLD CHEMSTRAND RD US HWY CANTONMENT, FL, 325600	YE	YE
SOLUTIA INC	TXD001700806		MORTESEN & FM 2917 ALVIN, TX, 77512	YE	YE
SOLUTIA INC	MAD001114818		730 WORCESTER ST SPRINGFIELD, MA, 011511089	YE	YE
SOLUTIA INC QUEENY PLANT	MOD004954111		201 RUSSELL BLVD ST LOUIS, MO, 63104	YE	YE
SOLUTIA INC WG KRUMMRICH PLANT	ILD000802702		500 MONSANTO AVE SAUGET, IL, 622061198	YE	YE
SOLUTIA INC.	NJD001700707		P.O. BOX 309 ROUTE 130 SOUTH, BRIDGEPORT, NJ, 08014	YE	YE
SOLUTIA NITRO SITE	WVD039990965		1 MONSANTO ROAD NITRO, WV, 25143	YE	IN
SOLVAY ADVANCED POLYMERS LLC	OHD981529688		17005 ST RTE 7 MARIETTA, OH, 45750	YE	YE
SOLVAY SOLEXIS, INC.	NJD980753875		10 LEONARD LANE THOROFARE, NJ, 08086	YE	NO STATUS
SOLVENT RECOVERY CORP	MOD000610766		716 MULBERRY ST KANSAS CITY, MO, 64101	YE	YE
SOLVENTS AND PETROLEUM SERVICE INC	NYD013277454		BREWERTON RD SYRACUSE, NY, 13208	YE	YE
SOMERS INDUSTRIAL FINISHING CORP	CTD062202791		19 FIELD RD SOMERS, CT, 06071	YE	NO

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

SOMERSET REFINERY INC., THE	KYD089227227	501 REFINERY RD SOMERSET, KY, 42502	YE	YE
SOUTH CAMPUS	FLR000049718	9751 UNIVERSAL BLVD ORLANDO, FL, 32819	YE	NO
SOUTHDOWN INC	CTD980515290	0 CROSS ST BRISTOL, CT, 06010	YE	YE
SOUTHERN WOOD PIEDMONT CO,	GAD067560870	1745 CONNALLY DR EAST POINT, GA, 30344	YE	YE
SOUTHERN WOOD PIEDMONT CO.	GAD051034387	1650 NIXON RD AUGUSTA, GA, 30906	YE	YE
SOUTHERN WOOD PIEDMONT COMPANY	SCD049690001	591 SPRINGFIELD RD SPARTANBURG, SC, 29304	YE	YE
SOUTHERN WOOD PIEDMONT COMPANY	TND003327400	400 WEST 33RD STREET CHATTANOOGA, TN, 37410	YE	YE
SOUTHINGTON MANUFACTURING FAC	CTD001149277	AIRCRAFT RD SOUTHINGTON, CT, 06489	YE	IN
SOUTHINGTON TOWN LANDFILL	CTD000844308	DEPAOLO DR SOUTHINGTON, CT, 06489	YE	IN
SOUTHLAND CORP	NJD092225721	ALPHANO RD GREAT MEADOWS, NJ, 07838	YE	YE
SOUTHWIRE COPPER DIVISION	GAD000814541	372 CENTRAL HIGH RD CARROLLTON, GA, 30117	YE	YE
SOUTHWIRE STRIPLING CHAPEL RD	GAR000000901	1825 STRIPLING CHAPEL RD CARROLLTON, GA, 30116	YE	YE
SPARTECH TOWNSEND	IAD005277231	4400 VANDALIA RD PLEASANT HILL, IA, 50327	YE	YE
SPARTON TECHNOLOGIES	NMD083212332	9621 COORS NW ALBUQUERQUE, NM, 87114	YE	YE
SPECIFICATIONS PLATING INC	CTD001174580	740 SEAVIEW AVE BRIDGEPORT, CT, 06607	IN	IN
SPECTRUM CONTROL INC	PAD990823858	1593 S MT JOY ST ELIZABETHTOWN, PA, 17022	YE	YE
SPIROL INTERNATIONAL CORP	CTD001140862	30 ROCK AVENUE DANIELSON, CT, 06239	YE	NA
SPORTING GOODS PROPERTIES INC	CTD001453216	615 ASYLUM ST BRIDGEPORT, CT, 06610	YE	YE
SPRING GROVE RESOURCE RECOVERY INC	OHD000816629	4879 SPRING GROVE AVE CINCINNATI, OH, 45232	YE	NO STATUS
SPS TECHNOLOGIES LLC	PAD000000554	HIGHLAND AVE JENKINTOWN, PA, 19046	YE	YE
SQUARE D CO	NJD986579449	90 US HWY 130 PLANT 1, BORDENTOWN, NJ, 08505	YE	YE
SQUARE D COMPANY	CAD050746775	1060 E THIRD ST BEAUMONT, CA, 92223	YE	YE
SQUARE D COMPANY	NCD067203752	8001 HWY. 64 EAST KNIGHTDALE, NC, 27545	YE	YE
ST CHARLES METAL FINISHING CO	MOD041881699	1300 OLIVE ST ST CHARLES, MO, 633010822	YE	YE
ST MARKS POWDER INC	FLD047096524	US HWY 98 & SR 363 ST MARKS, FL, 32355222	YE	YE
ST MARYS CEMENT	MID094553419	9333 DEARBORN ST DETROIT, MI, 48209	YE	YE
ST. MARYS REFINING COMPANY, INC.	WVD004337135	201 BARKWILL STREET SAINT MARYS, WV, 26170	YE	YE
STACKPOLE CORP	PAD063652820	201 STACKPOLE ST BLDG 100 ST MARYS, PA, 15857	YE	NO STATUS
STALLWORTH TIMBER COMPANY INC	ALD058223371	27 BRYAN STREET BEATRICE, AL, 364250380	YE	NO
STANDARD T CHEMICAL CO INC	NJD011394467	1312 ELIZABETH AVE LINDEN, NJ, 07036	YE	YE
STAR ANCHORS & FASTENERS	NYD001223338	20 INDUSTRY DR MOUNTAINVILLE, NY, 10953	YE	NO STATUS
STARK CERAMICS	OHD004461711	600 W CHURCH ST EAST CANTON, OH, 44730	YE	YE
STATE STREET LANDFILL (DOUGLAS CO LF)	NET320010234	12608 STATE STREET OMAHA, NE, 68142	YE	YE
STAUFFER MGMT CO SKANEATELES FALLS SITE	NYD004859955	JORDAN RD SKANEATELES FALLS, NY, 13153	NO STATUS	YE

STEELCOTE MFG CO	MOD006275036		1 STEELCOAT SQ ST LOUIS, MO, 63103	YE	IN
STERLING CASKET HARDWARE CO., INC.	VAD000020115		14430 ENTERPRISE ROAD ABINGDON, VA, 24210	YE	YE
STEWART WARNER SOUTHWIND CORP	IND005213715		1514 DROVER ST INDIANAPOLIS, IN, 46221	YE	NO STATUS
STONHARD INC APPLIED MAT SITE	CAD069130995		974 E ARQUES AVE SUNNYVALE, CA, 94086	YE	YE
STRATFORD ARMY ENGINE PLANT	CTD001181502	US Army	550 MAIN STREET STRATFORD, CT, 06615	YE	NO
STRATOS LIGHTWAVE	ILD005092135		7444 W WILSON AVE HARWOOD HTS, IL, 607064549	YE	YE
STRESAU LABORATORY INC	WID020488011		N8265 MEDLEY RD SPOONER, WI, 54801	YE	YE
STRUCTURAL METALS INC	TXD008119414		STEEL MILL DR SEGUIN, TX, 78155	YE	YE
SUMMIT CORP OF AMERICA	CTD002496909		1430 WATERBURY ROAD THOMASTON, CT, 06787	YE	IN
SUN, INC. (R&M)	OKD058078775		1700 S UNION TULSA, OK, 74107	YE	YE
SUNCOR ENERGY (USA) DNV REFINERY-MAIN	COD060627189		5801 BRIGHTON BLVD COMMERCE CITY, CO, 80022	YE	YE
SUNCOR ENERGY (USA) INC EAST PLANT	COD000109975		5800 BRIGHTON BLVD COMMERCE CITY, CO, 80022	YE	YE
SUNFLOWER ARMY AMMUN PLT	KS3213820878	US Army	35425 W 103RD (A) DE SOTO, KS, 660180640	YE	IN
SUNOCO CHEMICAL - HAVERHILL	OHD005108477		1019 HAVERHILL-OHIO FURNACE RD HAVERHILL, OH, 456360180	YE	YE
SUNOCO INC FRANKFORD PLANT	PAD002312791		MARGARET AND BERMUDA STS PHILADELPHIA, PA, 19137	YE	YE
SUNOCO INC (R&M) MARCUS HOOK REFINERY	PAD980550594		100 GREEN ST MARCUS HOOK, PA, 19061	YE	YE
SUNOCO INC (R&S) GIRARD POINT	PAD049791098		3144 PASSYUNK AVE PHILADELPHIA, PA, 19145	YE	YE
SUNOCO INC (R&S) POINT BREEZE	PAD002289700		3144 PASSYUNK AVE PHILADELPHIA, PA, 19145	YE	IN
SUNOCO INC SCHUYLKILL RIVER TF	PAD980555312		70TH & ESSINGTON AVE PHILADELPHIA, PA, 19145	YE	YE
SUNOCO PARTNERS MARKETING & TERMINALS LP	VAD048565279		10315 BALLS FORD RD MANASSAS, VA, 22109	YE	YE
SUNRISE MEDICAL	PAD990752537		100 DEVILBISS DR SOMERSET, PA, 15501	YE	YE
SUPERIOR TUBE CO	PAD002353407		3900 GERMANTOWN PIKE COLLEGEVILLE, PA, 19426	YE	YE
SWIFT M & SONS INC	CTD001139054		10 LOVE LN HARTFORD, CT, 06141	YE	YE
SYBRON CHEMICALS INC	NJD002339406		200 BIRMINGHAM RD BIRMINGHAM, NJ, 08011	YE	YE
SYNGENTA CROP PROTECTION, INC.	LAD053783445		3905 HWY 75 ST GABRIEL, LA, 70776	YE	YE
SYNTEX LYONS GROUNDWATER CLEANUP PROJECT	COD981551286		15211 N DAKOTA RIDGE RD LYONS, CO, 80540	YE	YE
SYNTHETIC PROD CO DIV OF PLASTIC SPECI	CTD000844365		375 BARNUM AVE STRATFORD, CT, 06497	YE	YE
SYRO STEEL	UTD041075896		950 WEST 400 SOUTH CENTERVILLE, UT, 84014	YE	YE
T R W SULLIVAN FACILITY	MOD094390416		300 RAMSEY ST SULLIVAN, MO, 63080	YE	NO
T THERMAL INC	PAD069006419		1 BROOK RD CONSHOHOCKEN, PA, 19428	YE	YE
T&S BRASS & BRONZE WORKS INC	SCD002038545		2 SADDLEBACK COVE TRAVELERS REST, SC, 29690	YE	YE
T. P. I. PETROLEUM, INC. A VALERO CO	OKD057705972		HIGHWAY 142 BYPASS ARDMORE, OK, 73401	YE	IN

TALON INC	PAD980550149		LIBERTY ST EXTENSION MEADVILLE, PA, 16335	YE	YE
TALON INC PLANT 7	PAD045297066		1305 S MAIN ST MEADVILLE, PA, 16335	YE	YE
TECH SYSTEMS CORP	CTD058865072		401 WATERTOWN ROAD THOMASTON, CT, 06787	YE	YE
TECHALLOY CO INC	CAD059277137		2500 A ST PERRIS, CA, 92570	YE	YE
TECHALLOY INC	ILD005178975		6509 OLSON RD P O BOX 423, UNION, IL, 60180	YE	YE
TECUMSEH PRODUCTS COMPANY	KYD054272554		33605 HIGHWAY 1247 SOMERSET, KY, 42502	YE	YE
TECUMSEH REDEVELOPMENT INC	PAD003053758		100 MAYNARD ST WILLIAMSPORT, PA, 17701	YE	YE
TECUMSEH REDEVELOPMENT INC	PAD004344222		RIDERS RD JOHNSTOWN, PA, 15907	YE	NO
TEKNICIRCUITS INC	CTD053707741		84 SHELTER ROCK RD DANBURY, CT, 06810	YE	YE
TELAIR INTERNATIONAL	CAD008383127		3303 OLD CONEJO RD NEWBURY PARK, CA, 91320	YE	YE
TELEDYNE CONTINENTAL MOTORS BATTERY PROD	CAD008386641		840 W BROCKTON AVE REDLANDS, CA, 92374	YE	YE
TELEDYNE MONARCH RUBBER PLANTS 2 AND 5	OHD000821348		ST RTE 43 N HARTVILLE, OH, 44632	YE	YE
TELEDYNE RYAN ELECTRONICS	CAD990833014		8650 BALBOA AVE SAN DIEGO, CA, 92123	YE	IN
TELEDYNE VEHICLE SYSTEMS	MID006407597		76 GETTY ST MUSKEGON, MI, 49442	YE	YE
TELEX COMMUNICATIONS INC	NED089569024		8601 E CORNHUSKER HWY LINCOLN, NE, 68507	YE	YE
TENNECO AUTOMOTIVE OPERATING CO INC	NED007263619		121 MERIDIAN AVE COZAD, NE, 69130	YE	YE
TERIS LLC	ARD069748192		309 AMERICAN CIRCLE EL DORADO, AR, 71730	YE	YE
TESORO - MANDAN REFINERY	NDD006175467		900 OLD RED TRAIL NE MANDAN, ND, 585545500	YE	YE
TESORO ALASKA KENAI REFINERY	AKD048679682		54741 TESORO ROAD KENAI, AK, 99611	YE	YE
TESORO REFINING AND MARKETING COMPANY	UTD000826362		474 WEST 900 NORTH SALT LAKE CITY, UT, 84103	YE	YE
TEXANA TANK CAR & MFG LTD	TXD043195221		HIGHWAY 82 W & FM 2148 NASH, TX, 75569	YE	YE
TEXAS ELECTRIC COOPERATIVES INC	TXD041468836		BEVIL LOOP RD 2.5 MI E OF JASPER, TX, 75951	YE	YE
TEXTRON, INC	NCD091249417		3800 LITTLE MOUNTAIN RD GASTONIA, NC, 28052	YE	YE
THE BOEING COMPANY - CANOGA	CAD074103771		6633 CANOGA AVE. CANOGA PARK, CA, 91303	YE	YE
THE BOEING COMPANY - SSFL NASA	CA1800090010	NASA	TOP OF WOOLSEY CANYON ROAD SIMI HILLS, CA, 91311	YE	IN
THE BOEING COMPANY - SSFL RMHF	CA3890090001	Dept. of Energy	TOP OF WOOLSEY CANYON RD. SIMI HILLS, CA, 91311	YE	IN
THE BOEING COMPANY-SANTA SUSANA 1,2,3,4	CAD093365435		TOP OF WOOLSEY CANYON ROAD SIMI HILLS, CA, 91311	YE	IN
THE COLONELS FACTORY OUTLET OF AR INC	ARD980621288		720 S WOODS W MEMPHIS, AR, 72301	YE	YE
THE COLONELS FACTORY OUTLET OF ARK INC	ARD035663301		804 S WOODS ST W MEMPHIS, AR, 72301	YE	YE
THE DOW CHEMICAL COMPANY	CAD076528678		901 LOVERIDGE ROAD PITTSBURG, CA, 94565	YE	YE
THE DOW CHEMICAL COMPANY	GAD045929643		1468 PROSSER DRIVE, SE DALTON, GA, 30721	YE	YE

THE DOW CHEMICAL COMPANY	TXD008092793		2301 N BRAZOSPORT BLVD STE B1226 FREEPORT, TX, 77541	YE	YE
THE DOW CHEMICAL COMPANY	TXD000017756		550 BATTLEGROUND RD LA PORTE, TX, 77571	YE	YE
THE DOW CHEMICAL COMPANY	MID000724724		ENVIRONMENTAL OPERATIONS, 34 B MIDLAND, MI, 48667	IN	YE
THE DOW CHEMICAL COMPANY 2003	LAD008187080		HWY 1 SOUTH P.O. BOX 150, PLAQUEMINE, LA, 70765	YE	YE
THE ENSIGN-BICKFORD COMPANY	UTD041310962		8305 S HIGHWAY 6 SPANISH FORK, UT, 84660	YE	YE
THE LUBRIZOL CORPORATION	TXD041067638		41 TIDAL ROAD DEER PARK, TX, 77536	YE	YE
THE OBRIEN CORP.	CAD005130455		450 E GRAND AVE UNIT A SOUTH SAN FRANCISCO, CA, 94080	YE	YE
THE PREMCOR REFINING GROUP INC	TXD008090409		1801 S GULFWAY DR PORT ARTHUR, TX, 77641	YE	YE
THE UNIVERSITY OF VIRGINIA	VAD000820712		515 EDGEMONT ROAD CHARLOTTESVILLE, VA, 22901	YE	YE
THOMAS & BETTS FACILITY FORMER	MOD048835961		1525 WOODSON RD OVERLAND, MO, 63114	YE	YE
THOMAS INDUSTRIES, INC.	KYD041165960		HIGHWAY 231 SOUTH BEAVER DAM, KY, 42320	YE	NO
THOMAS STEEL STRIP	OHD077755213		DELAWARE AVENUE NW WARREN, OH, 444852699	YE	YE
THOMPSON TOWN OF SANITARY LANDFILL	CTD000769729		PASAY RD NORTH GROSVENORDALE, CT, 06255	YE	YE
THOMSON INC	OHD043736644		24200 US RTE 23 S CIRCLEVILLE, OH, 431139002	YE	NO STATUS
THYSSEN KRUPP WAUPACA PLTS 2 & 3	WID006133441		311 TOWER RD WAUPACA, WI, 54981	YE	YE
TICONA POLYMERS INC	TXD008113441		HIGHWAY 77 2 MI S OF BISHOP, TX, 78343	YE	YE
TIMEX CORP	CTD001165208		PARK RD EXT MIDDLEBURY, CT, 06762	YE	YE
TIMKEN CORPORATION	GAD065344301		400 FRIENDSHIP RD SYLVANIA, GA, 30467	YE	YE
TIN INC DBA TEMPLE-INLAND	TXD000821199		600 A STREET DIBOLL, TX, 75941	YE	YE
TOOELE ARMY DEPOT	UT3213820894	US Army	SJMTE-CS-EO TOOELE, UT, 84074	YE	YE
TORRINGTON LANDFILL	CTD991289513		OLD DUMP RD TORRINGTON, CT, 06790	IN	YE
TOSCO CORP AVON REF	CAD000072751		SOLANO WAY/WATERFRONT RD MARTINEZ (E OF), CA, 94553	YE	YE
TOSCO CORP BAKERSFIELD REF	CAD000072769		6500 REFINERY AVE BAKERSFIELD, CA, 93308	YE	YE
TOWSON UNIVERSITY	MDD050793926		8400 YORK RD ADMIN BLDG RM 103 TOWSON, MD, 21204	YE	YE
TOXGON CORP SEATTLE	WAD061669644		631 S 96TH ST SEATTLE, WA, 981084914	YE	YE
TPI PETROLEUM INC	MID005358130		1780 E SUPERIOR ST ALMA, MI, 48801	YE	YE
TPI PETROLEUM INC ARK CITY REFINERY	KSD087418695		1400 SOUTH M STREET ARKANSAS CITY, KS, 67005	YE	YE
TR MILLER MILL COMPANY INC	ALD008161416		100 DEER STREET BREWTON, AL, 36426	YE	YE
TRANS GLOBAL SOLUTIONS INC	TXD089792121		BLOCK & LEE ST PORT NECHES, TX, 77651	YE	YE
TRANSTECHNOLOGY CORP SPACE ORD SYS DIV	CAD067776484		25977 SAND CANYON ROAD CANYON COUNTRY, CA, 91351	YE	YE
TRANSWESTERN PIPELINE CO STA 9 ROSWELL	NMD986676955		6381 N MAIN ST ROSWELL, NM, 88201	YE	NO STATUS
TRI-STATE STEEL DRUM, INC	GAD033842543		400 JULIAN RD GRAYSVILLE, GA, 30726	YE	IN
TRIAD INTERNATIONAL MAINT CORP	FLD004073177		RT 19 BOX 1029 LAKE CITY, FL, 320250	YE	NO

TRIUMUIRATE ENVIRONMENTAL (NYC) LLC	NYD077444263		19TH AVE ASTORIA, NY, 11105	YE	YE
TRW AUTOMOTIVE DANVILLE VALVE PLT	PAD003037934		601 E MARKET ST DANVILLE, PA, 17821	YE	YE
TVA POWER SERVICE CENTER	AL2640090005		HWY 133N NEAR WILSON DAM MUSCLE SHOALS, AL, 356621010	YE	YE
TXU GENERATION COMPANY LP	TXD020332078		FM 56 4.5 MI FROM GLEN ROSE, TX, 76043	YE	YE
TYCO ELECTRONICS CORP BLDG 64	PAD041421223		10709 SUSQUEHANNA TRAIL RD 2 BOX 248B, GLEN ROCK, PA, 173279550	YE	YE
TYCO SAFETY PRODUCTS - ANSUL STANTON ST	WID006125215		ONE STANTON ST MARINETTE, WI, 54143	YE	IN
U S DEPT OF ENERGY - KANSAS CITY PLANT	MO9890010524	Dept. of Energy	2000 E 95TH ST KANSAS CITY, MO, 64131	YE	YE
U S ARMY BADGER AMMUNITION PLT	WI9210020054	US Army	2 BADGER RD BARABOO, WI, 53913	YE	YE
U S ARMY FORT MCCOY	WI3210020563	US Army	FORT MCCOY SPARTA, WI, 546565000	YE	YE
U S NAVAL ACADEMY	MD0170022602	US Navy	194 KING GEORGE ST ANNAPOLIS, MD, 214025006	YE	YE
U.S. ARMY GARRISON, FORT AP HILL	VA2210020416	US Army	19952 NORTH RANGE ROAD BOWLING GREEN, VA, 22427	YE	YE
U.S. CERAMIC TILE CO.	OHD077752566		10233 SANDYVILLE RD SE EAST SPARTA, OH, 446269333	NO STATUS	IN
U.S. NNSA/DOE LOS ALAMOS NATIONAL LABORA	NM0890010515	Dept. of Energy	PO BOX 1663, MS K490 LOS ALAMOS, NM, 875450000	IN	IN
UGA HAZ MATERIALS TREATMENT FACILITY	GAD073460941		WILL HUNTER ROAD ATHENS, GA, 30602	YE	NO
ULRICH CHEMICAL INC	IND072081169		1400 LOCKPORT RD TERRE HAUTE, IN, 47802	YE	YE
UNIDYNAMICS / PHOENIX INC CRANE CO	AZD008398620		102 S LITCHFIELD RD GOODYEAR, AZ, 85338	IN	NO
UNILEVER BESTFOODS	NJD000692327		TAYLORTOWN ROAD MONTVILLE, NJ, 07632	YE	NO STATUS
UNION CARBIDE CARIBE LLC	PRD980594618		HWY # 127 KM. 17.3 PENUELAS, PR, 00624	YE	YE
UNION CARBIDE CORP WOODBINE	GAD981235294		5954 HARRIETTS BLUFF RD WOODBINE, GA, 31569	YE	YE
UNION CARBIDE CORP. - S. CHARLESTON	WVD005005483		437 MACCORKLE AVENUE, SW SOUTH CHARLESTON, WV, 25303	YE	YE
UNION CARBIDE CORP. - TECHNICAL CENTER	WVD060682291		3200 KANAWHA TURNPIKE SOUTH CHARLESTON, WV, 25303	YE	YE
UNION CARBIDE CORPORATION	TXD000461533		3301 5TH AVE S TEXAS CITY, TX, 77592	YE	YE
UNION CARBIDE CORPORATION	TXD041515420		7501 STATE HIGHWAY 185 N SEADRIFT, TX, 77983	YE	YE
UNION CARBIDE CORPORATION	TXD008114092		HIGHWAY 48 2.5 MILES EAST OF H BROWNSVILLE, TX, 78521	YE	YE
UNION PACIFIC - ANADARKO [OLD ENID REF]	OKD007234586		2529 E WILLOW ENID, OK, 73701	YE	YE
UNION PACIFIC RAILROAD COMPANY	TXD000820266		4910 LIBERTY ROAD HOUSTON, TX, 77026	YE	YE
UNION PACIFIC RAILROAD LARAMIE WY TIMBER	WYD061112470		2736 FORT SANDERS DRIVE LARAMIE, WY, 82070	YE	YE
UNION PACIFIC ROSEVILLE	CAD000628255		9451 ATKINSON ST ROSEVILLE, CA, 95747	YE	NO
UNION PACIFIC SACRAMENTO YARD	CAD073772030		501 JIBBOOM ST SACRAMENTO, CA, 95814	YE	IN
UNION TIMBER CORPORATION	GAD094075553		HWY 122 COGDELL, GA, 31628	NO	NO

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

UNITANK TERMINAL SERVICE	PAD087098653		ALLEGHENY AV & DELAWARE RVR PHILADELPHIA, PA, 19134	YE	NO STATUS
UNITED DEFENSE LP GSD	PAD003025418		1100 BAIRS RD YORK, PA, 17404	YE	YE
UNITED OIL RECOVERY INC	RID084802842		167 MILL STREET CRANSTON, RI, 02905	YE	YE
UNITED TECHNOLOGIES CORP	CAD001705235		600 METCALF RD SAN JOSE, CA, 95138	YE	YE
UNITED TECHNOLOGIES CRP PRATT & WHITNEY	FLD001447952		17900 BEELINE HWY SR 710 JUPITER, FL, 334780	YE	YE
UNIV MD DEPT ENVIRONMENTAL SAFETY	MDD980829873		REGENTS DRIVE COLLEGE PARK, MD, 20742	YE	YE
UNIV OF IL MAIN CAMPUS	ILD041544081		101 S GREGORY ST URBANA, IL, 61801	YE	YE
UNIVAR USA INC	GAD000828269		1455 COLUMBIA NITROGEN DR AUGUSTA, GA, 30901	YE	YE
UNIVAR USA INC	NED986375327		4120 BUCKINGHAM PLACE OMAHA, NE, 68107	YE	YE
UNIVAR USA INC	ORD009227398		3950 NW YEON AVE PORTLAND, OR, 97210	YE	YE
UNIVAR USA INC	IAT200010916		CASH & SILVER STS BURLINGTON, IA, 52601	YE	YE
UNIVAR USA INC	PAD061779815		6000 CASTEEL DR CORAOPOLIS, PA, 15108	YE	YE
UNIVAR USA INC - OMAHA	NED000809483		3002 F ST OMAHA, NE, 681071599	YE	YE
UNIVAR USA INC - SOUTH BEND	IND016627333		59865 MARKET ST SOUTH BEND, IN, 466144026	YE	YE
UNIVAR USA INC.	CAD010925576		2256 JUNCTION AVENUE SAN JOSE, CA, 95131	YE	YE
UNIVAR USA INC.	WAD009236811		4515 WISCONSIN AVE E SPOKANE, WA, 99212	YE	YE
UNIVERSITY OF ALASKA FAIRBANKS	AKD048679567		TANANA DRIVE FAIRBANKS, AK, 99775	YE	YE
US AIR FORCE PLANT #3 MCDONNELL DOUGLAS	OK9570000001	US Air Force	2000 N MEMORIAL DR TULSA, OK, 74115	YE	YE
US AIR FORCE PLANT - PJKS	CO7570090038	US Air Force	12257 HIGHWAY 121 LITTLETON, CO, 801278503	YE	YE
US AIR FORCE-LITTLE ROCK AFB	AR6571824808	US Air Force	4001 THOMAS AVE LITTLE ROCK AFB, AR, 720995005	YE	YE
US ALTUS AIR FORCE BASE	OK9571824045	US Air Force	97 CES/CEV 401 L AVE, ALTUS AFB, OK, 73523	YE	IN
US ARMY FORT POLK	LA0214022725	US Army	1647 23RD ST BLDG 2516 FT POLK, LA, 71459	YE	YE
US ARMY HQ I CORPS & FORT LEWIS	WA9214053465	US Army	HQI CORPS AFZH DEQ BLDG 9673 FT LEWIS, WA, 98433-5000	YE	YE
US ARMY IND ARMY AMMO PLT	IN9210020443	US Army	11452 HWY 62 CHARLESTOWN, IN, 47111	YE	NO STATUS
US ARMY REDSTONE ARSENAL	AL7210020742	US Army	REDSTONE ARSENAL BLDG 4488 MARTIN ROAD, REDSTONE ARSENAL, AL, 358985000	IN	NO
US ARMY WATERVLIET ARSENAL	NY7213820940	US Army	BUFFINGTON ST AMSTA-WV-IMS-E, WATERVLIET, NY, 121894050	YE	YE
US COAST GUARD SUPPORT CENTER	NC2690308232	Dept. of Trans.	HWY 34 SOUTH ELIZABETH CITY, NC, 27909	YE	YE
US DEPARTMENT OF ENERGY	NYD980779540	Dept. of Energy	W VALLEY DEMONSTRATION PROJECT 10282 ROCK SPRINGS RD, WEST VALLEY, NY, 141719799	YE	YE
US DEPARTMENT OF ENERGY	TX4890110527	Dept. of Energy	955 FM 2373 PANHANDLE, TX, 79068	YE	YE
US DEPARTMENT OF THE AIR FORCE	TX2571524105	US Air Force	251 FOURTH ST 47 CES CEVC DEL RIO, TX, 78843	YE	IN

Facilities on the RCRA GPRA Cleanup Baseline

Report run on: October 18, 2005 - 10:16 AM

US DEPARTMENT OF THE AIR FORCE	TX8571524091	US Air Force	9801 REESE BLVD LUBBOCK, TX, 79407	YE	YE
US DEPARTMENT OF THE AIR FORCE	TX6570024939	US Air Force	300 DRMO CIR BLDG 3050 KELLY AFB SAN ANTONIO, TX, 78226	YE	YE
US DEPARTMENT OF THE AIR FORCE	TX2571724333	US Air Force	KELLY AFB SAN ANTONIO, TX, 78241	YE	YE
US DEPARTMENT OF THE AIR FORCE	TX3571524161	US Air Force	231 9TH AVE BLDG 1402 82 CES CEV SHEPPARD AFB, TX, 76311	YE	YE
US DEPARTMENT OF THE AIR FORCE	TX3571924643	US Air Force	710 3RD ST DYESS AFB, TX, 79607	YE	YE
US DEPARTMENT OF THE ARMY	TX4213720101	US Army	1733 PLEASONTON RD BIGGS ARMY AIRFI EL PASO, TX, 79916	YE	YE
US DEPARTMENT OF THE ARMY	TX7213821831	US Army	US HIGHWAY 82 W TEXARKANA, TX, 75501	YE	YE
US DEPARTMENT OF THE ARMY	TX8214020424	US Army	4213 S 77TH ST BLDG 1348 FORT HOOD, TX, 76544	YE	YE
US DEPARTMENT OF THE NAVY	TX0571924042	US Air Force	CARSWELL AFB BLDG 1215, FORT WORTH, TX, 76127	YE	YE
US DEPARTMENT OF THE NAVY	TX3170024738	US Navy	SW 202 5 MI E CHASE FIELD BEEVILLE, TX, 78103	YE	YE
US DEPT OF ENERGY	FL6890090008	Dept. of Energy	7887 BRYAN DAIRY RD LARGO, FL, 346490	YE	YE
US DEPT OF ENERGY HANFORD FACILITY	WA7890008967	Dept. of Energy	HANFORD FACILITY RICHLAND, WA, 99352	YE	NO
US DEPT/DEFENSE	MID099113128		28700 RAILROAD AVE SELFRIDGE ANGB, MI, 48045	YE	NO STATUS
US DOE PADUCAH GAS DIFFUSION PLT	KY8890008982	Dept. of Energy	5600 HOBBS ROAD PADUCAH, KY, 42001	NO	NO
US ECOLOGY INC	ILD045063450		13279-350 E ST P O BOX 158, SHEFFIELD, IL, 61361	YE	YE
US ECOLOGY NEVADA	NVT330010000		11 11MILES S. HWY 95 BEATTY, NV, 89003	YE	YE
US ECOLOGY TEXAS LLP	TXD069452340		3277 COUNTY ROAD 69 ROBSTOWN, TX, 78380	YE	YE
US ENERGY DEPT KNOLLS ATOMIC POWER LAB	CT6890113792	Dept. of Energy	1900 DAY HILL RD WINDSOR, CT, 06095	YE	YE
US MARINE CORPS-RECRUIT DEPOT	SC6170022762	US Marines	AC/S I&L NREAO BLDG 154 PARRIS ISLAND, SC, 29905	YE	NO
US MCALESTER ARMY AMMUNITION PLANT	OK6213822798	US Army	1 C TREE ROAD MCALESTER, OK, 74501	YE	YE
US NAMEPLATE CO	IAD054758958		HWY 30 W MOUNT VERNON, IA, 52314	YE	YE
US NASA / LOCKHEED MARTIN	LA4800014587	NASA	13800 OLD GENTILLY ROAD NEW ORLEANS, LA, 70129	YE	YE
US NAVAL SURFACE WARFARE CTR CRANE DIV	IN5170023498	US Navy	300 HWY 361 BLDG 3260 CODE RP3, CRANE, IN, 475225009	YE	IN
US NAVY - NAVY TRANSITION OFFICE (ALAMED	CA2170023236	US Navy	WEST END CITY OF ALAMEDA ALAMEDA, CA, 94501	YE	YE
US NAVY PUBLIC WORKS CENTER, GUAM	GU5170022680	US Navy	BLDG 100 MARINE DR SANTA RITA, GU, 965402397	YE	YE
US NAVY, LONG BEACH NAVAL SHIPYARD	CA6170023109	US Navy	LONG BEACH NAVAL SHIPYARD LONG BEACH, CA, 90822	YE	YE
US PIPE AND FOUNDRY CO BESSEMER PIPE PLT	ALD004017869		2023 SAINT LOUIS AVENUE BESSEMER, AL, 35020	YE	YE
US STEEL - GARY WORKS	IND005444062		1 N BROADWAY GARY, IN, 46402	YE	NO STATUS

US STEEL CORP FAIRLESS WORKS	PAD002375376		SOUTH END OF PENNSYLVANIA AVE FAIRLESS HILLS, PA, 19030	YE	IN
US STEEL FAIRFIELD WORKS	ALD002904506		5700 VALLEY ROAD FAIRFIELD, AL, 35064	YE	IN
US TINKER AIR FORCE BASE	OK1571724391	US Air Force	OC-ALC/EM ROOM 204 7701 ARNOLD STREET, TINKER AFB, OK, 731459100	YE	NO
US VANCE AIR FORCE BASE	OK4571524095	US Air Force	140 CHANNEL STREET SUITE 231, VANCE AFB, OK, 737055621	YE	YE
USAADACENFB	NM4213720101	US Army	9509 HAWK ROAD MCGREGOR RANGE CAMP, NM, 88342	YE	YE
USAF DAVIS MONTHAN AFB	AZ4570024055	US Air Force	5285 E MADERA ST 355 CES/ CEV DAVIS MONTHAN, AZ, 85707	YE	YE
USAF AAC/EM	FL8570024366	US Air Force	501 DELEON ST SUITE 101 EGLIN AFB, FL, 325425133	YE	YE
USAF AFRPA/DA MYRTLE BEACH	SC7570024821	US Air Force	1048 AERODROME BLVD MYRTLE BEACH, SC, 29577	YE	YE
USAF AVON PARK	FL8572128587	US Air Force	OL A, DET 1, 347 OG/CEVC 29TH AVON PARK, FL, 336080	YE	YE
USAF CAPE CANAVERAL AIR FORCE STATION	FL2800016121	US Air Force	45 CES/CEV 122 4 JUPITER STREET MS 9125, PATRICK AIR FORCE BASE, FL, 329253343	YE	YE
USAF DETACHMENT 1 15TH AIR BASE WING	TT9570090002	US Air Force	JOHNSTON ATOLL PACIFIC OCEAN, TT, 96588	YE	YE
USAF HOMESTEAD	FL7570024037	US Air Force	HOMESTEAD AIR FORCE BASE HOMESTEAD, FL, 330390	YE	YE
USAF MACDILL DRMO	FL6570024582	US Air Force	DRMO MACDILL AFB, FL, 336210	YE	NO
USAF MATHER	CA8570024143	US Air Force	323 FTW EM MATHER AFB MATHER, CA, 95655	YE	NO
USAF NELLIS AIR FORCE BASE 99TH AB WING	NV7570024110	US Air Force	4430 GRISSOM AVE STE 110 NELLIS AFB, NV, 89191-6520	YE	YE
USAF PATRICK AIR FORCE BASE	FL2570024404	US Air Force	45 CES/CEV 1224 JUPTIER ST MS9125, PATRICK AIR FORCE BASE, FL, 329253343	YE	YE
USAF-CHARLESTON AIR FORCE BASE	SC3570024460	US Air Force	437 ABG DEEV CHARLESTON AFB, SC, 29404	YE	YE
USAF-SHAW AIR FORCE BASE	SC7570024466	US Air Force	345 CULLEN ST SHAW AFB, SC, 29152	YE	YE
USATC & FORT JACKSON	SC3210020449	US Army	BLDG 1916 OFF EWELL RD FORT JACKSON, SC, 29290	YE	YE
USDLA DRMO GUAM	GU6170027316	US Navy	SUMAY DRIVE DRMO NAVACTS AGANA, GU, 96932	YE	YE
USDOT CG INTEGRATED SUPPORT COMMAND	AK9690330742	Dept. of Trans.	ANTON LARSON BAY RD AND REZANOF HWY, KODIAK, AK, 99619	YE	IN
USEPA SUPERFUND TAYLOR LUMBER	ORD009042532		22125 SW ROCK CREEK RD SHERIDAN, OR, 97378	YE	YE
USMC AIR STATION	SC1750216169	US Marines	HWY 21 BEAUFORT, SC, 29904	YE	NO
USMC AIR STATION TUSTIN	CA9170090022	US Marines	MCAS TUSTIN TUSTIN, CA, 92710	YE	YE
USMC CAMP PENDLETON	CA2170023533	US Marines	BLDG 22165 CAMP PENDLETON, CA, 92055	YE	YE
USN COASTAL SYSTEMS CENTER	FL8170023792	US Navy	SOLOMONS DR PANAMA CITY, FL, 324070	YE	YE
USN MAYPORT	FL9170024260	US Navy	PERIMETER RD (MAYPORT) JACKSONVILLE, FL, 322280	YE	YE
USN-CHARLESTON NAVAL WEAPONS STATION	SC8170022620	US Navy	2316 RED BANK RD STE 100 GOOSE CREEK, SC, 29408	YE	NO
USNASA KENNEDY SPACE CENTER	FL6800014585	NASA	FLA HWY 3 KENNEDY SPACE CENTER, FL, 328990	YE	YE
USNAVAL NATIONAL MEDICAL CENTER	MD4170024687	US Navy	8901 WISCONSIN AVE BLDG 14 BETHESDA, MD, 208895600	YE	YE

USNAVY NAVAL AIR STATION NORTH ISLAND	CA7170090016	US Navy	BLDG 1606 SAN DIEGO, CA, 92135	YE	NO
USS LEAD REFINERY INC	IND047030226		5300 KENNEDY AVE EAST CHICAGO, IN, 46312	YE	NO STATUS
USS-POSCO INDUSTRIES	CAD009150194		900 LOVERIDGE ROAD MS67, PITTSBURG, CA, 94565	YE	YE
UTC PRATT & WHITNEY	CTD003935905		400 AIRCRAFT ROAD MIDDLETOWN, CT, 064575733	YE	IN
UTILITY MANUFACTURING CO	MAD001116078		2443 BOSTON RD WILBRAHAM, MA, 01095	YE	YE
VALBRUNA SLATER STAINLESS INC	IND005447537		2400 W TAYLOR ST FT WAYNE, IN, 46802	NO	NO
VALERO ST. CHARLES REFINERY	LAD000225862		14902 RIVER ROAD NORCO, LA, 70079	YE	YE
VALLEY PLATING	CAD055556062		3872 EL CAJON CENTRAL VALLEY, CA, 96019	YE	YE
VALMONT INDUSTRIES INC	NED007267214		7002 N 288TH ST VALLEY, NE, 68064	YE	YE
VALSPAR CORP THE	ILD081040107		1330 S KILBOURN AVE CHICAGO, IL, 60623	YE	YE
VANDENBERG AIR FORCE BASE	CA9570025149	US Air Force	806 13TH STREET SUITE 116, VANDENBERG AFB, CA, 93437	YE	NO
VANDERBILT CHEMICAL CORPORATION	CTD001181205		31 TAYLOR AVE BETHEL, CT, 06801	YE	NO
VARIAN N M R INSTRUMENTS	CAD009120817		3120 HANSEN WY PALO ALTO, CA, 943041030	YE	YE
VARLEY PRODUCTS CO	ILD982635534		1 N RAILROAD CRYSTAL LAKE, IL, 60014	YE	YE
VEEDER - ROOT COMPANY OF NC, INC	NCD041466251		2100 WEST BROAD ST ELIZABETHTOWN, NC, 28337	YE	YE
VELSICOL CHEMICAL	TND007024664		1199 WARFORD STREET MEMPHIS, TN, 38108	NO	NO
VELSICOL CHEMICAL CORP.	TND061314803		4902 CENTRAL AVENUE CHATTANOOGA, TN, 37409	YE	YE
VIACOM SHARON GROUNDWATER REMEDIATION	PAD005000575		469 SHARPSVILLE AVE SHARON, PA, 16146	YE	YE
VIASYSTEMS TECH CORP LLC	VAD066000993		4500 LABURNUM AVE RICHMOND, VA, 23231	YE	YE
VICKERS INC	MOD007155781		2800 W 10TH ST JOPLIN, MO, 64801	NO	NO
VICKERY ENVIRONMENTAL, INC.	OHD020273819		3956 STATE ROUTE 412 VICKERY, OH, 43464	YE	YE
VICKSBURG CHEMICAL COMPANY	MSD990714081		4280 RIFLE RANGE ROAD VICKSBURG, MS, 39180	NO STATUS	NO
VIRGINIA EMER FUEL STORAGE FAC	VAD988193223		JUNCTION VA RTS 641 & 199 YORKTOWN, VA, 23690	YE	YE
VIRGINIA INDUSTRIES INC	CTD001164334		30 KNOTTER DR CHESHIRE, CT, 06410	YE	YE
VIRGINIA SOLITE	VAD046970521		101 SOLITE ROAD CASCADE, VA, 24069	YE	IN
VISHAY VITRAMON INC	CTD001186212		10 MAIN ST RTE 25 MONROE, CT, 06468	YE	YE
VISION METALS INC GULF STATES TUBE D	TXD000449397		221 SCOTT ROAD ROSENBERG, TX, 77471	YE	YE
VISION PROPERTIES BLUE ISLAND	ILD005109525		3301 WIRETON RD BLUE ISLAND, IL, 60406	YE	YE
VISTEON CORPORATION	MID005057005		3200 E ELM AVE MONROE, MI, 48162	YE	YE
VISTEON CORPORATION SANDUSKY PLANT	OHD004461208		3020 TIFFIN AVENUE SANDUSKY, OH, 44870	YE	YE
VOGEL DISPOSAL SERVICE INC	PAD005820691		421 HARTMAN RD ZELIENOPLE, PA, 16046	YE	YE
VOLUNTEER ARMY AMMUNITION PLANT	TN6210020933	US Army	VOLUNTEER ARMY AMMUNITION PL. CHATTANOOGA, TN, 37421	YE	YE
VON ROLL ISOLA USA INC	NYD052987096		W CAMPBELL RD SCHENECTADY, NY, 123062442	YE	NO STATUS
VOUGHT AIRCRAFT INDUSTRIES INC	FLD043117522		1801 S E AIRPORT RD STUART, FL, 349954012	YE	YE

VOUGHT AIRCRAFT INDUSTRIES INC	TX6170022770	US Navy	9314 W JEFFERSON BLVD DALLAS, TX, 75211	YE	YE
VULCAN MATERIALS CO CHEMICALS DIV	WID046536231		101 HWY 73 S PORT EDWARDS TN, WI, 54469	YE	YE
W M W I - OMEGA HILLS LF	WID000808568		N96 W12730 COUNTY LINE RD GERMANTOWN, WI, 53022	YE	YE
WAH CHANG	ORD050955848		1600 OLD SALEM RD NE ALBANY, OR, 97321	YE	YE
WALD LLC	KYD980600043		1 MI OFF HWY 10 E OF HWY 1449 MAYSVILLE, KY, 41056	YE	YE
WALTON & LONSBURY INC	MAD001197755		78 NORTH AVE ATTLEBORO, MA, 02703	IN	NO
WAMPUS MILFORD ASSOCIATES LLC	CTD001453232		80 WAMPUS LN MILFORD, CT, 06460	NO	YE
WARING PRODUCTS A CTS COMPANY	CTD001157049		283 MAIN ST NEW HARTFORD, CT, 06057	YE	YE
WARNER ELECTRIC BRAKE & CLUTCH CO	ILD006114169		5253 MCCURRY RD ROSCOE, IL, 61073	YE	YE
WARRENDALE PLATING CO	PAD004386629		MARS VALENCIA ROAD MARS, PA, 16046	YE	YE
WATERBURY CO INC	CTD001165695		64 AVENUE OF INDUSTRY WATERBURY, CT, 06705	YE	YE
WATERBURY ROLLING MILLS	CTD001164607		240 EAST AURORA STREET WATERBURY, CT, 06708	YE	NO
WATERTOWN TOWN OF SANITARY LANDFILL	CTD991289398		OLD BAIRD RD WATERTOWN, CT, 06795	YE	NO
WAYNE DIV DRESSER EQUIP GROUP	MDD044147098		124 W COLLEGE AVE SALISBURY, MD, 21804	YE	YE
WCI STEEL INC	OHD060409521		1040 PINE AVE SE WARREN, OH, 44483	YE	NO STATUS
WERNER CO GREENVILLE DIV	PAD004329520		93 WERNER RD GREENVILLE, PA, 16125	YE	YE
WEST COUNTY LANDFILL, INC.	CAD041844002		FOOT OF PARR BLVD RICHMOND, CA, 94801	YE	YE
WESTERN BERKS REFUSE AUTHORITY	PAD000443705		455 POPLAR NECK RD BIRDSBORO, PA, 19508	YE	YE
WESTERN NY NUCLEAR SERVICE CENTER	NYD986905545		10282 ROCK SPRINGS RD ASHFORD, NY, 14171	YE	YE
WESTERN REFINING COMPANY LP	TXD007399637		6500 TROWBRIDGE ROAD EL PASO, TX, 79905	YE	YE
WESTERN REFINING COMPANY LP	TXD054256391		6501 TROWBRIDGE DR EL PASO, TX, 79905	YE	YE
WESTERN SLOPE REFINING COMPANY	COD067315390		2 MI W OF FRUITA ON HWY 6/50 FRUITA, CO, 81521	YE	YE
WESTERN ZIRCONIUM	UTD092024934		10,000 WEST 900 SOUTH OGDEN, UT, 84404	YE	IN
WESTINGHOUSE ELECTRIC CORPORATION	CTD001183078		1421 STATE STREET BRIDGEPORT, CT, 066052032	YE	YE
WESTLAKE VINYLS CO LP	LAD003913449		36045 HWY 30 GEISMAR, LA, 70734	YE	YE
WESTVACO CORP	MDD048005839		11101 JOHNS HOPKINS ROAD LAUREL, MD, 20810	YE	YE
WEYERHAEUSER CO/TREATING PLANT	ARD067671313		377 S TREATING PLANT RD DEQUEEN, AR, 71832	YE	YE
WHEELABRATOR CORP LANDFILL	VAD000063669		3 ABRASIVE AVE BEDFORD, VA, 24523	YE	YE
WHEELING-PITTSBURGH STEEL CORPORATION	WVD004319539		WV STATE ROUTE 2 FOLLANSBEE, WV, 26037	YE	IN
WHIRLPOOL CORP	MID005477773		201 UPTON DRIVE SAINT JOSEPH, MI, 49085	YE	YE
WHITE MOP WRINGER	NYD002076214		RIVERSIDE DR FULTONVILLE, NY, 12072	YE	YE
WHITE SANDS MISSILE RANGE	NM2750211235	US Army	BLDG 1510, WHITE SANDS MISSILE RANGE, NM, 88002	YE	IN
WHITING & DAVIS CO	MAD001195700		23 WEST BACON ST PLAINVILLE, MA, 02762	YE	YE
WHYCO FINISHING TECHNOLOGIES LLC	CTD001450154		670 WATERBURY ROAD THOMASTON, CT, 06787	YE	NO

WILLAMETTE VALLEY COMPANY	ORD009414400	3900 W 1ST EUGENE, OR, 97402	YE	YE
WILLIAM C. MEREDITH CO. INC	GAD003323805	2335 LAWRENCE ST EAST POINT, GA, 30344	YE	IN
WILLIAMS PETROLEUM SVCS LLC AUGUSTA	KSD007235138	215 OAK AUGUSTA, KS, 67010	IN	IN
WILSON JONES CO	VAD003124989	1000 ALLVIEW DR CROZET, VA, 22932	YE	IN
WINDSOR BLOOMFIELD SAN LANDFILL	CTD991289133	HUCKLEBERRY RD WINDSOR, CT, 06095	YE	YE
WOLF LAKE TERMINALS INC	IND054101415	3200 SHEFFIELD AVE HAMMOND, IN, 46327	YE	YE
WOLVERINE BRASS INC/TRW INC	SCD990704470	2951 HWY 501 E CONWAY, SC, 29526	YE	YE
WOLVERINE TUBE INC	ALD053363776	2100 MARKET STREET NE DECATUR, AL, 356092202	YE	YE
WOOD INDUSTRIES PA 1299	TXD027070655	11373 SOUTHTON RD SAN ANTONIO, TX, 78223	YE	YE
WOOD PRESERVERS, INC.	VAD003113750	15939 HISTORYLAND HIGHWAY WARSAW, VA, 22572	YE	YE
WOOD TREATING, INC.	MSD065490930	403 DAVIS STREET PICAYUNE, MS, 39466	YE	NO
WOODBURY BOX CO INC	GAD981270416	205 MAIN ST WOODBURY, GA, 30293	YE	YE
WORTHINGTON STEEL CO	PAD002324978	45 MOREHALL RD MALVERN, PA, 19355	YE	YE
WOTEN AVIATION SERVICES INC	CAD085595551	25980 NEIGHBORS BLVD AT ARPT RIPLEY, CA, 92272	YE	YE
WRR ENVIRONMENTAL SERVICES CO INC	WID990829475	5200 STATE RD 93 EAU CLAIRE, WI, 54701	YE	NO STATUS
WYETH HOLDINGS CORP	NJD002349009	4201 QUAKERBRIDGE RD PRINCETON JCT, NJ, 085505205	YE	YE
WYETH PHARMACEUTICALS	NYD054065909	401 NORTH MIDDLETOWN ROAD PEARL RIVER, NY, 10965	YE	YE
WYMAN-GORDON CO	MAD001128032	244 WORCESTER ST NORTH GRAFTON, MA, 01536	YE	NO
WYNNEWOOD REFINING COMPANY	OKD000396549	906 SOUTH POWELL WYNNEWOOD, OK, 73098	YE	YE
WYRE WYND	CTD002590461	77 ANTHONY STREET JEWETT CITY, CT, 06351	YE	YE
XEROX ATLANTA CRC FACILITY	GAD010103232	6077 FULTON INDUSTRIAL BLVD ATLANTA, GA, 30336	YE	YE
XEROX CORP CHICAGO PARTS REHAB	ILD096786009	100 WINDSOR DR OAK BROOK, IL, 60521	YE	YE
XEROX CORPORATION	NYD002211324	800 PHILLIPS ROAD (205-99F) WEBSTER, NY, 14580	YE	YE
XSYS PRINT SOLUTIONS, LLC	WVD000068601	24TH STREET & 5TH AVENUE HUNTINGTON, WV, 25703	YE	YE
YALE SECURITY INC.	TND095050019	100 YALE AVENUE LENOIR CITY, TN, 37771	YE	YE
YELLOWSTONE CODY REF	WYD006230189	1 MI N OF CODY CODY, WY, 82414	YE	YE
YKK SNAP FASTENERS AMERICA INC.	KYD044914356	302 FACTORY STREET LAWRENCEBURG, KY, 40342	YE	YE
YORK CASKET HARDWARE	GAD003265030	506 MALTBIE ST LAWRENCEVILLE, GA, 30245	YE	YE
ZENECA INC.	MAD051505477	333 MAIN STREET DIGHTON, MA, 02715	YE	NO STATUS
ZINC CORPORATION OF AMERICA	OKD000829440	11TH ST. & HIGHWAY 123 BARTLESVILLE, OK, 74003	YE	YE

*** End of Report ***

ENCLOSURE 5

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Most of these facilities were identified in the early 1990's when EPA and the states were prioritizing their corrective action workload, and were identified as facilities where early cleanup progress would be appropriate. Today, many of these facilities have already made substantial progress in their cleanup efforts. Some of these facilities have met the environmental indicator (EI) measures and at some of these facilities cleanup is complete. Many of the facilities that have not yet met the EI measures have still made substantial progress by stabilizing the problems or in some cases beginning final remedies. Some percentage of these facilities have not yet been assessed by EPA or the states for EI determinations. When assessed, it may be determined that some of these facilities currently meet EI measures. EPA will be focusing resources on meeting the environmental indicators for the facilities on this Baseline. The company names found on this list are the current facility owners. There may be companies on this baseline that are the current property owner but did not cause the contamination. There may also be cases where the former owners have entered an agreement to be responsible for cleanup. Unfortunately, the database is unable to track and identify these instances.

Remedy Decision
CA400
The absence of a CA400 event or an event that is not associated with an area defined as facility-wide is not included in counts.

Remedy Construction Completion
CA550 (Status Code)
NR - No Remedy Constructed
RC - Remedy Constructed
blank - CA550 Event with no status code. Counts as under control. (The absence of a CA550 event or an event that is not associated with an area defined as facility-wide is not included in counts.)

Human Exposure Environmental Indicator
CA725 (Status Code)
YE - "Current Human Exposures Under Control" has been verified.
NO - "Current Human Exposures" are NOT "Under Control."
IN - More information is needed to make a determination.
No Status - No status has been recorded for this facility.

Groundwater Environmental Indicator
CA750 (Status Code)
YE - Yes, "Migration of Contaminated Groundwater Under Control" is verified.
NO - Unacceptable migration of contaminated groundwater.
IN - More Information is needed to make a determination.
No Status - No status has been recorded for this facility.

Under Control for Both EIs	Under Control for Only CA725 (Human)	Under Control for Only CA750 (Groundwater)
1627	266	15

Final Remedy Selected	Final Remedy Constructed	Total on 2008 National Baseline
848	682	1968

Report Generated: 11/04/2008

Date Range: 10/01/1980 - 09/30/2008

Sorted by facility name

National

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

1968 of 1968 Facilities on the National RCRA 2008 GPRA Corrective Action Baseline

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date / Construction Completion / Date / HE Controlled / Date / GW Controlled / Date			
1990 BAY ROAD	CAT000611350		1990 BAY ROAD EAST PALO ALTO, CA, 94303
MEDIUM / NO / / NO / / YE / 01/10/2001 / YE / 07/23/2002			
2910 W BEAVER ST LLC	FLD020982716		2910 W BEAVER ST JACKSONVILLE, FL, 322543170
MEDIUM / YES / 01/25/1995 / YES / 05/25/1996 / YE / 12/14/2005 / YE / 12/14/2005			
3D INVESTMENT INC	NED986368728		I80 ALDA INTERCHANGE ALDA, NE, 68810
HIGH / YES / 07/31/2004 / YES / 09/17/2004 / YE / 09/20/2004 / YE / 09/11/2002			
3M COLUMBIA	MOD054950670		5400 RT B COLUMBIA, MO, 65202
HIGH / YES / 11/20/2002 / YES / 10/12/2005 / YE / 09/27/2001 / YE / 09/23/2002			
3M COMPANY	ALD004023164		1400 STATE DOCKS ROAD DECATUR, AL, 35601
HIGH / YES / 07/28/2005 / YES / 08/17/2007 / YE / 09/10/2003 / YE / 09/10/2003			
3M COMPANY	TXD001806868		4501 HIGHWAY 377 S BROWNWOOD, TX, 76801
HIGH / YES / 07/24/2006 / YES / 07/24/2006 / YE / 03/24/2005 / YE / 03/24/2005			
3M CORDOVA	ILD054236443		22614 RTE 84 N CORDOVA, IL, 61242
MEDIUM / YES / 05/21/2007 / YES / 05/21/2007 / YE / 01/29/1999 / YE / 01/29/1999			
914TH AIRLIFT WING (AFRC)	NY0570024273	US Air Force	2720 KIRKBRIDGE DRIVE NIAGARA FALLS, NY, 14304
HIGH / YES / 09/26/2007 / YES / 09/26/2007 / YE / 09/29/2000 / YE / 09/29/2000			
A & B ENTERPRISES	WID006103899		1606 PEARL ST , WAUKESHA, WI, 53186
HIGH / NO / / NO / / YE / 09/26/2008 / YE / 09/26/2008			
A K STEEL CORP	MOD007118029		7000 WINNER RD KANSAS CITY, MO, 64125
HIGH / NO / / NO / / NO / 09/30/1997 / NO / 09/30/1997			
A-CUBED CORP	PAD000765651		131 MYOMA RD MARS, PA, 16046
HIGH / NO / / NO / / YE / 06/21/2001 / YE / 06/21/2001			
A1L SYSTEMS INC.	CAD020159760		31717 LA TIENDA DR WESTLAKE VILLAGE, CA, 913595009
HIGH / NO / / NO / / YE / 08/07/2007 / YE / 08/07/2007			
AAD DISTRIBUTION & DRY CLEANING SERVICES	CAD981397417		2306 E THIRTY EIGHTH ST VERNON, CA, 90058-1627
HIGH / YES / 08/18/2006 / NO / / YE / 04/30/2003 / YE / 10/03/2005			
ABB INC PRODUCT SUPPORT	PAD082957127		231 THEOBOLD AVE GREENSBURG, PA, 15601
HIGH / NO / / NO / / YE / 05/02/2002 / YE / 05/02/2002			
ABBOTT LABORATORIES	ILD055409940		1400 SHERIDAN RD D72N , NORTH CHICAGO, IL, 60064
HIGH / YES / 03/25/1998 / YES / 06/02/1999 / YE / 09/24/1999 / YE / 09/24/1999			
ABBOTT LABORATORIES WICHITA	KSD981495567		6765 S RIDGE WICHITA, KS, 67277
MEDIUM / YES / 06/28/2002 / YES / 01/12/2004 / YE / 02/24/2000 / YE / 04/15/2008			
ACCELLENT COLLEGEVILLE	PAD002344463		200 W 7TH AVE TRAPPE, PA, 19426
HIGH / YES / 05/16/2001 / YES / 01/10/2006 / YE / 09/25/2002 / YE / 09/25/2002			
ACCELLENT INC	MAD065781197		660 MAIN ST STURBRIDGE, MA, 01566
HIGH / NO / / NO / / YE / 09/25/2000 / YE / 09/25/2000			
ACCESS BUSINESS GROUP LLC	MID006026793		7575 E FULTON RD ADA, MI, 49355
HIGH / YES / 07/10/2006 / NO / / YE / 09/30/2002 / YE / 08/20/2004			
ACE BATTERY INC SALV DIV	IND016389546		1966 BLUFF ROAD INDIANAPOLIS, IN, 46225
HIGH / YES / 04/15/2003 / YES / 05/11/2005 / YE / 07/27/2007 / YE / 07/27/2007			

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
ACME FILL CORPORATION	CAD041835695		950 WATERBIRD WAY MARTINEZ, CA, 94553
LOW NO	NO	YE 12/28/2000	YE 12/28/2000
ACME RIVET & MACHINE CORP	CTD001701168		400 MIDDLE ST BRISTOL, CT, 06010
HIGH NO	NO	YE 03/17/2000	YE 03/17/2000
ACTION MFG CO PLANT 5	PAD096844311		500 BAILEYS CROSSROADS ATGLEN, PA, 19310
HIGH NO	NO	YE 04/29/2003	IN 04/29/2003
ADCOM WIRE COMPANY	FLD053105821		925 LANE AVE N JACKSONVILLE, FL, 322542828
HIGH NO	NO	YE 09/27/2001	NO 09/27/2001
ADHESIVE RESEARCH INC	PAD003010345		PO BOX 100 400 SEAKS RUN RD, GLEN ROCK, PA, 17327-0100
HIGH YES 10/28/1999	YES 10/28/1999	YE 08/24/1999	YE 08/24/1999
ADVANCED BEARING MATERIALS LLC	IND052959640		1515 W MAIN ST , GREENSBURG, IN, 47240
HIGH NO	NO	YE 09/13/2005	NO 05/30/2002
ADVANCED ENVIRONMENTAL TECHNICAL SVCS	PAD064375470		1050 W 11TH AVE COATESVILLE, PA, 19320
HIGH YES 09/30/1996	YES 09/30/1996	YE 07/15/2002	YE 07/15/2002
AEP KANAWHA RIVER PLANT	WVD980554588		US ROUTE 60 EAST , GLASGOW, WV, 250860110
HIGH YES 01/14/2000	YES 01/14/2000	YE 11/03/1999	YE 11/03/1999
AEROJET - GENERAL CORPORATION	CAD000030494		HWY 50 AND AEROJET ROAD RANCHO CORDOVA, CA, 95670
HIGH NO	NO	YE 08/16/2005	NO 12/28/2000
AEROJET AZUSA	CAD079622569		1100 W HOLLYVALE ST AZUSA, CA, 917020296
HIGH NO	NO	YE 07/14/2005	YE 07/11/2005
AEROJET ORDNANCE CHINO FACILITY	CAD981457302		END OF WOODVIEW RD CHINO, CA, 91708
LOW YES 10/17/2000	NO	YE 06/05/2008	YE 09/22/2005
AEROJET/GENCORP	ARD091688283		HWY 274 5M E. WALTON ROAD EAST CAMDEN, AR, 71711
HIGH NO	NO	YE 09/22/2005	NO STATUS
AGC CHEMICALS AMERICAS, INC.	NJD001787944		229 EAST 22ND STREET BAYONNE, NJ, 07002
HIGH NO	NO	YE 09/29/2005	NO 09/29/1997
AGC FLAT GLASS NORTH AMERICA	TND037909348		600 AFG ROAD , CHURCH HILL, TN, 37642
HIGH YES 05/18/2007	YES 05/18/2007	YE 09/30/1999	YE 09/30/1999
AGE REFINING INC	TXD049754047		7811 S PRESA ST SAN ANTONIO, TX, 78223
HIGH NO	NO	YE 02/25/2008	YE 04/04/2005
AGENCY REALTY & MORTGAGE CO INC	RID002042216		477 CHURCH ST RTE 91 CHARLESTOWN, RI, 02894
HIGH NO	NO	YE 09/11/2000	YE 09/11/2000
AGROMAC - LOCKWOOD SITE	NED044101442		220757 HWY 92 EAST GERING, NE, 69341
HIGH YES 09/28/2007	YES 09/28/2007	YE 09/30/2003	YE 09/21/2004
AHLSTROM DEXTER	CTD983895137		CANAL BANK RD WINDSOR LOCKS, CT, 06096
HIGH YES 04/27/2008	YES 04/27/2008	YE 09/15/1999	YE 09/15/1999
AHLSTROM DEXTER MAIN PLANT	CTD983871914		CANAL BANK RD WINDSOR LOCKS, CT, 06096
HIGH YES 06/19/2008	NO	YE 09/22/2003	YE 09/22/2003
AID CORPORATION THE	GAD003292885		250 LAUREL HEIGHTS DR CLAYTON, GA, 30525
HIGH YES 08/22/2007	YES 08/22/2007	YE 09/20/2001	YE 09/15/2005
AIR FORCE BASE CONV AGENCY EAKER AFB	AR8571924473	US Air Force	A809 ATLANTA ST BLYTHEVILLE, AR, 72315
HIGH YES 07/13/1999	YES 09/13/2002	YE 09/06/2001	YE 09/06/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
AIR FORCE PLANT 6	GA8570024606	US Air Force	86 SOUTH COBB DRIVE RE3M, ZONE 0446, MARIETTA, GA, 30063
HIGH / NO	NO	YE / 09/28/2004	NO / 09/20/1996
AIR PRODUCTS & CHEMICALS ESM	PAD069778967		357 MARIAN AVE TAMAQUA, PA, 18252
HIGH / YES / 12/01/1997	YES / 02/14/2008	YE / 09/26/2002	YE / 09/26/2002
AIRCO WELDING PROD CHESTER WIRE PLANT	WVD980554760		RTE 2 2 MILES SO OF CHESTER CHESTER, WV, 26034
HIGH / YES / 08/13/2008	YES / 08/13/2008	YE / 07/17/2000	YE / 07/17/2000
AIRTEX PRODUCTS	ILD001662816		407 W MAIN ST , FAIRFIELD, IL, 62837
HIGH / YES / 03/21/2007	YES / 03/21/2007	YE / 03/21/2007	YE / 06/02/2008
AK STEEL - MANSFIELD WORKS	OHD004157418		913 BOWMAN STREET P.O. BOX 247, MANSFIELD, OH, 449010247
HIGH / NO	NO	YE / 06/30/2005	YE / 11/15/2007
AK STEEL CORP BUTLER WORKS	PAD004325254		210 PITTSBURGH RD BUTLER, PA, 16001
HIGH / NO	NO	YE / 01/31/2002	YE / 01/31/2002
AK STEEL CORPORATION	OHD058842501		PROP ADJ TO 530 N SECOND ST PARCEL ID 06-08894.000, CAMBRIDGE, OH, 43725
HIGH / YES / 09/06/2006	YES / 09/06/2006	YE / 09/30/2005	YE / 10/27/2004
AK STEEL CORPORATION - ZANESVILLE WORKS	OHD004281598		1724 LINDEN AVENUE ZANESVILLE, OH, 43701
HIGH / NO	NO	YE / 06/30/2005	YE / 03/31/2004
AKZO CHEMICALS INC	DED980551667		SCHOOLHOUSE RD DELAWARE CITY, DE, 19706
HIGH / NO	NO	YE / 05/09/2001	YE / 09/21/2007
AKZO NOBEL FUNCTIONAL CHEMICALS LLC	ALD008161176		13440 HIGHWAY 43 NORTH AXIS, AL, 36505
HIGH / YES / 09/29/2006	YES / 08/29/2008	YE / 07/26/2005	YE / 07/26/2005
AKZO NOBEL POLYMER CHEMICALS LLC	NYD043815158		2153 LOCKPORT-OLCOTT RD BURT, NY, 14028
HIGH / YES / 12/05/2005	YES / 04/07/2006	YE / 06/23/2004	YE / 06/23/2004
ALABAMA STATE PORT AUTHORITY	ALD058221326		3 OLD WATER STREET MOBILE, AL, 36604
HIGH / YES / 08/25/2003	NO	YE / 03/08/2005	IN / 03/08/2005
ALASKA RAILROAD CORP	AKD981767403		327 W SHIP CREEK AVE , ANCHORAGE, AK, 99501
HIGH / NO	NO	IN / 06/19/2002	NO / 08/01/2006
ALBEMARLE CORP ORANGEBURG PLT	SCD043384072		725 CANNON BRIDGE RD ORANGEBURG, SC, 29115
HIGH / NO	NO	YE / 03/20/2005	YE / 03/20/2005
ALBEMARLE CORPORATION SOUTH PLANT	ARD052528809		2270 HIGHWAY 79 SOUTH MAGNOLIA, AR, 71753
HIGH / NO	NO	YE / 06/01/2004	YE / 06/09/2004
ALBEMARLE CORPORATION WEST PLANT	ARD982558561		1550 HIGHWAY 371 SOUTH MAGNOLIA, AR, 71753
HIGH / NO	NO	YE / 09/22/2005	YE / 09/25/2006
ALCAN INGOT & POWDERS	CAD027909886		1069 SECOND ST BERKELEY, CA, 94710
LOW / YES / 07/24/2007	YES / 03/25/2008	YE / 08/15/2006	YE / 08/15/2006
ALCAN ROLLED PRODUCTS, LLC.	WVD009233297		CENTURY ROAD RAVENSWOOD, WV, 26164
HIGH / NO	NO	YE / 10/12/2001	YE / 10/12/2001
ALCO PACIFIC SITE	CAD008387250		16914 S BROADWAY CARSON, CA, 90749
HIGH / YES / 08/30/2006	NO	YE / 08/30/2006	YE / 08/02/2006
ALCOA FASTENER DIV LANCASTER WORKS	PAD003026663		1700 FRUITVILLE PIKE LANCASTER, PA, 17604-4685
HIGH / NO	NO	YE / 02/23/1999	YE / 02/23/1999
ALCOA INC WARRICK OPERATIONS	IND006366819		HIGHWAY 66 NEWBURGH, IN, 47630
HIGH / NO	NO	YE / 07/06/2001	YE / 01/28/2005

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
ALCOA INC. MASSENA OPERATIONS	NYD002232304		PARK AVE EAST MASSENA, NY, 13662
HIGH / YES / 09/29/2006	YES / 09/29/2006	YE / 09/19/2002	YE / 05/17/2001
ALCOA, INC.	NCD003162542		HIGHWAY 740 , BADIN, NC, 28009
HIGH / NO	NO	YE / 07/16/2004	YE / 07/16/2004
ALLEGHENY LUDLUM VANDERGRIFT	PAD004378501		130 LINCOLN AVE VANDERGRIFT, PA, 15690-1249
HIGH / YES / 03/07/2002	YES / 03/07/2002	YE / 09/05/2001	YE / 10/01/2001
ALLIANT TECHSYSTEMS INC	MDD003067121		55 THIOKOL RD ELKTON, MD, 21921
HIGH / NO	NO	YE / 08/02/2005	YE / 09/28/2007
ALLIANT TECHSYSTEMS INC PROVING GROUND	MND081138604		23100 SUGAR BUSH RD ST FRANCIS, MN, 55070
HIGH / NO	NO	YE / 09/30/1997	YE / 09/30/1997
ALLIED MATERIALS CORPORATION	OKD007192719		ALLIED ROAD STROUD, OK, 74079
HIGH / YES / 07/24/1986	YES / 10/01/1989	YE / 05/17/2001	YE / 05/17/2001
ALLISON TRANSMISSION INC-SPEEDWAY MAIN	IND006413348		4700 W 10TH ST , INDIANAPOLIS, IN, 46222
MEDIUM / NO	NO	YE / 09/25/2008	NO STATUS
ALLVAC LATROBE PLT	PAD057629479		ROUTE 981 N LATROBE, PA, 15650
HIGH / NO	NO	YE / 08/30/2001	YE / 08/30/2001
ALMADEN VINEYARDS INC PAICINES RANCH	CAD053995692		AIRLINE HWY PAICINES, CA, 95043
LOW / YES / 08/30/2006	YES / 04/09/2007	YE / 08/30/2006	YE / 08/30/2006
ALON USA LP	TXD008013468		200 REFINERY RD BIG SPRING, TX, 79720
HIGH / YES / 08/23/2007	YES / 08/23/2007	YE / 02/28/2003	YE / 02/28/2003
ALSIDE INC	OHD004163549		3773 STATE RD , CUYAHOGA FALLS, OH, 44223
HIGH / YES / 08/11/2005	YES / 08/09/2006	YE / 03/06/2002	YE / 03/31/2006
ALTON STEEL INC	ILD006280606		5 CUT ST ALTON, IL, 62002
HIGH / NO	NO	YE / 03/18/2004	YE / 06/19/2003
ALTUS AIR FORCE BASE	OK9571824045	US Air Force	97 CES/CEV 401 L AVE, ALTUS AFB, OK, 73523
HIGH / YES / 12/19/2007	NO	YE / 04/18/2005	YE / 10/18/2007
AMAX METALS RECOVERY, INC.	LAD058472721		3607 ENGLISH TURN ROAD BRAITHWAITE, LA, 70040
LOW / YES / 12/17/2007	YES / 04/02/2008	YE / 06/30/2003	YE / 06/30/2003
AMERCORD INC - GA EPD	GAD008966400		OCMULGEE ST INDUSTRIAL COMPLEX LUMBER CITY, GA, 31549
HIGH / NO	NO	YE / 09/22/1997	IN / 09/22/1997
AMERICAN AIRLINES M & E BASE	MOD043935048		9200 NW 112TH ST KANSAS CITY, MO, 64153
HIGH / YES / 08/07/1998	NO	YE / 05/31/2002	YE / 05/31/2002
AMERICAN AIRLINES, INC., M&E CENTER	OKD001824564		3800 N. MINGO ROAD, MD 508 , TULSA, OK, 74116
HIGH / YES / 05/27/1997	YES / 11/12/1998	YE / 06/07/2006	YE / 06/07/2006
AMERICAN AXLE AND MFG	MID000718551		1 MANUFACTURING DR THREE RIVERS, MI, 49093
HIGH / NO	NO	YE / 12/31/2007	YE / 12/31/2007
AMERICAN CANDLE CO	NYD000233510		1033 KINGS HWY SAUGERTIES, NY, 12477
HIGH / YES / 12/30/1993	YES / 10/30/1994	YE / 09/27/2000	YE / 06/19/2003
AMERICAN CAST IRON PIPE CO	ALD003397569		2930 NORTH 16TH STREET , BIRMINGHAM, AL, 35202
LOW / YES / 04/27/2007	YES / 12/19/2007	YE / 06/15/2007	YE / 06/15/2007
AMERICAN CHROME & CHEMICALS LP	TXD098818339		3800 BUDDY LAWRENCE DR CORPUS CHRISTI, TX, 78408
HIGH / NO	NO	YE / 02/09/2007	NO STATUS

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
AMERICAN COLOR & CHEMICAL CORP	PAD003047792		MOUNT VERNON ST LOCK HAVEN, PA, 17745-0088					
HIGH	YES	03/26/1997	YES	01/29/2004	YE	08/16/2002	YE	04/14/2003
AMERICAN CYANAMID CO	NJD002173276		E MAIN ST BRIDGEWATER, NJ, 08807					
HIGH	NO		NO		YE	09/26/2003	YE	09/26/2003
AMERICAN ENVIRONMENTAL SERVICES INC	KYD985073196		1689 SHAR-CAL ROAD , CALVERT CITY, KY, 42029					
HIGH	YES	09/16/2008	YES	09/16/2008	YE	04/28/2006	YE	04/28/2006
AMERICAN HOIST & DERRICK CO	MED001108463		143 FORE ST PORTLAND, ME, 04101					
HIGH	YES	06/21/2004	YES	06/21/2004	YE	11/10/1997	YE	01/25/2002
AMERICAN METALS CORPORATION	OHD004528873		1000 CROCKER ROAD WESTLAKE, OH, 44145					
HIGH	YES	08/19/2002	NO		YE	03/20/2003	YE	09/30/2004
AMERICAN NICKELOID CO	PAD002399285		129 CHERRY ST WALNUTPORT, PA, 18088-1608					
HIGH	NO		NO		YE	09/27/2002	YE	09/30/2004
AMERICAN OLEAN TILE COMPANY	PAD002347003		LANDSDALE PLANT 1000 CANNON AVE, LANSDALE, PA, 19446					
HIGH	YES	02/08/2000	YES	02/08/2000	YE	10/29/1999	YE	10/29/1999
AMERICAN REFINING GROUP	PAD001604693		77 NORTH KENDALL AVE BRADFORD, PA, 16701-1726					
HIGH	NO		NO		YE	01/04/2005	IN	04/09/2002
AMERICAN STANDARD INC PEABODY DIV	IND005161435		800 W 4TH ST NORTH MANCHESTER, IN, 46962					
HIGH	NO		NO		NO STATUS		NO STATUS	
AMERICAN STANDARD, INC.	NJD002366441		KLOCKNER ROAD TRENTON, NJ, 08619					
HIGH	NO		NO		YE	09/01/2000	YE	08/24/2000
AMERICAN WOOD - DIVISION OF POWE TIMBER	MSD021019914		HIGHWAY 15N RICHTON, MS, 39476					
HIGH	YES	05/30/2006	YES	05/30/2006	YE	09/23/1996	YE	09/23/1996
AMERICAS STYRENICS LLC ALLYNS POINT STYR	CTD001159730		1761 ROUTE 12 GALES FERRY, CT, 06335					
HIGH	YES	05/06/1997	NO		YE	03/31/1998	YE	03/31/1998
AMETEK US GAUGE DIVISION	PAD002342236		900 CLYMER AVE SELLERSVILLE, PA, 18960					
HIGH	NO		NO		YE	05/09/2003	YE	05/09/2003
AMLAND CORP/CHRYSLER-ROCKWELL INTL	IND981091515		13240 MCKINLEY AVE MISHAWAKA, IN, 46544					
HIGH	NO		NO		YE	07/14/2004	NO	09/29/2000
AMMUNITION ACCESSORIES INC. - CCI	IDD009066481		2299 SNAKE RIVER AVENUE LEWISTON, ID, 83501					
HIGH	YES	01/02/1997	YES	01/02/1997	YE	04/04/2001	YE	04/04/2001
AMOCO PIPELINE TANK FARM	WYD991301086		1MI N AMOCO CASPER REFINERY CASPER, WY, 82601					
HIGH	YES	11/19/2001	NO		YE	12/23/2003	YE	12/23/2003
AMOCO, RIVERFRONT PROPERTY	ILD980503106		301 EVANS AVE RIVERFRONT WOOD RIVER, IL, 62095					
HIGH	NO		NO		YE	02/11/2002	YE	05/20/2002
AMOCO, WOOD RIVER RFNRY	ILD980700967		301 EVANS AVE P O BOX 65, WOOD RIVER, IL, 62095					
HIGH	NO		NO		YE	09/28/2001	YE	03/13/2002
AMPCO PITTSBURGH CORP	MID004508628		1000 GENERAL DR PLYMOUTH, MI, 48170					
HIGH	YES	03/26/2002	YES	08/29/2003	YE	02/18/1996	YE	02/18/1996
AMPHENOL CORP BENDIX CONNECTOR DIV	NYD981133184		RIVER ST SIDNEY, NY, 13838					
MEDIUM	YES	04/27/2006	YES	04/27/2006	YE	09/24/1999	YE	09/24/1999
ANACOMP INC	CAD051612802		305 SOQUEL WY AND 307 N PASTORIA AVE TSDF PT, SUNNYVALE, CA, 94086					
MEDIUM	NO		NO		YE	12/28/2000	YE	12/28/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
ANADARKO PETROLEUM OLD ENID REF UNION PA	OKD007234586		2529 E WILLOW , ENID, OK, 73701					
HIGH	NO		NO		YE	05/17/2001	YE	05/17/2001
ANCHOR LAMINA AMERICA INC	MID006017966		3650 S DERENZY RD BELLAIRE, MI, 49615					
HIGH	YES	09/30/1999	YES	09/30/1999	YE	06/10/1999	YE	06/10/1999
ANDEROL INC.	NJD002160208		215 MERRY LANE EAST HANOVER, NJ, 07936					
HIGH	NO		NO		YE	09/28/2007	YE	09/24/2008
ANDERSON GENEVA DEVELOPMENT, INC.	UTD009086133		99 NORTH GENEVA ROAD VINEYARD, UT, 84057					
HIGH	YES	11/01/2006	NO		YE	08/12/2003	YE	03/21/2006
ANDREW WILLGOOS TURBINE LABORATORY	CTD000845131		PENT ROAD EAST HARTFORD, CT, 06108					
MEDIUM	NO		NO		YE	12/13/2001	YE	01/06/2003
AOC LLC	IND980502074		2552 INDUSTRIAL DR VALPARAISO, IN, 46383					
HIGH	NO		NO		YE	02/04/1993	YE	02/04/1993
APPALACHIAN TIMBER SERVICE	WVD063461958		393 EDGAR GIVEN PARKWAY , SUTTON, WV, 26601					
HIGH	YES	06/12/1997	NO		YE	09/29/2004	YE	09/08/2004
APPLIED MATERIALS	CAD069130995		974 E ARQUES AVE , SUNNYVALE, CA, 94086					
HIGH	NO		NO		YE	12/28/2000	YE	12/28/2000
APPROVED OIL SERVICES INC	COD060627262		5390 E 72ND AVE COMMERCE CITY, CO, 80022					
HIGH	YES	11/19/2001	YES	12/10/2003	YE	07/16/2001	YE	03/02/2004
APV CREPACO INC NORTH PLANT	WID980570584		621 E LAKE ST LAKE MILLS, WI, 53551					
HIGH	NO		NO		YE	09/25/2007	YE	09/25/2007
ARCELOR MITTAL WEIRTON INC	WVD000068908		ROUTE #2 MAIN ST , WEIRTON, WV, 26062					
HIGH	NO		NO		YE	09/12/2005	YE	10/03/2005
ARCELORMITTAL BURNS HARBOR LLC	IND003913423		250 W US HWY 12 BURNS HARBOR, IN, 46304					
HIGH	NO		NO		YE	05/16/2003	YE	05/16/2003
ARCELORMITTAL HENNEPIN INC	ILD000781591		10726 STEEL DR HENNEPIN, IL, 61327					
HIGH	NO		NO		YE	04/13/2005	YE	04/05/2004
ARCELORMITTAL INDIANA HARBOR LLC	IND005462601		3001 DICKEY RD EAST CHICAGO, IN, 46312					
HIGH	NO		NO		NO STATUS		NO STATUS	
ARCELORMITTAL ISG STEELTON INC	PAD003026531		215 SOUTH FRONT ST STEELTON, PA, 17113					
HIGH	YES	01/21/1994	YES	01/12/1995	YE	09/23/2002	YE	09/23/2002
ARCELORMITTAL USA INC	IND005159199		3210 WATLING ST EAST CHICAGO, IN, 46312					
MEDIUM	NO		NO		YE	09/13/2005	IN	01/19/1999
ARCH CHEMICALS INC	KYD006396246		2450 OLIN ROAD , BRANDENBURG, KY, 40108					
HIGH	NO		NO		YE	09/18/2003	YE	07/09/1996
ARCH CHEMICALS INC	NYD002220804		100 MCKEE RD ROCHESTER, NY, 14611					
MEDIUM	YES	04/07/1997	NO		NO STATUS		YE	09/26/2005
ARCH WOOD PROTECTION	IND000781609		2852 RAYSTONE DR , VALPARAISO, IN, 46383					
HIGH	NO		NO		YE	09/30/1992	YE	09/30/1992
ARCH WOOD PROTECTION	GAD000821934		1579 KOPPERS ROAD CONLEY, GA, 30288					
HIGH	YES	06/22/2006	YES	06/22/2006	YE	10/07/1998	YE	10/07/1998
ARCHIMICA INC	MOD095038329		2460 W BENNETT ST SPRINGFIELD, MO, 658071229					
HIGH	NO		NO		YE	09/26/2001	YE	09/22/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
ARGONNE NATIONAL LABORATORY	IL3890008946	Dept. of Energy	9700 S CASS AVE BLDG 306 LEMONT, IL, 60439-4803
HIGH	YES	03/29/2006	YES	03/29/2006	YE	06/28/2002	YE	06/18/2002
ARISTECH CHEM CORP	NJD001724988		1711 W ELIZABETH AVE LINDEN, NJ, 07036
HIGH	NO		NO		YE	12/18/2003	YE	09/20/2002
ARIZONA CHEMICAL	OHD004209094		875 HARGER ST DOVER, OH, 44622
HIGH	YES	11/15/1999	YES	05/20/2005	YE	09/04/2002	YE	05/13/1999
ARIZONA CHEMICAL	GAD003299526		1401 EAST HILL AVENUE VALDOSTA, GA, 31601
LOW	YES	09/29/2006	YES	09/29/2006	YE	09/17/2001	YE	09/11/2002
ARIZONA CHEMICAL COMPANY INC	FLD004065926		2 S EVERITT AVE PANAMA CITY, FL, 324014989
HIGH	YES	08/24/2006	YES	08/24/2006	YE	06/25/1999	YE	09/26/2003
ARKEMA INC	KYD006373922		2316 HIGHLAND AVENUE , CARROLLTON, KY, 41008
HIGH	NO		NO		YE	07/23/2001	YE	07/23/2001
ARKEMA INC	KYD006370159		4444 INDUSTRIAL PKWY , CALVERT CITY, KY, 42029
HIGH	NO		NO		YE	04/25/2000	NO	06/07/1996
ARKEMA INC	ALD000827154		13755 HIGHWAY 43 NORTH AXIS, AL, 365050099
LOW	YES	02/06/2008	YES	02/06/2008	YE	08/24/2001	YE	08/24/2001
ARKEMA INC	MID005363114		17168 JEFFERSON RIVERVIEW, MI, 48193
MEDIUM	NO		NO		YE	09/30/2004	YE	06/22/2005
ARKEMA INC.	NYD002218436		GENESEE STREET PIFFARD, NY, 14533
HIGH	YES	06/22/2006	YES	12/07/2006	YE	09/29/2000	YE	09/29/2000
ARMSTRONG WOOD PRODUCTS INC	FLD099703613		3820 MAINE AVE LAKELAND, FL, 338019757
MEDIUM	YES	08/16/2006	YES	08/16/2006	YE	08/08/2006	YE	08/16/2006
ARNOLD ENG DEVELOPMENT CENTER/SDE	TN8570024044	US Air Force	ARNOLD AIR FORCE BASE 100 KENDELDRIVE, SUITE A228, TULLAHOMA, TN, 37389-1228
HIGH	NO		NO		YE	09/30/2002	YE	09/29/2003
ARSYNCO INC	NJD044688935		13TH ST - FOOT OF CARLSTADT, NJ, 07072
HIGH	NO		NO		YE	09/21/2004	YE	07/23/2004
ARVIN MERITOR INC	IND000810903		505 INDUSTRIAL DR , NORTH VERNON, IN, 47265
HIGH	YES	07/19/2006	YES	10/18/2006	YE	09/30/2005	YE	08/25/2004
ASARCO LLC	TXD087491973		7901 N STATE HIGHWAY 136 AMARILLO, TX, 79108
HIGH	NO		NO		YE	08/03/2007	YE	11/05/2007
ASARCO LLC EAST HELENA PLANT	MTD006230346		100 SMELTER RD S OF EAST HELENA, EAST HELENA, MT, 596350000
HIGH	NO		NO		IN	02/07/2006	IN	02/07/2006
ASARCO LLC GLOBE PLANT	COD007063530		495 E 51ST AVE DENVER, CO, 80216
HIGH	YES	02/18/1993	NO		YE	07/12/2000	YE	07/12/2000
ASF-KEYSTONE	OHD017497587		20455 LAKE PK & HEACOCK RDS SMITH TOWNSHIP, OH, 44672
HIGH	NO		NO		YE	01/23/2001	YE	01/30/2001
ASHLAND CHEMICAL CO	CAD066562521		8610 ENTERPRISE DR NEWARK, CA, 945603315
MEDIUM	NO		NO		YE	09/19/2002	YE	09/19/2002
ASHLAND CHEMICAL CO	CAD091933895		291 W ADAMS ST COLTON, CA, 92324
LOW	NO		NO		YE	09/27/2004	YE	09/29/2005
ASHLAND CHEMICAL INC	FLD079859492		1645 MCDUFF AVE N JACKSONVILLE, FL, 322542091
HIGH	YES	09/14/2006	YES	09/14/2006	YE	08/18/1999	YE	08/27/2003

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
ASHLAND CHEMICAL INC	FLD059861344		200 NE 181ST ST MIAMI, FL, 331621081					
HIGH	YES	01/10/2000	YES	07/11/2006	YE	03/31/2004	YE	03/31/2004
ASHLAND CHEMICAL INC	WID053689196		1033 N HAWLEY ROAD MILWAUKEE, WI, 53208					
MEDIUM	YES	09/30/1999	NO		YE	02/19/2003	YE	09/29/2005
ASHLAND DISTRIBUTION	TND095058541		5263 NORTH NATIONAL DRIVE KNOXVILLE, TN, 37914					
HIGH	NO		NO		YE	08/27/2000	YE	08/27/2000
ASHLAND DISTRIBUTION	MSD000829150		455 INDUSTRIAL DRIVE JACKSON, MS, 39209					
MEDIUM	NO		NO		YE	09/23/2008	YE	09/23/2008
ASHLAND DISTRIBUTION	GAD066465824		4550 NE EXPRESSWAY DORAVILLE, GA, 30340					
HIGH	YES	09/30/1994	NO		YE	09/08/2005	NO	05/14/2003
ASHLAND DISTRIBUTION	GAD041007063		400 TELFAIR ROAD SAVANNAH, GA, 31401					
MEDIUM	NO		NO		YE	09/20/2005	YE	09/20/2005
ASHLAND DISTRIBUTION	MOD031005341		7710 POLK ST , ST LOUIS, MO, 63111					
HIGH	NO		NO		YE	09/30/2004	YE	09/30/2004
ASHLAND DISTRIBUTION	TND048319644		2351 CHANNEL AVENUE , MEMPHIS, TN, 38113					
HIGH	YES	03/20/2008	YES	03/20/2008	YE	09/20/1996	YE	09/19/2001
ASHLAND DISTRIBUTION	FLD067230771		5125 W HANNA AVE TAMPA, FL, 336348065					
HIGH	NO		NO		YE	09/26/2002	YE	04/08/2005
ASHLAND DISTRIBUTION	ILD980700538		8500 WILLOW SPRINGS RD , WILLOW SPRINGS, IL, 604801223					
HIGH	NO		NO		YE	08/25/2004	YE	06/06/2005
ASHLAND DISTRIBUTION CO	IND016621476		1817 W INDIANA AVE , SOUTH BEND, IN, 46613					
HIGH	NO		NO		YE	05/19/2000	YE	09/19/2005
ASHLAND DISTRIBUTION CO	OHD000723973		200 DARROW RD AKRON, OH, 44305					
MEDIUM	YES	12/31/1997	YES	10/23/2006	YE	02/25/2000	YE	09/24/2003
ASHLAND DISTRIBUTION CO	KSD057889313		5420 SPEAKER RD , KANSAS CITY, KS, 66106					
MEDIUM	YES	02/05/1999	YES	02/09/2001	YE	09/19/2001	YE	09/19/2001
ASHLAND DISTRIBUTION CO	WID000713602		204 MADISON ST , MENASHA, WI, 54952					
MEDIUM	YES	07/17/2007	NO		YE	09/03/2008	YE	09/03/2008
ASHLAND DISTRIBUTION COMPANY	CAD044061422		10505 S. PAINTER AVENUE SANTA FE SPRINGS, CA, 90670					
MEDIUM	NO		NO		YE	09/26/2002	YE	09/16/2004
ASHLAND INC	MID047173653		1800 GLENROSE AVE LANSING, MI, 48915					
MEDIUM	NO		NO		YE	04/28/2005	YE	05/26/2005
ASHLAND SPECIALTY CHEMICAL CO	ILD043369446		142ND & PAXTON AVE CALUMET CITY, IL, 60409					
HIGH	NO		NO		YE	12/03/2004	YE	09/16/2003
ATK LAUNCH SYSTEMS INC. (BACCHUS)	UTD001705029		5000 SOUTH HIGHWAY 111 , MAGNA, UT, 84044					
HIGH	NO		NO		YE	09/20/2004	IN	09/16/1996
ATK TACTICAL SYSTEMS DIVISION	WV0170023691		210 STATE ROUTE 956 , ROCKET CENTER, WV, 267263548					
HIGH	NO		NO		NO STATUS		NO STATUS	
ATKEMIX TEN INC	KYD006372197		6100 CAMPGROUND ROAD , LOUISVILLE, KY, 40216					
HIGH	NO		NO		YE	09/28/2004	YE	10/19/2005
ATLANTIC COAST ENVIRONMENTAL INC	DED000796300		225 STATE COLLEGE RD DOVER, DE, 19901					
HIGH	YES	09/30/1996	YES	09/30/1996	YE	01/18/2002	YE	01/18/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
ATLANTIC RESEARCH CORPORATION	VAD023741705		5945 WELLINGTON ROAD GAINESVILLE, VA, 20155
HIGH	YES	09/30/1991	YES	03/03/1999	YE	03/03/1999	YE	03/03/1999
ATLANTIC WOOD INDUSTRIES INC	GAD084914787		202 OXNARD DR PORT WENTWORTH, GA, 31407
HIGH	NO		NO		YE	09/29/2003	YE	06/24/2005
ATOFINA CHEMICALS INC	NJD052788528		SOUTH ST HOLMDEL, NJ, 07733
HIGH	NO		NO		YE	09/30/2002	YE	09/30/2002
AUBREY MFG INC	ILD005238159		6709 S MAIN ST UNION, IL, 60180
HIGH	NO		NO		YE	12/09/1999	YE	12/09/1999
AUBURN FOUNDRY LANDFILL	IND005070685		1537 AUBURN RD AUBURN, IN, 46706
HIGH	NO		NO		YE	09/19/2008	YE	09/19/2008
AUBURN UNIVERSITY	ALD000826958		971 CAMP AUBURN ROAD , AUBURN UNIVERSITY, AL, 368495317
HIGH	NO		NO		YE	09/30/1999	YE	09/30/1999
AUSTIN POWDER CO	OHD004293775		430 POWDER PLANT RD MCARTHUR, OH, 456510317
HIGH	YES	12/05/2006	YES	12/05/2006	YE	12/22/2000	YE	05/12/2003
AUTOLIV ASP INC	COD005127279		34501 E QUINCY AVE AURORA, CO, 80015
HIGH	YES	09/10/1997	YES	09/10/1997	YE	06/15/2000	YE	06/15/2000
AUTOMOTIVE COMPONENTS HOLDINGS LLC	MID005057005		3200 E ELM AVE MONROE, MI, 48162
HIGH	NO		NO		YE	10/01/2001	YE	03/25/2005
AUTOMOTIVE COMPONENTS HOLDINGS, LLC	OHD004461208		3020 TIFFIN AVENUE SANDUSKY, OH, 44870
HIGH	NO		NO		YE	08/04/2003	YE	08/04/2003
AVERY DENNISON FASSON ROLL DIV	PAD053277752		35 PENN AM DR QUAKERTOWN, PA, 18951
HIGH	YES	05/18/2000	YES	05/18/2000	YE	11/05/1999	YE	01/03/2000
AZS CORPORATION	GAD981237225		762 MARIETTA BLVD ATLANTA, GA, 30318
LOW	NO		NO		YE	09/08/2006	YE	09/08/2006
B A S F CORP	VAD990710642		RTE 60 EAST WILLIAMSBURG, VA, 23187
HIGH	NO		NO		YE	09/30/2003	YE	09/27/2004
BAE SYSTEMS LAND & ARMAMENTS LP	PAD003025418		1100 BAIRS RD YORK, PA, 17405
HIGH	YES	03/06/2006	YES	03/06/2006	YE	09/27/2002	YE	09/27/2002
BAE SYSTEMS NORFOLK SHIP REPAIR	VAD003175072		750 WEST BERKLEY AVENUE NORFOLK, VA, 23523
LOW	NO		NO		NO STATUS		NO STATUS	
BAKER PERFORMANCE CHEMICALS INC	TXD047872890		410 HILLMONT ODESSA, TX, 79764
LOW	YES	02/28/2006	YES	02/28/2006	YE	02/02/2000	YE	02/02/2000
BALDWIN HARDWARE CORP	PAD002350833		841 WYOMISSING BLVD READING, PA, 19612
LOW	YES	11/01/1984	YES	04/25/1988	YE	09/18/2006	YE	08/27/2007
BALDWIN POLE & PILING CO INC	ALD031490501		1101 HWY 31 NORTH , BAY MINETTE, AL, 36507
HIGH	YES	09/30/2004	YES	09/30/2004	YE	08/19/1999	YE	08/19/1999
BALL & SOCKET MFG CO INC	CTD001167493		493 W MAIN ST CHESHIRE, CT, 06410
HIGH	NO		NO		YE	08/22/2005	YE	09/26/2005
BARIUM & CHEMICALS INC	OHD004323465		515 KINGSDALE ROAD STEUBENVILLE, OH, 43952
HIGH	NO		NO		YE	03/10/2008	YE	03/10/2008
BARKSDALE AIR FORCE BASE	LA9571924050	US Air Force	2CES/ CEV 334 DAVIS AVE WEST SUITE 208, BARKSDALE AFB, LA, 71110
HIGH	NO		NO		YE	09/27/2001	YE	06/09/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
BARNES AEROSPACE WINDSOR DIV	CTD001148303		169 KENNEDY ROAD WINDSOR, CT, 06095					
HIGH	NO		NO		YE	09/04/2001	YE	09/04/2001
BARON BLAKESLEE	ORD061483384		5920 NE 87TH PORTLAND, OR, 97220-1314					
HIGH	YES	09/12/2008	NO		YE	04/19/2005	YE	04/19/2005
BASE TRANSITION TEAM - FT CHAFFEE	AR9210020187	US Army	BLDG 2033 1ST AVE BARLING, AR, 72923					
HIGH	YES	06/26/2002	YES	11/20/2003	YE	09/25/2002	YE	09/17/2002
BASF CATALYST LLC	OHD004203519		120 PINE ST , ELYRIA, OH, 44035					
MEDIUM	YES	02/12/1998	NO		YE	02/02/1999	YE	02/02/1999
BASF CATALYSTS LLC	MAD001190644		RTE 152 PLAINVILLE, MA, 02762					
HIGH	NO		NO		YE	09/10/2002	YE	03/21/2007
BASF CORP	MID048223986		471 HOWARD AVE HOLLAND, MI, 49423					
HIGH	NO		NO		YE	03/10/2004	YE	06/14/2007
BASF CORP	MID064197742		1609 BIDDLE AVE WYANDOTTE, MI, 48192					
HIGH	NO		NO		YE	06/30/2005	YE	09/30/2005
BASF CORP	MOD050226075		3150 HWY JJ PALMYRA, MO, 634612611					
HIGH	NO		NO		YE	08/13/2007	YE	09/12/2007
BASF CORPORATION	LAD040776809		8404 RIVER ROAD GEISMAR, LA, 70734					
HIGH	NO		NO		YE	12/18/2001	YE	12/18/2001
BASS PLATING CO THE	CTD001145671		82 OLD WINDSOR ROAD BLOOMFIELD, CT, 06002					
HIGH	NO		NO		YE	09/25/2003	YE	09/30/2002
BATES SUSAN INC	CTD080848666		212 MIDDLESEX AVE RTE 9A CHESTER, CT, 06412					
HIGH	YES	03/21/2000	YES	03/21/2000	YE	09/26/2000	YE	09/26/2000
BATH IRON WORKS-HARDINGS FACILITY	MED000841056		ROUTE ONE BRUNSWICK, ME, 04011					
HIGH	YES	06/29/2006	YES	06/26/2006	YE	06/30/2006	YE	06/30/2006
BATON ROUGE FACILITY	LAD079460895		GULF STATES ROAD & KCS RR BATON ROUGE, LA, 70805					
HIGH	NO		NO		YE	04/08/2005	IN	03/19/2007
BATTERY PARK INDUSTRIES INC	FLD043860451		12801 US HIGHWAY 441 ALACHUA, FL, 326158503					
HIGH	YES	09/05/1997	YES	09/25/1998	YE	09/30/2005	YE	09/30/2005
BAUSCH & LOMB INC	NYD002207744		465 PAUL RD ROCHESTER, NY, 146030450					
MEDIUM	YES	02/24/1998	YES	07/31/1999	YE	09/28/2007	YE	06/28/2007
BAY ZINC CO INC	WAD027530526		301 W CHARRON RD MOXEE CITY, WA, 989360167					
HIGH	YES	10/31/2002	YES	03/31/2003	YE	09/06/2006	YE	09/06/2006
BAYER CORP	TXD084972777		8701 PARK PLACE BLVD HOUSTON, TX, 77017					
HIGH	YES	02/06/2008	YES	02/06/2008	YE	10/22/2001	YE	08/28/2002
BAYER CORP	VAD003379062		807 SOUTH SHADY AVE DAMASCUS, VA, 24236					
MEDIUM	YES	06/24/1998	YES	06/24/1998	YE	08/20/2002	YE	08/20/2002
BAYER CROPSCIENCE	MOD056389828		8400 HAWTHORN RD KANSAS CITY, MO, 64120					
HIGH	NO		NO		YE	09/30/2003	YE	09/28/2005
BAYER CROPSCIENCE LP	MID080358351		1740 WHITEHALL RD MUSKEGON, MI, 49445					
HIGH	NO		NO		YE	09/14/2005	YE	09/23/2004
BAYER CROPSCIENCE LP	WVD005005509		RT. 25 & I64 INSTITUTE, WV, 25112					
HIGH	NO		NO		YE	09/15/2003	YE	10/03/2005

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
BAYER MATERIAL SCIENCE LLC	WVD056866312		STATE ROUTE 2 , NATRIUM, WV, 26155
HIGH / NO	NO	YE / 01/29/2002	YE / 07/02/2002
BAYER MATERIALSCIENCE LLC	TXD058260977		8500 W BAY RD BAYTOWN, TX, 77520
HIGH / YES / 08/09/2006	YES / 07/28/2008	YE / 01/13/2000	YE / 01/13/2000
BEALE AIR FORCE BASE	CA7570024508	US Air Force	9 CES/CEV 6601 B STREET, BEALE AFB, CA, 95903
HIGH / NO	NO	YE / 09/13/2004	NO / 01/10/2001
BEAZER EAST INC	ALD000771949		2134 KOPPERS DRIVE , DOLOMITE, AL, 35061
HIGH / NO	NO	YE / 09/30/2004	YE / 09/30/2004
BEAZER EAST INC	OHD004198784		1359 LOGAN AVE YOUNGSTOWN, OH, 44505
HIGH / YES / 12/27/2000	NO	YE / 09/17/2003	NO / 05/06/1999
BEAZER EAST INC	NHD001084979		2 HILLS FERRY RD NASHUA, NH, 03061
HIGH / NO	NO	NO STATUS	NO STATUS
BEAZER EAST INC	ILD000819946		1555 N MARION ST CARBONDALE, IL, 62901
HIGH / YES / 06/02/2004	NO	YE / 09/15/2005	YE / 10/02/2006
BEAZER EAST INC	OHD068911494		12873 BURTON CITY RD ORRVILLE, OH, 44667
HIGH / NO	NO	YE / 03/29/2006	YE / 03/29/2006
BEAZER EAST INC	PAD063764898		262 MILLER RUN RD BRIDGEVILLE, PA, 15017
HIGH / NO	NO	YE / 08/26/2003	YE / 08/26/2003
BEAZER EAST INC & KOPPERS INC	ALD004009403		1415 LOUISVILLE STREET , MONTGOMERY, AL, 361010530
MEDIUM / NO	NO	YE / 12/08/2003	YE / 12/08/2003
BEAZER EAST INC KANSAS CITY	MOD007146517		6740 STADIUM DR KANSAS CITY, MO, 641291816
HIGH / YES / 09/23/2005	NO	YE / 09/30/2003	YE / 09/30/2003
BEAZER EAST INC-PORT NEWARK	NJD000542282		MARITIME & TYLER PORT NEWARK, NJ, 15219
HIGH / YES / 08/10/2007	YES / 03/18/2008	YE / 08/01/2002	YE / 01/03/2003
BEAZER EAST, INC.	VAD003125770		4020 KOPPERS RD , SALEM, VA, 24153
HIGH / NO	NO	YE / 09/30/2004	YE / 09/29/2003
BEAZER EAST-COLLIERS	WVD980707178		RD 1 CROSSCREEK DISTRICT , COLLIERS, WV, 26035
HIGH / NO	NO	YE / 03/22/2000	YE / 03/22/2000
BEDFORD MATERIALS CO	PAD057631889		7676 ALLEGHENY RD MANNS CHOICE, PA, 15550
HIGH / YES / 11/01/2000	YES / 11/01/2000	YE / 08/14/2000	YE / 08/14/2000
BEHLEN MFG CO	NED007268790		4025 E 23RD STREET COLUMBUS, NE, 68601
HIGH / NO	NO	YE / 07/30/2004	NO / 08/02/2004
BELL AEROSPACE TEXTRON	NYD002106276		9812 NIAGARA FALLS BLVD WHEATFIELD, NY, 14150
HIGH / YES / 05/02/1994	YES / 12/14/1995	YE / 09/20/2000	YE / 09/29/1999
BELL HELICOPTER TEXTRON INC	TXD980626006		600 E HURST BLVD HURST, TX, 76053
HIGH / NO	NO	YE / 02/28/2005	YE / 02/28/2005
BENTON CREOSOTING WORKS	LAD008056632		6695 HWY 3 BENTON, LA, 71006
HIGH / NO	NO	YE / 06/30/2003	YE / 06/30/2003
BERKLEY PRODUCTS CO INC	PAD003003894		405 S 7TH ST AKRON, PA, 17501
HIGH / NO	NO	YE / 09/25/2006	NO STATUS
BETTIS ATOMIC POWER LAB	PA0890090004	Dept. of Energy	PGH-MCKEESPORT BLVD WEST MIFFLIN, PA, 15122-0109
HIGH / YES / 10/03/1997	NO	YE / 12/23/1999	YE / 12/23/1999

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
BF GOODRICH TIRE MFG	IND005421987		18906 US 24 E WOODBURN, IN, 467970277					
HIGH	NO		NO		YE	09/17/2004	YE	09/11/2008
BFI MISSOURI CITY LANDFILL	MOD000624452		8501 STILLHOUSE RD LIBERTY, MO, 64068					
HIGH	YES	12/19/2000	YES	09/30/2008	YE	09/30/2004	NO	02/15/1996
BFI, DAVIS JUNCTION	ILD980700751		8902 N RTE 251 DAVIS JUNCTION, IL, 61020					
HIGH	YES	09/17/1996	YES	09/17/1996	YE	09/17/1996	YE	09/17/1996
BIG WEST OF CALIFORNIA LLC - AREA 1	CAD099457087		6451 ROSEDALE HIGHWAY BAKERSFIELD, CA, 93308					
HIGH	NO		NO		YE	09/27/2002	YE	09/29/2003
BINGHAM & TAYLOR	VAD003064490		522 NALLE PLACE CULPEPER, VA, 22701					
HIGH	YES	10/27/2004	YES	10/27/2004	YE	09/26/2003	YE	01/27/2004
BIRKEN MFG CO	CTD001144062		3 OLD WINDSOR ROAD BLOOMFIELD, CT, 06002					
MEDIUM	NO		NO		YE	09/26/2008	YE	12/02/2002
BKK LANDFILL	CAD067786749		2210 SOUTH AZUSA AVENUE WEST COVINA, CA, 91792					
HIGH	NO		NO		IN	05/26/1999	NO	05/26/1999
BKOP1 LLC	FLD083200998		6000 FRUITVILLE RD SARASOTA, FL, 342326414					
HIGH	YES	01/17/2006	YES	01/17/2006	YE	08/24/1996	YE	09/25/2001
BLACK & DECKER	PAD003001732		1801 SOUTH 12TH ST ALLENTOWN, PA, 18103					
HIGH	NO		NO		YE	09/14/2001	NO STATUS	
BLACK & DECKER (U.S.), INC.	NYD002221919		STATE STREET BROCKPORT, NY, 14420					
HIGH	NO		NO		YE	09/30/2003	YE	09/26/2002
BLACK RIVER SCHOOLS	MID006411953		491 COLUMBIA AVE HOLLAND, MI, 49423					
LOW	YES	09/21/2006	NO		YE	09/21/2006	YE	09/16/2003
BLACKHAWK FOUNDRY & MACHINE CO	IAD005264049		323 S CLARK ST DAVENPORT, IA, 52802					
MEDIUM	NO		NO		YE	08/03/2002	YE	09/30/1999
BLACKMAN UHLER CHEMICAL CO	GAD042125146		1010 GLASS FACTORY AVE AUGUSTA, GA, 30901					
HIGH	YES	10/24/2005	YES	01/06/2006	YE	09/30/1997	YE	09/30/1997
BLACKMAN UHLER CHEMICAL DIV OF SYNALLOY	SCD003349065		2155 W CROFT CIRCLE DR SPARTANBURG, SC, 29302					
HIGH	YES	09/13/2007	NO		YE	03/15/2004	YE	07/20/2004
BLUE BIRD CORPORATION	GAD980729974		402 BLUE BIRD BLVD FORT VALLEY, GA, 31030					
LOW	NO		NO		YE	09/15/2003	YE	09/15/2003
BLUE COW INC	MID060197662		33 STATE ST MIDDLEVILLE, MI, 49333					
HIGH	YES	06/13/1996	YES	01/16/1998	YE	01/16/1998	YE	01/16/1998
BLUE GRASS ARMY DEPOT LEXINGTON	KY0210020509	US Army	HALEY RD LEXINGTON, KY, 40511					
HIGH	YES	09/29/2006	YES	06/15/2007	YE	08/26/2004	YE	08/29/2002
BLUE GRASS ARMY DEPOT, RICHMOND	KY8213820105	US Army	431 BATTLEFIELD MEMORIAL HIGHWAY RICHMOND, KY, 40475					
HIGH	NO		NO		YE	09/19/2003	YE	08/27/2002
BLUE LAKE INC	IND046107157		3023 W MORRIS INDIANAPOLIS, IN, 46241					
HIGH	NO		NO		YE	08/18/2006	YE	08/18/2006
BNSF PARADISE TIE PLANT	MTD000716787		HIGHWAY 200 BN TIE PLANT RD SW OF PARADISE, PARADISE, MT, 59856					
HIGH	YES	07/26/2006	YES	07/26/2006	YE	09/23/2003	YE	09/30/2003
BNSF RAILWAY COMPANY	TXD000778621		HWY 36 N @ AVE E SOMERVILLE, TX, 77879					
HIGH	NO		NO		YE	08/09/2004	YE	08/09/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
BNSF RAILWAY COMPANY	NED000822767		801 WEST O STREET , LINCOLN, NE, 68528					
HIGH	NO		NO		YE	06/17/2004	YE	09/21/2005
BOEING A&M DEVELOPMENTAL CENTER	WAD093639946		9725 E MARGINAL WAY S SEATTLE, WA, 98108					
HIGH	NO		NO		YE	08/05/2004	YE	08/05/2004
BOEING CO SSFL ETEC AREA I V	CAD000629972		TOP OF WOOLSEY CANYON RD HWMF SIMI VALLEY, CA, 93063					
HIGH	NO		NO		YE	09/29/2003	IN	04/04/2000
BOEING EVERETT	WAD041585464		3003 W CASINO RD EVERETT, WA, 98204					
HIGH	NO		NO		YE	08/18/2006	IN	08/22/2007
BOEING OF PORTLAND	ORD054964481		19000 NE SANDY BLVD PORTLAND, OR, 97230					
HIGH	YES	07/24/1997	YES	09/30/2002	YE	03/01/1999	YE	03/01/1999
BOEING PLANT 2	WAD009256819		7755 E MARGINAL WAY S SEATTLE, WA, 98108					
HIGH	NO		NO		NO	09/01/2004	NO	09/01/2004
BOEING RENTON	WAD009262171		800 N 6TH ST RENTON, WA, 98055					
HIGH	NO		NO		YE	09/01/2005	IN	09/01/2005
BOHLER UDDEHOLM SPECIALTY METALS INC	VAD089022685		2306 EASTOVER DR SOUTH BOSTON, VA, 24592					
LOW	NO		NO		YE	07/31/2006	YE	07/17/2006
BOISE CASCADE CORPORATION INSULITE DIV	MND980700884		400 W 2ND ST INTERNATIONAL FALLS, MN, 56649					
MEDIUM	YES	03/25/2008	YES	03/25/2008	YE	08/16/2006	YE	08/16/2006
BON L MANUFACTURING COMPANY	GAD003273224		25 BONNELL ST. NEWNAN, GA, 30263					
HIGH	NO		YES	08/20/2008	YE	09/24/2001	YE	09/24/2001
BORDEN CHEMICAL PRINTING INK DIV	OHD005043740		6725 GILEAD ST WHITEHOUSE, OH, 43571					
HIGH	NO		NO		YE	07/31/2007	YE	07/31/2007
BORICUA WOOD PROCESSING INC	PRD090564477		RD 865 KM 5.5 TOA BAJA, PR, 00759					
HIGH	YES	07/07/2006	YES	07/07/2006	YE	09/24/2003	YE	09/30/1999
BOSTIK, INC	MAD001039767		211 BOSTON ST MIDDLETON, MA, 01949					
HIGH	NO		NO		YE	09/26/2005	YE	09/09/2005
BOULDEN INC T/A DIRT MAGNET	MDD980550198		895 NOTTINGHAM ROAD CECIL, MD, 21921					
HIGH	YES	07/17/1998	YES	07/17/1998	YE	06/03/1999	YE	06/03/1999
BOVANO INC	CTD001179316		830 MAIN STREET CHESHIRE, CT, 06410					
HIGH	YES	08/15/2008	YES	08/15/2008	YE	09/29/1999	YE	04/30/2001
BOYERTOWN SANITARY DISPOS	PAD048603005		300 MERKEL RD GILBERTSVILLE, PA, 19525					
HIGH	NO		NO		YE	08/03/2004	YE	02/16/2001
BP OIL INC	PAD071612683		4100 POST RD MARCUS HOOK, PA, 19061					
HIGH	NO		NO		YE	09/12/2000	YE	09/12/2000
BP PRODUCTS NORTH AMERICA INC	MOD007161425		1000 N STERLING SUGAR CREEK, MO, 64054					
HIGH	NO		NO		YE	09/30/2002	YE	09/30/2003
BP PRODUCTS NORTH AMERICA INC	OHD005051826		1150 S METCALF ST LIMA, OH, 45804					
HIGH	NO		NO		YE	10/29/2001	YE	10/29/2001
BP PRODUCTS NORTH AMERICA INC	IND074375585		2815 INDIANAPOLIS BLVD WHITING, IN, 46394					
HIGH	NO		NO		YE	04/16/2002	YE	08/27/2001
BP PRODUCTS NORTH AMERICA INC TOLEDO REF	OHD005057542		4001 CEDAR POINT RD OREGON, OH, 43616					
HIGH	NO		NO		YE	10/29/2001	YE	10/29/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
BP PRODUCTS NORTH AMERICA, INC.	WYD007064447		1707 WEST YELLOWSTONE HWY CASPER, WY, 82601
BP WEST COAST PRODUCTS - CARSON REFINERY	CAD077227049		1801 E. SEPULVEDA BLVD. CARSON,, CA, 90745
BRADFORD ELECTRONICS INC	PAD046762258		550 HIGH ST BRADFORD, PA, 167010798
BRC RUBBER	IND005081526		589 US 33 S CHURUBUSCO, IN, 46723
BRENNTAG GREAT LAKES LLC	WID023350192		N59 W14776 BOBOLINK AVE MENOMONEE FALLS, WI, 53051
BRENNTAG MID-SOUTH INC	IND072081169		1400 LOCKPORT RD TERRE HAUTE, IN, 47802
BRENNTAG SOUTHEAST - GREENSBORO	NCD003471158		2 HCI BLVD. GREENSBORO, NC, 27409
BRIDGEPORT DISPOSAL, LLC	NJD053288239		2858 ROUTE 322 BRIDGEPORT, NJ, 08014
BRIDGEPORT HARBOR STATION	CTD000638627		1 ATLANTIC ST , BRIDGEPORT, CT, 06604
BRISTOL METALS L.P.	TND003374790		390 BRISTOL METALS ROAD , BRISTOL, TN, 37620
BRISTOL SANITARY LANDFILL	CTD000790725		LAKE AVE BRISTOL, CT, 06010
BRISTOL-MYERS SQUIBB MANUFACTURING CO.	PRD090021056		STATE ROAD #3 KM. 77.5 HUMACAO, PR, 00791
BROSKI BROTHERS INC	MOT300010972		39TH BELMONT KANSAS CITY, MO, 64129
BROWN AND BRYANT SHAFTER FAC	CAD009531823		135 COMMERCIAL DR SHAFTER, CA, 93263
BROWN GROUP RETAIL INC	COD056828940		5800 E JEWELL AVE , DENVER, CO, 80224
BROWNING FERRIS INC - SOLLEY LANDFILL	MDD000797365		7890 SOLLEY RD GLEN BURNIE, MD, 21061
BRUSH WELLMAN INC	OHD004212999		14710 W PORTAGE RIVER SOUTH RO ELMORE, OH, 43416
BUFFALO COLOR CORPORATION	NYD080335052		LEE ST BUFFALO, NY, 14210
BUICK RESOURCE RECYCLING FACILITY	MOD059200089		HWY KK BOSS, MO, 65440
BULL HN INFORMATION SYSTEMS INC	AZD054408794		13430 N BLACK CANYON HWY PHOENIX, AZ, 85029
BURLINGTON BASKET CO-PLANT NO. 2	IAD000678037		1404-1418 W MT PLEASANT ST , WEST BURLINGTON, IA, 52655

NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
HIGH	YES	09/18/2001	NO		YE	12/23/2003	YE	12/23/2003
MEDIUM	NO		NO		YE	05/31/2007	IN	09/09/2008
HIGH	YES	06/12/2007	YES	06/12/2007	YE	09/27/2000	YE	09/27/2000
HIGH	NO		NO		YE	09/09/2005	YE	09/05/2003
HIGH	NO		NO		YE	07/16/2004	NO STATUS	
HIGH	YES	12/05/2007	NO		YE	09/07/2001	YE	09/30/2002
HIGH	YES	09/26/2008	YES	09/26/2008	YE	08/30/2002	YE	08/15/2001
HIGH	NO		NO		YE	09/26/2003	YE	09/29/1997
HIGH	YES	08/12/2008	NO		YE	09/29/1997	YE	09/29/1997
LOW	NO		NO		YE	05/24/2007	YE	05/24/2007
HIGH	NO		NO		YE	03/08/2001	IN	03/08/2001
HIGH	NO		NO		YE	09/30/1999	YE	09/27/2001
LOW	YES	06/06/1996	YES	09/05/1997	YE	01/24/2000	YE	01/26/2000
HIGH	NO		NO		YE	09/09/2005	YE	04/21/2005
HIGH	YES	09/28/2007	YES	09/28/2007	YE	03/30/2006	YE	03/30/2006
HIGH	YES	05/27/1994	YES	07/01/1996	YE	08/23/2002	YE	08/23/2002
HIGH	NO		NO		YE	12/22/2000	YE	09/04/2008
HIGH	YES	03/25/2005	NO		YE	09/30/2004	YE	09/15/2005
HIGH	NO		NO		YE	09/29/2005	YE	11/18/2002
MEDIUM	NO		YES	09/15/1994	YE	10/10/2007	YE	03/29/2007
HIGH	YES	03/08/2007	YES	03/08/2007	YE	08/23/2002	YE	08/23/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
BURLINGTON ENVIRONMENTAL INC	WAD000812917		2001 W GARFIELD ST E SIDE OF B SEATTLE, WA, 981193100
HIGH / NO	NO	YE / 09/15/2005	YE / 09/15/2005
BURLINGTON ENVIRONMENTAL LLC GEORGETOWN	WAD000812909		734 S LUCILE ST SEATTLE, WA, 98108
HIGH / NO	NO	YE / 09/06/2005	YE / 08/29/2007
BURLINGTON ENVIRONMENTAL LLC TACOMA	WAD020257945		1701 E ALEXANDER AVE TACOMA, WA, 984214106
HIGH / NO	NO	YE / 09/16/2005	YE / 09/21/2006
BURLINGTON ENVIRONMENTAL LLC WASHOUGAL	WAD092300250		625 S 32ND ST WASHOUGAL, WA, 98671
HIGH / NO	NO	YE / 09/23/2005	IN / 09/11/2008
BURLINGTON NORTHERN SANTA FE RAILROAD	IAD000688572		1801 NW BURLINGTON AVE BURLINGTON, IA, 52601
HIGH / NO	NO	YE / 02/18/2005	YE / 03/25/2008
BURNHAM FOUNDRY LLC	OHD004282158		2345 LICKING ROAD ZANESVILLE, OH, 43701
HIGH / NO	NO	YE / 03/05/1999	YE / 03/05/1999
BUZZI UNICEM USA	KSD980739999		1765 LIMESTONE LN , INDEPENDENCE, KS, 67301
HIGH / NO	NO	YE / 06/17/2004	IN / 07/11/2003
BWX TECHNOLOGIES, INC.	VAD046960449		1570 MT. ATHOS RD. LYNCHBURG, VA, 24504
HIGH / NO	NO	YE / 02/25/2000	YE / 02/25/2000
C & M PLATING WORKS	CAD009204736		598 SIXTH ST SAN FRANCISCO, CA, 941034708
LOW / YES / 08/30/2006	YES / 04/09/2007	YE / 08/15/2006	YE / 08/15/2006
C R R A	CTD991288960		25 PENT RD WALLINGFORD, CT, 06492
HIGH / NO	NO	YE / 09/30/2002	YE / 09/30/2002
C&D TECHNOLOGIES INC	PAD056771405		82 E MAIN ST LEOLA, PA, 17540
HIGH / NO	NO	YE / 01/08/2001	YE / 01/08/2001
CABOT CORP	ILD042075333		700 E RTE 36 TUSCOLA, IL, 61953
HIGH / YES / 12/31/1996	YES / 12/31/1996	YE / 09/24/1999	YE / 09/24/1999
CABOT PERFORMANCE MATERIALS	PAD014512388		BEAVER RUN RD REVERE, PA, 18953
HIGH / NO	NO	YE / 03/03/2004	YE / 03/03/2004
CABOT SUPERMETALS	PAD002335545		COUNTY LINE RD BOYERTOWN, PA, 19512
HIGH / NO	NO	YE / 08/09/2001	YE / 08/09/2001
CALDWELL SYS INC	NCD086871282		MT HERMON RD LENOIR, NC, 28645
HIGH / NO	NO	YE / 09/01/2000	IN / 09/22/1998
CALGON CARBON CORP	PAD000736942		200 NEVILLE RD PITTSBURGH, PA, 15225-1324
HIGH / YES / 08/26/2003	YES / 08/26/2003	YE / 08/08/2001	YE / 08/08/2001
CALGON CARBON CORPORATION	KYD005009923		US RT 23 SOUTH , CATLETTSBURG, KY, 41129
HIGH / NO	NO	YE / 08/05/2002	YE / 08/05/2002
CAMERON YAKIMA INC	WAD009477175		1414 S 1ST ST YAKIMA, WA, 989011729
HIGH / YES / 04/20/1999	YES / 12/31/2000	YE / 08/29/2001	YE / 02/07/2002
CAMP JOSEPH T ROBINSON	ARD982552739		DCSEN-E NORTH LITTLE ROCK, AR, 72199
HIGH / YES / 07/31/2000	YES / 07/31/2000	YE / 07/31/2000	YE / 07/31/2000
CAMP NAVAJO	AZ7213820635 US Army		I-40, EXIT 185 BELLEMONT, AZ, 86001
HIGH / NO	NO	YE / 09/24/2002	IN / 09/27/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
CANDESCENT TECHNOLOGIES CORP	CAD076314459		10460 BUBB RD CUPERTINO, CA, 95014					
LOW	YES	07/12/2007	YES	07/12/2007	YE	04/10/2007	YE	04/10/2007
CANNON AIR FORCE BASE NM	NM7572124454	US Air Force	506 N DL INGRAM BLVD CANNON AFB, NM, 881035003					
HIGH	NO		NO		YE	06/04/2004	YE	06/17/2003
CAPE CANAVERAL AFB	FL2800016121	US Air Force	45 CES/CEV 1224 JUPITER ST MS9 PATRICK AFB, FL, 329253343					
HIGH	NO		NO		YE	09/14/2005	YE	09/14/2005
CARE TAKER SITE OFFICE, MARE ISLAND	CA7170024775	US Navy	WEST END OF TENNESSEE STREET VALLEJO, CA, 94592					
HIGH	NO		NO		YE	06/09/2004	NO	08/11/2000
CARIBBEAN PETROLEUM REFINING	PRD000632182		ROAD 28 KM 2.0 LUCHETTI INDUSTRIAL PARK, BAYAMON, PR, 00961					
HIGH	NO		NO		YE	09/29/2004	YE	09/30/2008
CARIBE GENERAL ELECTRIC PRODUCT JUANA DI	PRD090282757		CARR 149 KM 67 JUAN DIAZ PLANT, JUANA DIAZ, PR, 00665					
HIGH	YES	09/27/2007	YES	09/27/2007	YE	09/27/2001	YE	09/27/2001
CARLISLE SYNTEC	PAD069784049		1295 RITNER HWY CARLISLE, PA, 17013					
HIGH	YES	01/15/2008	YES	01/15/2008	YE	04/20/2004	YE	09/12/2007
CARLTON CREEK IRONWORKS LLC	MID006025217		2625 W WINSTON RD ROTHBURY, MI, 49452					
HIGH	NO		NO		YE	07/14/2004	NO	01/28/2008
CAROLINA PLATING WORKS INC	SCD003351996		1101 W BLUE RIDGE DR GREENVILLE, SC, 29609					
HIGH	YES	11/16/2005	YES	03/30/2007	YE	06/23/2003	YE	07/12/2005
CAROLINA STALITE CO AQUDALE PROERTIES	NCD003152642		12423 OLD AQUADALE ROAD , NORWOOD, NC, 28128					
HIGH	YES	01/04/2005	YES	01/04/2005	YE	01/05/2005	YE	01/05/2005
CARPENTER TECHNOLOGY CORP	PAD002344315		PO BOX 14662 READING, PA, 19612-4662					
HIGH	YES	09/29/1998	YES	09/29/1998	YE	08/16/2002	YE	08/16/2002
CASCADE CORP	OHD004284923		2501 SHERIDAN AVE SPRINGFIELD, OH, 45505					
HIGH	NO		NO		YE	06/28/2006	NO STATUS	
CATERPILLAR INC	ILD052664604		901 W WASHINGTON ST EAST PEORIA, IL, 61611-2044					
HIGH	NO		NO		YE	02/14/2003	YE	02/14/2003
CAVENHAM FOREST INDUSTRIES INC	OKD010327948		W REDWOOD AVE .25M W , SALLISAW, OK, 74955					
HIGH	YES	06/08/1995	YES	06/06/1998	YE	11/30/2000	YE	11/30/2000
CAVENHAM FOREST INDUSTRIES, INC.	MSD057226961		9502 CREOSOTE ROAD GULFPORT, MS, 39503					
HIGH	YES	07/26/1996	NO		IN	09/26/2007	YE	11/06/1995
CAVENHAM FOREST INDUSTRIES, INC.	ALD057226904		SOUTH END HERBERT ST MOBILE, AL, 36652					
HIGH	YES	12/11/1996	YES	08/05/1997	YE	09/22/1998	YE	09/22/1998
CCSWA LANCHESTER STABILIZED DSPL	PAD980550545		7224 DIVISION HWY NARVON, PA, 17555					
HIGH	NO		NO		YE	09/30/2003	NO STATUS	
CECOS INTERNATIONAL, INC.	OHD087433744		5092 ABER ROAD WILLIAMSBURG, OH, 45176					
HIGH	YES	09/29/1994	YES	08/04/1998	YE	05/08/2008	YE	05/08/2008
CECOS INTERNATIONAL, INC.	NYD080336241		NIAGARA FALLS BLVD NIAGARA FALLS, NY, 14304					
HIGH	YES	02/25/1995	YES	01/31/1997	YE	09/30/1999	YE	09/30/1999
CECOS INTERNATIONAL, INC., LIVINGSTON	LAD000618298		28422 FROST ROAD , LIVINGSTON, LA, 70754					
HIGH	YES	05/19/2006	YES	05/19/2006	YE	03/30/2001	YE	03/30/2001
CECOS INTL, INC. CALCASIEU FACILITY	LAD000618256		918 WILLOW SPRINGS RD , WESTLAKE, LA, 70669					
HIGH	YES	06/17/2008	NO		YE	05/23/2003	YE	05/23/2003

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
CEDAR CHEMICAL	ARD990660649		49 PHILLIPS RD 311 W HELENA, AR, 72342
HIGH / NO	NO	YE / 05/01/2007	YE / 05/01/2007
CEE ASSOC	CTD044121697		80 PICKETT DISTRICT RD NEW MILFORD, CT, 06776
HIGH / NO	NO	YE / 09/20/2004	YE / 09/25/2008
CEI DOUGLASSVILLE INC	PAD097153399		447 OLD SWEDE RD DOUGLASSVILLE, PA, 19518-1239
HIGH / YES / 07/19/1999	YES / 07/19/1999	YE / 12/16/1999	YE / 12/16/1999
CELANESE LTD	TXD069450278		1901 CLARKWOOD RD CORPUS CHRISTI, TX, 78409
HIGH / YES / 01/10/2006	YES / 01/10/2006	YE / 01/13/2000	YE / 08/28/2002
CELANESE LTD	TXD007376700		US HIGHWAY 60 W 5 MI W OF PAMPA, TX, 79065
HIGH / YES / 08/01/2006	YES / 08/01/2006	YE / 04/28/2003	YE / 02/14/2002
CELANESE LTD	TXD078432457		9502 BAYPORT BLVD PASADENA, TX, 77507
MEDIUM / YES / 08/13/2008	YES / 08/13/2008	YE / 02/27/2004	YE / 12/31/2003
CEMEX	PAD083965897		2001 PORTLAND PARK ROUTE 18, WAMPUM, PA, 16157-9109
HIGH / NO	NO	YE / 08/08/2001	YE / 08/08/2001
CENEX LUBE BLENDING PLT	MND980504260		11600 COURTHOUSE BLVD INVER GROVE HEIGHTS, MN, 55076
MEDIUM / YES / 07/10/1990	YES / 07/10/1990	YE / 09/30/1997	YE / 09/30/1997
CENTENNIAL PLACE	WID006121347		2205 S 43RD ST , MILWAUKEE, WI, 53219
MEDIUM / YES / 10/27/2005	NO	YE / 09/19/2008	YE / 09/19/2008
CENTURY BRASS FORMERLY KNOWN AS	CTR000003012		73 HAMILTON AVE WATERBURY, CT, 06706
HIGH / NO	NO	YE / 05/01/1997	YE / 05/01/1997
CENTURY BRASS PRODS NEW MILFORD PLT	CTD000847707		12 SCOVILL ST NEW MILFORD, CT, 06776
HIGH / NO	NO	YE / 12/16/2004	YE / 12/16/2004
CENTURY BRASS PRODUCTS INC	CTD060008307		SILVER ST WATERBURY, CT, 06702
HIGH / NO	NO	YE / 09/28/2005	YE / 09/28/2005
CENTURY FOREST INDUSTRIES INC	TXD990706517		HIGHWAY 103 LUFKIN, TX, 75904
HIGH / YES / 03/12/2007	YES / 03/12/2007	YE / 12/30/2004	YE / 02/09/2007
CERMATICS INC	WID980614994		10014 N 124W WAUSAUKEE RD MEQUON, WI, 53092
LOW / NO	NO	YE / 09/25/2007	NO STATUS
CERRO FABRICATED PRODUCTS	CTD001145317		201 PINE ST BRISTOL, CT, 06010
LOW / NO	NO	YE / 07/24/2007	YE / 07/24/2007
CHAIN BIKE CORP	PAD053061909		200 CASCADE DR ALLENTOWN, PA, 18103
HIGH / NO	NO	YE / 01/29/2002	YE / 01/29/2002
CHALMETTE REFINING, L.L.C	LAD008179707		500 WEST ST. BERNARD HWY. CHALMETTE, LA, 70043
HIGH / NO	NO	YE / 03/09/2004	YE / 06/30/2004
CHANUTE AIR FORCE BASE	IL1570024157 US Air Force		1 AVIATION CTR DR STE 101 RANTOUL, IL, 61866
HIGH / NO	NO	NO STATUS	NO STATUS
CHARLESTON NAVAL COMPLEX	SC0170022560 US Navy		1330 KILO ST BLDG 1824 CHARLESTON, SC, 29419-9010
HIGH / NO	NO	YE / 09/18/2003	YE / 12/19/2003
CHEM TECHNOLOGY LABS INC	CAD008275885		12150 S ALAMEDA ST (SEE MAP) LYNWOOD, CA, 90262
HIGH / NO	NO	YE / 02/07/2003	YE / 09/14/2007
CHEM WASTE MGMT BAKERSFIELD	CAT000624056		27001 ROUND MOUNTAIN RD BAKERSFIELD, CA, 93308
LOW / YES / 09/22/2008	NO	YE / 04/05/2000	YE / 04/05/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
CHEMICAL LEAMAN TANK LINES INC	PAD000414441		1700 RIVER ROAD CROYDON, PA, 19020					
HIGH	YES	07/21/1998	YES	07/21/1998	YE	09/05/2002	YE	09/05/2002
CHEMICAL SPECIALTIES INC	GAD980843155		1219 OLD CLYATTVILLE ROAD VALDOSTA, GA, 31601					
HIGH	YES	03/31/2008	YES	03/31/2008	YE	04/24/1996	YE	04/24/1996
CHEMICAL SPECIALTIES, INC.	NCD048467427		5910 PHARR MILL RD. HARRISBURG, NC, 28075					
HIGH	NO		NO		YE	09/28/2001	YE	09/26/2003
CHEMICAL WASTE MANAGEMENT	ALD000622464		36964 ALABAMA HWY 17 NORTH EMELLE, AL, 35459					
LOW	YES	03/09/2005	NO		YE	07/09/2002	YE	07/09/2002
CHEMICAL WASTE MANAGEMENT OF T	ORD089452353		17629 CEDAR SPRINGS LN ARLINGTON, OR, 97812					
HIGH	YES	01/01/1990	YES	01/01/1990	YE	02/07/2001	YE	02/07/2001
CHEMICAL WASTE MANAGEMENT, INC.	CAT000646117		35251 OLD SKYLINE ROAD KETTLEMAN CITY, CA, 93239					
LOW	NO		NO		YE	04/07/2000	YE	04/07/2000
CHEMICAL WASTE MGMT INC	KSD070902952		8808 N 127TH ST E VALLEY CENTER, KS, 67147					
HIGH	YES	05/31/1985	YES	01/26/1987	YE	01/18/2000	NO	12/12/2006
CHEMKO TECHNICALS SERVICES INC	FLD982091506		5325 N US HWY #1 MIMS, FL, 32754					
HIGH	YES	11/23/2005	YES	11/23/2005	YE	09/23/2008	YE	09/23/2008
CHEMTRONICS INC	NCD095459392		180 OLD BEE TREE RD SWANNANOA, NC, 28778					
HIGH	NO		NO		YE	09/29/2003	NO	09/29/2003
CHEMTURA CORP	CTD001449826		280 ELM STREET , NAUGATUCK, CT, 06770					
HIGH	NO		NO		YE	11/12/1999	YE	09/26/2005
CHEMTURA CORP	NJD002165561		1000 CONVERY BLVD PERTH AMBOY, NJ, 08861					
HIGH	YES	07/13/1998	YES	12/17/2001	YE	03/27/2001	YE	03/27/2001
CHEMTURA CORP - NORTH PLANT	WVD980552384		1000 MORGANTOWN IND PARK PLANT 1, MORGANTOWN, WV, 26501					
HIGH	NO		NO		YE	09/30/2004	IN	02/29/1996
CHEMTURA CORPORATION	LAD065470916		471 HWY 3142 , TAFT, LA, 70057					
LOW	YES	06/29/2007	YES	06/29/2007	YE	03/27/2002	YE	03/27/2002
CHEMTURA CORPORATION	ALD010394021		43300 HIGHWAY 225 , BAY MINETTE, AL, 36507					
MEDIUM	YES	09/13/2006	NO		YE	08/31/2006	YE	08/31/2006
CHEMTURA CORPORATION - SOUTH PLANT	WVD061776977		1000 MORGANTOWN IND PARK PLANT 2, MORGANTOWN, WV, 26501					
HIGH	NO		NO		YE	09/30/2004	YE	10/03/2005
CHEMWOOD TREATMENT CO INC	HID981424138		2024 N KING ST HONOLULU, HI, 96819					
HIGH	NO		NO		YE	05/26/1999	YE	05/26/1999
CHEROKEE COLUMBUS REAL ESTATE, LLC	NYD000691865		108-112 N MAIN ST BAINBRIDGE, NY, 137331213					
HIGH	YES	11/30/1998	YES	01/26/2005	YE	09/28/2001	YE	09/30/2003
CHEROKEE PHARMACEUTICALS LLC	PAD003043353		100 AVENUE C PO BOX 367, RIVERSIDE, PA, 17868					
HIGH	YES	01/16/2007	NO		YE	09/23/2002	YE	09/23/2002
CHESAPEAKE FINISHED METALS INC.	MDD069380657		6754 SANTA BARBARA COURT ELKRIDGE, MD, 21075					
HIGH	YES	03/26/2002	YES	03/26/2002	YE	07/18/2001	YE	07/18/2001
CHEVRON CESC	ILD041518861		301 W 2ND ST -A LOCKPORT, IL, 60441					
HIGH	NO		NO		YE	05/13/2003	YE	05/15/2002
CHEVRON CHEMICAL CO	NJD002171593		800 METUCHEN RD SOUTH PLAINFIELD, NJ, 07080					
HIGH	NO		NO		YE	09/16/2005	YE	09/26/2003

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
CHEVRON CHEMICAL CO	IAD005173992		6103 ORTHOWAY FORT MADISON, IA, 52627					
HIGH	YES	03/13/2001	YES	10/04/2001	YE	09/28/1999	YE	09/28/1999
CHEVRON CHEMICAL CO (CHEVRON USA)	CAD043237486		940 HENSLEY ST RICHMOND, CA, 94804					
HIGH	NO		NO		YE	08/06/2003	YE	08/06/2003
CHEVRON EL SEGUNDO REFINERY	CAD008336901		324 WEST EL SEGUNDO BLVD EL SEGUNDO, CA, 90245					
HIGH	NO		NO		YE	08/15/2002	YE	06/30/2004
CHEVRON ENVIRONMENTAL MANAGEMENT COMPANY	TXD054256391		6501 TROWBRIDGE DR EL PASO, TX, 79905					
HIGH	YES	02/26/2007	YES	08/20/2008	YE	08/11/2004	YE	08/26/2003
CHEVRON ENVIRONMENTAL MANAGMENT CO.	OHD004254132		STATE ROUTE 128 & BY-PASS 50 HOOVEN, OH, 45033					
HIGH	YES	08/30/2006	NO		YE	09/22/2005	YE	06/06/2002
CHEVRON PHILIPS CHEMICAL PUERTO RICO	PRD991291972		ROAD 710 KM.1.3 GUAYAMA, PR, 00785					
HIGH	NO		NO		YE	05/10/2002	YE	09/25/2003
CHEVRON PHILLIPS CHEMICAL COMPANY LP	TXD008098725		1400 JEFFERSON ST PASADENA, TX, 77506					
HIGH	YES	08/01/2008	YES	08/01/2008	YE	08/11/2006	YE	08/14/2007
CHEVRON PRODUCTS COMPANY	NJD081982902		1200 STATE ST PERTH AMBOY, NJ, 08861					
HIGH	NO		NO		YE	09/30/2005	YE	09/25/2008
CHEVRON PRODUCTS COMPANY PASCAGOULA	MSD054179403		250 INDUSTRIAL ROAD PASCAGOULA, MS, 39581					
HIGH	YES	05/03/2004	NO		YE	09/29/2000	YE	05/20/2008
CHEVRON PRODUCTS COMPANY,HAWAII REFINERY	HIT160010005		91-480 MALAKOLE STREET KAPOLEI, HI, 96707					
MEDIUM	YES	05/15/1998	NO		YE	05/26/1998	YE	05/26/1999
CHEVRON SALT LAKE REFINERY	UTD092029768		2351 NORTH 1100 WEST SALT LAKE CITY, UT, 84116					
HIGH	YES	09/02/1997	YES	12/31/1998	YE	07/09/1999	YE	07/09/1999
CHEVRON TEXACO AT BEACON	NYD091894899		OLD GLENHAM RD GLENHAM, NY, 125271001					
MEDIUM	NO		NO		YE	09/28/2007	NO STATUS	
CHEVRON U.S.A. INC. RICHMOND REFINERY	CAD009114919		841 CHEVRON WAY RICHMOND, CA, 94802					
HIGH	NO		NO		YE	12/28/2000	YE	12/28/2000
CHEVRONTEXACO CORPORATION	TXD007378995		315 S GRAND ST AMARILLO, TX, 79104					
HIGH	YES	02/12/2008	YES	02/12/2008	YE	01/31/2000	YE	01/08/2001
CHRYSLER CORP	MID990760100		2880 ZEEB RD DEXTER, MI, 48130					
MEDIUM	NO		NO		YE	09/28/2006	YE	08/14/2007
CIBA CORPORATION	ALD001221902		1379 CIBA ROAD , MCINTOSH, AL, 36553					
HIGH	YES	01/31/2006	YES	01/31/2006	YE	10/04/1999	YE	10/04/1999
CIBA GEIGY CORP	RID001194323		180 MILL ST CRANSTON, RI, 02905					
HIGH	NO		NO		YE	09/26/1996	YE	08/24/2000
CIBA SPECIALTY CHEMICALS	MED001037126		55 CROWLEY RD LEWISTON, ME, 04240					
HIGH	YES	11/30/2001	YES	11/30/2001	YE	08/16/2001	YE	11/05/2003
CID RECYCLING & DISPOSAL FAC	ILD010284248		138TH & I-94 P O BOX 1309, CALUMET CITY, IL, 60409					
HIGH	YES	10/29/1997	YES	10/29/1997	YE	10/29/1997	YE	06/18/2001
CITGO PETROLEUM CORPORATION	LAD008080350		4401 HWY 108 , LAKE CHARLES, LA, 70602					
HIGH	NO		NO		YE	04/19/2005	IN	08/17/1999

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
CLARIANT CORPORATION	NJD001213453		00-09 FAIR LAWN AVENUE FAIR LAWN, NJ, 07410					
HIGH	NO		NO		YE	09/27/2001	YE	08/10/2004
CLARIANT CORPORATION, MT HOLLY EAST PLT	NCD001810365		11701 MOUNT HOLLY ROAD CHARLOTTE, NC, 28214					
HIGH	NO		NO		YE	09/27/2003	YE	09/27/2003
CLEAN CARE CORP	WAD980738512		1510 TAYLOR WY TACOMA, WA, 984214127					
HIGH	NO		NO		YE	09/21/2006	YE	09/21/2006
CLEAN EARTH OF NORTH JERSEY INC	NJD991291105		105 JACOBUS AVE KEARNY, NJ, 07032					
MEDIUM	NO		NO		YE	09/28/2006	NO STATUS	
CLEAN HARBORS	ILD000672121		11700 S STONY ISLAND AVE CHICAGO, IL, 60617					
HIGH	NO		NO		YE	03/01/2006	YE	05/30/2008
CLEAN HARBORS BATON ROUGE LLC	LAD010395127		13351 SCENIC HWY BATON ROUGE, LA, 70807					
HIGH	YES	02/29/2008	NO		YE	09/28/2001	YE	06/22/2001
CLEAN HARBORS DEER PARK LP	TXD055141378		2027 BATTLEGROUND RD LA PORTE, TX, 77571					
MEDIUM	YES	08/24/2007	YES	05/09/2008	YE	07/31/2003	YE	07/21/2003
CLEAN HARBORS ENVIRONMENTAL SERVICES	ARD069748192		309 AMERICAN CIRCLE EL DORADO, AR, 71730					
HIGH	YES	01/10/2001	YES	01/10/2001	YE	07/27/2001	YE	07/27/2001
CLEAN HARBORS KANSAS LLC	KSD007246846		2549 N NEW YORK AVE , WICHITA, KS, 672194322					
HIGH	NO		NO		YE	10/05/2004	IN	07/11/2003
CLEAN HARBORS OF BRAINTREE	MAD053452637		1 HILL AVE BRAINTREE, MA, 02184					
MEDIUM	NO		NO		YE	09/26/2005	YE	02/12/2004
CLEAN HARBORS OF CT INC	CTD000604488		51 BRODERICK ROAD BRISTOL, CT, 06010					
MEDIUM	NO		NO		YE	06/09/1996	YE	04/29/1997
CLEAN HARBORS OF NATICK INC	MAD980523203		10 MERCER RD NATICK, MA, 01760					
MEDIUM	NO		NO		YE	09/26/2000	YE	09/25/2002
CLEAN HARBORS PECATONICA LLC	ILD980502744		6125 N PECATONICA RD PECATONICA, IL, 61063					
MEDIUM	YES	08/10/1998	YES	08/10/1998	YE	03/01/2006	YE	07/25/2007
CLEAN HARBORS PPM LLC	KSD981506025		2474 N HWY 169, INDUSTRIAL PARK , COFFEYVILLE, KS, 67337					
HIGH	YES	08/08/2005	YES	08/08/2005	YE	10/12/2000	YE	09/24/2001
CLEAN HARBORS RECYCLING SERVICES OF OHIO	OHD980587364		581 MILLIKEN DR SE HEBRON, OH, 43025					
HIGH	YES	05/26/1998	YES	09/30/1999	YE	06/13/2000	NO	10/23/2007
CLEAN HARBORS SAN JOSE LLC	CAD059494310		1021 BERRYESSA ROAD SAN JOSE, CA, 95133					
HIGH	YES	08/15/1990	YES	11/30/1990	YE	12/28/2000	YE	09/16/2004
CLEAN HARBORS SVCS INC	ILD000608471		11800 S STONY ISLAND AVE , CHICAGO, IL, 60617					
HIGH	NO		NO		YE	03/18/2004	YE	03/08/2004
CLEAN HARBORS WESTMORLAND, LLC	CAD000633164		5295 SOUTH GARVEY ROAD WESTMORLAND, CA, 92281					
LOW	NO		NO		YE	04/06/2000	YE	04/06/2000
CMC STEEL SOUTH CAROLINA	SCD003353760		310 NEW STATE RD , CAYCE, SC, 29171					
HIGH	YES	09/30/2008	YES	09/30/2008	YE	08/14/2001	YE	08/14/2001
CND INDUSTRIES, INC	OHD045205424		359 STATE AVE NW MASSILLON, OH, 44647					
HIGH	YES	08/26/2002	YES	09/12/2003	YE	10/01/2001	YE	12/29/2000
COASTAL WAREHOUSE LLC	NCD070430178		NC RT 32 S OLD HERTFORD RD, EDENTON, NC, 27932					
HIGH	YES	07/28/2003	YES	08/04/2004	YE	09/29/2000	YE	09/29/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
COATING SYSTEMS INC	NHD056331077		55 CROWN ST NASHUA, NH, 03060					
MEDIUM	YES	08/06/2001	YES	08/06/2001	YE	06/11/1996	YE	09/14/1999
COFFEYVILLE RESOURCES REFINING & MARKETI	KSD007138605		400 N LINDEN ST , COFFEYVILLE, KS, 67337					
HIGH	NO		NO		YE	09/30/2005	YE	09/21/2005
COFFEYVILLE RESOURCES TERMINAL LLC	KSD007134695		1589 HWY 183 , PHILLIPSBURG, KS, 67661					
HIGH	NO		NO		YE	09/26/2006	YE	09/28/2006
COINCO INC DBA MORCO	PAD056882822		125 HIGH ST COCHRANTON, PA, 16314					
HIGH	NO		NO		YE	04/30/2002	YE	08/27/2002
COL-FIN SPECIALTY STEEL CORP	PAD000737031		FRONT ST PO BOX 562, FALLSTON, PA, 15066					
HIGH	YES	04/10/2000	YES	04/10/2000	YE	12/08/1999	YE	12/08/1999
COLFAX TREATING CO LLC, ALEXANDRIA	LAD069524981		3600 KOPPERS ST , ALEXANDRIA, LA, 71302					
HIGH	NO		NO		YE	12/29/2006	YE	06/29/2005
COLFAX TREATING COMPANY, LLC	LAD008184616		74 WADLEY ROAD PINEVILLE, LA, 71360					
HIGH	YES	06/29/2007	YES	01/04/2008	YE	06/29/2001	YE	06/29/2001
COLLIS INC	KYD057591133		1101 W PARK RD , ELIZABETHTOWN, KY, 42701					
HIGH	YES	05/16/2002	YES	02/07/2003	YE	08/06/2002	YE	04/01/2005
COLLIS INC	IAD047303771		2005 S 19TH ST CLINTON, IA, 52732					
MEDIUM	NO		NO		YE	09/29/2003	IN	02/23/2000
COLO DEPT OF TRANS - HQ COMPLEX	COD980952097		4201 E ARKANSAS AVE DENVER, CO, 802223406					
HIGH	YES	03/13/2001	YES	01/31/2001	YE	05/15/2000	YE	05/15/2000
COLONIAL BRONZE CO	CTD058508722		511 WINSTED RD TORRINGTON, CT, 06790					
HIGH	NO		NO		YE	09/20/2004	NO STATUS	
COLTSVILLE HERITAGE PARK INC	CTD001157106		140 HUYSHOPE AVE HARTFORD, CT, 06106					
HIGH	NO		NO		YE	10/22/2003	NO STATUS	
COLUMBIA HELICOPTERS INC	ORD009673609		14452 ARNDT RD NE AURORA, OR, 97002					
HIGH	YES	04/25/2000	YES	11/01/2000	YE	02/07/2001	YE	02/07/2001
COLUMBIA MANUFACTURING CO	MAD001115609		1 CYCLE ST WESTFIELD, MA, 01085					
HIGH	NO		NO		YE	10/02/2005	YE	08/21/2008
COMBUSTION ENGINEERING	CTD001159557		2000 DAY HILL ROAD WINDSOR, CT, 06095					
HIGH	NO		NO		YE	09/29/2000	YE	09/28/2001
COMMERCE INDUSTRIAL CHEMICALS	WID023375884		3420 W MILL RD MILWAUKEE, WI, 53209					
MEDIUM	NO		NO		NO STATUS		NO STATUS	
COMMONWEALTH OIL REFINING COMPANY, INC.	PRD091017228		STATE ROAD 127 KM. 17.3 PENUELAS, PR, 00624-980					
HIGH	NO		NO		YE	09/30/2005	YE	09/30/2005
CONGOLEUM CORP	PAD002343200		4401 RIDGE RD TRAINER, PA, 19061-4396					
HIGH	NO		NO		YE	09/07/2005	IN	09/07/2005
CONN-SELMER	AZT000612135		1310 W FAIRWAY DR NOGALES, AZ, 85621-3851					
HIGH	YES	09/14/2007	YES	03/25/2008	YE	09/27/2001	YE	09/23/2003
CONN-SELMER INC	OHD004153854		34199 CURTIS BLVD EASTLAKE, OH, 44095					
LOW	YES	07/20/1995	YES	08/31/1998	YE	06/25/2008	YE	06/25/2008
CONOCO PHILLIPS CO ALLIANCE REFINERY	LAD056024391		15551 HWY 23 S BELLE CHASSE, LA, 70037					
MEDIUM	NO		NO		YE	10/31/2000	YE	09/28/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
CONOCOPHILLIPS CO FERNDALE REFINERY	WAD009250366		3901 UNICK RD FERNDALE, WA, 98248					
HIGH	NO		NO		YE	04/18/2001	YE	04/18/2001
CONOCOPHILLIPS CO. LAR, CARSON PLANT	CAD980881676		1520 E. SEPULVEDA BLVD. CARSON, CA, 90745					
HIGH	NO		NO		YE	09/27/2002	NO	03/09/2001
CONOCOPHILLIPS COMPANY	TXD048210645		HIGHWAY 35 & FM 524 OLD OCEAN, TX, 77463					
MEDIUM	YES	01/10/2006	YES	01/10/2006	YE	02/06/2003	YE	02/06/2003
CONOCOPHILLIPS INC., LAKE CHARLES	LAD990683716		2200 OLD SPANISH TRAIL WESTLAKE, LA, 70669					
HIGH	NO		NO		YE	10/26/2005	YE	10/26/2005
CONOCOPHILLIPS LAR, WILMINGTON PLANT	CAD008237679		1660 WEST ANAHEIM STREET WILMINGTON, CA, 90744					
HIGH	NO		NO		YE	11/14/2002	NO	03/09/2001
CONOCOPHILLIPS REFINERY/TECHNOLOGY/TRANS	OKD007233836		1000 SOUTH PINE PONCA CITY, OK, 74601					
HIGH	NO		NO		YE	11/02/2000	YE	11/02/2000
CONOCOPHILLIPS SAN FRANCISO REFINERY	CAD009108705		1380 SAN PABLO AVENUE RODEO, CA, 94572					
HIGH	NO		NO		YE	12/28/2000	YE	12/28/2000
CONRAIL MEADVILLE CAR REPAIR FACILITY	PAD000799916		10677 MCHENRY ST MEADVILLE, PA, 16355					
HIGH	YES	07/17/2000	YES	07/17/2000	YE	02/23/2000	YE	02/23/2000
CONSOLIDATED RCYL CO INC/CARSON'S TRANPR	IND098958283		11210 SOLOMAN RD TELL CITY INDUSTRIAL PK, TROY, IN, 47588					
LOW	YES	06/01/1999	YES	06/01/1999	YE	06/01/1999	YE	06/01/1999
CONSUMERS ENERGY CO	MID051763696		6900 EAST MICHIGAN AVENUE COMSTOCK, MI, 49041					
HIGH	NO		NO		YE	08/08/2007	NO STATUS	
CONTAINER PROPERTIES LLC	WAD009282302		9229 E MARGINAL WAY S TUKWILA TUKWILA, WA, 98108					
HIGH	NO		NO		NO	09/20/2007	YE	09/27/2004
CONTAINER SPECIALTIES INC (USEPA REGIN	MID005361597		3261 FLUSHING RD FLINT, MI, 48504					
HIGH	NO		NO		NO STATUS		NO STATUS	
CONTINENTAL CEMENT CO LLC GREEN AMERICA	MOD054018288		10107 HWY 79 , HANNIBAL, MO, 63401					
HIGH	YES	10/14/1999	YES	06/13/2001	YE	07/23/2001	YE	09/26/2000
CONTINENTAL TEVES INC	VAD030341077		13456 LOVERS LN CULPEPER, VA, 22701					
HIGH	NO		NO		YE	10/01/2002	YE	10/01/2002
COOK COMPOSITES & POLYMERS CO	MOD086787371		1412 KNOX ST NORTH KANSAS CITY, MO, 64116					
HIGH	NO		NO		YE	09/29/2003	YE	09/30/2004
COOK COMPOSITES & POLYMERS CO	TXD108999863		2434 HOLMES RD HOUSTON, TX, 77051					
HIGH	YES	05/15/2006	YES	05/15/2006	YE	06/04/2001	YE	06/07/2001
COOK COMPOSITES & POLYMERS CO	WID980615439		340 RAILROAD ST , SAUKVILLE, WI, 53080					
HIGH	NO		NO		YE	09/28/2004	YE	09/28/2004
COOK COMPOSITES AND POLYMERS	TXD000807875		2434 HOLMES ROAD HOUSTON, TX, 77051					
HIGH	NO		NO		YE	06/06/2001	YE	06/07/2001
COOK COMPOSITES AND POLYMERS CO.	VAD055046049		920 TIGHTSQUEEZE INDUSTRIAL RD CHATHAM, VA, 24531					
HIGH	NO		NO		YE	04/26/2005	YE	09/25/2003
COOPER INDS INC	VAD023717853		RT 660 EARLYSVILLE, VA, 22936					
HIGH	YES	09/27/1991	YES	09/27/1991	YE	02/14/2002	YE	02/14/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
CORBIN RUSSWIN, INC.	CTD052541695		225 EPISCOPAL ROAD BERLIN, CT, 06037					
HIGH	NO		NO		YE	09/29/2000	YE	08/14/2002
CORNING INC	IND005557244		AIRPORT RD BLUFFTON, IN, 46714					
HIGH	YES	07/25/2008	YES	07/25/2008	YE	05/29/2002	YE	06/15/2001
CORNING INCORPORATED	KYD006388797		680 E. OFFICE ST , HARRODSBURG, KY, 403301311					
HIGH	NO		NO		YE	06/30/2006	YE	06/30/2006
CORNWALL PROPERTIES LLC	NYD001223338		20 INDUSTRY DR MOUNTAINVILLE, NY, 10953					
MEDIUM	NO		NO		YE	09/30/2005	NO STATUS	
COUNTY OF LENAWEE	MID005044813		410 E BEECHER ST ADRIAN, MI, 49221					
HIGH	NO		NO		YE	03/30/2005	YE	05/30/2007
COZINCO	COD094154671		100 W LEAD STREET SALIDA, CO, 81201					
HIGH	YES	10/22/1998	YES	03/16/1993	YE	08/25/2000	YE	08/25/2000
CP CHEMICALS INC	NJD002141950		ARBOR ST SEWAREN, NJ, 07024					
HIGH	YES	06/13/2008	YES	06/13/2008	YE	10/13/2000	YE	06/12/2008
CPI PLASTICS LLC	GAD981266208		434 CORINTH ROAD NEWNAN, GA, 30264					
MEDIUM	YES	04/16/2007	YES	04/16/2007	YE	08/27/1996	YE	08/27/1996
CRITERION CATALYSTS & TECHNOLOGIES, L.P.	CAD000094243		2840 WILLOW PASS ROAD PITTSBURG, CA, 94565					
HIGH	YES	07/24/2007	NO		YE	09/07/2006	YE	09/07/2006
CRITERION CATALYSTS & TECHNOLOGIES, LP	CAD008344228		1001 NORTH TODD AVE AZUSA, CA, 90702					
LOW	NO		NO		YE	03/09/2001	YE	03/09/2001
CROWLEY DISPOSAL LLC	LAD079464095		2029 BAYOU PLAQUEMINE RD RAYNE, LA, 70527					
HIGH	NO		NO		YE	03/31/2004	YE	03/31/2004
CROWN CORK AND SEAL COMPANY INC.	CAD062062435		8201 WOODLEY VAN NUYS, CA, 91406					
LOW	NO		NO		YE	05/02/2000	YE	05/02/2000
CROWN FOOD PACKAGING USA	NED007263353		4133 SOUTH 72ND OMAHA, NE, 68127					
HIGH	NO		NO		YE	05/31/2002	YE	09/11/2002
CSX TRANSPORTATION INC	GAD991275900		1100 W HAMILTON AVE WAYCROSS, GA, 31503					
LOW	NO		NO		YE	09/15/2003	YE	09/15/2003
CSX TRANSPORTATION, INC.	VAD003121977		4005 CHARLES CITY RD RICHMOND, VA, 23231					
HIGH	NO		NO		YE	09/27/2001	YE	04/09/2003
CT RESOURCE RECOVERY AUTH	CTD000604546		866 RIVER RD SHELTON, CT, 06484					
HIGH	YES	08/25/1998	YES	04/27/2001	YE	09/29/2000	YE	09/29/2000
CT YANKEE ATOMIC POWER	CTD042306720		362 INJUN HOLLOW ROAD EAST HAMPTON, CT, 06424					
HIGH	YES	09/30/2007	YES	09/30/2007	YE	08/14/2002	YE	02/10/2003
CURTIS METALS	NED058808908		HWY 81 S CURTIS, NE, 69025					
HIGH	YES	09/05/2002	YES	07/17/2003	YE	09/30/2002	YE	02/19/1999
CURWOOD INC (NEW LONDON)	WID006144737		718 HIGH ST NEW LONDON, WI, 54961					
HIGH	YES	08/03/2006	YES	04/14/2008	YE	08/19/2002	YE	08/19/2002
CUSTOM RESINS INC	KYD082388372		1421 HWY 136 W , HENDERSON, KY, 42420					
HIGH	NO		NO		YE	06/29/2007	YE	06/29/2007
CWM CHEMICAL SERVICES, LLC	NYD049836679		BALMER ROAD MODEL CITY, NY, 14107					
HIGH	YES	02/13/2001	YES	06/26/2006	YE	09/30/1999	YE	09/30/1999

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
CYCLECHEM,INC.	NJD002200046		SOUTH FIRST STREET ELIZABETH, NJ, 07206					
HIGH	NO		NO		YE	09/17/2004	NO STATUS	
CYN OIL CORP D/B/A CYN ENVIRONMNTL SERV	MAD082303777		1771 WASHINGTON ST STOUGHTON, MA, 02072					
HIGH	YES	06/23/2008	YES	06/23/2008	YE	03/05/2003	YE	09/30/2002
CYTEC ENGINEERED MATERIALS INC	MDD003075942		1300 REVOLUTION ST HAVRE DE GRACE, MD, 21078					
HIGH	NO		NO		YE	12/15/2000	YE	09/16/2003
CYTEC INDUSTRIES INC	MID005360680		2715 MILLER RD KALAMAZOO, MI, 49001					
LOW	NO		NO		IN	09/26/2008	IN	09/26/2008
CYTEC INDUSTRIES INC	OHD004341509		1405 GREENE ST , MARIETTA, OH, 45750					
HIGH	NO		NO		YE	08/23/2004	YE	07/24/2002
CYTEC INDUSTRIES INC - WARNERS	NJD002173144		4900 TREMLEY POINT RD LINDEN, NJ, 07036					
HIGH	YES	06/29/2001	YES	11/26/2002	YE	08/23/2000	YE	09/30/1999
CYTEC INDUSTRIES INC.	LAD008175390		10800 RIVER ROAD WAGGAMAN, LA, 70094					
HIGH	NO		NO		YE	09/22/2000	YE	09/22/2000
CYTEC INDUSTRIES INC.- WILLOW ISLAND	WVD004341491		#1 HEILMAN AVENUE WILLOW ISLAND, WV, 26134					
HIGH	NO		NO		YE	09/19/2002	IN	04/23/1996
D&H FARMS LLC FRMR PROD ANODIZING CORP	GAD003308335		1460 INDUSTRIAL BLVD , ADEL, GA, 31620					
HIGH	YES	08/22/2008	YES	08/22/2008	YE	08/28/1997	YE	08/28/1997
DAK AMERICAS LLC	NCD047369046		3500 DANIELS RD NE LELAND, NC, 28451					
HIGH	NO		NO		YE	07/11/2005	YE	07/11/2005
DAKOTA GASIFICATION COMPANY	NDD000690594		420 COUNTY ROAD 26 BEULAH, ND, 58523-9400					
HIGH	NO		NO		YE	02/22/1999	YE	02/22/1999
DAL-CHROME COMPANY	TXD042687061		3044 MORRELL AVE DALLAS, TX, 75216					
HIGH	YES	02/02/2006	YES	02/02/2006	YE	02/27/2006	YE	02/27/2006
DAL-TILE	TXD988032769		PLEASANT RUN ROAD 1/4 MI W OF POST, TX, 79356					
HIGH	YES	02/28/2006	YES	02/28/2006	YE	02/15/2005	YE	02/15/2005
DAMAR INC	GAD003275971		823 DAMAR RD NE MARIETTA, GA, 30062					
HIGH	YES	04/10/2006	YES	09/29/2006	YE	09/26/2002	YE	09/30/2004
DANA COMPANIES LLC	ILD006114169		5253 MCCURRY RD ROSCOE, IL, 61073					
HIGH	YES	02/12/1991	YES	11/30/1991	YE	01/22/1999	YE	01/22/1999
DANA COMPANIES LLC	OHD005039730		5278 US ROUTE 24 ANTWERP, OH, 45813					
HIGH	YES	07/16/2008	NO		YE	09/29/2005	YE	12/22/2006
DANA CORPORATION	MID980499735		2001 SANFORD ST MUSKEGON HEIGHTS, MI, 49444					
LOW	NO		NO		YE	10/03/2002	YE	08/28/2002
DANAHER SENSORS & CONTROLS	NCD041466251		2100 WEST BROAD STREET ELIZABETHTOWN, NC, 28337					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2003
DANBURY LANDFILL	CTD000841163		PLUMTREES RD DANBURY, CT, 06810					
HIGH	YES	12/19/1995	YES	04/09/2002	YE	06/18/2001	YE	04/13/2000
DASSAULT FALCON JET- WILMINGTON CORP.	DED011028438		191 NORTH DUPONT HWY NEW CASTLE, DE, 19720					
HIGH	YES	03/02/2001	YES	03/02/2001	YE	07/09/1999	YE	07/09/1999
DAVIS PIPE	TND066723263		250 BIRCH STREET BLOUNTVILLE, TN, 37617					
HIGH	YES	03/22/2006	YES	03/22/2006	YE	09/30/1999	YE	08/30/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
DE PERE FOUNDRY INC	WID048876239		805 SO SIXTH ST DE PERE, WI, 54115
HIGH / YES / 10/04/2006	YES / 10/04/2006	YE / 10/04/2006	YE / 10/04/2006
DE VILBISS SOMERSET HEALTH CARE DIV	PAD990752537		ROUTE 31 E SOMERSET, PA, 15501
HIGH / YES / 01/18/2001	YES / 01/18/2001	YE / 11/14/2000	YE / 11/14/2000
DECATUR CO/FORMER ITT-UP	GAD048708572		DECATUR CO INDUSTRIAL PK BAINBRIDGE, GA, 31717
HIGH / YES / 08/27/2007	YES / 08/22/2007	YE / 09/19/2000	YE / 09/19/2000
DEFENSE SUPPLY CENTER COLUMBUS	OH6210020222		3990 E BROAD ST COLUMBUS, OH, 43216
HIGH / NO	NO	YE / 09/26/2008	NO STATUS
DEGUSSA INITIATORS INC	OHD046202602		555 GARDEN STREET ELYRIA, OH, 440354870
HIGH / YES / 09/30/1997	NO	YE / 02/07/2000	YE / 01/29/2001
DELBAR PRODUCTS INC	PAD002378149		601 W SPRUCE ST PERKASIE, PA, 189440801
MEDIUM / YES / 09/26/2007	YES / 09/26/2007	YE / 08/04/2006	YE / 08/18/2006
DELEK REFINING LTD	TXD007333800		1702 E COMMERCE ST TYLER, TX, 75702
HIGH / YES / 07/21/2006	NO	YE / 01/25/2000	YE / 02/04/2005
DELPHI AHG VANDALIA	OHD052151701		480 N DIXIE DR VANDALIA, OH, 45377
HIGH / YES / 03/30/2007	YES / 09/25/2007	YE / 02/24/2004	YE / 12/28/2004
DELPHI AUTOMOTIVE SYSTEMS	OHD045557766		3100 NEEDMORE ROAD DAYTON, OH, 45414
HIGH / NO	NO	YE / 01/29/2001	YE / 01/29/2001
DELPHI AUTOMOTIVE SYSTEMS LLC	MID017079625		2100 BURLINGAME AVE SW WYOMING, MI, 49509
HIGH / NO	NO	YE / 09/29/2004	YE / 12/28/2006
DELPHI AUTOMOTIVE SYSTEMS LLC	MID005356647		2926 DAVISON RD FLINT, MI, 48506
HIGH / NO	NO	YE / 09/29/2004	YE / 12/28/2006
DELPHI DELCO ELECTRONICS SYS ADM BLDG	IND006068050		700 E FIRMIN ST KOKOMO, IN, 469049005
HIGH / NO	NO	YE / 03/05/2008	YE / 06/30/2008
DELPHI ENERGY & CHASSIS	GAD075942706		342 PERRY HOUSE ROAD FITZGERALD, GA, 31750
MEDIUM / YES / 04/13/2000	NO	YE / 09/29/2006	YE / 09/29/2006
DELPHI PACKARD ELECTRIC SYSTEMS	MSD065462517		1001 INDUSTRIAL PARK DRIVE CLINTON, MS, 36056
HIGH / YES / 11/27/2006	YES / 11/27/2006	YE / 01/29/2001	YE / 01/29/2001
DELTA AIRLINES INC.	GAD006924872		1775 AVIATION BLVD. ATLANTA, GA, 30320
HIGH / NO	NO	YE / 09/14/1999	YE / 10/26/1999
DELTA RUBBER CO A SUB OF N N INC	CTD046238630		39 WAUREGAN ROAD DANIELSON, CT, 06239
HIGH / YES / 09/27/2007	YES / 09/27/2007	YE / 06/12/1999	YE / 09/29/1999
DELTECH CORPORATION	LAD008188583		11911 SCENIC HIGHWAY BATON ROUGE, LA, 70807
HIGH / NO	NO	YE / 04/17/2002	YE / 06/28/2002
DEMENNO/KERDOON	CAT080013352		2000 N. ALAMEDA ST. COMPTON, CA, 90222
HIGH / NO	NO	YE / 09/27/2002	NO / 05/05/2000
DEMMER PROPERTIES LLC	MID005380134		1600 N LARCH ST LANSING, MI, 48906
HIGH / NO	NO	YE / 09/27/2002	YE / 10/23/2006
DEPT OF THE ARMY / FORT CARSON	CO2210020150 / US Army		1638 ELWELL ST BLDG 6236 , FORT CARSON, CO, 80913
HIGH / NO	NO	IN / 08/28/2000	NO / 08/28/2000
DESERET CHEMICAL DEPOT	UT5210090002 / US Army		11500 STARK ROAD STOCKTON, UT, 84071
HIGH / NO	NO	YE / 05/15/2000	YE / 03/16/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
DESIGN ORIGINALS INC	OHD063989545		402 JACKSON ST JACKSON CENTER, OH, 45334					
HIGH	NO		NO		YE	03/29/2007	YE	03/29/2007
DETREX CORP	MID091605972		12886 EATON AVE DETROIT, MI, 48227					
LOW	NO		NO		IN	09/29/2008	YE	02/10/2006
DETROIT DIESEL CORPORATION	MID005356803		13400 W OUTER DR DETROIT, MI, 48239					
MEDIUM	NO		NO		YE	12/04/1999	YE	09/02/2003
DETROIT STEEL COMPANY	MID017422304		1491 W JEFFERSON AVE TRENTON, MI, 48183					
MEDIUM	NO		NO		NO STATUS		NO STATUS	
DIAMOND HARD CHROME INC	OHD987040334		6110 GRAND AVENUE CLEVELAND, OH, 44104					
HIGH	NO		NO		YE	04/27/2005	IN	04/29/1999
DIAMOND SHAMROCK REFINING AND MARKETING	TXD990709966		301 LE ROY ST THREE RIVERS, TX, 78071					
HIGH	YES	02/02/2007	YES	02/02/2007	YE	01/31/2000	YE	01/31/2000
DIC IMAGING PRODUCTS USA INC	WID055301055		7300 S TENTH ST OAK CREEK, WI, 53154					
LOW	YES	11/04/2005	YES	11/04/2005	YE	11/04/2005	YE	11/04/2005
DIGITAL EQUIPMENT CORP	PRD000706333		RD 368 KM 24 SABANA GRANDE, PR, 00747					
HIGH	YES	08/30/2006	YES	08/30/2006	YE	09/28/2000	YE	09/28/2000
DIXIE METALS CORP	LAD055792097		HWY 531 E AT CITY LIMITS HEFLIN, LA, 71039					
HIGH	YES	08/15/2005	YES	12/12/2007	YE	06/30/2005	YE	06/30/2005
DIXON TICONDEROGA CO DEER LAKE	PAD041250242		2 MI N OF INTERSECTION RT 61 & RT 895 ON LEFT, DEER LAKE, PA, 17961					
HIGH	YES	09/27/1994	YES	07/01/2003	YE	09/24/2002	YE	09/24/2002
DLAC/WRI LLC	FLD101877876		1819A ALBERT ST JACKSONVILLE, FL, 322021103					
MEDIUM	YES	09/29/2006	YES	10/15/2007	YE	09/29/2006	YE	09/28/2006
DM&IR RAILWAY - PROCTOR YARD	MND006961239		329 2ND ST BLDG 146 PROCTOR, MN, 55810					
HIGH	NO		NO		NO STATUS		IN	09/30/1997
DOLAN WOHLERS CORP	NJD002155448		429 ROCKAWAY VALLEY RD BOONTON TWP, NJ, 07005					
HIGH	YES	01/01/1986	YES	12/01/1997	YE	04/27/2001	YE	08/01/2002
DONHAM CRAFT, INC.	CTD001450006		15 EAST WATERBURY ROAD NAUGATUCK, CT, 06770					
HIGH	NO		NO		YE	11/18/1999	YE	09/25/2003
DORE INDUSTRIAL INC	MID005359286		501 MORTON ST BAY CITY, MI, 48706					
HIGH	YES	09/21/2006	YES	09/30/1999	YE	09/21/2006	YE	09/21/2006
DOT FAIRBANKS DISPOSAL PIT	FLD980799050		8000 NE 51ST ST GAINESVILLE, FL, 326091288					
HIGH	YES	05/03/1996	YES	07/30/1996	YE	09/30/1998	YE	09/30/1998
DOVER CHEMICAL-HAMMOND WORKS	IND082071234		3000 SHEFFIELD AVE , HAMMOND, IN, 463271099					
HIGH	NO		NO		YE	09/17/2007	NO STATUS	
DOVER INDUSTRIES REMEDIATION	COD005548037		5601-1/2 N 71ST ST LONGMONT, CO, 805038698					
HIGH	YES	09/25/2003	YES	04/20/2006	YE	04/06/2000	YE	04/06/2000
DOW CORNING CORPORATION	MID000809632		3901 SOUTH SAGINAW ROAD MIDLAND, MI, 48640					
MEDIUM	NO		NO		YE	09/24/1999	YE	09/24/1999
DRACKETT INC	PAD003038544		RTE 447 EAST STROUDSBURG, PA, 18301					
HIGH	YES	08/31/1999	YES	08/31/1999	YE	07/03/2002	YE	09/03/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
DRIFT RIVER TERMINAL COOK INLET PIPELINE	AKD000641811		ANCHORAGE APPROX 90 MI SW OF ANCHORAGE, DRIFT RIVER, AK, 99600
HIGH	YES	09/28/2006	YES	09/28/2006	YE	06/14/2002	YE	09/30/2003
DSM CHEMICALS NORTH AMERICA INC	GAD051011609		#1 COLUMBIA NITROGEN ROAD AUGUSTA, GA, 30901
LOW	NO		NO		YE	09/30/2002	NO	08/16/1996
DSM NUTRITIONAL PRODUCTS INC	NJD042321042		205 MACKS ISLAND DR BELVIDERE, NJ, 07823
HIGH	YES	01/01/1995	YES	03/26/2003	YE	09/30/1999	YE	09/30/1999
DSM PHARMACEUTICALS, INC.	NCD047373766		5900 NW GREENVILLE BLVD. GREENVILLE, NC, 27834
HIGH	YES	04/19/2007	YES	09/10/2008	YE	09/29/2003	YE	09/29/2003
DU PONT E I DE NEMOURS AND CO	IND005174354		5215 KENNEDY AVE EAST CHICAGO, IN, 46312
HIGH	NO		NO		YE	12/21/2004	YE	06/29/2005
DUCOMMUN AEROSTRUCTURES	CAD093245645		4001 EL MIRAGE ROAD EL MIRAGE, CA, 92301
HIGH	NO		NO		YE	11/18/2003	YE	09/25/2008
DUDLEY LAUNDRY COMPANY	NED035093178		126 N 3RD NORFOLK, NE, 68701
HIGH	NO		NO		YE	07/10/2003	YE	09/04/2002
DUGWAY PROVING GROUND	UT3750211259	US Army	COMMANDER, U.S. ARMY DUGWAY PROVING GROUND, DUGWAY, UT, 84022
HIGH	NO		NO		YE	09/04/2002	YE	09/04/2002
DULUTH AIR NATIONAL GUARD BASE	MND000773341		4680 VIPER STREET , DULUTH, MN, 558116033
HIGH	YES	01/07/1997	YES	01/14/2004	YE	09/30/1997	YE	01/14/2004
DUOLITE INTERNATIONAL	CAD990792335		800 CHESTNUT ST REDWOOD CITY, CA, 94063
HIGH	YES	01/20/1993	NO		YE	09/23/2002	YE	09/22/2003
DUPONT - SPRUANCE PLANT	VAD009305137		5401 JEFFERSON DAVIS HIGHWAY RICHMOND, VA, 23234
HIGH	NO		NO		YE	01/15/2002	YE	02/14/2003
DUPONT CHAMBERS WORKS	NJD002385730		ROUTE 130 DEEPWATER, NJ, 08023
HIGH	NO		NO		YE	05/28/2004	YE	09/02/2004
DUPONT CIRCLEVILLE PLANT	OHD004287322		800 DUPONT ROAD CIRCLEVILLE, OH, 43113
HIGH	YES	03/21/2005	NO		YE	04/30/2003	YE	12/27/2001
DUPONT E I DE NEMOURS & CO POMPTON LAKES	NJD002173946		2000 CANNONBALL RD POMPTON LAKES, NJ, 074421797
HIGH	NO		NO		NO STATUS		YE	04/14/2005
DUPONT E I DENEMOURS & CO INC	IAD005272398		801 35TH ST FORT MADISON, IA, 52627
HIGH	NO		NO		YE	09/27/2001	YE	09/27/2001
DUPONT EXPERIMENTAL STATION	DED003930807		PO BOX 80249 WILMINGTON, DE, 198800249
HIGH	YES	09/30/1991	YES	07/12/1996	YE	01/09/2002	YE	01/09/2002
DUPONT WAYNESBORO	VAD003114832		400 DUPONT BLVD WAYNESBORO, VA, 22980
HIGH	NO		NO		YE	10/01/2003	YE	09/19/2005
DUPONT-MOBILE SITE	ALD093179315		12650 HIGHWAY 43 AXIS, AL, 36505
HIGH	YES	09/30/2004	YES	08/26/2005	YE	12/27/2001	YE	12/27/2001
DUREZ CORP	OHD990747859		13717 US RTE 68 S KENTON, OH, 43326
HIGH	YES	12/08/1997	YES	04/21/1998	YE	09/02/2008	YE	08/14/2008
DUREZ CORPORATION	NYD002103216		PACKARD ROAD NIAGARA FALLS, NY, 14304
HIGH	YES	09/29/1995	YES	09/29/1995	YE	09/22/2000	YE	09/22/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address	NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
DURIRON CO INC THE FOUNDRY AND PUMP DIV	OHD004241550		425 N FINDLAY ST DAYTON, OH, 45404									
				HIGH	NO		NO		NO STATUS		NO STATUS	
DUROMATIC PRODUCTS CORP	TND052144011		121 FACTORY STREET CAMPAIGN, TN, 38550									
				LOW	YES	09/29/1993	YES	09/29/1997	YE	09/30/1998	YE	09/30/1998
DYMON INC	KSD067952994		3401 KANSAS AVE KANSAS CITY, KS, 66106									
				HIGH	NO		NO		YE	09/30/2003	YE	09/30/2004
DYNEGY MORRO BAY LLC	CAT080011646		1290 EMBARCADERO ROAD MORRO BAY, CA, 93442									
				HIGH	YES	01/01/1996	YES	11/01/1997	YE	04/10/2000	YE	04/10/2000
DYNO NOBEL INC	COD075754663		7800 N MOORE RD LITTLETON, CO, 80125									
				HIGH	YES	09/05/2006	YES	09/05/2006	YE	07/17/2003	YE	09/28/2004
DYNO NOBEL INC.	NYD000799122		ULSTER AVENUE ULSTER PARK, NY, 12487									
				HIGH	NO		NO		YE	09/30/2002	YE	09/29/2004
DYNO NOBEL, INC.	CTD058509712		660 HOPMEADOW STREET SIMSBURY, CT, 06070									
				HIGH	NO		NO		YE	09/08/2003	YE	11/20/2003
E I DU PONT DE NEMOURS AND COMPANY	TXD063101794		HWY 361 INGLESIDE, TX, 78362									
				HIGH	NO		NO		YE	03/09/2005	YE	03/09/2005
E I DU PONT DE NEMOURS AND COMPANY	TXD008079212		12501 STRANG RD LA PORTE, TX, 77571									
				HIGH	NO		NO		YE	08/26/2002	YE	10/19/2005
E I DUPONT DE NEMOURS & CO	PAD003038056		PATTERSON BLVD TOWANDA, PA, 18848									
				HIGH	NO		NO		YE	09/25/2002	YE	09/26/2002
E I DUPONT DE NEMOURS & CO INC	TND007024672		2571 FITE RD MEMPHIS, TN, 381270038									
				MEDIUM	NO		NO		YE	09/28/2006	YE	09/28/2006
E I DUPONT DE NEMOURS & COMPANY	NJD002444024		250 CHEESEQUAKE RD PARLIN, NJ, 08859									
				HIGH	NO		NO		YE	09/30/2004	NO STATUS	
E I DUPONT DENEMOURS & CO INC	DED042263764		RTE 896 BUILDING 200 GLASGOW SITE, NEWARK, DE, 19702									
				HIGH	YES	08/10/2000	YES	03/13/2003	YE	11/05/1999	YE	11/05/1999
E. I. DU PONT DE NEMOURS & CO INC	TND003331766		4501 N. ACCESS ROAD CHATTANOOGA, TN, 37415									
				HIGH	YES	09/04/2008	YES	09/04/2008	YE	09/07/2000	YE	09/30/2002
E. I. DUPONT COMPANY - REPAUNO PLANT	NJD002373819		200 N. REPAUNO AVENUE GIBBSTOWN, NJ, 08027									
				HIGH	NO		NO		YE	09/25/2003	YE	09/23/2003
E. I. DUPONT DE NEMOURS & CO	CAD009151671		6000 BRIDGEHEAD ROAD OAKLEY, CA, 94561									
				HIGH	NO		NO		YE	01/10/2001	YE	05/04/2005
E. I. DUPONT DE NEMOURS & COMPANY	WVD005012851		901 WEST DUPONT AVENUE , BELLE, WV, 25015									
				HIGH	NO		NO		YE	12/19/2003	YE	09/22/2005
E. I. DUPONT DE NEMOURS & COMPANY	WVD045875291		8480 DUPONT ROAD , WASHINGTON, WV, 26181									
				HIGH	NO		NO		YE	09/29/2003	YE	04/23/2004
E. I. DUPONT POTOMAC RIVER WORKS	WVD041952714		US RTE 11 , FALLING WATERS, WV, 25419									
				HIGH	NO		NO		YE	09/29/2003	YE	09/29/2003
E.I. DU PONT DE NEMOURS AND CO	MSD096046792		7685 KILN-DELISLE ROAD PASS CHRISTIAN, MS, 39571									
				MEDIUM	NO		NO		YE	07/07/2004	YE	07/07/2004
E.I. DUPONT DE NEMOURS & CO	KYD003924198		4200 CAMPGROUND RD , LOUISVILLE, KY, 40216									
				MEDIUM	NO		NO		YE	07/23/2008	NO	07/09/1996

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
EAGLE PICHER TECHNOLOGIES LLC	COD048126726		3820 S HANCOCK EXPWY COLORADO SPRINGS, CO, 80911					
HIGH	YES	06/04/2003	YES	10/03/2003	YE	09/24/2003	YE	09/17/2002
EAGLEBROOK INC	OHD000724088		17877 ST CLAIR AVE CLEVELAND, OH, 44110					
HIGH	NO		NO		YE	12/07/1999	YE	12/07/1999
EAGLEPICHER TECHNOLOGIES LLC	MOD046740148		C & PORTER ST JOPLIN, MO, 64801					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2003
EAST CHICAGO WATERWAYS MGMT DIST	IND082547803		3500 INDIANAPOLIS BLVD EAST CHICAGO, IN, 46312					
HIGH	NO		NO		YE	10/10/2002	NO	09/29/2000
EAST COAST ENVIRONMENTAL SERVICES	CTD089631956		454 QUINNIPIAC AVE NEW HAVEN, CT, 06513					
HIGH	YES	08/07/2007	NO		YE	02/09/2004	IN	12/17/2002
EAST PENN MFG CO	PAD002330165		PO BOX 147 DEKA RD, LYON STATION, PA, 19536-0147					
HIGH	NO		YES	11/13/2001	YE	08/19/2002	YE	08/19/2002
EASTMAN CHEMICAL COMPANY	TXD007330202		STATE HWY 149 @ KODAK BLVD LONGVIEW, TX, 75603					
HIGH	YES	07/24/2006	YES	07/24/2006	YE	01/28/2000	YE	01/28/2000
EASTMAN CHEMICAL COMPANY, TENNESSEE OPER	TND003376928		1137 EASTMAN ROAD KINGSPORT, TN, 37664					
HIGH	YES	04/04/2006	YES	04/04/2006	YE	07/27/2000	YE	07/27/2000
EASTMAN KODAK CO	NYD980592497		LAKE AVE ROCHESTER, NY, 14652					
HIGH	NO		NO		YE	09/30/2008	YE	09/29/2005
EASTON UTILITIES COMM MUNI ELECT UTIL	MDD980555668		219 NORTH WASHINGTON STREET EASTON, MD, 21601					
HIGH	YES	04/14/2003	YES	04/14/2003	YE	10/03/2002	YE	10/03/2002
EASTPOINT	NCD067203752		8001 HWY 64 E KNIGHTDALE, NC, 27545					
HIGH	YES	08/10/2007	YES	08/10/2007	YE	09/28/2001	YE	09/28/2001
EATON CORPORATION	KYD098950306		2901 INDUSTRIAL DRIVE BOWLING GREEN, KY, 42101					
HIGH	YES	09/29/2006	YES	09/29/2006	YE	09/29/2006	YE	09/29/2006
EATON DBA SORENSEN PARK PLAZA	NED007286198		6600 N 72ND ST OMAHA, NE, 68122					
MEDIUM	NO		NO		YE	03/20/2001	YE	06/13/2005
EATON HYDRAULICS INC	MOD007155781		2800 W 10TH ST JOPLIN, MO, 64801					
HIGH	NO		NO		YE	09/29/2006	YE	09/29/2006
EATON MDH COMPANY INC	NED065133167		4200 HWY 30 E KEARNEY, NE, 68847					
HIGH	NO		NO		YE	08/04/2000	YE	09/21/2005
ECC CORPORATION	MAD001138726		156 PRINCETON ST JEFFERSON, MA, 01522					
HIGH	NO		NO		YE	09/26/2001	YE	09/26/2001
ECOLOGICAL SERVICES INC	OHD980795264		6201 S PLEASANT DR , EAST PALESTINE, OH, 44413					
HIGH	YES	11/20/2006	NO		YE	11/24/2000	YE	11/24/2000
EDGERTON METAL PRODUCTS	OHD005052493		218 E BEMENT ST EDGERTON, OH, 43517					
HIGH	NO		NO		YE	12/31/2007	YE	12/31/2007
EDGEWATER STEEL CO	PAD074966789		300 COLLEGE AVE OAKMONT, PA, 15139-2108					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2003
EDMOS CORP	NYD047648472		20 GARVIES POINT RD GLEN COVE, NY, 11542					
HIGH	NO		NO		YE	02/01/2007	YE	12/08/2006
EDMUND OPTICS	PAD002334373		601 MONTGOMERY AVE PENNSBURG, PA, 18073-1515					
HIGH	NO		NO		YE	12/02/2004	YE	09/27/2007

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
EDWARD C LEVY CO	MID094549425		13950 MELLON RD DETROIT, MI, 48217					
LOW	NO		NO		YE	11/04/1999	YE	11/04/1999
EDWARD C LEVY CO	MID000809665		100 W WESTFIELD RD ECORSE, MI, 48229					
LOW	NO		NO		YE	11/04/1999	YE	11/04/1999
EDWARDS OIL SERVICE INC	MID088754668		530 S ROUGE ST DETROIT, MI, 48217					
MEDIUM	NO		NO		YE	07/02/1992	YE	11/22/1993
EI DUPONT FLINT SITE	MID005512066		1555 JAMES P COLE BLVD FLINT, MI, 48503					
LOW	YES	08/14/2006	NO		YE	09/21/2006	YE	01/30/2006
ELECTRIC BOAT CORP SHIPYARD	CTD001147842		75 EASTERN POINT ROAD GROTON, CT, 06340					
HIGH	NO		NO		YE	09/20/2004	YE	08/13/2001
ELECTRIC BOAT CORPORATION - MIDWAY FACIL	CTD018668269		DEPOT ROAD GROTON, CT, 06340					
MEDIUM	NO		NO		YE	01/25/2001	YE	09/26/2000
ELECTROLUX HOME PRODUCTS NORTH AMERICA	MND092304856		701 33RD AVE N ST CLOUD, MN, 56301					
HIGH	YES	04/29/2008	YES	04/29/2008	YE	08/16/2006	YE	08/16/2006
ELECTRONIC PARTS SPECIALTY CO	NJD002361665		COLES AVE LUMBERTON, NJ, 08048					
HIGH	YES	10/08/1998	NO		YE	04/18/2001	YE	04/27/2001
ELECTROPLATING IMPOUNDMENT LDFL	PAD063652820		201 STACKPOLE ST SAINT MARYS, PA, 15857					
HIGH	NO		NO		YE	09/29/2005	NO STATUS	
ELEMENTIS CHEMICALS INC	NHD000471771		441 D W HWY MERRIMACK, NH, 03054					
HIGH	YES	09/19/2006	YES	09/19/2006	YE	08/16/2006	YE	08/16/2006
ELI LILLY & CO-TIPPECANOE LABS	IND006050967		1650 LILLY RD LAFAYETTE, IN, 47909					
MEDIUM	NO		NO		YE	11/13/2000	YE	05/16/2003
ELI LILLY AND CO CLINTON LABS	IND072040348		10500 S SR 63 , CLINTON, IN, 478420099					
MEDIUM	YES	06/13/2002	YES	06/13/2002	YE	05/11/1999	YE	05/12/1999
ELISKIM INC.	SCD003342938		SC 81 S AND TRUE TEMPER RD ANDERSON, SC, 29624					
HIGH	YES	06/28/2006	YES	06/28/2006	YE	09/30/2003	YE	09/05/2002
EMD CHEMICALS INC	OHD086438538		2909 HIGHLAND AVE CINCINNATI, OH, 45212					
HIGH	NO		NO		YE	04/20/2002	YE	12/28/2006
EMERALD CAROLINA CHEMICAL LLC	NCD003168168		8309 WILKINSON BLVD , CHARLOTTE, NC, 28214					
HIGH	YES	09/17/2007	YES	09/17/2007	YE	07/15/2004	YE	07/15/2004
EMERALD KALAMA CHEMICAL LLC	WAD092899574		1296 NW 3RD ST KALAMA, WA, 986259799					
HIGH	NO		NO		YE	09/23/2005	YE	09/23/2005
EMERALD MATERIALS HILTON DAVIS	OHD004240313		2235 LANGDON FARM ROAD CINCINNATI, OH, 452374712					
MEDIUM	NO		NO		YE	09/30/2008	NO STATUS	
EMERALD RECYCLING	WAD058367152		1500 AIRPORT WAY S SEATTLE, WA, 98134					
HIGH	NO		NO		YE	03/26/2003	YE	03/26/2003
EMHART INDUSTRIAL IN	NHD000845768		77 L WEBSTER ST JAFFREY, NH, 03452					
HIGH	YES	12/18/2000	YES	12/05/2004	YE	03/17/1998	YE	03/17/1998
EMPIRE SPECIALTY STEEL INC	NYD030215529		90 WILLOWBROOK AVE DUNKIRK, NY, 140480152					
HIGH	NO		NO		YE	09/30/2008	YE	09/01/2005

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
EMPORIA FOUNDRY INC.	VAD023720105		620 REESE ST EMPORIA, VA, 23847
MEDIUM	NO		NO		YE	09/11/2008	YE	09/11/2008
ENCYCLE TEXAS INC	TXD008117186		5500 UP RIVER RD CORPUS CHRISTI, TX, 78407
HIGH	NO		NO		YE	12/16/2004	YE	04/20/2004
ENGLAND AIR FORCE BASE	LA9572124452	US Air Force	6911 ARNOLD DR ALEXANDRIA, LA, 71303
HIGH	NO		NO		YE	06/30/2003	YE	06/30/2003
ENSIGN-BICKFORD CO	ILD980700710		HIGHWAY 3 N WOLF LAKE, IL, 62998
HIGH	NO		NO		YE	05/13/2003	YE	06/13/2002
ENVIRITE CORP	CTD093616613		OLD WATERBURY RD THOMASTON, CT, 06787
HIGH	NO		NO		YE	08/21/2001	YE	09/04/2001
ENVIROFOCUS TECHNOLOGIES LLC	FLD004092839		1901 N 66TH ST TAMPA, FL, 336192901
HIGH	NO		NO		YE	01/25/2002	YE	01/25/2002
ENVIRONMENTAL COMPLIANCE CORP	MAD062179890		441 R CANTON ST STOUGHTON, MA, 02072
MEDIUM	NO		NO		YE	09/10/2002	YE	09/10/2002
ENVIRONMENTAL PROCESSING SERVICES	OHD000608588		416 LEO ST DAYTON, OH, 45404
HIGH	NO		NO		YE	06/29/2001	NO STATUS	
ENVIRONMENTAL RESEARCH CENTER	AL3640090004		RESERVATION ROAD , MUSCLE SHOALS, AL, 35661
LOW	NO		NO		YE	09/30/2008	YE	09/30/2008
ENVIRONMENTAL WASTE RESOURCES INC	ILD087157251		SOUTH BROADWAY ST & REED RD COAL CITY, IL, 60416
HIGH	NO		NO		YE	04/13/2005	YE	03/07/2005
ENVIROSAFE SERVICES OF OHIO INC	OHD045243706		876 OTTER CREEK ROAD OREGON, OH, 43616
HIGH	NO		NO		YE	03/30/2005	IN	08/28/1997
ENVIROTROL BEAVER FALLS COHWO	PAD980707087		24TH ST & 31ST ST EXT BEAVER FALLS, PA, 15010
HIGH	YES	04/03/2003	YES	04/03/2003	YE	09/12/2001	YE	09/12/2001
EPC EASTSIDE DSPL FARM	CAD030384267		SEC 24&30 T28S R28-29E MDBM BAKERSFIELD, CA, 93301
HIGH	YES	09/25/2008	NO		YE	08/11/2000	YE	09/09/2004
EPEC POLYMERS, INC.	NJD001890300		45 RIVER RD FLEMINGTON, NJ, 08822
HIGH	YES	04/11/2003	YES	09/19/2008	YE	09/30/2002	YE	02/15/1995
EQ RESOURCE RECOVERY INC	MID060975844		36345 VAN BORN RD ROMULUS, MI, 48174
MEDIUM	NO		NO		YE	09/24/1999	YE	09/24/1999
EQUILON DBA SHELL OIL PRODUCTS	ILD080012305		900 S CENTRAL AVE ROXANA, IL, 62084
HIGH	NO		NO		YE	06/30/2003	YE	06/30/2003
EQUISTAR CHEMICALS LP	ILD048296180		8805 N TABLER RD MORRIS, IL, 60450
HIGH	YES	05/13/2005	NO		YE	05/19/2000	YE	05/19/2000
EQUISTAR CHEMICALS LP	IAD045372836		3400 ANAMOSA RD CLINTON, IA, 52732
HIGH	YES	09/29/1994	YES	02/12/1999	YE	11/22/2006	YE	09/15/2005
EQUISTAR CHEMICALS LP	TXD058275769		8280 SHELDON RD BLDG 1 CHANNELVIEW, TX, 77530
MEDIUM	NO		NO		YE	01/22/2001	YE	01/22/2001
EQUISTAR CHEMICALS-TUSCOLA	ILD005078126		625 E RTE 36 TUSCOLA, IL, 61953
HIGH	NO		NO		YE	03/05/2002	YE	03/10/2008
ERCO WORLDWIDE (USA) INC - PORT EDWARDS	WID046536231		101 STH 73 S PORT EDWARDS TN, WI, 54469
HIGH	YES	12/17/1997	YES	12/17/1999	YE	08/23/2000	YE	08/23/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
ESAB WELDING & CUTTING PRODUCTS	SCD005574967		411 S EBENEZER RD FLORENCE, SC, 29501					
HIGH	NO		NO		YE	09/24/1996	YE	09/23/1996
ESCAST INC	ILD000672139		21 N CHURCH ST ADDISON, IL, 60101					
HIGH	NO		NO		YE	12/09/1999	YE	12/09/1999
ESSROC CEMENT CORP	IND005081542		SR 25 S 3084 W CR 225 S LOGANSPORT, IN, 46947					
HIGH	NO		NO		YE	05/16/2003	YE	09/30/2002
ETHICON INC., JOHNSON & JOHNSON	NJD002144145		US ROUTE 22 WEST BRIDGEWATER TOWNSHIP, NJ, 08876					
MEDIUM	NO		NO		YE	09/29/2006	YE	09/30/2008
ETHYL CORPORATION	TXD008096158		1000 N SOUTH ST PASADENA, TX, 77503					
HIGH	NO		NO		YE	01/13/2000	YE	01/13/2000
EVERGREEN LANDFILL	OHD068111327		2625 E BROADWAY NORTHWOOD, OH, 43619					
HIGH	NO		NO		YE	03/05/1999	YE	03/05/1999
EVERWOOD TREATMENT COMPANY INC	ALD004488169		6740 TAYLOR ROAD , IRVINGTON, AL, 36544					
HIGH	YES	05/17/2007	YES	08/20/2007	YE	09/18/2006	YE	09/18/2006
EVONIK CYRO LLC	MED040249096		1796 MAIN STREET SANFORD, ME, 04073					
HIGH	YES	05/15/2006	YES	05/15/2006	YE	09/05/1996	YE	09/26/1997
EVONIK GOLDSCHMIDT CORP	WID094361458		900 S PALM ST JANESVILLE, WI, 535471018					
MEDIUM	YES	12/05/1996	YES	02/10/1997	YE	04/02/2001	YE	04/02/2001
EWS ALABAMA INC	ALD981020894		402 WEBSTER CHAPEL ROAD GLENCOE, AL, 35905					
MEDIUM	YES	03/26/2004	YES	03/26/2004	YE	04/07/2000	YE	04/07/2000
EXIDE SAN FRANCISCO SERV CTR	CAD046000931		286 LAWRENCE AVE SOUTH SAN FRANCISCO, CA, 94080					
LOW	NO		NO		YE	04/17/2000	YE	04/17/2000
EXIDE TECHNOLOGIES	GAD070330576		3639 JOY ROAD , COLUMBUS, GA, 31906					
MEDIUM	NO		NO		NO	07/31/1996	NO	07/31/1996
EXIDE TECHNOLOGIES	FLD000608083		3521 SOUTH YOKAM DIAMOND STREE TAMPA, FL, 33619					
HIGH	NO		NO		YE	09/30/2005	NO	05/27/1998
EXIDE TECHNOLOGIES	PAD990753089		MONTROSE & SPRING VALLEY RD READING, PA, 19605					
HIGH	NO		NO		IN	04/09/1996	IN	04/09/1996
EXIDE TECHNOLOGIES	CAD097854541		2700 SOUTH INDIANA STREET LOS ANGELES, CA, 90023					
HIGH	NO		NO		YE	06/03/2005	NO	05/04/2000
EXIDE TECHNOLOGIES - CANON HOLLOW PLANT	MOD030712822		CANON HOLLOW RD FOREST CITY, MO, 64451					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2003
EXIDE TECHNOLOGIES BATON ROUGE SMELTER	LAD008184137		2400 BROOKLAWN DR , BATON ROUGE, LA, 70807					
HIGH	NO		NO		YE	07/02/2002	YE	03/20/2002
EXLINE INC	KSD007127327		3256 E COUNTRY CLUB RD , SALINA, KS, 67401					
HIGH	NO		NO		YE	09/30/2003	YE	08/16/2002
EXPERT MANAGEMENT	PAD071203046		2 RIVER RD TAMAQUA, PA, 18252					
HIGH	YES	09/28/2007	YES	09/28/2007	YE	10/05/2001	YE	06/10/2003
EXPERT MANAGEMENT INC	MOD077887909		3078 COUNTY RD 180 CARTHAGE, MO, 64836					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
EXXON BAYWAY REFINING CO	NJD062037031		1400 PARK AVE LINDEN, NJ, 070361610					
HIGH	NO		NO		YE	07/06/2005	YE	08/29/2005
EXXON MOBIL CORPORATION	TXD000782698		2800 DECKER DR BAYTOWN, TX, 77520					
MEDIUM	NO		NO		YE	04/28/2004	YE	04/28/2004
EXXON MOBIL CORPORATION	TXD082684002		8230 STEDMAN ST HOUSTON, TX, 77029					
HIGH	NO		NO		YE	08/16/2007	IN	08/16/2007
EXXON MOBIL PORT MOBIL TERMINAL	NYD000824516		4101 ARTHUR KILL RD STATEN ISLAND, NY, 10309					
HIGH	NO		NO		YE	06/30/2003	YE	09/30/2003
EXXONMOBIL BATON ROUGE REFINERY	LAD062662887		4045 SCENIC HIGHWAY BATON ROUGE, LA, 70805					
HIGH	NO		NO		YE	06/28/2002	YE	06/28/2002
EXXONMOBIL BR PLASTICS PLANT	LAD000778381		11675 SCOTLAND ZACHARY HWY BATON ROUGE, LA, 70807					
HIGH	YES	03/28/2008	YES	04/03/2008	YE	06/26/2002	YE	06/26/2002
EXXONMOBIL OIL CORPORATION	TXD990797714		1795 BURT BEAUMONT, TX, 77001					
HIGH	YES	07/28/2008	NO		YE	01/31/2000	YE	06/30/2004
EXXONMOBIL OILL CORP TORRANCE REFINERY	CAD008354052		3700 W 190TH STREET TORRANCE, CA, 90504					
HIGH	NO		NO		YE	09/26/2003	YE	04/07/2006
FAGERDALA USA	ILD006536239		605 12TH ST MENDOTA, IL, 61342					
HIGH	YES	07/12/1994	YES	02/07/2003	YE	06/30/2001	YE	06/14/2001
FAIRCHILD REPUBLIC CO	NYD079818555		CONKLIN ST FARMINGDALE, NY, 11735					
MEDIUM	YES	04/01/2008	NO		YE	09/17/2001	YE	07/28/2005
FARIA THOMAS G CORP	CTD043038744		385 NORWICH NEW LONDON TPK UNCASVILLE, CT, 06382					
HIGH	NO		NO		YE	09/30/2003	YE	06/12/2006
FEDERAL CARTRIDGE COMPANY	MND006156590		900 EHLEN DRIVE ANOKA, MN, 55303					
MEDIUM	NO		NO		YE	08/16/2006	YE	08/16/2006
FEDERAL CORRECTION INSTITUTION	OK9151909117		4205 HWY 66 WEST EL RENO, OK, 730361000					
HIGH	YES	07/16/1997	YES	11/23/1998	YE	06/12/2006	YE	06/12/2006
FEDERAL MOGUL FRICTION PRODUCTS	VAD003070976		2410 PAPERMILL ROAD , WINCHESTER, VA, 22601					
HIGH	YES	07/14/1995	YES	07/14/1995	YE	01/31/2002	YE	01/31/2002
FEDERAL PACIFIC ELECTRIC CO	GAD041011099		HWY 292 EAST TRACT "B" 2803 NORTH ST EAST, VIDALIA, GA, 30474					
HIGH	YES	10/01/2005	YES	01/31/2006	YE	01/09/2001	YE	01/09/2001
FEDERAL-MOGUL CORP	MID006021414		510 E GROVE ST GREENVILLE, MI, 48838					
HIGH	NO		NO		YE	03/10/2008	NO STATUS	
FEDERAL-MOGUL CORPORATION	VAD054039961		300 INDUSTRIAL PARK ROAD, SE BLACKSBURG, VA, 24060					
HIGH	NO		NO		YE	09/29/2003	YE	09/23/2003
FEDERATED METALS CORP	NJD079320495		150 SAINT CHARLES ST NEWARK, NJ, 07101					
HIGH	YES	11/27/1999	YES	11/27/2000	YE	09/28/2000	YE	09/29/2000
FEDERATED METALS CORP	IND005444104		2330 INDIANAPOLIS BLVD WHITING, IN, 46394					
HIGH	YES	02/06/2001	NO		YE	12/10/2004	IN	08/28/1997
FERMILAB	IL6890030046	Dept. of Energy	KIRK & PINE P O BOX 500, BATAVIA, IL, 60510					
HIGH	YES	03/29/2006	YES	05/21/2007	YE	09/27/2000	YE	09/27/2000
FERNWOOD INDUSTRIES, L. L. C.	MSD008183519		1047 FERNWOOD ROAD FERNWOOD, MS, 39635					
HIGH	YES	03/13/2006	YES	03/13/2006	YE	11/22/1995	YE	11/22/1995

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
FHWA CFLHD MATERIALS LABORATORY	CO4690090010	Dept. of Trans.	DNV FED CTR - 6TH AVE BLDG 52 DENVER, CO, 80225
HIGH	YES	08/19/2004	YES	09/20/2004	YE	03/29/2001	YE	09/19/2002
FIBERDYNE INC - FSO	IAR000003152		29582 HWY 57 , NEW HARTFORD, IA, 50660
MEDIUM	YES	08/22/1996	YES	10/18/2000	YE	09/26/2000	YE	09/26/2000
FIBERDYNE INC - FSO	IAR000003145		2816 W 1ST ST , CEDAR FALLS, IA, 50613
MEDIUM	YES	08/22/1996	YES	10/18/2000	YE	09/26/2000	YE	09/26/2000
FIGGIE PROPERTIES CUDAHY	WID988617528		4751 S MEYER PL SITE B CUDAHY, WI, 53110
HIGH	YES	04/10/2007	YES	04/10/2007	YE	04/10/2007	YE	04/10/2007
FIRESTONE FIBERS & TEXTILES	VAD003112588		105 WINSTON CHURCHILL DR HOPEWELL, VA, 23860
HIGH	YES	07/17/2006	YES	08/21/2007	YE	06/07/2002	YE	09/07/2004
FIRESTONE INDUSTRIAL PRODUCTS CO	IND006418263		1700 FIRESTONE BLVD NOBLESVILLE, IN, 46060
HIGH	YES	03/27/2001	YES	08/31/2006	YE	06/30/2004	YE	03/31/2004
FIRESTONE POLYMERS LLC	TXD008073538		5713 FM 1006 ORANGE, TX, 77630
HIGH	YES	08/16/2007	NO		YE	08/16/2007	YE	11/05/2007
FIRST CHEMICAL CORPORATION	MSD033417031		1001 INDUSTRIAL ROAD PASCAGOULA, MS, 39581
HIGH	NO		NO		YE	09/29/2003	YE	09/26/2005
FISHER SCIENT CO LLC FAIR LAWN PLANT	NJD004362059		1 REAGENT LANE FAIR LAWN, NJ, 07410
HIGH	NO		NO		YE	09/27/2001	YE	09/27/2001
FISHER SCIENTIFIC	NJD052207982		755 STATE HWY RTE 202 SOMERVILLE, NJ, 08876
HIGH	YES	07/18/2006	NO		YE	03/29/2000	YE	09/30/1999
FITZGERALD RAILCAR SERVICES	TXD086467800		1100 WAYNE DR ANGLETON, TX, 77515
HIGH	YES	07/24/2006	YES	07/24/2006	YE	08/03/2006	YE	03/06/2007
FLEET AND INDUSTRIAL SUPPLY CTR	CA4170090027	US Navy	250 EXECUTIVE WAY BLDG 3211C OAKLAND, CA, 946255000
HIGH	NO		NO		YE	08/11/2000	YE	01/14/2003
FLINT GROUP	WVD000068601		2401 5TH AVE , HUNTINGTON, WV, 25703
HIGH	NO		NO		YE	04/01/2004	YE	04/01/2004
FLINT HILLS RESOURCES LP	TXD000820928		4241 SAVANNAH AVE GATE 24 PORT ARTHUR, TX, 77640
LOW	NO		NO		YE	06/29/2001	YE	06/29/2001
FLINT HILLS RESOURCES LP	MND000686071		12555 CLARKE RD ROSEMOUNT, MN, 55068
MEDIUM	YES	08/16/2006	YES	08/16/2006	YE	08/16/2006	YE	08/16/2006
FLINT HILLS RESOURCES LP	TXD088474663		2825 SUNTIDE RD CORPUS CHRISTI, TX, 78409
HIGH	YES	08/27/2007	YES	08/27/2007	YE	02/08/2000	YE	12/31/2003
FLINT HILLS RESOURCES LP	TXD066447376		1700 NUECES BAY BLVD CORPUS CHRISTI, TX, 78407
HIGH	YES	02/24/2006	YES	02/24/2006	YE	03/30/2005	YE	03/30/2005
FLINT HILLS RESOURCES LP	TXD980626014		2400 S GRANDVIEW ST ODESSA, TX, 79766
HIGH	YES	08/10/2006	YES	08/10/2006	YE	05/07/2001	YE	05/07/2001
FLORIDA FENCE POST CO	FLD004107017		5251 SR 64 W ONA, FL, 33865
HIGH	NO		NO		YE	09/30/1998	YE	09/30/1998
FLORIDA TILE INC.	KYD045735305		1247 ALTON RD LAWRENCEBURG, KY, 40342
HIGH	YES	06/30/2000	YES	06/27/2003	YE	06/12/2001	YE	06/18/1996
FLYING J PETROLEUMS INC WILLISTON REFINE	NDT390010049		1 MI E. OF WILLISTON HWY 1804 SW 1/4 SEC 19 T154N R100W, WILLISTON, ND, 58801
HIGH	YES	08/25/1995	YES	05/28/1997	YE	02/18/1994	YE	02/27/1995

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
FMC CORP	ILD005472881		RTE 17 E P O BOX 180, WYOMING, IL, 61491					
HIGH	NO		NO		YE	05/21/2007	YE	06/02/2008
FMC CORP - HYDROGEN PEROXIDE DIVISION	WVD005005079		3200 MACCORKLE AVE SOUTH CHARLESTON, WV, 25303					
HIGH	YES	08/30/2000	YES	08/30/2000	YE	06/07/1999	YE	06/07/1999
FMC CORP AGRI CHEM GROUP	CAD000629998		2501 S SUNLAND AVE FRESNO, CA, 93725					
HIGH	YES	06/28/1991	NO		YE	09/29/2004	YE	05/01/2006
FMC CORP AGRICULTURAL CHEM GROUP	NJD009448432		RTE 47 N DELSEA DR MALAGA, NJ, 08328					
MEDIUM	YES	11/30/2006	NO		YE	08/04/2006	YE	08/04/2006
FMC CORP FIRE APPARATUS OPERATION	IND006416838		516 DEARBORN ST TIPTON, IN, 46072					
HIGH	NO		NO		YE	12/31/2007	YE	12/31/2007
FMC CORPORATION	MDD003071875		1701 E PATAPSCO AVE BALTIMORE, MD, 21226					
HIGH	NO		NO		YE	07/02/2002	YE	07/02/2002
FMC CORPORATION - LITHIUM DIVISION	NCD000771964		1115 BESSEMER CITY/KINGSMTN HWY, BESSEMER CITY, NC, 28016					
HIGH	YES	09/12/2007	NO		YE	09/17/2003	YE	09/17/2003
FMC CORPORATION- MIDDLEPORT, NY	NYD002126845		100 NIAGARA STREET MIDDLEPORT, NY, 14105					
HIGH	NO		NO		NO STATUS		YE	05/14/2007
FMC IDAHO, LLC	IDD070929518		HIGHWAY 30 WEST POCATELLO, ID, 83202					
HIGH	NO		NO		YE	06/14/2002	YE	07/29/2005
FORCE ROAD OIL & VACUUM TRUCK COMPANY	TXD000633453		1722 COUNTY ROAD 573 ARCOLA, TX, 77011					
HIGH	NO		NO		NO STATUS		NO STATUS	
FORD MOTOR CO	CAD041330077		1000 FORD RD NEWPORT BEACH, CA, 926588900					
LOW	NO		NO		YE	03/09/2001	IN	03/09/2001
FORD MOTOR COMPANY	MID980568711		17005 OAKWOOD BLVD ALLEN PARK, MI, 48101					
MEDIUM	YES	09/30/2004	YES	09/30/2004	YE	09/07/2007	YE	01/04/2007
FORESTVILLE IND PLATING CO INC	CTD001152545		811 QUEEN ST SOUTHINGTON, CT, 06489					
HIGH	NO		NO		YE	06/11/2001	YE	07/23/2002
FORMER APPLIANCE PARK EAST FACILITY	MDD046279311		ROBERT FULTON DR COLUMBIA, MD, 21046					
HIGH	NO		NO		YE	02/25/2000	YE	02/25/2000
FORMER BORDEN INC FACILITY	NCD001725464		3106 HWY 11 N KINSTON, NC, 28501					
HIGH	NO		NO		YE	09/30/1997	YE	09/30/1997
FORMER DEERE/GASTONIA PLANT	NCD091249417		LITTLE MOUNTAIN RD SR 2412, GASTONIA, NC, 28052					
HIGH	YES	09/14/2007	YES	09/14/2007	YE	06/19/2001	YE	06/19/2001
FORMER DELPHI HARRISON THERMAL SYS	OHD000817577		3600 DRYDEN RD , MORAINE, OH, 45439					
HIGH	NO		NO		YE	09/05/2002	YE	03/23/2001
FORMER DELPHI HARRISON THERMAL SYSTEMS	OHD017958604		300 TAYLOR ST DAYTON, OH, 45402					
MEDIUM	NO		NO		YE	09/26/2008	NO STATUS	
FORMER ELF ATOCHEM ATOFINA SITE	PAD002290823		2375 STATE ROAD BENSALEM, PA, 19020-7307					
HIGH	NO		NO		YE	08/13/2004	YE	01/16/2008
FORMER FARMLAND IND NITROGEN PLT	KSD007128507		1608 N 1400 RD LAWRENCE, KS, 66046					
HIGH	NO		NO		YE	07/20/2000	YE	07/20/2000
FORMER SK WELLMAN SITE / EGBERT CORP	OHD055829022		200 EGBERT RD BEDFORD, OH, 44146					
HIGH	NO		NO		YE	06/22/2001	YE	09/24/2008

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
FORMER SUNFLOWER ARMY AMMUN PLT	KS3213820878	US Army	35425 W 103RD (A) , DE SOTO, KS, 660180640
HIGH / NO	NO	YE / 09/22/2003	IN / 07/11/2003
FORMER TELEDYNE MONARCH RUBBER PLT 1	OHD068901610		10 LINCOLN PK HARTVILLE, OH, 44682
HIGH / YES / 07/14/2006	NO	YE / 08/25/2004	YE / 04/21/2005
FORMER TEXACO CASPER REFINERY	WYD088677943		75 EVANS STREET EVANSVILLE, WY, 82636
HIGH / NO	NO	YE / 12/23/2003	YE / 12/23/2003
FORMER TREATED WOOD PRODUCTS FACILITY	LAD008077315		235 POST PLANT ROAD DERIDDER, LA, 70634
HIGH / NO	NO	YE / 12/30/1999	YE / 12/30/1999
FORMER VELCO FACILITY	ORD009414400		3900 W 1ST EUGENE, OR, 97402
HIGH / YES / 06/26/2008	YES / 06/26/2008	YE / 07/30/1999	YE / 08/02/2005
FORMER WEAREVER FACILITY-ENVIRONMENTAL R	OHD041081548		1089 EASTERN AVE CHILLICOTHE, OH, 45601
HIGH / YES / 03/22/1999	YES / 12/05/2005	YE / 01/03/2001	YE / 01/03/2001
FORMOSA PLASTICS CORP LA	LAD041224932		GULF STATES RD BATON ROUGE, LA, 70805
HIGH / NO	NO	YE / 06/25/2004	IN / 07/29/1997
FORMOSA PLASTICS CORPORATION TEXAS	TXT490011293		201 FORMOSA DR POINT COMFORT, TX, 77978
HIGH / NO	NO	YE / 11/09/1999	IN / 11/09/1999
FORT BENNING	GA3210020084	US Army	USAIC-DPW-EMD BLDG. 6 RM 310 FORT BENNING, GA, 31905
HIGH / NO	NO	YE / 09/26/2005	YE / 09/26/2005
FORT DODGE ANIMAL HEALTH	IAD005275540		2000 ROCKFORD RD CHARLES CITY, IA, 50616
HIGH / YES / 08/13/2003	NO	YE / 09/24/2002	YE / 06/19/2003
FORT HUNTER LIGGETT (CSTC)	CA8210020436	US Army	ATTN: IMSW-PRK-PWE (ENV) JOLON, CA, 93928
HIGH / NO	NO	YE / 09/06/2002	YE / 12/28/2000
FORT RECOVERY INDUSTRIES INC	OHD005046149		2440 ST RTE 49 FORT RECOVERY, OH, 45846
HIGH / NO	NO	YE / 06/30/2000	YE / 06/01/2004
FORT STEWART	GA9210020872	US Army	1157 ITALY STREET FORT STEWART, GA, 31314
HIGH / NO	NO	YE / 06/23/2003	YE / 06/23/2003
FORT WINGATE DEPOT ACTIVITY	NM6213820974	US Army	U.S. 66 EAST GALLUP, NM, 87316
HIGH / NO	NO	IN / 11/19/1997	IN / 11/19/1997
FREESCALE SEMICONDUCTOR INC - MESA SITE	AZD043848050		2200 W BROADWAY RD MESA, AZ, 85202-1004
LOW / YES / 09/24/2008	NO	YE / 03/29/1999	YE / 03/29/2007
FREUDENBERG NOK GENERAL PARTNERSHIP	NHD001084672		450 PLEASANT ST RTE 104, BRISTOL, NH, 03222
HIGH / YES / 09/01/2007	YES / 09/01/2007	YE / 08/16/2006	YE / 05/29/2008
FRONTIER CHEMICAL WASTE PROCESS	NYD043815703		4626 ROYAL AVE NIAGARA FALLS, NY, 143030309
HIGH / NO	NO	YE / 06/06/2006	NO STATUS
FRONTIER CHEMICAL WASTE PROCESS INC	NYD991292053		7025 TOWNLINE RD PENDLETON, NY, 14120
HIGH / YES / 09/26/2007	YES / 09/26/2007	YE / 06/06/2006	YE / 06/06/2006
FRONTIER REFINING	WYD051843613		2700 EAST 5TH STREET CHEYENNE, WY, 82007
HIGH / NO	NO	YE / 03/26/2008	NO / 12/23/2003
FRONTLINE MFG INC	IND005130695		300 SCHOOL ST LEESBURG, IN, 46538
HIGH / NO	NO	YE / 09/21/2000	NO / 09/29/2000
FRUEHAUF CORP	PAD004338646		RTE #119 N UNIONTOWN, PA, 15401
HIGH / NO	NO	YE / 04/15/2002	YE / 04/15/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
FT LAKELAND HOLDINGS LLC	FLD004091583		1 SIKES BLVD LAKELAND, FL, 338151575					
HIGH	YES	08/30/2005	NO		YE	09/25/2003	YE	02/25/2008
FULLCO LUMBER COMPANY, INC.	ALD045632312		HWY 5 N HAYLEYVILLE, AL, 35565					
HIGH	NO		NO		YE	09/11/2006	NO	09/11/2006
FUTUREFUEL CHEMICAL COMPANY	ARD089234884		2800 GAP ROAD BATESVILLE, AR, 72501					
MEDIUM	YES	06/27/1996	YES	09/30/1999	YE	04/28/2000	YE	04/28/2000
G A R ELECTROFORMING DIV ELECTRO INC	CTD064834914		11 AUGUSTA DR DANBURY, CT, 06810					
HIGH	NO		NO		YE	05/16/1999	YE	06/04/1999
G E MEDICAL SYSTEMS ELECTRIC AVE FACILIT	WID086686003		4855 W ELECTRIC AVE , WEST MILWAUKEE, WI, 53219					
LOW	YES	05/22/2001	NO		YE	12/20/2001	YE	12/20/2001
G E RESIDENTIAL PRODUCTS INC	PRD090510793		RD 191 KM 0.4 PALMER, PR, 00721					
MEDIUM	NO		NO		YE	08/31/2007	YE	08/31/2007
G T E OPERATIONS SUPPORT INC	MED058951047		228 NORTHEAST RD RTE 35 STANDISH, ME, 04084					
MEDIUM	YES	06/28/1994	YES	06/28/1994	YE	09/10/1997	YE	08/16/2001
G T E PRODUCTS CORP	MED000840991		RTE 25 PARSONFIELD, ME, 04048					
MEDIUM	YES	08/15/1994	YES	08/15/1994	YE	11/03/2005	YE	11/03/2005
GALLADE CHEMICAL INC	CAD029363876		1230 E SAINT GERTRUDE PL SANTA ANA, CA, 92707					
MEDIUM	NO		NO		YE	08/09/2004	NO	03/09/2001
GALVESTON ENVIRONMENTAL SERVICES INC	TXD980628028		6038 FM 517 RD E SAN LEON, TX, 77539					
HIGH	YES	02/22/2007	YES	02/22/2007	YE	07/11/2005	YE	07/11/2005
GASTON PARK AND ASSOCIATES	SCD001368075		700 SOUTHBOUND RD GASTON, SC, 29053					
MEDIUM	YES	12/19/2006	YES	12/21/2007	YE	08/01/2007	YE	08/01/2007
GE AIRCRAFT ENGINES	OHD000817312		1 NEUMANN WAY CINCINNATI, OH, 45215					
HIGH	NO		NO		YE	05/19/2000	IN	08/28/1997
GE AVIATION	WAD009278706		220 S DAWSON ST SEATTLE, WA, 98108					
HIGH	NO		NO		YE	08/18/2006	YE	09/07/2005
GE CONSUMER AND INDUSTRIAL	KYD006387021		APPLIANCE PARK AP1 108, LOUISVILLE, KY, 40225					
MEDIUM	NO		NO		YE	09/23/2005	YE	08/05/2008
GE ELECTROMATERIALS	OHD004302428		1350 S SECOND ST COSHOCTON, OH, 438121979					
HIGH	YES	03/30/1993	NO		YE	12/29/2000	YE	08/21/2003
GE LIGHTING BRIDGEVILLE GLASS	PAD060682622		540 MAYER ST BRIDGEVILLE, PA, 15017					
HIGH	YES	06/15/1992	YES	08/15/1995	YE	09/25/2002	YE	09/25/2002
GE NORYL, LLC	NYD066832023		1 NORYL AVENUE SELKIRK, NY, 12158					
MEDIUM	YES	09/23/2008	YES	09/23/2008	YE	08/30/2006	YE	08/30/2006
GE PUERTO RICO INVESTMENT INC	PRD090492109		STATE RD 3 KM 122.9 PATILLAS PLANT, PATILLAS, PR, 00723					
HIGH	NO		NO		YE	09/17/2004	NO STATUS	
GE WINCHESTER LAMP PLANT	VAD070360219		125 APPLE VALLEY ROAD WINCHESTER, VA, 22602					
HIGH	YES	07/28/1999	YES	07/28/1999	YE	02/04/2002	YE	05/28/1999
GEISINGER HEALTH SYSTEM	PAD980551840		115 WOODBINE LN DANVILLE, PA, 17822					
HIGH	YES	12/20/2000	YES	12/20/2000	YE	04/17/2000	YE	04/17/2000
GENERAL CHEMICAL - BAY POINT WORKS	CAD009142290		501 NICHOLS RD PITTSBURG, CA, 94565					
HIGH	NO		NO		YE	09/27/2004	YE	03/26/2008

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
GENERAL CHEMICAL CORP	MAD019371079		133-138 LELAND ST FRAMINGHAM, MA, 01702
LOW NO	NO	YE 09/30/2008	NO STATUS
GENERAL CHEMICAL CORP DEL VALLEY WORKS N	PAD990823742		6300 PHILADELPHIA PIKE MARCUS HOOK, PA, 19601
HIGH NO	NO	YE 09/30/2004	IN 03/09/1999
GENERAL CHEMICAL, LLC- DE VALLEY	DED154576698		6300 PHILADELPHIA PIKE CLAYMONT, DE, 19703
HIGH NO	NO	YE 09/30/2004	IN 03/09/1999
GENERAL COMPONENTS INCORPORATED	FLD004088258		7425 124TH AVE LARGO, FL, 337733017
MEDIUM YES 12/18/2002	YES 01/31/2005	YE 09/30/1997	YE 09/30/2002
GENERAL DATA CO	CTD072142052		400 CAPTAIN NEVILLE DR WATERBURY, CT, 06705
HIGH NO	NO	YE 09/02/2004	NO STATUS
GENERAL DYNAMICS ARMAMENT & TECH PRODUCT	VTD002083434		128 LAKESIDE AVE BURLINGTON, VT, 054014985
MEDIUM YES 01/23/2006	YES 01/23/2006	YE 09/20/1999	YE 02/14/2003
GENERAL DYNAMICS ATP INC LINCOLN OPER	NED043534635		4300 INDUSTRIAL AVE MAIN PLANT, LINCOLN, NE, 68504
HIGH YES 06/30/1998	YES 06/30/1998	YE 08/28/2002	YE 06/20/2003
GENERAL ELECTRIC - HORNELL	NYD000632471		EDISON DR HORNELL, NY, 14843
MEDIUM YES 03/21/1994	YES 12/30/1997	YE 09/28/2000	YE 09/28/2000
GENERAL ELECTRIC - HUDSON FALLS	NYD002080075		1 JOHN STREET HUDSON FALLS, NY, 12839
HIGH YES 09/27/2007	NO	YE 09/30/2003	NO STATUS
GENERAL ELECTRIC CO	PAD003026903		PLEASURE RD LANCASTER, PA, 17604
HIGH NO	NO	YE 09/24/2002	YE 09/24/2002
GENERAL ELECTRIC CO APPARATUS SER SHOP	NMD047140256		4420 MCLEOD RD N E ALBUQUERQUE, NM, 87109
MEDIUM YES 09/07/2007	YES 09/07/2007	YE 02/27/2006	YE 02/27/2006
GENERAL ELECTRIC CO WASTE WATER FACL	CTD000842492		WOODFORD AVE & WOODLAND ST PLAINVILLE, CT, 06062
HIGH NO	NO	YE 09/02/2004	YE 02/09/2004
GENERAL ELECTRIC CO.	NYD002231272		WEST GENESEE RD. AUBURN, NY, 13021
MEDIUM NO	NO	YE 12/31/2004	NO STATUS
GENERAL ELECTRIC CO. - CPQP	NYD093256063		381 BROADWAY FORT EDWARD, NY, 12828
HIGH NO	NO	YE 09/30/2005	NO STATUS
GENERAL ELECTRIC COMPANY	CAT000622357		234 EAST MAIN STREET ONTARIO, CA, 91761
HIGH NO	NO	YE 09/24/2004	YE 03/09/2001
GENERAL ELECTRIC COMPANY	GAD003308145		1935 REDMOND CIRCLE ROME, GA, 30165
HIGH NO	NO	YE 09/30/2005	YE 09/30/2005
GENERAL ELECTRIC COMPANY	NYD002084135		BLDG 273-1029 1 RIVER ROAD, SCHENECTADY, NY, 12345
HIGH YES 09/25/2007	NO	YE 09/29/2004	YE 09/29/2004
GENERAL ELECTRIC N CLARENDON	VTD001075894		270 WINDCREST ROAD NORTH CLARENDON, CLARENDON, VT, 05759
HIGH YES 12/14/1998	YES 12/14/1998	YE 07/29/1999	YE 07/29/1999
GENERAL ENVIRONMENTAL MANAGEMENT LLC	OHD004178612		2655 TRANSPORT ROAD CLEVELAND, OH, 44115
HIGH NO	NO	YE 10/10/2001	NO STATUS
GENERAL HOUSEWARES CORP	IND058477688		1536 BEECH ST TERRE HAUTE, IN, 47804
HIGH YES 09/11/2008	YES 09/02/2008	YE 09/28/2007	YE 09/04/2007

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
GENERAL INSTRUMENT CO C P CLARE DIV	ILD000672204		930 S LAKE ST MUNDELEIN, IL, 60060
HIGH / YES / 05/15/1997	YES / 05/15/1997	YE / 03/01/2006	YE / 09/25/2007
GENERAL MOTORS	IND980700801		2915 DR MARTIN LUTHER KING JR ANDERSON, IN, 46016
LOW / NO	NO	YE / 09/26/2005	YE / 09/26/2005
GENERAL MOTORS CORP	IND980503825		2900 S SCATTERFIELD RD ANDERSON, IN, 46013
HIGH / YES / 07/11/2006	YES / 07/30/2007	YE / 06/30/2003	YE / 05/16/2003
GENERAL MOTORS CORP DELCO CHASSIS DIV	CTD018625632		780 JAMES P CASEY RD BRISTOL, CT, 06010
HIGH / NO	NO	YE / 12/22/1999	YE / 12/22/1999
GENERAL MOTORS CORPORATION	MID005356951		G3100 VAN SLYKE RD FLINT, MI, 48551
MEDIUM / YES / 11/04/2005	YES / 11/04/2005	YE / 11/04/2005	YE / 11/04/2005
GENERAL MOTORS CORPORATION	MID041793340		1629 N WASHINGTON AVE SAGINAW, MI, 48601
HIGH / NO	NO	YE / 08/25/2004	YE / 09/29/2004
GENERAL MOTORS CORPORATION	MID005356621		13000 ECKLES RD LIVONIA, MI, 48150
HIGH / NO	NO	YE / 03/05/2008	YE / 11/16/2004
GENERAL MOTORS CORPORATION	MID005356688		1001 WOODSIDE AVE BAY CITY, MI, 48708
HIGH / NO	NO	YE / 09/27/2007	YE / 03/10/2008
GENERAL MOTORS CORPORATION	MID005356696		77 W CENTER ST SAGINAW, MI, 48602
HIGH / NO	NO	YE / 09/27/2007	YE / 09/15/2006
GENERAL MOTORS CORPORATION	MID005356712		902 E LEITH ST FLINT, MI, 48505
HIGH / NO	NO	YE / 08/17/2004	YE / 09/29/2005
GENERAL MOTORS CORPORATION	MID005356860		1245 E COLDWATER RD FLINT, MI, 48505
HIGH / YES / 10/29/1992	NO	YE / 05/29/1998	YE / 05/29/1998
GENERAL MOTORS CORPORATION	MID005356886		220 E COLUMBIA AVE PONTIAC, MI, 48340
HIGH / NO	NO	YE / 03/02/2004	YE / 09/29/2004
GENERAL MOTORS CORPORATION	MID005356902		2100 S OPDYKE RD PONTIAC, MI, 48341
HIGH / NO	NO	YE / 12/06/2000	YE / 12/06/2000
GENERAL MOTORS MORAINE ASSEMBLY	OHD041063074		2601 W STROOP RD MORAINE, OH, 454391929
HIGH / NO	NO	YE / 12/29/2000	YE / 03/23/2001
GENERAL MOTORS NAVO	GAD003310810		3900 MOTORS INDUSTRIAL WAY DORAVILLE, GA, 30360
MEDIUM / NO	NO	YE / 07/20/1999	YE / 08/23/1996
GENERAL SERVICES ADMIN	CO5670990105	General Services Agency	DFC SVC CTR BLDG 41 RM 240 6TH & KIPLING, LAKEWOOD, CO, 80225
HIGH / NO	NO	YE / 09/28/2004	YE / 10/10/2001
GENERAL SERVICES ADMINISTRATION	DC8470090004	General Services Agency	2ND & M STS SW WASHINGTON, DC, 20407
HIGH / NO	NO	YE / 09/08/2003	YE / 09/29/2004
GENICOM CORP	VAD003132438		1 SOLUTIONS WAY WAYNESBORO, VA, 229801999
HIGH / NO	NO	YE / 11/12/1999	YE / 11/12/1999
GENRAD INC	MAD001441054		41 MAIN ST BOLTON, MA, 01740
HIGH / NO	NO	YE / 09/25/2000	YE / 09/25/2000
GEORGIA GULF CHEMICAL & VINYL, LLC	LAD057117434		26100 HIGHWAY 405 S PLAQUEMINE, LA, 70764
HIGH / NO	NO	YE / 06/30/2004	YE / 04/21/2008
GEORGIA GULF LAKE CHARLES, LLC	LAD086478047		1600 VCM PLANT ROAD WESTLAKE, LA, 70669
HIGH / NO	NO	YE / 03/31/2003	YE / 03/31/2003

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
GEORGIA PACIFIC CORP PLAQUEMINE	LAR000003483		26100B HWY 405 PLAQUEMINE, LA, 70764					
HIGH	YES	06/20/2008	NO		YE	12/20/2007	YE	06/27/2007
GERDAU AMERISTEEL SAND SPRINGS	OKD007219181		2300 S. HIGHWAY 97 , SAND SPRINGS, OK, 74063					
HIGH	YES	06/24/2002	YES	07/02/2002	YE	05/03/2006	YE	05/03/2006
GERDAU AMERISTEEL ST. PAUL	MND041775008		1678 RED ROCK ROAD ST PAUL, MN, 551190000					
MEDIUM	YES	08/16/2006	YES	08/16/2006	YE	08/16/2006	YE	08/16/2006
GETS GLOBAL SIGNALING LLC	MOD000298398		2712 S DILLINGHAM RD GRAIN VALLEY, MO, 64029					
MEDIUM	YES	07/31/1996	YES	07/31/1996	YE	09/30/1999	YE	09/30/1999
GIANT CEMENT COMPANY	SCD003351699		654 JUDGE ST HARLEYVILLE, SC, 29448					
HIGH	NO		NO		YE	09/13/1999	YE	09/28/2000
GIANT REFINING COMPANY - BLOOMFIELD	NMD089416416		#50 COUNTY ROAD 4990 BLOOMFIELD, NM, 87413					
MEDIUM	NO		NO		NO	11/29/2006	IN	08/29/1996
GIANT RESOURCE RECOVERY - ARVONIA, INC.	VAD098443443		11049 BRIDGEPORT ROAD ARVONIA, VA, 23004					
HIGH	NO		NO		YE	02/14/2002	YE	02/14/2002
GIANT RESOURCE RECOVERY, INC.	VAD046970521		101 SOLITE ROAD CASCADE, VA, 24069					
HIGH	NO		NO		YE	09/30/2004	IN	04/22/2003
GIBSON ENVIRONMENTAL INC	CAD980883177		END OF COMMERCIAL DR DEADEND HWY 58 AND GIBSON, BAKERSFIELD, CA, 93308					
HIGH	NO		NO		YE	06/01/2004	YE	09/27/2004
GILBERT & BENNETT MFG CORP GEORGETOWN LA	CTD001162775		1 N MAIN ST GEORGETOWN, CT, 06829					
HIGH	YES	09/28/2007	NO		YE	09/08/2003	NO	09/11/1995
GIVAUDAN CORP	NJD002156354		125 DELAWANNA AVE CLIFTON, NJ, 07014					
MEDIUM	NO		NO		YE	09/29/2008	NO STATUS	
GLOBAL TUNGSTEN & POWDERS CORP	PAD003044609		100 HAWES ST TOWANDA, PA, 18848					
HIGH	NO		NO		YE	01/14/2002	YE	01/14/2002
GM LORDSTOWN COMPLEX	OHD020632998		2300 HALLOCK-YOUNG ROAD LORDSTOWN, OH, 444819238					
HIGH	YES	05/03/2007	YES	05/03/2007	YE	12/30/2003	YE	09/30/2003
GM POWERTRAIN	OHD005050273		26427 STATE ROUTE 281 EAST DEFIANCE, OH, 43512					
HIGH	YES	08/24/2004	YES	08/03/2007	YE	12/27/2001	YE	12/28/2001
GM POWERTRAIN	VAD091222588		11032 TIDEWATER TR FREDERICKSBURG, VA, 22408					
HIGH	YES	08/31/1999	YES	08/31/1999	YE	02/04/2002	YE	02/04/2002
GM POWERTRAIN-BEDFORD FACILITY	IND006036099		105 GM DR , BEDFORD, IN, 47421					
MEDIUM	NO		NO		YE	07/31/2007	NO STATUS	
GM'S SPO BULK CENTER #37 (AREA #6)	WVD044145209		891 AUTO PARTS PLACE BULK CENTER #37 (AREA #6), MARTINSBURG, WV, 25401					
MEDIUM	YES	08/08/1992	YES	09/27/1996	YE	07/02/2002	YE	07/02/2002
GMC DETROIT DIESEL ALLISON PLANT 8	IND094469913		2001 S TIBBS AVE INDIANAPOLIS, IN, 46206					
HIGH	NO		NO		YE	09/29/2006	YE	06/30/2008
GMC MORAINE ENGINE PLANT GMPTG	OHD980569388		4100 SPRINGBORO PIKE MORAINE, OH, 45439					
HIGH	NO		NO		YE	12/29/2000	YE	03/23/2001
GNB TECHNOLOGIES INC	TXD006451090		7471 S 5TH ST FRISCO, TX, 75034					
HIGH	YES	08/10/2006	YES	08/10/2006	YE	02/28/2001	YE	02/28/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
GOLD MILLS INC PENN DYE & FIN	PAD002377703		1 PENN DYE ST PINE GROVE, PA, 17963
HIGH / NO	NO	YE / 01/02/2002	YE / 01/02/2002
GRACE DAVISON, W. R. GRACE & CO. - CONN.	MDD001710227		5500 CHEMICAL RD. BALTIMORE, MD, 212261698
HIGH / NO	NO	YE / 09/01/2004	YE / 07/12/2005
GRAND FORKS AIR FORCE BASE	ND3571924759	US Air Force	525 TUSKEGEE AIRMEN BLVD GRAND FORKS AFB, ND, 58205-6434
MEDIUM / YES / 08/10/2007	YES / 08/10/2007	YE / 01/26/2001	YE / 04/27/1999
GRANGER LAND DEVELOPMENT CO	MID082771700		8550 W GRAND RIVER HWY GRAND LEDGE, MI, 48837
HIGH / YES / 08/17/2006	YES / 09/17/2008	YE / 09/05/2001	YE / 09/05/2001
GRAPHITE PRODUCTS CORP	OHD004201406		5756 WARREN SHARON RD BROOKFIELD, OH, 44403
HIGH / NO	NO	YE / 12/31/2007	YE / 12/31/2007
GREAT LAKES CHEMICAL CORP CENTRAL PLANT	ARD043195429		2226 HAYNESVILLE HIGHWAY EL DORADO, AR, 71730
HIGH / YES / 09/28/2006	YES / 09/28/2006	YE / 09/30/2003	YE / 09/30/2003
GREAT LAKES CHEMICAL CORPORATION	WVD005005087		200 PICKENS ROAD NITRO, WV, 25143
HIGH / NO	NO	YE / 09/18/2003	YE / 09/27/2004
GREDE FOUNDRIES, INC., GREDE PERM CAST	KYD093903862		NEW LAIR ROAD CYNTHIANA, KY, 41031
HIGH / YES / 01/24/2003	YES / 01/24/2003	YE / 09/30/2002	YE / 10/29/1999
GREENS OF ROCK HILL	SCD003159928		2850 CHERRY RD ROCK HILL, SC, 29730
HIGH / YES / 09/27/2007	NO	YE / 09/30/1996	YE / 09/30/1996
GRENADA MANUFACTURING LLC	MSD007037278		635 HIGHWAY 332 , GRENADA, MS, 38901
HIGH / YES / 04/05/2006	NO	YE / 04/05/2006	YE / 04/05/2006
GRIFFIN PIPE PRODUCTS	NJD003951985		1100 W FRONT ST FLORENCE, NJ, 085181015
HIGH / YES / 09/29/2008	YES / 09/29/2008	YE / 09/30/1999	YE / 09/30/1999
GROWS INC	PAD000429589		1513 BORDENTOWN RD MORRISVILLE, PA, 19067
HIGH / NO	NO	YE / 01/08/2001	YE / 01/08/2001
GTE COMMUNICATIONS SYSTEMS CORPORATION	ALD050166750		2951 GREEN COVE ROAD HUNTSVILLE, AL, 35803
LOW / YES / 09/08/1998	YES / 09/08/1998	YE / 08/18/2003	YE / 08/18/2003
GTE OSI	CAD076306836		100 FERGUSON DR MOUNTAIN VIEW, CA, 94039
MEDIUM / NO	NO	YE / 04/09/2007	YE / 08/30/2006
GTX, INC.	LAD981057706		9828 HIGHWAY 90 EAST AMELIA, LA, 70340
HIGH / NO	NO	IN / 09/19/1996	IN / 09/19/1996
GULF CHEMICAL & METALLURGICAL CORPORATIO	TXD074195678		302 MIDWAY RD FREEPORT, TX, 77542
HIGH / YES / 08/15/2007	NO	YE / 06/29/2004	YE / 08/30/2002
GULF OIL CORP GULF ADHESIVES & RESINS	PAD014304976		632 N CANNON AVE LANSDALE, PA, 19446
HIGH / YES / 03/30/2000	YES / 03/30/2000	YE / 03/30/2000	YE / 03/30/2000
GULFSTREAM AEROSPACE CORPORATION	GAD061022216		500 GULFSTREAM ROAD SAVANNAH, GA, 31407
LOW / YES / 10/24/2005	NO	YE / 09/17/1996	YE / 09/30/2002
HACCO INC	WID006075352		110 HOPKINS DR RANDOLPH, WI, 53956
HIGH / NO	NO	YE / 02/19/2003	YE / 09/24/2002
HALLMACK, DIVISION OF NUTONE, INC.	KYD081017667		US HWY 127 & TAPP RD HARRODSBURG, KY, 40330
MEDIUM / NO	NO	YE / 09/27/2005	NO / 07/24/1996

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
HAMILTON SUNDSTRAND	COD007057995		2480 W 70TH AVE , DENVER, CO, 80221
HIGH / YES / 08/25/2008	NO	YE / 09/17/2002	YE / 09/15/2003
HAMILTON SUNDSTRAND CORP A UTC COMPANY	CTD001145341		ONE HAMILTON RD WINDSOR LOCKS, CT, 06096
HIGH / NO	NO	YE / 09/30/2003	IN / 07/30/1999
HAMPSHIRE CHEMICAL CORPORATION	NHD048724173		2 E SPIT BROOK RD NASHUA, NH, 030605737
HIGH / YES / 09/10/1997	YES / 02/29/2000	YE / 09/29/1998	YE / 09/20/1999
HANDY & HARMAN	CTD018656819		1770 KINGS HIGHWAY FAIRFIELD, CT, 06430
HIGH / NO	NO	YE / 09/29/2005	IN / 07/29/1999
HANDY & HARMAN ELECTRONIC MATERIALS	MAD048974349		72 ELM ST NORTH ATTLEBOROUGH, MA, 02760
MEDIUM / NO	NO	NO STATUS	NO STATUS
HARCROS CHEMICALS INC	KST210010062		5200 SPEAKER RD , KANSAS CITY, KS, 66106
HIGH / NO	NO	YE / 09/29/2003	YE / 09/29/2005
HARCROS CHEMICALS INC	IAD022100671		2040 W RIVER DR DAVENPORT, IA, 52808
HIGH / NO	NO	NO STATUS	NO STATUS
HARLEY DAVIDSON MOTOR CO	PAD001643691		1425 EDEN RD YORK, PA, 17402-1507
HIGH / NO	NO	YE / 09/15/2005	NO STATUS
HARPER LEADER INC	CTD001166008		1046 S MAIN ST WATERBURY, CT, 06706
HIGH / NO	NO	YE / 09/29/1997	NO / 09/05/1996
HARRISON CO GARAGE FORMER DRUM STOR	OHD987021177		ST RTE 9 AND TOOT RD CADIZ, OH, 43907
HIGH / YES / 04/19/2006	YES / 04/19/2006	YE / 01/11/2006	YE / 01/11/2006
HARRISON ENTERPRISES INC	OHD041082025		5600 N HAMILTON RD COLUMBUS, OH, 43230
HIGH / NO	NO	YE / 03/29/2007	YE / 03/29/2007
HAWAIIAN WESTERN STEEL LIMITED	HID981581788		91-150 HANUA ST KAPOLEI, HI, 96707
HIGH / YES / 04/09/2007	NO	YE / 05/25/1999	YE / 05/25/1999
HAWAIIAN WESTERN STEEL WASTEPI	HID982516775		MALAKOLE RD AND HANUA ST EWA BEACH, HI, 96706
HIGH / YES / 04/09/2007	NO	YE / 07/10/2000	YE / 07/10/2000
HAYNES INTERNATIONAL INC	IND984867481		2000 W DEFENBAUGH ST , KOKOMO, IN, 46902
HIGH / NO	NO	YE / 05/19/2000	YE / 05/19/2000
HEADQUARTERS US ARMY GARRISON FORT DIX	NJ4213720275	US Army	REG. DIR. OF PUBLIC WORKS ATTN: AFRC-FA-PWN, FORT DIX, NJ, 08640
HIGH / NO	NO	YE / 09/25/2006	YE / 09/28/2007
HELENA INDUSTRIES INC	ARD030414494		101 MLK DRIVE WEST HELENA, AR, 72390
HIGH / NO	NO	YE / 09/30/2005	NO STATUS
HENKEL CORPORATION	WID057163941		420 W MARQUETTE AVE OAK CREEK, WI, 531542039
MEDIUM / YES / 04/10/2007	YES / 04/10/2007	YE / 04/10/2007	YE / 04/10/2007
HENKEL SURFACE TECHNOLOGIES	CAD009152364		37899 NILES BLVD FREMONT, CA, 94536
HIGH / NO	NO	YE / 12/28/2000	YE / 12/28/2000
HENKEL SURFACE TECHNOLOGIES	MID058723867		322 W MAIN ST MORENCI, MI, 49256
HIGH / YES / 06/15/2006	YES / 06/27/2006	YE / 08/24/2004	YE / 08/26/2003
HENNIGES AUTOMOTIVE	IAD005136023		3200 MAIN ST KEOKUK, IA, 52632
HIGH / YES / 09/22/2006	YES / 03/10/2008	YE / 03/13/2000	YE / 08/24/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
HERCULES INC	NJD011136884	NECK RD BURLINGTON, NJ, 08016						
HIGH	YES	05/02/2001	YES	09/30/2008	YE	08/25/2003	YE	01/18/2002
HERCULES INC - HOPEWELL PLANT	VAD003121928	1111 HERCULES RD HOPEWELL, VA, 23860						
HIGH	NO		NO		YE	09/30/2004	YE	09/27/2004
HERCULES INCORPORATED	NJD002521961	50 SOUTH MINISINK AVENUE PARLIN, NJ, 08859						
HIGH	NO		NO		YE	09/30/2004	YE	04/14/2005
HERCULES INCORPORATED	VAD003122165	27123 SHADY BROOK TRAIL COURTLAND, VA, 23837						
HIGH	NO		NO		YE	09/28/2004	IN	08/23/1999
HERCULES INCORPORATED	GAD004065520	2801 COOK STREET BRUNSWICK, GA, 31520						
HIGH	NO		NO		YE	08/26/2008	NO	09/30/1997
HERCULES INCORPORATED/RESEARCH CENTER	DED001315647	500 HERCULES ROAD WILMINGTON, DE, 198081599						
HIGH	NO		NO		YE	09/24/2003	YE	09/26/2007
HERCULES/ CIBA	NYD002069748	89 LOWER WARREN STREET QUEENSBURY, NY, 12804						
HIGH	YES	12/07/2000	NO		YE	08/27/2001	YE	09/25/2002
HERITAGE ENVIRONMENTAL SERVICES LLC	AZD081705402	284 E STOREY RD COOLIDGE, AZ, 85228						
LOW	YES	09/24/2008	NO		YE	09/21/2006	YE	03/29/2007
HERITAGE ENVIRONMENTAL SVCS LLC	IND093219012	7901 W MORRIS ST INDIANAPOLIS, IN, 46231						
MEDIUM	NO		NO		YE	02/07/2000	YE	02/07/2000
HESS PURVIS TERMINAL	MSD079461406	5151 US HIGHWAY 11 PURVIS, MS, 39475						
HIGH	YES	09/29/2006	YES	08/22/2007	YE	09/29/2000	YE	09/29/2000
HEWLETT PACKARD	CAT000624866	1201 PINER ROAD REMEDIATION ACTIVITIES, SANTA ROSA, CA, 95401						
HIGH	YES	09/07/2006	YES	09/07/2006	YE	09/14/2006	YE	12/28/2000
HEWLETT PACKARD	CAD009122532	1501 PAGE MILL ROAD PALO ALTO, CA, 94304						
MEDIUM	YES	08/17/1994	YES	02/28/1996	YE	09/25/2002	YE	12/28/2000
HEWLETT PACKARD MFG DIV	CAD009122557	395 PAGE MILL RD PALO ALTO, CA, 94306						
MEDIUM	YES	09/21/1994	YES	09/09/1996	YE	12/28/2000	YE	12/28/2000
HEXION SPECIALTY CHEMICALS INC	GAD084823301	71 BARNETT ROAD FOREST PARK, GA, 30297						
LOW	NO		NO		YE	09/13/2007	IN	08/26/1997
HEXION SPECIALTY CHEMICALS INC	FLD000605519	5004 N COMBEE RD LAKELAND, FL, 338057508						
MEDIUM	YES	09/24/2001	YES	10/27/2004	YE	08/18/2006	YE	08/18/2006
HEXION SPECIALTY CHEMICALS INC.	LAD980622104	16122 RIVER ROAD LOT #3 NORCO, LA, 70079						
HIGH	NO		NO		YE	06/28/2002	YE	06/28/2002
HEXION SPECIALTY CHEMICALS, INC.	CAD076180843	2801 LYNWOOD ROAD LYNWOOD, CA, 90262						
MEDIUM	NO		NO		YE	03/29/2002	YE	02/17/2005
HOCKING STATE FOREST WOOD TREATING PLT	OHD980996128	19275 ST RTE 374 ROCKBRIDGE, OH, 43149						
HIGH	NO		NO		YE	12/31/2007	YE	12/31/2007
HODGE FOUNDRY INC	PAD004323796	42 LEECH RD GREENVILLE, PA, 16125						
HIGH	NO		YES	05/12/2008	YE	08/26/2002	YE	08/26/2002
HOFFMANN LA-ROCHE INC	NJD002191211	340 KINGSLAND ST NUTLEY, NJ, 071101198						
MEDIUM	NO		NO		NO STATUS		NO STATUS	

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
HOLLOMAN AIR FORCE BASE	NM6572124422	US Air Force	6 MI. W. OF ALAMOGORDO, NM ON US HW 70, HOLLOMAN AIR FORCE BASE, NM, 883308277
HIGH / NO	NO	YE / 06/29/2001	YE / 11/27/2002
HOLSTON ARMY AMMUNITION PLANT	TN5210020421	4509 WEST STONE DRIVE , KINGSPORT, TN, 37660	
MEDIUM / NO	NO	YE / 05/25/2007	YE / 05/25/2007
HOLTRACHEM MANUFACTURING CO	MED000242701	99 INDUSTRIAL WAY ORRINGTON, ME, 04474	
HIGH / NO	NO	NO / 08/26/1996	NO / 08/26/1996
HONEYWELL - CF-RR GW TREATMENT PLANT	NYD038641601	4000 RIVER RD TONAWANDA, NY, 14150	
HIGH / YES / 01/11/2007	YES / 11/30/2007	YE / 09/22/2006	YE / 09/22/2006
HONEYWELL BALTIMORE INNER HARBOR	MDD069396711	1000 WILLS ST BALTIMORE, MD, 212310000	
HIGH / YES / 04/15/1992	YES / 01/24/2003	YE / 11/05/1999	YE / 11/05/1999
HONEYWELL INC	FLD004104105	13350 US HIGHWAY 19 N CLEARWATER, FL, 337647290	
MEDIUM / YES / 05/23/2008	YES / 05/23/2008	YE / 08/16/1996	YE / 09/12/2003
HONEYWELL INC PROCESS CONTROL DIV	PAD002386761	1100 VIRGINIA DR FRONT 2 STORY FORT WASHINGTON, PA, 19034	
HIGH / YES / 08/18/1995	YES / 12/15/1997	YE / 09/27/2002	YE / 09/27/2002
HONEYWELL INTERNATIONAL INC	MID099114704	7819 W JEFFERSON AVE DETROIT, MI, 48209	
HIGH / NO	NO	YE / 09/25/2003	NO STATUS
HONEYWELL INTERNATIONAL INC	MID072575731	1953 S HARVEY ST MUSKEGON, MI, 49442	
HIGH / NO	NO	YE / 09/27/2007	YE / 03/10/2008
HONEYWELL INTERNATIONAL INC.	VAD065385296	905 EAST RANDOLPH ROAD HOPEWELL, VA, 23860	
HIGH / NO	NO	YE / 09/28/2004	IN / 09/09/1996
HONEYWELL INTERNATIONAL INC.	NJD048794986	101 COLUMBIA ROAD MORRISTOWN, NJ, 07962	
HIGH / YES / 05/23/1996	YES / 05/23/2008	YE / 09/28/2000	YE / 09/28/2000
HONEYWELL INTL INC	ILD005463344	209 BREWER RD P O BOX 13, DANVILLE, IL, 61832	
HIGH / NO	NO	YE / 05/31/2007	YE / 07/31/2007
HONEYWELL INTL INC	PAD981739758	6300 PHILADELPHIA PIKE MARCUS HOOK, PA, 19061	
HIGH / NO	NO	NO STATUS	NO STATUS
HONEYWELL INTL INC	ILD006278170	2768 N RTE 45 RD P O BOX 430, METROPOLIS, IL, 629600430	
HIGH / YES / 12/11/1991	NO	YE / 09/23/1999	YE / 01/29/2001
HONEYWELL RESINS & CHEMICALS LLC	VAD023690183	4101 BERMUDA HUNDRED RD , CHESTER, VA, 23836	
HIGH / NO	NO	YE / 10/01/2002	IN / 10/01/2002
HONEYWELL SKINNER VALVE DIV	CTD001149582	95 EDGEWOOD AVE NEW BRITAIN, CT, 06051	
HIGH / NO	NO	YE / 09/10/2002	YE / 09/10/2002
HOOD PACKAGING CORP (FRMR DOWLING BAG)	GAD981224942	910 RIVER ST , VALDOSTA, GA, 31601	
HIGH / YES / 08/18/2008	YES / 08/18/2008	YE / 09/28/2000	YE / 09/28/2000
HOOVER CO PLANT NO 1	OHD004462131	101 E MAPLE ST NORTH CANTON, OH, 44720	
MEDIUM / NO	NO	YE / 09/28/2000	YE / 08/15/2001
HOOVER TREATED WOOD PRODUCTS	VAD988190021	18315 HOUSE DR CAROLINE IND PARK, MILFORD, VA, 22514	
LOW / NO	NO	YE / 09/15/2008	YE / 07/18/2006
HOP UNION USA INC 1ST AVE	WAH000010488	1ST AVE & MONROE ST NW CORNER MABTON, WA, 98935	
HIGH / NO	NO	YE / 09/28/2006	NO STATUS
HORSEHEAD CORP (FKA ZCA)	OKD000829440	11TH ST. & HIGHWAY 123 , BARTLESVILLE, OK, 74003	
HIGH / YES / 10/30/1997	YES / 10/19/2004	YE / 11/02/2000	YE / 11/02/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
HOUSTON REFINING LP	TXD082688979		12000 LAWNDALE ST GATE 14 HOUSTON, TX, 77017
HIGH / YES / 07/17/2006	YES / 08/14/2007	YE / 08/28/2002	YE / 08/28/2002
HOVENSA L L C	VID980536080		1 ESTATE HOPE CHRISTIANSTED, VI, 00820
HIGH / NO	NO	YE / 06/05/2001	YE / 09/01/2000
HOWE FURNITURE CORP	CTD001162858		151 WOODWARD AVE NORWALK, CT, 06854
HIGH / NO	NO	YE / 03/04/2002	YE / 12/21/2007
HQ 10TH MTN DIV & FORT DRUM	NY0214020281	US Army	85 FIRST STREET WEST, PUBLIC WORKS,ENVIRONMENTAL DIV, FORT DRUM, NY, 136025097
HIGH / NO	NO	YE / 06/19/2002	YE / 09/26/2007
HQ, GARRISON COMMAND (ABN)	NC8210020121	US Army	DIRECTORATE OF PUBLIC WORKS IM SE-BRG-PW, BUTNER ROAD, FORT BRAGG, NC, 28310
HIGH / NO	NO	YE / 12/21/2004	YE / 12/21/2004
HQ,101ST AIRBORNE DIV.(AASLT)FT.CAMPBELL	KY5210020140	US Army	IMSE-CAM-PWE, BLDG 2186 13 1/2 ST, FORT CAMPBELL, KY, 42223
MEDIUM / NO	NO	YE / 07/31/2007	NO / 07/31/2007
HQ,USAFACFS, DPW, ENVIRONMENTAL DIVISION	OK4213720846	US Army	5503 NW CURRIE RD FORT SILL, OK, 735039051
HIGH / YES / 01/20/1993	YES / 01/20/1993	YE / 06/26/2006	YE / 06/26/2006
HSL INC	SCD065053217		183 ROLLING HILLS CIR EASLEY, SC, 29640
HIGH / NO	NO	YE / 09/11/1998	YE / 09/11/1998
HUFFMAN WOOD PRESERVING CO INC	OKD053128492		HWY 70 E BROKEN BOW, OK, 74728
HIGH / NO	NO	YE / 06/28/2006	NO STATUS
HUKILL CHEMICAL CORPORATION	OHD001926740		7013 KRICK ROAD BEDFORD, OH, 44142
HIGH / YES / 02/06/1990	NO	YE / 03/16/2001	YE / 03/12/2001
HUNT REFINING COMPANY	ALD004009320		1855 FAIRLAWN ROAD TUSCALOOSA, AL, 35401
LOW / NO	NO	YE / 08/02/1999	YE / 08/02/1999
HUNTINGTON ALLOYS SPECIAL METALS CO.	KYD049465255		OLD US RT 23 , BURNAUGH, KY, 41129
HIGH / NO	NO	YE / 08/20/2004	YE / 09/30/2003
HUNTSMAN CORP	NJD002482602		MANTUA GROVE RD WEST DEPTFORD TWP, NJ, 08096
HIGH / YES / 12/03/2001	YES / 03/28/2006	YE / 09/29/2000	YE / 03/19/2001
HUXFORD POLE & TIMBER CO INC	ALD008185407		14200 HIGHWAY 21 NORTH , HUXFORD, AL, 36543
HIGH / YES / 08/08/2000	YES / 01/10/2001	YE / 09/28/1999	YE / 09/28/1999
HYATT - CLARK INDUSTRIES FORMER	NJD002457174		1300 RARITAN RD CLARK, NJ, 070661100
HIGH / YES / 02/03/1999	NO	YE / 08/01/2002	YE / 09/30/2005
HYDRITE CHEMICAL CO	WID000808824		114 N MAIN ST COTTAGE GROVE, WI, 53527
HIGH / NO	NO	YE / 09/15/2005	NO STATUS
HYDRITE CHEMICAL CO	IAT200010593		2815 W C F & N DR WATERLOO, IA, 50703
HIGH / NO	NO	YE / 07/10/2003	YE / 07/10/2003
I B M CORPORATION	VTD002084705		1000 RIVER ST ESSEX JUNCTION, ESSEX, VT, 05452
HIGH / YES / 03/23/1993	YES / 01/19/1994	YE / 09/13/1999	YE / 09/13/1999
I T W WATERBURY BUCKLE PLASTIGLIDE	CTD001165703		952 S MAIN ST WATERBURY, CT, 06721
HIGH / NO	NO	YE / 08/02/1999	YE / 08/02/1999
I-75 BRENT SPENCE BRIDGE	KYD985081421		OHIO RIVER MP 471.2, UNDER I75 COVINGTON, KY, 41017
HIGH / NO	NO	YE / 07/30/2008	YE / 05/14/2007

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
IBM CORP - ENDICOTT	NYD002233039		1701 NORTH ST ENDICOTT, NY, 13760					
HIGH	YES	09/03/1992	NO		YE	09/30/2005	YE	09/30/2001
IBM CORP - KINGSTON	NYD001359694		300 ENTERPRISE DR KINGSTON, NY, 12401					
HIGH	NO		NO		YE	09/27/1999	YE	09/27/1999
IBM CORPORATION	MND006161756		3605 HIGHWAY 52 NORTH DEPT KP8, ROCHESTER, MN, 55901					
HIGH	YES	07/09/1992	YES	08/31/1992	YE	09/30/1997	YE	09/30/1997
IBM CORPORATION	VAD064872575		9600 GODWIN DRIVE MANASSAS, VA, 20110					
HIGH	YES	07/25/1990	YES	09/30/1997	YE	09/19/2002	YE	09/19/2002
IBM CORPORATION	NYD080480734		2455 SOUTH RD. POUGHKEEPSIE, NY, 126015400					
HIGH	NO		NO		YE	09/30/2002	YE	09/27/2002
IBM CORPORATION - EAST FISHKILL FACILITY	NYD000707901		2070 ROUTE 52 HOPEWELL JUNCTION, NY, 125333507					
HIGH	NO		NO		YE	02/25/2002	YE	09/10/2001
IBM THOMAS J. WATSON RESEARCH CENTER	NYD084006741		1101 KITCHAWAN ROAD ROUTE 134, P.O.BOX 218, YORKTOWN HEIGHTS, NY, 10598					
HIGH	YES	06/23/1997	YES	06/23/1997	YE	03/27/2000	YE	03/27/2000
IBP, INC.	NED072892037		US 283 & PROSPECT RD LEXINGTON, NE, 68850					
MEDIUM	YES	11/25/1998	YES	11/25/1998	YE	10/12/1999	YE	10/12/1999
ICI AMERICAS INC	PAD000797928		RT 443 W OFF RT 309 TAMAQUA, PA, 18252					
HIGH	YES	09/28/2007	YES	09/28/2007	YE	10/05/2001	YE	10/04/2005
IDT INC GREENSTEEL DIV	OHD987033370		14536 OYSTER RD ALLIANCE, OH, 44601					
HIGH	YES	03/08/2007	YES	03/08/2007	YE	10/19/2005	YE	10/19/2005
ILLIANA HEAT TREATING INC	ILR000007203		3109 E VORHEES ST DANVILLE, IL, 61832					
HIGH	YES	09/27/2007	YES	09/27/2007	YE	11/19/1999	YE	11/19/1999
INDSPEC CHEMICAL CORP	PAD004336731		133 MAIN ST PETROLIA, PA, 16050-0307					
HIGH	NO		NO		YE	09/30/2004	YE	09/30/2005
INDUSTRIAL CONTAINER SERVICE-KY LLC	KYD041167396		401 COLORADO AVE , LOUISVILLE, KY, 40208					
MEDIUM	NO		NO		YE	09/04/2008	NO STATUS	
INDUSTRIAL RECOVERY CAPITAL CO OF OHIO	OHD004495545		OAK AND NINTH STS MARYSVILLE, OH, 43040					
HIGH	YES	04/21/1998	YES	12/11/1998	YE	03/12/1999	YE	03/12/1999
INDUSTRIAL RUBBER APPLICATORS	MND990878456		3804 13TH AVE E HIBBING, MN, 55746					
HIGH	YES	03/25/2008	YES	03/25/2008	YE	08/16/2006	YE	08/16/2006
INDUSTRIAL SERVICE CORP	MOD073027609		1633 MARSH AVE KANSAS CITY, MO, 64126					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2005
INDUSTRIAL WASTES INC	PAD000621839		E PALESTINE RD PO BOX 406, DARLINGTON, PA, 16115					
HIGH	NO		NO		YE	09/30/2002	YE	09/30/2002
INEOS USA LLC	OHD042157644		1900 FORT AMANDA ROAD LIMA, OH, 45804					
HIGH	NO		NO		YE	03/18/1999	YE	03/18/1999
INGERSOLL RAND-TIMKEN REMEDIATION	GAD065344301		400 FRIENDSHIP RD , SYLVANIA, GA, 30467					
HIGH	YES	10/18/1991	NO		YE	03/29/1996	YE	03/29/1996
INGERSOLL- RAND COMPANY	NCD041414772		501 SANFORD AVENUE , MOCKSVILLE, NC, 27028					
HIGH	YES	03/21/2001	YES	03/29/2006	YE	09/29/2000	YE	09/14/1998
INGERSOLL-RAND SECURITY TECHNOLOGIES	COD082657420		3899 HANCOCK EXPRWY , SECURITY, CO, 80911					
HIGH	YES	08/29/2002	YES	06/17/2003	YE	10/24/2000	YE	09/21/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
INMETCO MFG	PAD087561015		ONE INMETCO DR PO BOX 720, ELLWOOD CITY, PA, 16117					
HIGH	YES	03/24/2003	YES	03/24/2003	YE	10/17/2002	YE	10/17/2002
INMONT CORP - HAWTHORNE PLT	NJD002165371		150 WAGARAW RD HAWTHORNE, NJ, 07506					
HIGH	NO		NO		YE	08/26/2004	NO STATUS	
INTERCONTINENTAL TERMINALS COMPANY LLC	TXD073912974		1943 BATTLEGROUND RD LA PORTE, TX, 77571					
HIGH	YES	08/22/2007	YES	08/22/2007	YE	03/21/2005	YE	03/21/2005
INTERFACEAR	MDD030320709		7364 BALTIMORE ANNAPOLIS BLVD GLEN BURNIE, MD, 21061					
HIGH	YES	05/18/2007	YES	05/18/2007	YE	06/13/2001	YE	01/24/2002
INTERMET RADFORD FOUNDRY	VAD010063006		1605 WEST MAIN STREET RADFORD, VA, 24141					
HIGH	NO		NO		YE	09/30/2004	YE	09/30/2004
INTERNATIONAL BUSINESS MACHINES CORP.	CAD990843989		5600 COTTLE ROAD SAN JOSE, CA, 951930001					
HIGH	YES	10/19/1988	YES	07/17/1989	YE	07/23/2002	YE	12/28/2000
INTERNATIONAL FLAVORS & FRAGRANCES INC.	NJD002194843		800 ROSE LANE UNION BEACH, NJ, 07735					
HIGH	YES	01/31/1996	YES	06/30/2000	YE	09/28/2001	YE	05/10/2002
INTERNATIONAL FUEL SYSTEMS INC	IND044587848		980 HURRICANE RD FRANKLIN, IN, 46131					
HIGH	YES	12/08/1998	YES	02/07/2000	YE	01/21/2000	YE	01/21/2000
INTERNATIONAL PAPER	MSD980600084		1633 SOUTH FIRST STREET , WIGGINS, MS, 39577					
HIGH	NO		NO		YE	09/29/2003	YE	09/28/2001
INTERNATIONAL PAPER	VAD046979498		3400 DEEPWATER TERM RD RICHMOND, VA, 23234					
HIGH	YES	05/17/1994	YES	05/17/1994	YE	08/23/2002	YE	08/23/2002
INTERNATIONAL PAPER	TXD008077356		HWY 6 N @ SEBASTIAN RD NAVASOTA, TX, 77868					
HIGH	YES	07/24/2006	YES	08/15/2007	YE	01/28/2000	YE	01/28/2000
INTERNATIONAL PAPER CO	MND006255319		6100 OLSON HWY MINNEAPOLIS, MN, 55422					
MEDIUM	YES	08/16/2006	YES	08/16/2006	YE	08/16/2006	YE	08/16/2006
INTERNATIONAL PAPER COMPANY	GAD003275252		1201 WEST LATHROP AVENUE SAVANNAH, GA, 31402					
MEDIUM	NO		NO		YE	09/26/2005	YE	01/31/2005
INTERNATIONAL PAPER JOPLIN TWP	MOD007129935		2609 S RANGELINE RD JOPLIN, MO, 64804					
HIGH	YES	03/27/1991	YES	08/21/1992	YE	08/27/2003	YE	09/20/2001
INTERNATIONAL PAPER LONGVIEW	WAD010745917		10 INTERNATIONAL WAY LONGVIEW, WA, 98632					
HIGH	NO		NO		YE	08/13/2003	YE	07/06/2005
INTERNATIONAL PAPER- FRANKLIN MILL	VAD003112265		34040 UNION CAMP DRIVE FRANKLIN, VA, 23851					
HIGH	YES	06/09/2008	YES	06/09/2008	YE	09/29/2003	YE	08/01/2007
INTERNATIONAL SHOE CO	TXD008071227		CARSON & FINFEATHER BRYAN, TX, 77801					
HIGH	NO		NO		YE	11/22/2004	IN	07/22/2002
INTERNATIONAL WAXES INC	PAD046761763		45 RTE 446 SMETHPORT, PA, 16749-0667					
HIGH	NO		NO		YE	08/21/2002	YE	08/21/2002
INTERNATIONAL WOOLEN CO INC	MED057977092		100 DALE ST SANFORD, ME, 04073					
HIGH	YES	10/01/2007	NO		YE	09/28/2006	YE	09/28/2006
INTEVAC	CAT080010804		601 CALIFORNIA AVE PALO ALTO, CA, 943040883					
HIGH	YES	09/21/1994	YES	10/15/1996	YE	12/28/2000	YE	12/28/2000
INVISTA INC. MARTINSVILLE	VAD003114865		1000 DUPONT ROAD MARTINSVILLE, VA, 24112					
HIGH	NO		NO		YE	09/27/2004	YE	09/28/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
INVISTA SEAFORD PLANT	DED002348845		25876 DUPONT ROAD , SEAFORD, DE, 19973					
HIGH	YES	05/25/2006	YES	10/30/2007	YE	03/16/1999	YE	09/30/2003
IPSCO KOPPEL TUBULARS CORP	PAD000651752		6TH & MOUNT ST BEAVER FALLS, PA, 15010					
HIGH	YES	12/31/1998	YES	12/31/1998	YE	05/06/1999	YE	05/06/1999
IRATHANE SYSTEMS INC	MND022818306		3516 13TH AVE E HIBBING, MN, 55746					
MEDIUM	YES	03/25/2008	YES	03/25/2008	YE	08/16/2006	YE	08/16/2006
IRVING TANNING CO	MED001065580		REAR PLEASANT ST HARTLAND, ME, 049430400					
MEDIUM	YES	10/02/2006	NO		YE	10/02/2006	NO STATUS	
ISELI CO	CTD083343269		651 GREYSTONE ROAD TERRYVILLE, CT, 06786					
HIGH	NO		NO		YE	11/12/1999	YE	05/23/2000
ISG TECUMSEH REDEVELOPMENT INC	PAD990824161		1805 E FOURTH ST BETHLEHEM, PA, 180167699					
HIGH	NO		NO		YE	01/07/2004	NO STATUS	
ISO-TEX INC	TXD072206311		1511 COUNTY ROAD 129 FRIENDSWOOD, TX, 77546					
HIGH	YES	07/19/2006	YES	07/19/2006	YE	07/11/2005	YE	07/11/2005
ISU - CHEMICAL WASTE HANDLING FACILITY	IAT200010601		1916 N SCHOLL RD , AMES, IA, 50014					
HIGH	YES	09/03/1997	YES	09/03/1997	YE	04/24/2002	YE	04/24/2002
IT CORPORATION - VINE HILL COMPLEX	CAD982521460		896 WATERBIRD WAY MARTINEZ, CA, 94553					
HIGH	NO		NO		YE	04/07/2000	YE	04/07/2000
ITT CORPORATION - NIGHT VISION	VAD003123072		7635 PLANTATION ROAD ROANOKE, VA, 240193257					
HIGH	NO		NO		YE	02/25/2000	YE	02/25/2000
ITT CORPORATION-NIGHT VISION	VAD980550909		7669 ENON DRIVE ROANOKE, VA, 24019-3257					
HIGH	NO		NO		YE	02/25/2000	YE	02/25/2000
IWG WYRE WYND	CTD002590461		77 ANTHONY STREET JEWETT CITY, CT, 06351					
HIGH	NO		NO		YE	03/26/2002	YE	03/18/2002
J AND M PLATING INC	ILD990783995		1711 SEMINARY ST ROCKFORD, IL, 61004					
HIGH	NO		NO		YE	11/30/1999	YE	09/29/2000
J M HUBER CORPORATION	TXD980874135		1110 PENN ST BORGER, TX, 79007					
HIGH	YES	07/17/2006	YES	07/17/2006	YE	11/16/2001	YE	11/16/2001
JAMESTOWN PAINT CO	PAD004323788		108 MAIN ST JAMESTOWN, PA, 16134					
HIGH	NO		YES	07/30/2008	YE	07/15/2002	YE	07/15/2002
JASON R MORMAN	TXD087612834		11101 FAIRMONT PKWY LA PORTE, TX, 77571					
HIGH	YES	02/14/2006	YES	02/14/2006	YE	03/23/2005	YE	03/23/2005
JEA - NORTHSIDE POWER PLANT	FLD000735860		4377 HECKSCHER DR JACKSONVILLE, FL, 322263033					
HIGH	NO		NO		YE	09/13/2007	NO STATUS	
JEA KENNEDY GENERATING STATION	FLD000814392		4215 TALLEYRAND AVE JACKSONVILLE, FL, 322061799					
HIGH	NO		NO		NO STATUS		NO STATUS	
JERSEY PLATING CO	NJD002202885		214 BIRCH ST BOONTON, NJ, 070051728					
HIGH	NO		NO		NO STATUS		NO STATUS	
JOHN DEERE DES MOINES WORKS	IAD069624500		825 SW IRVINEDALE DR ANKENY, IA, 50023					
HIGH	NO		NO		YE	09/30/2005	IN	07/11/2003
JOHN DEERE WATERLOO WORKS-WESTFIELD AVE	IAD005289806		400 WESTFIELD AVE WATERLOO, IA, 507010270					
HIGH	NO		NO		YE	09/30/2004	YE	09/30/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
JOHN SMITH SOLID WASTE SITE	CAD990665432		JOHN SMITH ROAD HOLLISTER, CA, 95023					
MEDIUM	YES	06/12/1996	YES	06/12/1996	YE	04/06/2000	YE	06/17/2002
JOHNSON CONTROLS INC	MID099124299		425 FRANK ST FOWLERVILLE, MI, 48836					
HIGH	YES	12/01/2006	NO		YE	03/31/2004	YE	09/30/2004
JOHNSON CONTROLS, INC	DED002353092		700 NORTH BROAD STREET MIDDLETOWN, DE, 19709					
HIGH	YES	12/22/2005	YES	02/24/2006	YE	05/07/2001	YE	05/04/1999
JOHNSON MATTHEY INC	NJD000692194		PINEY HOLLOW RD WINSLOW, NJ, 08095					
HIGH	YES	07/01/1996	YES	05/30/2008	YE	09/30/1999	YE	09/30/1999
JONES ENVIRONMENTAL SERVICES (NE), INC	MAD047075734		263 HOWARD ST LOWELL, MA, 01825					
HIGH	YES	08/08/2006	YES	08/08/2006	YE	08/26/2003	YE	08/26/2003
JULY PRODUCTS	PAD004340444		12TH ST & MIDLAND AVE MIDLAND, PA, 15059					
HIGH	YES	07/13/2000	YES	07/13/2000	YE	02/08/2000	YE	02/08/2000
KABA ILCO CORP	NCD045646924		400 JEFFREYS RD ROCKY MOUNT, NC, 27802					
HIGH	YES	08/30/2007	YES	08/30/2007	YE	09/30/2002	YE	09/30/2002
KAISER ALUMINUM - MULBERRY FAC DIW	FLD004106811		2420 STATE ROAD 60 E MULBERRY, FL, 338607926					
HIGH	NO		NO		YE	09/27/1995	YE	09/27/1995
KAISER VENTURES, INC.	CAD008274938		13429 SAN BERNARDINO AVE FONTANA, CA, 92334					
HIGH	NO		NO		YE	06/16/2005	IN	08/11/2000
KAMAN AEROSPACE CORP	CTD001155225		OLD WINDSOR ROAD BLOOMFIELD, CT, 06002					
HIGH	NO		NO		YE	09/29/2005	NO STATUS	
KAMAN AEROSPACE CORPORATION	CTD065529158		100 SOUTH MAIN ST MOOSUP, CT, 06354					
HIGH	NO		NO		YE	09/09/2005	YE	08/08/2006
KANE MAGNETICS DIV ENERGY CONVERSION SYS	PAD043817444		700 ELK AVE KANE, PA, 16735-1068					
HIGH	NO		NO		YE	09/27/2000	YE	09/27/2000
KANSAS ARMY AMMUN PLT	KS0213820467	US Army	23018 ROOKS RD (A) , PARSONS, KS, 67357					
MEDIUM	YES	04/04/2006	NO		YE	09/30/2003	YE	06/10/2005
KANTHAL CORP	CTD001449602		119 WOOSTER STREET BETHEL, CT, 06801					
HIGH	NO		NO		YE	09/04/2001	YE	09/10/2002
KAPL, INC.- KNOLLS SITE	NY6890008992	Dept. of Energy	RIVER RD NISKAYUNA, NY, 12309					
HIGH	NO		NO		YE	07/15/2005	YE	09/28/2004
KEARFOTT GUIDANCE & NAVIGATION CORPORATI	NJD002148484		1150 MCBRIDE AVENUE WEST PATERSON, NJ, 07424					
HIGH	YES	09/24/1993	NO		YE	12/30/2003	YE	02/06/2004
KEARNEY-KPF	CAD981429715		1624 E ALPINE AVE STOCKTON, CA, 952052594					
HIGH	NO		NO		YE	04/03/2000	YE	08/19/2004
KEESLER AFB, 81ST CES/CEV	MS2570024164	US Air Force	508 L STREET KEESLER AFB, MS, 395342115					
HIGH	YES	05/23/2006	YES	05/23/2006	YE	11/05/2001	YE	11/05/2001
KELLY RUN SANITATION INC	PAD004810222		RTE 51 ELIZABETH, PA, 15037					
HIGH	NO		NO		YE	03/13/2000	YE	03/13/2000
KELLY-SPRINGFIELD TIRE CO	MDD003060217		KELLY RD CUMBERLAND, MD, 21502					
HIGH	YES	08/22/2007	YES	08/22/2007	YE	09/29/2003	YE	09/15/2003

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
KELSEY HAYES LANDFILL	OHD052859170		2400 CHARLES ST PORTSMOUTH, OH, 45662					
HIGH	YES	01/25/2007	YES	01/25/2007	YE	03/05/1999	YE	03/05/1999
KENDRO LABORATORY PRODUCTS LP	CTD072115793		31 PECKS LANE NEWTOWN, CT, 06470					
HIGH	YES	10/03/2007	NO		YE	08/11/2000	YE	08/11/2000
KENNAMETAL INC BEDFORD PLT	PAD004397683		CHALYBEATE SPRINGS RD BEDFORD, PA, 15522					
HIGH	YES	12/20/1996	YES	12/20/1996	YE	06/17/2002	YE	06/17/2002
KENTUCKY ELECTRIC STEEL LLC	KYD000207282		2704 SOUTH BIG RUN ROAD , ASHLAND, KY, 41102					
HIGH	YES	09/27/2007	NO		YE	04/28/2005	YE	09/24/2003
KERR MCGEE CHEMICAL, LLC	MSD007025117		40034 KERR MCGEE RD. HAMILTON, MS, 39746					
HIGH	NO		NO		YE	09/30/2005	YE	09/30/1998
KERR MCGEE CHEMICAL, LLC-COLUMBUS	MSD990866329		2300 14TH AVE NORTH COLUMBUS, MS, 39701					
HIGH	NO		NO		YE	09/08/2005	YE	07/02/1997
KESTREL HAWK LF	WID076171008		1989 OAKES RD RACINE, WI, 53406					
HIGH	YES	02/12/1997	YES	02/12/1997	YE	08/23/2000	YE	08/23/2000
KEY TERMINALS INC	WID982068801		N MAIN ST KEWAUNEE, WI, 54216					
MEDIUM	YES	10/04/2006	YES	10/04/2006	YE	10/04/2006	YE	10/04/2006
KEYSTONE CEMENT CO	PAD002389559		ROUTE 329 BATH, PA, 18014					
HIGH	YES	08/07/2003	YES	08/07/2003	YE	05/20/2002	YE	05/20/2002
KEYSTONE STEEL & WIRE CO	ILD000714881		7000 SW ADAMS ST-A PEORIA, IL, 61641					
HIGH	YES	10/19/2005	YES	07/31/2006	YE	03/29/2002	YE	03/29/2002
KHI INC	MID006020895		582 E LAKEWOOD BLVD HOLLAND, MI, 49424					
HIGH	YES	10/30/1997	YES	01/16/2001	YE	01/16/2001	IN	08/28/1997
KIK CUSTOM PRODUCTS INC	ILD005141726		1 W HEGELER LN DANVILLE, IL, 61832					
MEDIUM	NO		NO		YE	09/30/2003	YE	09/30/2003
KILGORE FLARES COMPANY LLC	TND981026594		KELLER RD TOONE, TN, 38381					
HIGH	NO		NO		YE	07/06/2001	YE	03/31/2003
KILTEX CORPORATION	OHD049370729		2064 KILLIAN RD AKRON, OH, 44312					
HIGH	NO		NO		YE	08/28/2007	YE	06/08/2007
KIMBERLY-CLARK BERKELY MILLS	NCD003151990		32 SMYTH AVE HENDERSONVILLE, NC, 28792					
MEDIUM	YES	11/10/2005	YES	09/27/2006	YE	09/18/1997	YE	09/18/1997
KING MFG	NHD001090729		SQUANTUM RD JAFFREY, NH, 03452					
HIGH	YES	11/30/2001	YES	10/22/2003	YE	02/05/1997	YE	02/05/1997
KIRTLAND AFB, NM	NM9570024423	US Air Force	2050 WYOMING BLVD SE BLDG 20685 KIRTLAND AFB, NM, 87117					
HIGH	NO		NO		YE	06/13/2001	IN	01/25/1996
KLI SITE	VAD052356623		16174 INDUSTRIAL DRIVE MILFORD, VA, 22514					
HIGH	NO		NO		YE	06/05/2002	YE	09/25/2003
KM LIQUIDS TERMINALS LLC	TXD026481523		906 CLINTON DR TERMINAL A GALENA PARK, TX, 77547					
HIGH	YES	08/07/2008	YES	08/07/2008	YE	12/30/2004	YE	12/30/2004
KOCH NITROGEN CO	KSD044625010		11559 US HWY 50 , DODGE CITY, KS, 678011337					
HIGH	NO		NO		YE	07/20/2004	IN	06/20/2002
KOHLER CO	WID006073225		444 HIGHLAND DR KOHLER, WI, 53044					
HIGH	NO		NO		YE	08/03/2005	YE	09/03/2008

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
KOPPERS CO INC	PAD082245754	440 COLLEGE PARK DR MONROEVILLE, PA, 15146
HIGH	NO		NO		YE	06/10/2003	YE	06/19/2003
KOPPERS COMPANY INC	TXD008089021	INDUSTRIAL RD 1M S OF I-10 HOUSTON, TX, 77015
HIGH	YES	08/10/2006	NO		YE	07/22/2004	YE	07/22/2004
KOPPERS INC	COD007077175	465 W 56TH AVE DENVER, CO, 80216
HIGH	YES	07/20/2004	NO		YE	09/21/2005	YE	09/05/2006
KOPPERS INC	ARD006344824	2201 EDMONDS ST. NORTH LITTLE ROCK, AR, 72117
HIGH	YES	09/15/2008	NO		YE	04/20/2005	YE	09/30/2003
KOPPERS INC	WID006179493	3185 S CTH A SUPERIOR, WI, 54880
HIGH	NO		NO		YE	09/28/2006	YE	09/18/2008
KOPPERS INC WOODWARD TAR	ALD085765808	1835 KOPPERS DRIVE , DOLOMITE, AL, 35061
HIGH	NO		NO		YE	09/30/2004	YE	09/30/2004
KOPPERS INC.	MSD007027543	ONE KOPPERS DRIVE TIE PLANT, MS, 38960
HIGH	NO		NO		YE	09/30/2005	YE	09/30/2005
KOPPERS INC.	WVD003080959	98 RAILROAD STREET GREEN SPRING, WV, 26722
HIGH	NO		NO		YE	08/31/2004	YE	08/31/2004
KOPPERS INCORPORATED	WVD004336749	100 KOPPERS ROAD FOLLANSBEE, WV, 26037
HIGH	NO		NO		YE	11/12/1999	YE	09/30/2004
KOPPERS, INC.	KYD006383392	198 FAIRGROUNDS RD , GUTHRIE, KY, 42234
MEDIUM	NO		NO		YE	07/25/2005	YE	09/28/2004
KOSMOS CEMENT COMPANY	KYD024111981	15301 DIXIE HIGHWAY LOUISVILLE, KY, 40272
MEDIUM	NO		NO		YE	04/11/2003	YE	04/11/2003
KRATON POLYMERS US LLC	OHD004343117	2419 STATE ROUTE 618 BELPRE, OH, 45714
HIGH	YES	03/17/2003	YES	01/27/2005	YE	09/30/2003	YE	09/30/2003
L-3 COMMUNICATIONS INTEGRATED SYSTEMS LP	TXD007365984	10001 JACK FINNEY BLVD GREENVILLE, TX, 75401
HIGH	YES	08/11/2008	YES	08/11/2008	YE	10/23/2001	YE	08/26/2003
LACKS INDUSTRIES INC	MID006014666	1601 GALBRAITH AVE SE GRAND RAPIDS, MI, 49546
HIGH	NO		NO		YE	09/29/2003	YE	09/27/2007
LACKS INDUSTRIES INC	MID080359433	6138 RIVERSIDE DR SARANAC, MI, 48881
HIGH	NO		NO		YE	09/30/2004	YE	09/17/2003
LAFARGE CORPORATION	OHD987048733	11435 COUNTY ROAD 176 PAULDING, OH, 45879
LOW	NO		YES	12/23/2002	YE	02/05/2003	YE	09/30/2002
LAFARGE MIDWEST INC	MID005379607	1435 FORD AVE ALPENA, MI, 49707
HIGH	YES	05/17/2001	YES	05/17/2001	YE	05/17/2001	YE	05/17/2001
LAMSON & SESSIONS COMPANY	OHD004196614	800 MOGADORE RD KENT, OH, 44240
HIGH	NO		NO		YE	04/10/2006	NO STATUS	
LANCASTER METALS SCIENCE CORP	PAD980919005	826 N QUEEN ST LANCASTER, PA, 17603-2740
HIGH	NO		YES	01/03/2008	YE	08/20/2002	YE	08/20/2002
LANCASTER METALS SCIENCE CORPORATION	PAD082434747	1695 STATE RD E PETERSBURG, PA, 17520
HIGH	YES	09/25/1997	NO		YE	04/16/1999	YE	04/16/1999
LANGDALEFOREST PRODUCTS CO.	TND003493103	555 SOUTH MAIN STREET SWEETWATER, TN, 37874
HIGH	YES	11/14/2006	YES	11/14/2006	YE	03/30/2001	YE	03/30/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
LANIER CLOTHES (OXFORD INDUSTRIES)	GA0000233163		736 WOODBURY RD GREENVILLE, GA, 30222
HIGH / YES / 05/01/2008	YES / 08/29/2008	YE / 12/18/2001	YE / 06/29/2002
LANXESS CORP	SCD048373468		1588 BUSHY PARK RD GOOSE CREEK, SC, 29445
HIGH / NO	NO	YE / 09/05/2001	YE / 09/13/2001
LARAWAY RECYCLING & DISP FAC	ILD074411745		21101 W LARAWAY RD ELWOOD, IL, 60421
HIGH / YES / 07/28/1993	YES / 07/28/1993	YE / 03/03/1993	YE / 03/04/1993
LARSEN OIL CO INC	MND980990667		311 FOWLER FARIBAULT, MN, 55021
MEDIUM / YES / 03/25/2008	YES / 03/25/2008	YE / 08/16/2006	YE / 08/16/2006
LAWRENCE BERKELEY NATIONAL LABORATORY	CA4890008986	Dept. of Energy	1 CYCLOTRON ROAD BERKELEY, CA, 94720
MEDIUM / NO	YES / 07/13/2007	YE / 04/27/2000	YE / 08/15/2002
LBC HOUSTON LP	TXD000719286		11807 PORT RD SEABROOK, TX, 77586
HIGH / YES / 02/24/2006	YES / 02/24/2006	YE / 02/29/2000	YE / 02/29/2000
LEE BRASS	ALD057213811		1800 GOLDEN SPRINGS ROAD , ANNISTON, AL, 36207
HIGH / YES / 01/14/2008	YES / 09/29/2008	YE / 05/18/2007	YE / 05/18/2007
LEE ENGINEERING & CONST (GC LEE SITE)	GA0000012914		LEE FARM RD DU PONT, GA, 31630
HIGH / YES / 05/03/2002	NO	YE / 06/10/1997	YE / 06/10/1997
LEHIGHTON ELEC INC PRINTED CIRCUIT	PAD002399186		15 BLAKESLEE BOULEVARD WEST LEHIGHTON, PA, 18235-0328
HIGH / YES / 08/09/2000	YES / 12/11/2006	YE / 08/24/1999	YE / 08/24/1999
LEMEAN PROPERTY HOLDINGS CORP	PAD045137247		8281 RT 873 SLATINGTON, PA, 18080
HIGH / YES / 02/15/2006	YES / 02/15/2006	YE / 06/29/2005	YE / 06/29/2005
LENOX, INCORPORATED D/B/A LENOX CHINA	NJD002325074		TILTON ROAD POMONA, NJ, 08240
HIGH / YES / 02/03/2004	YES / 09/28/2007	YE / 08/24/2000	YE / 09/26/2005
LEXINGTON ABRASIVES INC	OHD093289700		16123 ARMOUR ST NE ALLIANCE, OH, 44601
HIGH / NO	NO	NO STATUS	NO STATUS
LIC WAREHOUSE REALTY CO INC	CTD001153253		76 RONZO ROAD BRISTOL, CT, 06010
MEDIUM / NO	NO	YE / 09/26/2007	YE / 09/26/2007
LIGHT METALS COLORING CO INC	CTD001162460		270 SPRING ST SOUTHINGTON, CT, 06489
HIGH / NO	NO	YE / 09/28/2004	YE / 09/28/2006
LIGHTOLIER NORWICH	CTD000841130		40 WISCONSIN AVE NORWICH, CT, 06360
HIGH / YES / 12/01/2005	YES / 09/28/2006	YE / 06/22/2001	YE / 02/23/2006
LINDEN DEVELOPMENT LLC	NJD002186690		1016 W EDGAR RD LINDEN, NJ, 07036
HIGH / NO	NO	YE / 09/30/2004	YE / 09/30/2005
LION OIL COMPANY	ARD000021998		1000 MCHENRY EL DORADO, AR, 71730
HIGH / YES / 02/13/2006	NO	YE / 09/22/2003	YE / 09/22/2003
LITTLE ROCK AFB	AR6571824808	US Air Force	528 THOMAS AVENUE LITTLE ROCK AFB, AR, 720994987
HIGH / YES / 02/28/2007	NO	YE / 09/08/2004	YE / 09/14/2004
LOCKHEED MARTIN - FORMER IBM OWEGO FACIL	NYD986874501		1801 STATE RTE 17C OWEGO, NY, 13827
HIGH / YES / 09/29/1994	YES / 09/29/1994	YE / 01/25/2002	YE / 01/25/2002
LOCKHEED MARTIN - MISSILES & FIRE CONTRO	FLD061993606		498 OAK RD OCALA, FL, 344723006
HIGH / YES / 02/19/1998	YES / 06/23/2007	YE / 09/19/2000	YE / 09/19/2000
LOCKHEED MARTIN CORPORATION	NYD059385120		497 ELECTRONICS PARKWAY LIVERPOOL, NY, 13088
HIGH / YES / 02/01/1997	YES / 05/11/2006	YE / 09/05/2001	YE / 09/29/1999

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
LOCKHEED MARTIN CORPORATION	ORD052221025		3313 W 2ND THE DALLES, OR, 97058
HIGH / YES / 09/29/1988	YES / 12/10/1995	YE / 05/04/2000	YE / 05/04/2000
LOCKHEED MARTIN DEFENSE SYSTEM	MND000823922		2751 SHEPARD RD ST PAUL, MN, 551160000
MEDIUM / YES / 08/16/2006	YES / 08/16/2006	YE / 08/16/2006	YE / 08/16/2006
LOCKHEED MARTIN MFC	FLD060240207		5600 W SAND LAKE RD # MP-280 ORLANDO, FL, 328198907
HIGH / YES / 09/11/2007	YES / 09/11/2007	YE / 09/27/1995	YE / 09/22/2005
LOCKHEED MARTIN MISSILES & FIRE CONTROL	ARD980621155		LEWIS RD HIGHLAND INDUSTRIAL P CAMDEN, AR, 71701
MEDIUM / YES / 03/04/1998	YES / 03/06/1998	YE / 08/22/2000	YE / 08/22/2000
LOCKHEED MARTIN SITE B-1	CAD045256187		1705 N VICTORY PLACE BURBANK, CA, 91505
HIGH / NO	NO	YE / 03/09/2001	YE / 03/09/2001
LOCKHEED MARTIN SPACE SYSTEMS COMPANY	CAD009125535		1111 LOCKHEED MARTIN WAY SUNNYVALE, CA, 94089
HIGH / NO	NO	YE / 12/28/2000	YE / 12/28/2000
LOCKHEED MARTIN TACTICAL SYSTEMS	MND000823914		3333 PILOT KNOB RD EAGAN, MN, 55121
HIGH / YES / 12/02/1993	YES / 12/02/1993	YE / 09/30/1997	YE / 09/30/1997
LOCKHEED MARTIN WATERTON PLANT	COD001704790		12257 S WADSWORTH BLVD LITTLETON, CO, 80125
HIGH / YES / 09/24/1990	YES / 10/26/1999	YE / 10/27/1999	YE / 08/08/2000
LONGVIEW REFINING ASSOCIATES INC	TXD045586187		601 PREMIER RD LONGVIEW, TX, 75606
HIGH / NO	NO	YE / 07/16/2008	NO STATUS
LORD CORP	PAD051129757		124 GRANT ST CAMBRIDGE SPRINGS, PA, 16403
HIGH / NO	YES / 02/02/2007	YE / 09/28/2000	YE / 09/28/2000
LOS ANGELES CO AGRI COMM	CAD000626077		8841 E SLAUSON AVE PICO RIVERA, CA, 90660
MEDIUM / NO	NO	YE / 05/01/2000	YE / 05/01/2000
LOUISIANA-PACIFIC CORP-LOCKHART	ALD095687786		2613 AL HWY 55 , LOCKHART, AL, 36455
MEDIUM / YES / 09/25/2003	NO	YE / 02/09/2004	YE / 09/29/2005
LUCENT TECHNOLOGIES	OKD007189111		7725 W. RENO AVE. OKLAHOMA CITY, OK, 73127
HIGH / NO	NO	YE / 06/06/2001	IN / 06/06/2001
LUVATA- FRANKLIN	KYD062969290		4720 BOWLING GREEN ROAD FRANKLIN, KY, 42134-762
MEDIUM / NO	NO	YE / 05/02/2000	YE / 08/10/2001
LWD, INC.	KYD088438817		2475 INDUSTRIAL PKWY , CALVERT CITY, KY, 42029
HIGH / NO	NO	YE / 08/05/2003	NO / 09/25/1998
LYONDELL CHEMICAL COMPANY	TXD083472266		2502 SHELDON RD CHANNELVIEW, TX, 77530
HIGH / YES / 02/28/2006	YES / 02/28/2006	YE / 06/29/2001	YE / 06/29/2001
M E M C ELECTRONIC MATERIALS INC	MOD001700673		501 PEARL DR MZ65 ST PETERS, MO, 63376
HIGH / YES / 08/01/1996	YES / 05/30/1997	YE / 09/30/1999	YE / 09/30/1999
M H RHODES INC	CTD001162114		139 MILL ROCK RD OLD SAYBROOK, CT, 06475
HIGH / NO	NO	YE / 12/23/2003	YE / 09/30/2003
MACDERMID INC	CTD001164599		526 HUNTINGDON AVENUE WATERBURY, CT, 06708
HIGH / NO	NO	YE / 03/22/2005	YE / 09/26/2008
MACDILL AFB - DRMO	FL6570024582	US Air Force	7621 HILLSBOROUGH LOOP DR TAMPA, FL, 336215207
HIGH / NO	NO	YE / 11/16/1996	NO / 09/16/1996
MADEWELL & MADEWELL, INC.	OKD032963530		9400 N. CHOCTAW RD. , JONES, OK, 73049
HIGH / YES / 11/27/1997	YES / 04/02/1998	YE / 11/02/2000	YE / 11/02/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion	Date	HE Controlled / Date / GW Controlled / Date
MAGELLAN PIPELINE CO - WRENSHALL	MND980613772		10 BROADWAY ST N WRENSHALL, MN, 55797
HIGH YES 08/16/2006	NO		YE 10/01/2005 YE 08/16/2006
MAGELLAN PIPELINE COMPANY LP	COD076459601		15000 E SMITH RD , AURORA, CO, 800112401
HIGH YES 10/26/2000	YES	10/26/2000	YE 06/05/2001 YE 06/14/2000
MAGELLAN PIPELINE TERMINALS LP	TXD026896290		2700 S GRANDVIEW AVE ODESSA, TX, 79766
HIGH YES 08/23/2007	YES	08/23/2007	YE 02/28/2003 YE 02/28/2003
MAGNA CORP ACROLEIN PLT	CAT000618728		GOSFORD & PACHECO RDS BAKERSFIELD, CA, 93309
MEDIUM YES 09/12/1996	NO		YE 04/04/2000 YE 04/04/2000
MAHLE ENGINE COMPONENTS USA	OHD986979466		5130 N STATE ROUTE 60 MCCONNELSVILLE, OH, 43756-9021
HIGH YES 09/27/2006	YES	09/27/2006	YE 05/15/2006 YE 05/15/2006
MAINE ELECTRONICS	MED065034183		19 SAINT ANNE ST LISBON, ME, 04250
HIGH YES 12/17/1997	YES	12/17/1997	YE 11/03/2005 YE 11/03/2005
MAINE YANKEE ATOMIC POWER COMPANY	MED071749329		321 OLD FERRY ROAD WISCASSET, ME, 04578
HIGH YES 11/30/2007	YES	11/30/2007	YE 11/03/2005 YE 11/03/2005
MALLINCKRODT INC	MOD096726484		3600 N 2ND ST , ST LOUIS, MO, 631473457
HIGH NO	NO		NO STATUS NO STATUS
MALTA WINDOWS	OHD004290078		210 13TH ST MALTA, OH, 437589900
HIGH YES 09/18/2001	YES	07/31/2002	YE 03/07/2002 YE 03/11/2002
MANHEIM AREA ECONOMIC DEV CORP	PAD003015328		123 E STIEGEL ST MANHEIM, PA, 17545-1626
HIGH NO	NO		YE 04/04/2005 IN 08/28/1998
MANNINGTON MILLS INC	NJD002349256		75 MANNINGTON MILLS RD SALEM, NJ, 080790030
HIGH NO	NO		YE 09/28/2006 YE 09/28/2007
MANOR TIMBER COMPANY INC	GAD061921052		BLACK ANKLE RD ARGYLE, GA, 31623
HIGH YES 07/09/2007	YES	07/09/2007	YE 09/15/1997 YE 11/30/1998
MARATHON PETROLEUM CO LLC	ILD005476882		100 MARATHON AVE P O BOX 1200, ROBINSON, IL, 62454
HIGH NO	YES	09/05/2002	YE 09/25/1992 YE 09/25/1992
MARATHON PETROLEUM COMPANY LLC	MND006162820		459 3RD ST ST. PAUL PARK, MN, 55071
HIGH YES 07/07/1995	YES	12/31/1998	YE 02/01/1997 YE 02/01/1997
MARATHON PETROLEUM COMPANY LLC - LRD	LAD081999724		US HWY 61 @ MARATHON AVE. GARYVILLE, LA, 70051
HIGH YES 11/29/2006	YES	11/29/2006	YE 09/22/1999 YE 09/22/1999
MARINE CORPS AIR STATION BEAUFORT	SC1750216169	US Marines	HWY 21 BLDG 601 BEAUFORT, SC, 29904
HIGH NO	NO		YE 01/20/2004 NO 09/30/1998
MARINE CORPS BASE, CAMP LEJEUNE	NC6170022580	US Marines	1 HOLCOMB BOULEVARD ROOM 260 CAMP LEJEUNE, NC, 28542
HIGH NO	NO		YE 03/29/2004 YE 03/29/2004
MARINE CORPS LOGISTICS BASE, BARSTOW	CA8170090023	US Marines	WAREHOUSE 3 BARSTOW, CA, 92311
HIGH NO	NO		YE 03/09/2001 YE 03/09/2001
MARJOL BATTERY	PAD003041910		600 DELAWARE ST THROOP, PA, 18512
HIGH YES 12/01/2000	NO		YE 09/27/2002 YE 09/30/1999
MARLEY COOLING TOWER CO THE	CAD009140120		150 N SINCLAIR AVE STOCKTON, CA, 95215
HIGH YES 06/06/2007	YES	08/18/2006	YE 09/24/2001 YE 09/24/2001
MARTIN ELECTRONICS INC	FLD047966593		10625 PUCKETT RD PERRY, FL, 323488505
HIGH YES 11/27/2007	YES	11/27/2007	YE 09/28/2000 YE 09/28/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date / Construction Completion / Date	HE Controlled / Date	GW Controlled / Date	
MARTIN METAL FINISHING INC	CAD059794974		12150 S ALAMEDA ST (SEE MAP) LYNWOOD, CA, 90262
HIGH / NO / / NO /	YE / 02/07/2003	YE / 09/14/2007	
MASON CORPORATION	IND005460209		1049 US HWY 41 , SCHERERVILLE, IN, 46375
HIGH / NO / / NO /	YE / 09/26/2003	NO / 10/11/2000	
MATHESON GAS PRODUCTS INC.	TND047002589		SCEPTER RD OFF HWY 70 , NEW JOHNSONVILLE, TN, 37134
HIGH / YES / 10/09/2007 / YES / 10/09/2007	YE / 09/30/1999	YE / 09/30/1999	
MATLACK INC	NJD043584101		RTE 322 SWEDESBORO, NJ, 08085
HIGH / NO / / NO /	YE / 09/23/2005	NO STATUS	
MATTACO INC	CTD001165760		1981 E MAIN ST , WATERBURY, CT, 06705
HIGH / YES / 10/21/2004 / NO /	YE / 09/02/2004	YE / 11/22/1999	
MAX ENVIRONMENTAL TECHNOLOGIES INC	PAD059087072		200 MAX DR RR 1, BULGER, PA, 15019-9801
HIGH / NO / / NO /	YE / 11/08/2000	YE / 11/08/2000	
MAX ENVIRONMENTAL YUKON	PAD004835146		233 MAX LN YUKON, PA, 15698
HIGH / NO / / NO /	YE / 01/26/2001	YE / 01/26/2001	
MAYTAG HERRIN LAUNDRY PRODUCTS	ILD093746014		410 E LYERLA DR HERRIN, IL, 62948
HIGH / YES / 05/21/2007 / YES / 05/21/2007	YE / 03/01/2006	YE / 09/14/2006	
MCALESTER ARMY AMMUNITION PLANT	OK6213822798 / US Army		1 C TREE ROAD MCALESTER, OK, 74501
HIGH / NO / / NO /	YE / 05/29/2001	YE / 05/29/2001	
MCAS CHERRY POINT	NC1170027261 / US Marines		NC HWY 101 @ US 70 WEST HAVELOCK, NC, 285330006
HIGH / NO / / NO /	YE / 11/06/2002	YE / 05/27/2004	
MCCONNELL AFB	KS1571924140 / US Air Force		53000 HUTCHINSON STE 109 , WICHITA, KS, 67221
MEDIUM / NO / / NO /	YE / 09/27/2007	NO STATUS	
MCDONALD AY DISPOSAL SITE-FORMER SITE OF	IAD005103882		12TH & 14TH ST , DUBUQUE, IA, 52001
HIGH / YES / 09/28/2007 / YES / 09/28/2007	YE / 08/24/2006	YE / 08/24/2006	
MCDONNELL DOUGLAS CORP - BLDG 14	MOD000818963		5220 BANSHEE RD HAZELWOOD, MO, 63042
MEDIUM / NO / / NO /	YE / 02/27/2008	YE / 02/27/2008	
MCFARLAND CASCADE POLE & LUMBER CO	WAD008958357		1640 E MARC ST TACOMA, WA, 98421
HIGH / NO / / NO /	YE / 08/09/2004	YE / 08/09/2004	
MCGRAW-EDISON COMPANY	PAD004339297		30 CURRY AVE PO BOX 440, CANONSBURG, PA, 15317
HIGH / NO / / NO /	YE / 06/30/2004	IN / 09/03/1999	
MCKESSON ENVIROSYSTEMS	NYD075806836		400 BEAR ST SYRACUSE, NY, 13204
MEDIUM / YES / 09/26/2006 / YES / 09/26/2006	YE / 09/26/2000	YE / 09/26/2000	
MCKINNEY SMELTING INC	TXR000025387		300 N MCDONALD MCKINNEY, TX, 75070
HIGH / NO / / NO /	NO STATUS	NO STATUS	
ME COASTAL SERVICES	MED000604496		601 DANFORTH ST PORTLAND, ME, 04102
LOW / YES / 10/25/2002 / YES / 10/25/2002	YE / 11/03/2005	YE / 11/03/2005	
MEAD STORAGE DEPOT	OHD043730209		1748 LANCASTER ROAD CHILLICOTHE, OH, 45601
HIGH / NO / / NO /	YE / 09/17/2004	YE / 06/26/2008	
MEADWESTVACO SOUTH CAROLINA, LLC	LAD010390599		400 CROSBY ROAD DERIDDER, LA, 70634
HIGH / YES / 02/14/2006 / YES / 02/14/2006	YE / 09/22/2000	YE / 09/22/2000	
MEDALLIC ART	CTD001265636		OLD RIDGEBURY RD DANBURY, CT, 06810
HIGH / NO / / NO /	YE / 02/09/2004	NO STATUS	

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
MEDORA LANDFILL CAMU	IND000772707		546 CR 870 W MEDORA, MEDORA, IN, 47260					
HIGH	YES	07/16/2007	NO		YE	08/18/2006	YE	08/18/2006
MERCK & CO INC	GAD003324985		3517 RADIUM SPRINGS ROAD ALBANY, GA, 31705					
MEDIUM	YES	04/10/2006	YES	04/10/2006	YE	10/07/1998	YE	10/07/1998
MERCK & CO INC	PAD002387926		770 SUMNEYTOWN PIKE WEST POINT, PA, 19486					
HIGH	YES	09/30/1994	YES	10/01/1998	YE	09/23/2002	YE	09/23/2002
MERCK & CO., INC.	NJD001317064		126 EAST LINCOLN AVE RAHWAY, NJ, 07065-090					
HIGH	NO		NO		YE	09/28/2005	NO STATUS	
MERCK & CO., INC.	VAD001705110		2778 SOUTH EAST SIDE HIGHWAY ELKTON, VA, 22827					
HIGH	YES	03/30/2001	NO		YE	09/26/2005	YE	09/15/2005
MERCK SHARP & DOHME QUIMICA DE P R LTD	PRD090028101		ROAD #2 KM 56.7 BO TRINIDAD BARCELONETA, PR, 00617					
MEDIUM	NO		NO		YE	09/13/2007	YE	09/26/2007
MERITOR HEAVY VEHICLE SYSTEMS	OHD004289450		444 HEBRON RD HEATH, OH, 430561440					
HIGH	YES	03/04/2003	YES	10/25/2007	YE	09/27/2005	YE	09/28/2004
METAL FINISHING TECHNOLOGIES, INC.	CTD001154558		60 WOOSTER COURT FORESTVILLE, CT, 06010					
HIGH	NO		NO		YE	05/24/2002	YE	09/04/2002
METALICO - COLLEGE GROVE INC	TND004048690		8430 HORTON HIGHWAY , COLLEGE GROVE, TN, 37046					
MEDIUM	YES	09/26/2007	YES	09/26/2007	YE	09/27/2006	YE	09/27/2006
METALLURG VANADIUM CORPORATION	OHD042319244		60790 SOUTHGATE ROAD CAMBRIDGE, OH, 43725					
HIGH	NO		NO		YE	11/08/2006	YE	11/17/2006
METALTEK INTERNATIONAL	TND071521884		4106 SOUTH CREEK ROAD CHATTANOOGA, TN, 37406					
HIGH	YES	09/29/1992	YES	09/29/1993	YE	02/03/1998	YE	09/26/2006
METALWORKING LUBRICANTS COMPANY	IND000646950		1509 S SENATE , INDIANAPOLIS, IN, 46225					
HIGH	YES	09/28/2007	NO		YE	09/02/2003	IN	08/28/1997
METHODE ELECTRONICS	NJD048608897		1 INDUSTRIAL PARK WILLINGBORO, NJ, 08046					
MEDIUM	NO		NO		YE	09/26/2008	NO STATUS	
MI DEPT/ENVIRONMENTAL QUALITY	MID072589328		2637 WILSON SW GRAND RAPIDS, MI, 49504					
HIGH	NO		NO		YE	04/25/2005	NO STATUS	
MI DEPT/ENVIRONMENTAL QUALITY	MID047153077		9899 EAST D AVE RICHLAND, MI, 49083					
HIGH	NO		NO		YE	07/14/2000	YE	06/12/2001
MI DEPT/NATURAL RESOURCES	MID980825632		1515 E ROBINSON LAKE RD ROSCOMMON, MI, 48653					
HIGH	YES	08/09/2000	YES	02/01/2002	YE	09/29/2000	YE	09/29/2000
MICHIGAN REUTILIZATION LLC	KSD087418695		1400 SOUTH M STREET , ARKANSAS CITY, KS, 67005					
HIGH	NO		NO		YE	01/08/2002	YE	09/20/2001
MICHIGAN SEAMLESS TUBE LLC	MID082767591		400 MCMUNN ST SOUTH LYON, MI, 48178					
HIGH	NO		NO		YE	09/09/2004	YE	09/30/2005
MICHIGAN STATE UNIVERSITY	MID053343976		3885 JOLLY RD EAST LANSING, MI, 48824					
HIGH	NO		YES	02/18/1993	YE	05/29/1998	YE	05/29/1998
MICRO CHEMICAL COMPANY, INC.	LAD008181927		3393 FRONT STREET , WINNSBORO, LA, 71295					
HIGH	NO		NO		YE	03/18/2000	NO	03/18/2000
MICROSEMI CONSORTIUM	COR000012443		802 HOYT ST BROOMFIELD, CO, 80020					
HIGH	YES	02/20/2004	YES	10/03/2005	YE	10/03/2005	YE	10/03/2005

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
MICROTECH INC	CTD054476973		1425 HIGHLAND AVE CHESHIRE, CT, 06410
HIGH / NO	NO	YE / 08/26/2002	IN / 08/26/2002
MIDWEST ENVIRONMENTAL SERVICES, INC.	KYD000821942		3601 PARKER AVE , LOUISVILLE, KY, 40212
MEDIUM / NO	NO	YE / 08/29/2008	YE / 08/29/2008
MILITARY OCEAN TERMINAL BAYONNE-FORMER	NJ0210022752		FOOT OF 32ND ST & ST HWY 169 (BAYONNE, NJ, 07002
HIGH / YES / 01/12/2006	YES / 05/24/2006	YE / 09/24/2003	YE / 08/07/2002
MILLENNIUM BUSINESS PARK	CTD051320372		699 MIDDLE ST MIDDLETOWN, CT, 06457
HIGH / NO	NO	YE / 09/02/2004	YE / 09/02/2004
MILLENNIUM PETROCHEMICALS INC	TXD058276130		1350 MILLER CUT OFF RD LA PORTE, TX, 77571
HIGH / YES / 02/28/2006	YES / 02/28/2006	YE / 01/31/2000	YE / 08/04/2003
MILLENNIUM RAIL INC	PAD990752321		BERWIND DR PO BOX 349, HOLLIDAYSBURG, PA, 16648
HIGH / NO	NO	YE / 10/02/2006	IN / 09/30/1999
MILLER SPRINGS REMEDIATION MGMT - GLENN	WVD005010277		301 W DUPONT AVE BELLE, WV, 25015
MEDIUM / NO	NO	YE / 04/17/2003	YE / 09/30/2005
MILLIKEN CHEMICAL DEWEY PLANT	SCD069314045		1440 CAMPTON RD INMAN, SC, 29349
HIGH / NO	NO	YE / 08/29/2002	YE / 11/03/2006
MINERAL KING MINERALS INC	CAD990769465		10585 INDUSTRY AVE HANFORD, CA, 93230
HIGH / NO	NO	NO / 03/26/1999	IN / 03/26/1999
MINOT AIR FORCE BASE	ND4571924758	US Air Force	5 CES/CEV 320 PEACEKEEPER PLACE , MINOT AFB, ND, 58705-5006
HIGH / YES / 02/09/2006	YES / 09/09/2008	YE / 04/27/1999	YE / 04/27/1999
MISSOURI PRESSED METALS INC	MOD073029936		1200 E BOONVILLE RD SEDALIA, MO, 65301
HIGH / YES / 09/28/1998	YES / 09/28/1998	YE / 08/13/2001	YE / 08/13/2001
MIXON BROTHERS WOOD PRESERVING INC	OKD007336258		HWY 70W 1M N IDABELL IDABEL, OK, 74745
HIGH / NO	NO	YE / 06/06/2001	YE / 06/06/2001
MODERN PLATING CORP	ILD005172325		701 S HANCOCK AVE P O BOX 838, FREEPORT, IL, 61032
HIGH / YES / 04/11/2000	YES / 03/20/2008	YE / 06/30/2001	YE / 06/22/2001
MODINE MFG CO	MOD062439351		221 SUNSET DR CAMDENTON, MO, 65020
HIGH / NO	NO	YE / 07/12/2004	YE / 09/30/2008
MOHEGAN TRIBAL GAMING AUTHORITY ENG DEPT	CTD001147875		1 MOHEGAN SUN BLVD UNCASVILLE, CT, 06382
HIGH / YES / 12/21/1994	YES / 06/02/1995	YE / 09/08/1999	YE / 09/08/1999
MOLYCORPWASHINGTON PLT	PAD030068282		CALDWELL AVE & GREEN ST CANTON TOWNSHIP, PA, 15301
HIGH / NO	NO	YE / 11/04/2003	IN / 08/17/2000
MONARCH TILE INC	TXD008041048		333 MARSHALL STREET MARSHALL, TX, 75670
HIGH / NO	NO	YE / 04/18/2005	IN / 04/18/2005
MONSANTO COMPANY	LAD001700756		12501 SOUTH RIVER ROAD LULING, LA, 70070
HIGH / YES / 02/26/2007	YES / 02/26/2007	YE / 03/30/2001	YE / 03/30/2001
MONTROSE CHEM CORP OF CA HENDERSON SITE	NVD008237489		8000 LAKE MEAD DR HENDERSON, NV, 89015
MEDIUM / NO	NO	NO STATUS	NO STATUS
MONTVILLE STATION	CTD049181654		74 LATHROP RD UNCASVILLE, CT, 06382
HIGH / NO	NO	YE / 03/21/2002	YE / 12/08/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
MOODY AIR FORCE BASE	GA0570024109	US Air Force	BEMISS ROAD MOODY AFB, GA, 31699
HIGH / NO	NO	YE / 11/02/2004	YE / 11/02/2004
MOOG COMPONENTS	NCD044438406		1995 HWY 141 MURPHY, NC, 28906
HIGH / NO	NO	YE / 09/30/1998	NO / 09/30/1998
MOORE OIL COMPANY INC	WID001779313		4033 W CUSTER AVE MILWAUKEE, WI, 53209
HIGH / NO	NO	YE / 09/11/2008	YE / 09/11/2008
MORGAN ADVANCED MATERIALS & TECHNOLOGY	PAD002103273		1118 E 2ND ST COUDERSPORT, PA, 16915
HIGH / YES / 09/12/2001	YES / 06/16/2006	YE / 04/22/2000	YE / 04/21/2000
MORTON INTERNATIONAL INC.,	MSD008186587		5724 ELDER FERRY ROAD MOSS POINT, MS, 39563
MEDIUM / NO	NO	YE / 09/30/2005	NO / 09/30/2005
MOTIVA - DELAWARE CITY REFINERY	DED002329738		4550 WRANGLE HILL ROAD DELAWARE CITY, DE, 19706
HIGH / NO	NO	YE / 02/25/2003	IN / 08/28/1996
MOTIVA ENTERPRISES LLC C/O GILBARCO VEED	TXD008097529		2100 HOUSTON AVENUE PORT ARTHUR, TX, 77640
HIGH / NO	NO	YE / 04/13/2004	YE / 04/13/2004
MOTIVA ENTERPRISES LLC C/O GILBARCO VEED	TXD980626022		E OF SPUR 136 GRIGSBY AVE & S PORT NECHES, TX, 77651
HIGH / NO	NO	YE / 12/01/2004	YE / 12/01/2004
MOTIVA ENTERPRISES LLC-NORCO	LAD008186579		15536 RIVER ROAD , NORCO, LA, 70079
HIGH / NO	NO	YE / 12/30/2002	YE / 12/30/2002
MOTIVA ENTERPRISES, LLC - FAIRFAX TERMIN	VAD093952935		3800 PICKETT RD FAIRFAX, VA, 22031
HIGH / YES / 02/12/1999	YES / 10/15/1999	YE / 11/05/1999	YE / 11/05/1999
MOTOROLA	FLD056921471		8000 W SUNRISE BLVD PLANTATION, FL, 333224104
HIGH / YES / 03/15/1996	YES / 02/04/1997	YE / 07/27/1999	YE / 07/27/1999
MOULTRIE BRIDGEPORT WWTP	GAD991275710		MOULTRIE INDUSTRIAL PK MOULTRIE, GA, 31768
HIGH / YES / 09/20/1995	NO	YE / 09/29/2000	YE / 10/22/1999
MOUNT JOY WIRE CORP	PAD003023371		1100 E MAIN ST MOUNT JOY, PA, 175529337
HIGH / NO	NO	YE / 03/31/2005	IN / 02/23/1999
MPM INC	WID988643169		509 S WISCONSIN AVE HWY 35 FREDERIC, WI, 54837
HIGH / YES / 03/29/2000	NO	YE / 12/10/1999	YE / 09/10/2002
MPM SILICONES LLC	WVD004325353		3500 SOUTH STATE ROUTE 2 FRIENDLY, WV, 26146
HIGH / YES / 09/20/2007	YES / 09/20/2007	YE / 08/23/2002	YE / 08/23/2002
MPM SILICONES LLC	NYD002080034		260 HUDSON RIVER RD WATERFORD, NY, 12188
HIGH / YES / 01/25/1993	NO	YE / 08/30/2001	YE / 09/17/2002
MRP PROPERTIES CO LLC	MID005358130		1780 E SUPERIOR ST ALMA, MI, 48801
HIGH / NO	NO	YE / 09/27/2004	YE / 09/16/2004
MT AIRY WOOD PRESERVING COMPANY INC	GAD041013657		1036 WELCOME HOME RD MT AIRY, GA, 39563
HIGH / NO	NO	YE / 09/15/1997	NO / 09/15/1997
MURPHY OIL USA	WID006194336		2400 STINSON AVE SUPERIOR, WI, 548800456
HIGH / NO	NO	NO STATUS	NO STATUS
MURPHY OIL USA, INC. MERAUX REFINERY	LAD008058471		2500 EAST ST. BERNARD HWY. MERAUX, LA, 70075
HIGH / NO	NO	YE / 06/28/2001	YE / 06/28/2001
MURRY CORPORATION OF MARYLAND	TXD053115978		2002 TILE FACTORY RD STE A PALESTINE, TX, 75801
MEDIUM / YES / 07/21/2006	YES / 07/21/2006	YE / 04/08/2004	YE / 04/05/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
N S I UNITED TECHNOLOGIES CORP	CTD089623318		NORDEN PL NORWALK, CT, 06855
NAS KEY WEST	FL6170022952	US Navy	US HIGHWAY 1, MILE MARKER 8 BLDG A4078, KEY WEST, FL, 33040
NASA - KENNEDY SPACE CENTER	FL6800014585	NASA	FLA HWY 3 KENNEDY SPACE CENTER, FL, 328991000
NASA JSC WHITE SANDS TEST FACILITY	NM8800019434	NASA	12600 NASA ROAD LAS CRUCES, NM, 88012
NASA PLUM BROOK STATION	OH3800015379	NASA	6100 COLUMBUS AVENUE SANDUSKY, OH, 44870
NASHUA LABEL CORPORATION	NED045275260		3838 S 108TH ST OMAHA, NE, 681444951
NATIONAL CHROMIUM CO INC	CTD001160811		SENEXET RD PUTNAM, CT, 06260
NATIONAL COPPER PRODUCTS INC	MID005068507		415 E PRAIRIE RONDE ST DOWAGIAC, MI, 49047
NATIONAL ELECTRICAL CARBON PRODUCTS INC	PAD059282459		100 STOKES AVE EAST STROUDSBURG, PA, 18301
NATIONAL FORGE CO	PAD002101418		1 FRONT ST IRVINE, PA, 163290258
NATIONAL GRID	NYD000730382		7TH NORTH SERVICE CNTR 7437 HENRY CLAY BLVD., LIVERPOOL, NY, 13088
NATIONAL NAVAL MEDICAL CENTER	MD4170024687	US Navy	8901 WISCONSIN AVE BETHESDA, MD, 20889-5600
NATIONAL STANDARD LLC	ALD054571278		104 INDUSTRIAL PARKWAY , COLUMBIANA, AL, 35051
NATIONAL STANDARD NILES CITY COMPLEX	MID005069257		601 N 8TH ST NILES, MI, 49120
NAVAJO REFINING COMPANY, LLP	NMD048918817		501 E MAIN ARTESIA, NM, 88210
NAVAL ACTIVITY PUERTO RICO	PR2170027203	US Navy	NAVAL STATION ROOSEVELT RD RTE 3, CEIBA, PR, 00735
NAVAL AIR STATION LEMOORE	CA3170024381	US Navy	700 AVENGER AVENUE LEMOORE, CA, 93246
NAVAL AIR STATION, NORTH ISLAND	CA7170090016	US Navy	BLDG 1606 SAN DIEGO, CA, 92135
NAVAL AIR WEAPONS STATION CHINA LAKE	CA2170023152	US Navy	1 ADMINISTRATION CIR CHINA LAKE, CA, 93555
NAVAL BASE VENTURA COUNTY PORT HUENEME	CA6170023323	US Navy	1000 23RD AVE PORT HUENEME, CA, 93043

NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
HIGH	NO		NO		YE	08/16/1999	YE	05/16/2007
HIGH	YES	05/06/1998	NO		YE	07/12/2000	YE	07/12/2000
HIGH	NO		NO		YE	08/19/2005	YE	08/22/2005
HIGH	NO		NO		YE	06/11/2001	NO	06/11/2001
HIGH	NO		NO		YE	09/29/2003	IN	04/29/1999
HIGH	YES	09/27/2007	YES	07/09/2008	YE	05/08/2003	YE	05/06/2003
HIGH	NO		NO		YE	12/22/1999	YE	12/22/1999
MEDIUM	NO		NO		YE	06/28/2007	YE	04/07/2008
HIGH	NO		NO		YE	11/03/1999	YE	11/03/1999
HIGH	NO		NO		YE	05/10/2002	YE	04/19/2004
HIGH	YES	07/15/1997	YES	12/22/1997	YE	02/16/2000	YE	02/16/2000
HIGH	NO		NO		YE	07/09/2004	YE	08/24/2004
MEDIUM	YES	05/26/2006	YES	11/13/2007	YE	09/11/2007	YE	09/11/2007
HIGH	NO		NO		YE	09/29/2003	YE	09/22/2004
HIGH	NO		NO		YE	06/27/2001	IN	02/13/1996
HIGH	NO		NO		YE	09/26/2003	YE	09/26/2003
HIGH	NO		NO		YE	06/16/2005	YE	04/11/2005
HIGH	NO		NO		YE	01/08/2003	NO	01/23/2001
HIGH	NO		NO		YE	08/13/2004	NO	03/09/2001
HIGH	NO		NO		YE	10/13/2004	YE	10/13/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
NAVAL FACILITIES ENGINEERING COMMAND MAR	GU5170022680	US Navy	BLDG 1790 CONNELEE LN SANTA RITA, GU, 96915
HIGH	NO		NO		YE	03/29/2002	YE	03/29/2002
NAVAL ORDNANCE STATION	KY5170024173	US Navy	180 ROCHESTER DR LOUISVILLE, KY, 402145001
LOW	YES	05/25/2005	YES	05/25/2005	YE	06/05/2001	YE	06/05/2001
NAVAL ST (32ND ST) NAVAL BASE SAN DIEGO	CA6170024289	US Navy	BLDG 3458, NAVAL STATION SAN DIEGO, CA, 92136
MEDIUM	NO		NO		YE	06/02/2004	YE	09/08/2003
NAVAL SUBMARINE BASE KINGS BAY	GA4170090001	US Navy	1063 USS TENNESSEE AVE KINGS BAY, GA, 31547
HIGH	NO		NO		YE	03/27/2003	YE	09/30/2002
NAVAL SUBMARINE BASE-POINT LOMA COMPLEX	CA1170090020	US Navy	140 SLYVESTER RD., BLDG 375 SAN DIEGO, CA, 92106
HIGH	NO		NO		YE	07/19/2004	YE	09/15/2005
NAVAL SUPPORT ACTIVITY MID-SOUTH	TN2170022600	US Navy	WILLIS GATE@ NAVY ROAD MILLINGTON, TN, 38054
HIGH	NO		NO		YE	09/20/2001	YE	09/12/2005
NAVAL SUPPORT ACTIVITY PANAMA CITY	FL8170023792	US Navy	101 VERNON AVE PANAMA CITY BEACH, FL, 32407
HIGH	NO		NO		YE	04/27/2004	YE	04/27/2004
NAVAL WEAPONS STATION CHARLESTON	SC8170022620	US Navy	2316 RED BANK RD STE 100 GOOSE CREEK, SC, 29445
HIGH	NO		NO		YE	09/30/1998	NO	09/30/1998
NAVAL WEAPONS STATION SEAL BEACH	CA0170024491	US Navy	800 SEAL BEACH BLVD SEAL BEACH, CA, 907405000
HIGH	NO		NO		YE	11/08/2004	YE	07/24/2008
NCR CORPORATION	OHD001876267		800 COCHRAN AVE CAMBRIDGE, OH, 43725
HIGH	YES	04/07/2008	NO		YE	05/25/2004	YE	04/16/2004
NCRA	KSD007145956		1391 IRON HORSE RD (B) , MCPHERSON, KS, 674601404
HIGH	NO		NO		YE	09/11/2002	YE	07/17/2002
NCTS SD DETACHMENT STOCKTON	CA2170024382	US Navy	305 FYFFE AVENUE STOCKTON, CA, 95203
HIGH	NO		NO		YE	11/26/2003	YE	11/26/2003
NEPERA, DIVISION RUTHERFORD CHEMICALS LL	NYD002014595		ARDEN HOUSE RD HARRIMAN, NY, 10926
HIGH	YES	03/30/1997	NO		YE	09/22/2005	YE	09/30/2004
NEVAMAR CO LLC	VAD044736213		721 WEST MAIN ST WAVERLY, VA, 23890
HIGH	NO		NO		YE	02/03/2003	YE	02/03/2003
NEVILLE CHEMICAL CO	PAD004334157		2800 NEVILLE RD PITTSBURGH, PA, 15222
HIGH	NO		NO		YE	06/29/2005	IN	06/29/2005
NEW HAVEN HARBOR STATION	CTD000844381		1 WATERFRONT ST NEW HAVEN, CT, 06512
HIGH	NO		NO		YE	10/16/1997	YE	10/16/1997
NEWARK	CAD074644659		8333 ENTERPRISE DR. NEWARK, CA, 94560
HIGH	YES	07/24/2007	NO		YE	12/28/2000	YE	07/24/2007
NEWPORT CHEMICAL DEPOT	IN1210022272	US Army	SR 63 N OF US 36 NEWPORT, IN, 47966
MEDIUM	NO		NO		YE	09/30/2003	YE	09/30/2003
NEWPORT HEALTH CENTER LLC	CAD057468944		500 SUPERIOR AVE NEWPORT BEACH, CA, 92663
MEDIUM	YES	09/07/2006	YES	03/25/2008	YE	09/23/2005	YE	12/07/2005

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NEWPORT NEWS SHIPBUILDING & DRY DOCK CO	VAD001307495		4101 WASHINGTON AVE NEWPORT NEWS, VA, 23607

NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
HIGH	NO		NO		YE	09/30/2005	IN	11/22/2002
NGK METALS CORP	PAD044540136		150 TUCKERTON RD READING, PA, 19612-3367					
HIGH	YES	06/29/1994	YES	03/07/2007	YE	08/22/2002	YE	08/22/2002
NIPSCO BAILLY GENERATING STATION	IND000718114		246 BAILLY STATION RD CHESTERTON, IN, 463049754					
HIGH	NO		NO		YE	11/27/2006	NO STATUS	
NORTH AMERICAN GALVANIZING CO	OHD981950207		1723 CLEVELAND AVE SW CANTON, OH, 44707					
HIGH	NO		NO		YE	09/13/2007	NO STATUS	
NORTH BRANCH CHICAGO RIV RESERVIOR 29A	IL0000060392		110 PFINGSTEN RD NORTHBROOK, IL, 60062					
HIGH	YES	08/27/1992	YES	07/14/1995	YE	08/27/2000	YE	08/27/2000
NORTHEAST ELECTRONICS CORP	CTD001176486		455 BIC DRIVE MILFORD, CT, 06460					
HIGH	NO		NO		NO STATUS		NO STATUS	
NORTHEAST ENVIRONMENTAL SERVICES	NYD057770109		CANAL RD. CANASTOTA, NY, 13032					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2004
NORTHEAST PAINT & VARNISH CO INC	PAD002262020		7914 BRISTOL PIKE LEVITTOWN, PA, 19059					
HIGH	YES	05/18/2006	YES	05/18/2006	YE	04/30/1999	YE	04/30/1999
NORTHLAND ENVIRONMENTAL INC.	RID040098352		275 ALLENS AVE PROVIDENCE, RI, 02905					
HIGH	NO		NO		YE	06/09/1997	YE	09/26/2000
NORTHROP GRUMMAN CORP	NYD002047967	US Navy	830 S OSTER BAY RD BETHPAGE, NY, 11714					
HIGH	NO		NO		NO STATUS		NO STATUS	
NORTHROP GRUMMAN CORP	FLD046771952		5000 US HIGHWAY 1 N ST AUGUSTINE, FL, 320956200					
HIGH	YES	08/19/1999	YES	09/20/2000	YE	08/18/1999	YE	08/18/1999
NORTHSHORE MINING COMPANY	MND006449649		10 OUTER DRIVE SILVER BAY, MN, 55614					
HIGH	YES	07/01/2004	NO		YE	03/14/2002	IN	09/30/1997
NORTHWEST AIRLINES INC	GAD097392971		1000 INNER LOOP ROAD , ATLANTA, GA, 30337					
LOW	NO		NO		IN	08/26/1997	IN	08/26/1997
NORTHWEST INDUSTRIES	ORD009020835		125 34TH AVE SW ALBANY, OR, 97322					
HIGH	YES	03/21/2003	YES	07/01/2005	YE	05/04/2001	YE	05/04/2001
NORTHWEST PETROCHEMICAL CORP	WAD009624347		9056 N TEXAS RD NW PETRO ANACORTES, WA, 98221					
HIGH	NO		NO		YE	08/02/2005	YE	08/28/2006
NOVARTIS PHARMACEUTICALS CORPORATION	NJD002147023		59 ROUTE 10 EAST HANOVER, NJ, 07936					
HIGH	NO		NO		YE	09/25/2000	YE	03/28/2003
NRG DEVON STATION	CTD000845248		700 NAUGATUCK AVENUE MILFORD, CT, 06460					
LOW	NO		NO		YE	03/18/2002	YE	09/29/2000
NRG MIDDLETOWN STATION	CTD000845230		1866 RIVER ROAD MIDDLETOWN, CT, 06457					
HIGH	NO		NO		YE	03/21/2002	YE	08/16/2001
NRG NORWALK HARBOR OP INC	CTD000845214		MANRESA ISLAND AVENUE SOUTH NORWALK, CT, 06854					
MEDIUM	NO		NO		YE	03/18/2002	YE	09/29/2000
NSC CREDITOR TRUST	IND016584641		6300 US HWY 12 , PORTAGE, IN, 46368					
MEDIUM	YES	05/19/2006	YES	05/19/2006	YE	02/11/2003	YE	09/24/1999
NUCLEAR FUEL SERVICES, INC.	TND003095635		1205 BANNER HILL ROAD ERWIN, TN, 37650					
HIGH	NO		NO		YE	09/11/1996	YE	09/17/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
NUCLEAR SOURCES AND SERVICES INC	TXD982560294		5709 ETHERIDGE ST HOUSTON, TX, 77087
HIGH / YES / 02/28/2006	YES / 02/28/2006	YE / 10/17/2000	YE / 10/17/2000
NUSTAR TERMINALS OPERATIONS PARTNERSHIP	TXD091936351		159 LEVEE RD TEXAS CITY, TX, 77590
HIGH / YES / 08/26/2008	YES / 08/26/2008	NO STATUS	NO STATUS
NWIRP CALVERTON	NYD003995198	US Navy	GRUMMAN BLVD CALVERTON, NY, 11933
HIGH / NO	NO	YE / 09/24/2004	YE / 09/30/2005
O & G INDUSTRIES INC	CTD001180587		325 HANCOCK AVE BRIDGEPORT, CT, 06605
HIGH / NO	NO	YE / 09/29/2005	NO STATUS
OCCIDENTAL CHEMICAL CORP	WAD009242314		605 ALEXANDER AVE TACOMA, WA, 984214209
HIGH / NO	NO	YE / 09/16/2005	NO / 09/02/2008
OCCIDENTAL CHEMICAL CORP	KSD007482029		6200 S RIDGE RD , WICHITA, KS, 67215
HIGH / NO	NO	YE / 07/17/2002	YE / 07/19/2004
OCCIDENTAL CHEMICAL CORP	MID006014906		7601 OLD CHANNEL TRAIL MONTAGUE, MI, 49437
HIGH / YES / 07/18/2001	NO	YE / 09/30/2003	YE / 02/24/2000
OCCIDENTAL CHEMICAL CORP	LAD092681824		8318 ASHLAND ROAD GEISMAR, LA, 70734
HIGH / NO	NO	YE / 03/09/2005	YE / 03/09/2005
OCCIDENTAL CHEMICAL CORP MUSCLE SHOALS	ALD004019642		1000 NORTH WILSON DAM ROAD MUSCLE SHOALS, AL, 356611300
LOW / NO	NO	YE / 12/03/2003	YE / 12/03/2003
OCCIDENTAL CHEMICAL CORP.	DED003913266		1657 RIVER ROAD NEW CASTLE, DE, 197205194
HIGH / NO	NO	YE / 09/19/2002	YE / 09/28/2005
OCCIDENTAL CHEMICAL CORPORATION	TXD007325111		8800 S CENTRAL EXPY DALLAS, TX, 75241
HIGH / NO	NO	YE / 04/06/2005	YE / 04/06/2005
OCCIDENTAL CHEMICAL CORPORATION	NYD000824482		4700 BUFFALO AVENUE NIAGARA FALLS, NY, 14302
HIGH / YES / 02/10/2000	YES / 05/22/2007	YE / 09/26/2001	YE / 09/27/2001
OCCIDENTAL CHEMICAL CORPORATION MOBILE P	ALD008163388		1300 JARVIS ROAD MOBILE, AL, 366141099
HIGH / NO	NO	YE / 09/30/1999	YE / 09/30/1999
OCEAN STATE STEEL INC	RID001546811		300 BOURNE AVE EAST PROVIDENCE, RI, 02914
HIGH / YES / 04/12/2004	YES / 05/22/2006	YE / 06/14/2007	YE / 06/14/2007
ODNR COWAN LAKE STATE PARK	OHD986967719		729 BEECHWOOD RD WILMINGTON, OH, 45177
HIGH / NO	NO	YE / 06/30/2006	YE / 07/14/2008
OFFUTT AFB	NE8571924648	US Air Force	106 PEACEKEEPER DR STE 2N3 55 CES/ CEV, OFFUTT AFB, NE, 681134019
HIGH / NO	NO	YE / 03/16/2004	YE / 08/20/2008
OLD PHILLIPS BUILDING	NMD000709782		9201 PAN AMERICAN FRWY. NE ALBUQUERQUE, NM, 87113
MEDIUM / YES / 04/12/2006	YES / 04/12/2006	YE / 03/20/2007	YE / 04/12/2006
OLIN BRASS & WINCHESTER INC	ILD006271696		427 N SHAMROCK ST EAST ALTON, IL, 620241197
MEDIUM / NO	NO	YE / 12/22/2000	YE / 08/25/2004
OLIN CHLOR ALKALI PRODUCTS	TND003337292		1186 LOWER RIVER ROAD N.W. CHARLESTON, TN, 37310
HIGH / YES / 04/04/2006	YES / 04/04/2006	YE / 09/29/1997	YE / 09/29/1997

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
OLIN CORP	LAD008080681		960 I10 & WESTLAKE EXIT WESTLAKE, LA, 70602
HIGH / NO	NO	YE / 06/17/2003	YE / 06/17/2003
OLIN CORP CHLOR ALKALI PRODUCT MCINTOSH	ALD008188708		1638 INDUSTRIAL ROAD , MCINTOSH, AL, 36553
HIGH / YES / 01/04/2000	YES / 01/04/2000	YE / 09/09/2003	YE / 09/04/2003
OLIN CORPORATION	GAD040690737		2402 DOUG BARNARD PARKWAY AUGUSTA, GA, 309062139
HIGH / NO	NO	YE / 06/14/1996	YE / 06/14/1996
OLIN CORPORATION	NYD002123461		2400 BUFFALO AVENUE NIAGARA FALLS, NY, 14302
HIGH / YES / 04/14/1997	YES / 01/16/2008	YE / 09/18/2000	YE / 09/18/2000
OLIN HUNT SPECIALTY PRODUCTS INC	CAD009552944		4265 CHARTER STREET LOS ANGELES, CA, 90058
HIGH / NO	NO	YE / 09/30/2005	YE / 09/25/2008
OMARK CARIBBEAN INC	PRD090038092		88-90 CALLE D MIN INDUSTRIAL PARK, BAYAMON, PR, 00619
HIGH / YES / 06/30/2006	YES / 06/30/2006	YE / 03/23/2006	YE / 04/12/2006
OMG AMERICAS INC	PAD014130439		240 TWO MILE RUN RD FRANKLIN, PA, 16323
HIGH / NO	NO	YE / 01/09/2003	YE / 09/22/2008
OMNIUM	MOD042865816		1417A LOWER LAKE RD ST JOSEPH, MO, 64504
HIGH / NO	NO	YE / 09/30/2008	IN / 09/30/2002
ORION REFINING CORP	LAD062644778		15272 RIVER RD , NORCO, LA, 70079
HIGH / NO	NO	YE / 06/30/2006	YE / 06/30/2006
ORTHO CLINICAL DIAGNOSTICS	NJD068715424		1001 ROUTE 202 RARITAN, NJ, 08869
HIGH / NO	NO	YE / 09/29/2006	YE / 09/25/2007
OSRAM SYLVANIA PROD	PAD980554570		816 LEXINGTON AVE PO BOX 129, WARREN, PA, 16365-2833
HIGH / NO	NO	YE / 08/10/2001	YE / 08/10/2001
OSRAM SYLVANIA PRODUCTS INC	PAD003046794		1 JACKSON ST WELLSBORO, PA, 16901-1717
HIGH / YES / 10/30/2003	NO	YE / 03/13/2001	YE / 03/13/2001
OSRAM SYLVANIA PRODUCTS INC	KYD068339217		1000 TYRONE PIKE , VERSAILLES, KY, 40383
MEDIUM / YES / 12/18/2007	NO	YE / 09/30/2003	YE / 09/30/2002
OUTLAYING LANDING FIELD, IB (NOLF)	CA4170023788	US Navy	REAM FIELD, 13TH STREET IMPERIAL STREET, CA, 93132
HIGH / NO	NO	YE / 07/14/2006	IN / 07/14/2006
OUTOKUMPU STAINLESS INC., PLATE PRODUCTS	IND093220861		549 W SR 38 NEW CASTLE, IN, 47362
HIGH / NO	NO	YE / 05/30/2007	YE / 05/30/2007
OUTOKUMPU STAINLESS PIPE INC	FLD064675978		1101 N MAIN ST WILDWOOD, FL, 347853432
HIGH / YES / 11/07/2000	YES / 06/21/2001	YE / 10/29/2001	YE / 09/20/2002
OWENS CORNING ANDERSON	SCD003349982		4837 HWY 81 S STARR, SC, 29684
HIGH / NO	NO	YE / 08/14/2002	YE / 08/25/2003
OWENS CORNING SCIENCE & TECHNOLOGY CENTE	OHD039992516		2790 COLUMBUS ROAD, ST. RT. 16 GRANVILLE, OH, 43023
HIGH / NO	NO	YE / 09/29/2004	YE / 09/29/2005
OWENSBORO RIVERPORT PROPERTIES INC	KYD062951801		4701 U.S. 60 EAST , OWENSBORO, KY, 42303
HIGH / NO	NO	YE / 08/19/1996	YE / 08/19/1996
OXYCHEM CORPORATION	TXD982286932		HIGHWAY 361 3 MI E OF GREGORY, TX, 78359
HIGH / YES / 10/01/2005	YES / 10/01/2005	YE / 05/29/2001	YE / 07/11/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date / Construction Completion / Date / HE Controlled / Date / GW Controlled / Date			
P & R RAIL CAR SERVICE CORPORATION	MDD078288354		TRINCO INDUSTRIAL PARK ELKTON, MD, 21921
HIGH / NO / / NO / / YE / 04/03/2003 / YE / 04/02/2008			
P H GLATFELTER CO SPRING GROVE FAC	PAD003003407		228 S MAIN ST SPRING GROVE, PA, 17362-1000
HIGH / NO / / NO / / YE / 04/02/2004 / NO STATUS			
P P G INDUSTRIES CARIBE	PRD000692715		RTE 2 GUAYANILLA, PR, 00656
MEDIUM / NO / / NO / / YE / 09/20/2005 / YE / 09/20/2005			
P R C PATTERSON INC	CAD083166728		13331 N HWY 33 PATTERSON, CA, 95363
HIGH / NO / / NO / / YE / 09/20/2001 / YE / 09/23/2008			
PA HOUSE	PAD003026762		137 N 10TH ST LEWISBURG, PA, 17837
HIGH / YES / 03/15/2000 / YES / 03/15/2000 / YE / 04/08/1999 / YE / 04/07/1999			
PACIFIC FUNCTIONAL FLUIDS LLC	WAD027543032		2244 PORT OF TACOMA RD TACOMA, WA, 984213607
HIGH / YES / 06/29/2007 / NO / / YE / 09/30/2005 / YE / 08/13/2003			
PACIFICORP	IDD000602631		2200 LESLIE AVE IDAHO FALLS, ID, 83402
HIGH / YES / 02/17/1988 / YES / 02/04/1992 / YE / 04/06/2001 / YE / 04/06/2001			
PACKAGING DIVISION INC	ILD005070545		400 N WOLF RD , NORTHLAKE, IL, 60164
HIGH / YES / 11/22/2005 / YES / 11/22/2005 / YE / 03/01/2006 / YE / 09/13/2006			
PACSCI QUANTIC L L C	CAD981368392		2751 SAN JUAN RD HOLLISTER, CA, 95023
HIGH / NO / / NO / / YE / 09/29/2004 / NO / 12/28/2000			
PAGE-TROWBRIDGE RANCH LANDFILL	AZD980665814		SEC 27-34 T9S R14E ORACLE, AZ, 85719
LOW / YES / 09/24/2008 / NO / / YE / 09/21/2006 / YE / 03/29/2007			
PANOCHE	CAD000060012		2251 LAKE HERMAN ROAD BENICIA, CA, 94510
HIGH / YES / 06/28/2001 / NO / / YE / 04/03/2000 / YE / 09/09/2002			
PARKER SOLVENTS COMPANY	ARD035565068		8909 MABLEVALE PIKE LITTLE ROCK, AR, 72209
HIGH / YES / 02/27/2007 / NO / / YE / 05/04/2005 / NO STATUS			
PASADENA REFINING SYSTEM INC	TXD008091290		111 RED BLUFF RD PASADENA, TX, 77506
HIGH / NO / / NO / / YE / 04/29/2004 / YE / 04/29/2004			
PATRICK AFB	FL2570024404	US Air Force	1224 JUPITER ST 45 CES/CEV, PATRICK AFB, FL, 329253343
HIGH / NO / / NO / / YE / 03/21/2002 / YE / 03/21/2002			
PCS NITROGEN FERTILIZER L.P.	GAD057281958		23 COLUMBIA NITROGEN ROAD AUGUSTA, GA, 30903
LOW / NO / / NO / / YE / 09/29/2006 / NO STATUS			
PCS PURIFIED PHOSPHATES	OHD071267090		PADDYS RUN RD NEAR RTE 128 HARRISON, OH, 45030
HIGH / NO / / NO / / YE / 09/26/2008 / NO STATUS			
PD GLYCOL LP	TXD020805446		3510 GULF STATES RD BEAUMONT, TX, 77701
HIGH / YES / 02/28/2006 / YES / 02/28/2006 / YE / 04/06/2005 / YE / 04/06/2005			
PDI MULTIFLEX DIV	MND000819292		5400 OPPORTUNITY CT , MINNETONKA, MN, 55343
MEDIUM / YES / 04/29/2008 / YES / 04/29/2008 / YE / 08/16/2006 / YE / 08/16/2006			
PECHINEY PLASTIC PACKAGING INC	IAD001818327		1500 E AURORA AVE DES MOINES, IA, 50313
MEDIUM / NO / / NO / / YE / 09/05/2002 / YE / 09/30/1999			
PECO ENERGY CO GOULD CHEMCLEAR	PAD000731026		JEFFREY ST & DELAWARE AVE CHESTER, PA, 19013
HIGH / NO / / NO / / YE / 04/16/1999 / YE / 04/16/1999			
PENDLETON WOOLEN MILLS	WAD009035502		A ST & 17TH ST WASHOUGAL, WA, 98671
HIGH / YES / 05/10/1995 / YES / 07/02/1997 / YE / 04/23/2001 / YE / 04/23/2001			

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
PENNZOIL QUAKER STATE CO	PAD004329835		260 ELM ST OIL CREEK, PA, 16301					
HIGH	NO		NO		YE	08/16/2004	YE	08/16/2004
PENRECO	PAD065626822		138 PETOLIA ST KARNS CITY, PA, 16041					
HIGH	NO		NO		YE	09/23/2002	YE	07/31/2008
PEPIN IRECO INC	MID041413154		9045 COUNTY ROAD 476 ISHPEMING, MI, 49849					
MEDIUM	NO		NO		YE	09/08/2008	NO STATUS	
PERFORMANCE FIBERS OPERATIONS INC	NCD041043811		7401 STATESVILLE BLVD SALISBURY, NC, 28147					
MEDIUM	YES	09/13/2000	YES	09/13/2000	YE	08/13/1998	YE	09/29/2000
PERGAN MARSHALL LLC	TXD049213127		710 BUSSEY RD MARSHALL, TX, 75670					
HIGH	YES	02/07/2006	YES	02/07/2006	YE	08/12/2003	YE	08/12/2003
PERMA FIX OF MICHIGAN INC	MID096963194		18550 ALLEN RD BROWNSTOWN TOWNSHIP, MI, 48193					
HIGH	NO		YES	01/13/2006	YE	03/24/2004	YE	09/24/2003
PERMA FIX OF SOUTH GEORGIA INC	GAD093380814		1612 JAMES P RODGERS CIRCLE VALDOSTA, GA, 31601					
MEDIUM	NO		NO		YE	09/15/2003	YE	04/13/2004
PERMA-FIX ENVIRONMENTAL SERVICES, INC.	TND991279480		901 EAST BODLEY AVE MEMPHIS, TN, 38106					
HIGH	NO		NO		YE	09/24/1996	YE	09/19/2001
PERMAPOST PRODUCTS COMPANY INC	ORD009041187		4066 SE TUALATIN VALLEY HWY HILLSBORO, OR, 97123-0100					
HIGH	NO		NO		YE	04/19/2005	YE	08/18/2004
PETROWAX PA INC EMLENTON PLANT	PAD004337127		HILL ST EMLENTON, PA, 16373					
HIGH	NO		NO		YE	08/20/2002	YE	08/20/2002
PFISTER CHEMICAL, INC.	NJD001293216		LINDEN AVENUE RIDGEFIELD, NJ, 07657					
HIGH	NO		NO		NO STATUS		NO STATUS	
PFIZER PHARMACEUTICALS LLC	PRD090346909		RD. # 2, KM. 58.2 BARCELONETA, PR, 00617					
MEDIUM	NO		NO		YE	09/28/2007	YE	09/30/2008
PFIZER PHARMACEUTICALS LLC ARECIBO	PRD090398074		ROAD NO. 2 KM 60.0 ARECIBO, PR, 00612					
HIGH	YES	09/06/2007	YES	09/06/2007	YE	09/29/2000	YE	09/30/1999
PHARMACIA & UPJOHN CO LLC	CTD001168533		41 STILES LANE NORTH HAVEN, CT, 06473					
HIGH	NO		NO		YE	08/25/1999	YE	09/21/1999
PHARMACIA & UPJOHN CO LLC	CTD000635896		410 SACKETT POINT RD NORTH HAVEN, CT, 06473					
HIGH	NO		NO		YE	09/26/1995	YE	09/23/1999
PHARMACIA & UPJOHN COMPANY LLC	MID000820381		7171 PORTAGE RD PORTAGE, MI, 49001					
HIGH	YES	03/30/2001	YES	03/30/2001	YE	03/29/2001	YE	03/29/2001
PHELPS DODGE EL PASO OPERATIONS	TXD048924989		897 HAWKINS BLVD EL PASO, TX, 79915					
HIGH	YES	01/10/2006	YES	01/10/2006	YE	01/19/2006	YE	01/19/2006
PHIBRO TECH INC	SCD070371885		2395 CAINS MILL RD SUMTER, SC, 29151					
HIGH	NO		NO		YE	09/07/2001	YE	07/29/2004
PHIBRO-TECH INC	ILD062480850		10 INDUSTRY AVE JOLIET, IL, 60435					
HIGH	YES	01/07/2008	NO		YE	08/12/2004	YE	06/13/2003
PHIBRO-TECH INC	GAD981027055		4080 INDUSTRY ROAD POWDER SPRINGS, GA, 30127					
MEDIUM	YES	09/20/1990	NO		YE	03/01/2007	NO	09/23/1996
PHIBRO-TECH, INC.	CAD008488025		8851 DICE ROAD SANTA FE SPRINGS, CA, 90670					
HIGH	YES	08/02/1995	NO		YE	03/29/2002	YE	09/04/2008

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
PHILIPS DISPLAY COMPONENTS FORMER	NYD002246015		50 JOHNSTON ST SENECA FALLS, NY, 13148					
HIGH	NO		NO		YE	09/30/2005	YE	09/30/2003
PHILIPS LIGHTING COMPANY	KYD006395644		320 VAKSDAHL AVE , DANVILLE, KY, 40422					
HIGH	YES	09/17/1999	NO		YE	01/20/2005	NO	08/13/1998
PHILIPS SEMICONDUCTORS	CAD070466479		811 E ARQUES AVE MAIL STOP 39 SUNNYVALE, CA, 940883409					
HIGH	YES	06/19/1991	YES	09/14/1992	YE	09/27/2005	YE	12/28/2000
PHILLIPS PETROLEUM COMPANY	TXD091263558		300 W 6TH ST BORGER, TX, 79008					
HIGH	YES	08/21/2008	NO		YE	07/30/2004	YE	07/30/2004
PHILLIPS PETROLEUM KC	KSD007162100		2029 FAIRFAX TRFWY KANSAS CITY, KS, 66115					
HIGH	NO		NO		YE	08/27/2002	YE	08/27/2002
PIERCE BIOTECHNOLOGY INC	ILD041539230		3747 N MERIDIAN RD ROCKFORD, IL, 61105					
HIGH	YES	09/13/2002	YES	05/19/2003	YE	05/21/2002	YE	09/17/2001
PINE BLUFF ARSENAL	AR0213820707	US Army	10020 KABRICH CIRCLE PINE BLUFF, AR, 71602					
HIGH	NO		NO		YE	09/29/2003	YE	09/27/2004
PINE HILLS ROAD LANDFILL	FLD984178095		5103 N PINE HILLS RD ORLANDO, FL, 32809					
HIGH	NO		NO		YE	09/22/2005	NO	10/01/1998
PINE-BELT WOOD PRESERVING COMPANY	MSD991277195		HIGHWAY 15 SOUTH, I-59 LAUREL, MS, 39440					
HIGH	YES	10/11/2007	YES	10/11/2007	YE	09/29/2000	YE	09/23/2004
PINEWOOD SITE PS	SCD070375985		8430 CAMP MACBOYKIN RD PINEWOOD, SC, 29125					
HIGH	YES	09/28/2006	YES	05/21/2007	YE	09/08/1997	YE	09/08/1997
PIONEER AMERICAS L L C DBA OLIN CHLOR AL	NVD062081500		8000 LAKE MEAD PKWY , HENDERSON, NV, 89015					
MEDIUM	NO		NO		NO STATUS		NO STATUS	
PIONEER PLASTICS CORPORATION	MED040228983		1 PIONITE ROAD AUBURN, ME, 04210					
MEDIUM	NO		NO		NO STATUS		NO STATUS	
PITTSBURG POWER PLANT	CAT080011695		696 WEST TENTH STREET PITTSBURG, CA, 94565					
HIGH	NO		NO		YE	04/17/2000	YE	04/17/2000
PLAINVILLE PLATING CO INC	CTD001149459		21 FORESTVILLE AVENUE PLAINVILLE, CT, 06062					
HIGH	NO		NO		YE	09/22/2003	YE	09/28/2004
PLM PROPERTIES LLC	OHD097537609		2941 BAKER RD SPRINGFIELD, OH, 45504					
HIGH	NO		NO		YE	05/30/2001	YE	05/30/2001
PNM PERSON GENERATING STATION	NMT360010342		BROADWAY SE & RIO BRAVO RD ALBUQUERQUE, NM, 87105					
MEDIUM	YES	04/12/2006	YES	04/12/2006	YE	04/12/2006	YE	04/12/2006
POLYONE CORPORATION	NJD043973122		1804 RIVER RD BURLINGTON, NJ, 08016					
HIGH	YES	10/01/2003	NO		YE	05/10/2002	YE	05/10/2002
POLYONE CORPORATION AND GOODRICH CORPORA	KYD006370167		2468 INDUSTRIAL RD , CALVERT CITY, KY, 42029					
HIGH	NO		NO		YE	09/29/1995	YE	09/29/1995
PORTSMOUTH GASEOUS DIFFUSION PLANT	OH7890008983	Dept. of Energy	3930 US ROUTE 23 SOUTH PIKETON, OH, 45661					
HIGH	NO		NO		IN	08/28/1997	IN	08/28/1997
POWER ENGINEERING COMPANY	COD007060999		2525 S DELAWARE ST , DENVER, CO, 802234400					
HIGH	YES	03/12/2001	YES	12/04/2003	YE	06/12/2000	YE	10/26/2000
POWER SEMICONDUCTORS INC	CTD002593416		90 MUNSON ST MILFORD, CT, 06460					
HIGH	NO		NO		NO	10/02/1996	NO	10/04/2005

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
PPG IND INC COATINGS & RESINS	PAD004336319		151 COLFAX ST SPRINGDALE, PA, 15144-1506					
HIGH	YES	12/28/2000	YES	12/28/2000	YE	09/21/2000	YE	09/21/2000
PPG INDUSTRIES INC	WID059972935		10800 S 13TH ST OAK CREEK, WI, 53154					
HIGH	NO		NO		YE	01/20/2000	YE	01/20/2000
PPG INDUSTRIES INC	MID048788749		961 DIVISION ST ADRIAN, MI, 49221					
HIGH	NO		NO		YE	09/27/2007	YE	03/10/2008
PPG INDUSTRIES INC	OHD004198917		4829 FAIRLAND ROAD BARBERTON, OH, 442033913					
HIGH	NO		NO		YE	12/20/2001	YE	01/22/2007
PPG INDUSTRIES INC	LAD008086506		1300 PPG DR WESTLAKE, LA, 70669					
HIGH	NO		NO		YE	06/30/2004	YE	06/25/2004
PPG INDUSTRIES NO 5 INCINERATOR	LAD981514441		1300 COLUMBIA SO RD WESTLAKE, LA, 70669					
HIGH	YES	12/20/2005	YES	12/20/2005	YE	06/12/2000	YE	06/12/2000
PPG INDUSTRIES OHIO INC	OHD004304689		559 PITTSBURGH ROAD CIRCLEVILLE, OH, 43113					
HIGH	NO		NO		YE	09/27/2002	YE	08/15/2008
PPG INDUSTRIES, INC.	WVD004336343		SR 2, MARSHALL COUNTY (SOUTH) NEW MARTINSVILLE, WV, 26155					
HIGH	NO		NO		YE	09/26/2000	YE	08/31/2000
PPG SPRINGDALE R & D CTR	PAD000650366		151 COLFAX ST SPRINGDALE, PA, 15144-1506					
HIGH	YES	07/13/2000	YES	07/13/2000	YE	02/17/2000	YE	02/17/2000
PPL MARTINS CREEK LLC	PAD987393212		6605 FOUL RIFT RD BANGOR, PA, 18013					
HIGH	YES	09/04/2001	YES	09/04/2001	YE	09/22/2000	YE	09/22/2000
PRATT & WHITNEY	CTD990672081		400 MAIN STREET EAST HARTFORD, CT, 06108					
MEDIUM	NO		NO		YE	02/22/2005	NO STATUS	
PRATT & WHITNEY	MED000791681		113 WELLS STREET NORTH BERWICK, ME, 03906					
MEDIUM	NO		NO		YE	01/29/2008	NO STATUS	
PRATT & WHITNEY	CTD000844399		100 COLT STREET EAST HARTFORD, CT, 06108					
HIGH	NO		NO		YE	11/10/1999	YE	11/10/1999
PRATT & WHITNEY AIRCRAFT DIV U T C	CTD001449511		415 WASHINGTON AVE , NORTH HAVEN, CT, 06473					
HIGH	NO		NO		YE	05/29/2002	YE	05/29/2002
PRATT & WHITNEY CPD	CTD000844332		45 NEWELL ST , SOUTHINGTON, CT, 06489					
HIGH	YES	11/30/2000	YES	01/16/2002	YE	09/15/2003	IN	01/09/2002
PRATT & WHITNEY ROCKY HILL	CTD000844407		60 BELAMOSE AVE ROCKY HILL, CT, 06067					
HIGH	NO		NO		YE	09/11/2000	YE	09/11/2000
PRECISION FABRICATING & CLEANING COMPANY	FLD981471121		3975 E RAILROAD AVE COCOA, FL, 329265975					
HIGH	YES	09/30/1996	NO		YE	09/18/2002	YE	09/18/2002
PRIDE REFINING INC	TXD005964598		1209 N 4TH ST ABILENE, TX, 79601					
HIGH	YES	02/28/2006	YES	02/28/2006	YE	05/25/2004	YE	05/25/2004
PRIDE SOLVENTS & CHEMICAL CO INC	NYD057722258		88 LAMAR ST WEST BABYLON, NY, 11704					
MEDIUM	NO		NO		NO STATUS		NO STATUS	
PRINCETON TECHNOLOGY CTR - FORMER IBM	NJD002177210		CULVER RD DAYTON, NJ, 08810					
HIGH	NO		NO		YE	09/25/2006	YE	09/26/2008
PROTEX INDUSTRIES INC	COD007091200		1331 W EVANS AVE DENVER, CO, 80223					
HIGH	YES	04/27/1992	YES	03/10/1998	YE	06/14/2000	YE	06/14/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date / Construction Completion / Date / HE Controlled / Date / GW Controlled / Date			
PRYM WILLIAM INC	CTD001140920		HARTFORD PIKE DAYVILLE, CT, 06241
HIGH / NO / / NO / / YE / 09/20/1999 / YE / 09/29/1999			
PTO - UCC - DOW	WVD000739722		31350 1ST AVENUE S NITRO, WV, 25143
HIGH / NO / / NO / / YE / 09/19/2002 / YE / 08/25/2005			
PUEBLO CHEMICAL DEPOT	CO8213820725	US Army	45825 HWY 96 E , PUEBLO, CO, 810069330
HIGH / NO / / NO / / NO / 09/21/1998 / YE / 09/25/2002			
PURDUE UNIVERSITY	IND072051394		201 AHLERS DR WEST LAFAYETTE, IN, 47906
HIGH / YES / 06/19/1995 / YES / 04/09/1999 / YE / 07/12/1999 / YE / 07/12/1999			
PUTNAM TOWN OF MUNICIPAL LANDFILL	CTD991288622		RIVER RD PUTNAM, CT, 06260
HIGH / NO / / NO / / YE / 09/05/2001 / YE / 09/04/2001			
QUALITY TECHNOLOGIES CORP.	CAD095984167		3400 HILLVIEW AVE PALO ALTO, CA, 94304
MEDIUM / YES / 06/04/1993 / YES / 04/29/1996 / YE / 08/11/2000 / YE / 08/11/2000			
QUEBECOR PRINTING ATGLEN INC	PAD051397768		4581 LOWER VALLEY RD PO BOX 465, ATGLEN, PA, 19310-0465
HIGH / YES / 06/13/1997 / YES / 02/17/2000 / YE / 02/17/2000 / YE / 02/17/2000			
QUEMETCO INC	IND000199653		7870 W MORRIS ST INDIANAPOLIS, IN, 46231
MEDIUM / NO / / NO / / YE / 03/30/2005 / YE / 04/05/2005			
QUEMETCO, INC.	CAD066233966		720 S. 7TH AVENUE CITY OF INDUSTRY, CA, 91746
HIGH / NO / / NO / / YE / 09/23/2004 / YE / 06/09/2005			
R AND D CHEMICAL CO	OHD080930050		TWP RD 235 MANSFIELD, OH, 44904
HIGH / YES / 03/09/2004 / YES / 03/09/2004 / YE / 12/17/2001 / YE / 12/17/2001			
R STRESAU LABORATORY INC	WID020488011		N8265 MEDLEY RD , SPOONER, WI, 54801
MEDIUM / YES / 01/22/1997 / YES / 10/15/1997 / YE / 10/15/1997 / YE / 10/15/1997			
R V HOPKINS INC	IAD022096028		743 SCHMIDT RD DAVENPORT, IA, 52802
HIGH / NO / / NO / / YE / 07/10/2003 / YE / 09/20/2005			
RADIATOR SPECIALTY COMPANY	NCD091245969		600 RADIATOR ROAD INDIAN TRAIL, NC, 28079
HIGH / YES / 09/14/2007 / YES / 09/14/2007 / YE / 04/26/2005 / YE / 04/26/2005			
RADIO MATERIALS CORP	IND005477021		1095 E SUMMIT ATTICA, IN, 47918
HIGH / NO / / NO / / YE / 09/29/2005 / NO STATUS			
RAILWAY MAINT PRODUCTS DIV	PAD004336814		900 FREEPORT ROAD ASPINWALL, PA, 15215
HIGH / NO / / NO / / YE / 04/30/2002 / YE / 06/20/2003			
RAMP INDUSTRIES INC	COD980718985		1127 W 46TH AVE DENVER, CO, 802112302
HIGH / YES / 09/10/1999 / YES / 09/10/1999 / YE / 09/10/1999 / YE / 09/10/1999			
RAYBESTOS PRODUCTS CO	IND006061477		1204 DARLINGTON AVE , CRAWFORDSVILLE, IN, 47933
LOW / NO / / NO / / YE / 04/29/2005 / NO STATUS			
RAYTHEON AIRCRAFT COMPANY - BOULDER	COD007068646		6859 N FOOTHILLS HWY , BOULDER, CO, 80302
HIGH / YES / 09/30/2008 / NO / / YE / 09/28/2000 / YE / 09/19/2007			
RAYTHEON EW OPERATIONS	CAD001425206		6380 HOLLISTER AVENUE GOLETA, CA, 93117
HIGH / NO / / NO / / YE / 09/23/2003 / YE / 09/23/2003			
RCL WIRING LP	MOD095046306		601 S MARSHALL SEDALIA, MO, 65301
HIGH / YES / 08/27/2008 / YES / 09/24/2008 / YE / 06/30/2005 / YE / 09/17/2001			
REA MAGNET WIRE CO	IND004320032		3600 E PONTIAC ST FT WAYNE, IN, 46803
MEDIUM / YES / 09/15/2005 / YES / 01/26/2007 / YE / 09/06/2001 / YE / 09/10/2001			

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
REALCO INC	NYD060545209	LINCOLN AVE - PO BOX 212 WATERVLIET, NY, 121890212						
HIGH	NO		NO		YE	06/18/2001	YE	09/22/2005
RECLAIMERS INC	IND984894527	6928 N 400 E BLDG 102 KENDALLVILLE, IN, 46755						
HIGH	YES	08/11/2008	NO		YE	11/12/1999	YE	06/17/2004
REFINED METAL SITE	FLD080677347	2640 CAPITOLA STREET JACKSONVILLE, FL, 32209						
HIGH	YES	04/28/2004	YES	06/04/2004	YE	09/02/2003	YE	09/02/2003
REFINED METALS CORP	IND000718130	3700 S ARLINGTON AVE , INDIANAPOLIS, IN, 46203						
MEDIUM	NO		NO		YE	10/11/2002	YE	03/31/2004
REFINED METALS CORPORATION	TND067690040	257 WEST MALLORY AVENUE MEMPHIS, TN, 38109						
HIGH	NO		NO		YE	09/29/2003	YE	09/19/2001
REICHHOLD INC	MID020087128	601 WOODWARD HTS BLVD FERNDALE, MI, 48220						
HIGH	NO		NO		YE	05/28/1998	YE	04/24/1998
REICHHOLD, INC.	MSD001661719	11015 REICHHOLD ROAD GULFPORT, MS, 39506						
HIGH	NO		NO		YE	11/08/2001	YE	11/08/2001
RELIABLE ELECTRO PLATING INC	MAD001209121	304 WEST MAIN ST NORTON, MA, 02712						
HIGH	NO		NO		YE	04/09/1998	YE	08/24/2000
RELIANCE TECHNICAL SVCS	CAD001938828	895 KIFER RD SUNNYVALE, CA, 94086						
MEDIUM	NO		NO		YE	09/19/2002	YE	09/19/2002
REMELT METALS INC	COD040708455	2350 S RARITAN ENGLEWOOD, CO, 801101073						
HIGH	YES	09/12/2006	YES	09/12/2006	YE	07/16/2001	YE	09/30/2002
REMINGTON ARMS COMPANY INC	AR0000064311	2592 AR HWY 15 N LONOKE, AR, 72086						
HIGH	YES	07/31/2003	YES	09/15/2004	YE	09/26/2002	YE	09/30/2002
RENTOKIL INITIAL ENVIRONMENTAL SERVICES	ALD021257951	10565 HIGHWAY 43 CREOLA, AL, 365254550						
HIGH	YES	12/18/1997	YES	12/18/1997	YE	09/28/2001	YE	09/28/2001
REPUBLIC ENV SYSTEMS (PA) INC	PAD085690592	SANDSTONE DR HATFIELD, PA, 19440						
HIGH	YES	07/26/1999	YES	07/26/1999	YE	07/12/2002	YE	07/15/2002
REPUBLIC ENVIRONMENTAL SYSTEMS	OHD055522429	33 INDUSTRY DR BEDFORD, OH, 44146						
HIGH	NO		NO		YE	06/25/2002	IN	08/28/1997
RESERVE ENVIRONMENTAL SERVICES INC	OHD980793384	4633 MIDDLE ROAD ASHTABULA, OH, 44004						
HIGH	YES	03/10/2005	NO		YE	09/16/2005	IN	08/28/1997
RESOURCE RECOVERY OF AMERICA	FLD980602734	2300 US HWY 60 W MULBERRY, FL, 33860						
HIGH	YES	09/02/2005	YES	09/02/2005	YE	03/28/2002	YE	06/01/2006
REVERE SMELTING & REFINING CORP.	NYD030485288	65 BALLARD RD MIDDLETOWN, NY, 10941						
HIGH	NO		NO		YE	09/30/2004	NO STATUS	
REVLON CONSUMER PRODUCTS CORP.	NJD002520542	2121 ROUTE 27 EDISON, NJ, 08818-403						
HIGH	YES	04/19/2007	YES	04/19/2007	YE	10/16/2000	YE	09/30/2004
REYNOLDS METALS CO.	NYD002245967	COUTY ROUTE 45 MASSENA, NY, 13662						
HIGH	YES	01/30/1992	YES	12/30/1996	YE	09/28/2001	YE	05/17/2001
REYNOLDS METALS COMPANY	ARD006354161	500 EAST REYNOLDS ROAD ARKADELPHIA, AR, 71923						
HIGH	YES	06/21/2004	YES	06/21/2004	YE	08/01/2002	YE	08/01/2002
RHO CHEM LLC	CAD008364432	425 ISIS AVE INGLEWOOD, CA, 90301						
HIGH	NO		NO		YE	12/27/2005	NO	05/08/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
RHODIA INC	PAD002336410		2300 S PENNSYLVANIA AVE MORRISVILLE, PA, 19067-2504
HIGH / NO	NO	YE / 09/30/2004	IN / 04/17/2002
RHODIA INC	SCD003358389		2151 KING ST EXTENSION CHARLESTON, SC, 29415
HIGH / NO	NO	YE / 09/11/2001	YE / 09/18/2002
RHODIA INC	IND001859032		2000 MICHIGAN ST , HAMMOND, IN, 46320
MEDIUM / NO	NO	YE / 08/07/2002	YE / 08/07/2002
RHODIA INC SILVER BOW PLANT	MTD057558546		119130 GERMAN GULCH RD - NEAR RAMSAY/ BUTTE, BUTTE, MT, 597509732
HIGH / NO	NO	YE / 03/04/2008	IN / 05/09/2006
RHODIA INC.	CAD053049490		100 MOCOCO ROAD MARTINEZ, CA, 94553
HIGH / NO	NO	YE / 12/28/2000	YE / 12/28/2000
RICHLAND COUNTY LANDFILL	OHD000384248		536 CAIRNS RD MANSFIELD, OH, 44903
HIGH / NO	NO	YE / 09/30/2003	NO STATUS
RICHMOND LINER FNDRY PRFCT CIR DIV DANA	IND003935236		2153 WILLIAMSBURG PIKE , RICHMOND, IN, 47374
HIGH / NO	NO	YE / 09/26/2007	YE / 09/29/2008
RINCHEM COMPANY INC	NMD002208627		6133 EDITH BLVD NE ALBUQUERQUE, NM, 87107
LOW / YES / 03/10/2006	YES / 03/10/2006	YE / 03/10/2006	YE / 03/10/2006
RISDON AMS CORP	CTD001168558		15 OLD NEWTOWN ROAD DANBURY, CT, 06810
HIGH / NO	NO	YE / 11/26/2003	YE / 09/22/2008
RIVER CEMENT CO SELMA PLANT	MOD050232560		1000 RIVER CEMENT RD SELMA PLANT, FESTUS, MO, 63028
HIGH / NO	NO	YE / 09/30/2005	YE / 09/30/2005
RIVER RECYCLING INDUSTRIES INC	OHD004187035		4195 BRADLEY RD CLEVELAND, OH, 44109
HIGH / NO	NO	YE / 03/05/2002	YE / 03/05/2002
RMI TITANIUM CO EXTRUSION PLANT	OHD980683544		1601 E 21ST ST ASHTABULA, OH, 44004
HIGH / YES / 07/12/2006	YES / 11/27/2006	YE / 04/06/2001	YE / 09/25/2003
RMI TITANIUM CO FORMER SODIUM PLT	OHD000810242		600 STATE RD ASHTABULA, OH, 44004
HIGH / NO	NO	YE / 03/09/2001	YE / 02/07/2000
ROBERT SHAW CONTROLS CO	CTD075397943		155 HILL ST , MILFORD, CT, 06460
MEDIUM / YES / 02/12/2007	NO	YE / 09/26/2008	NO STATUS
ROCK ISLAND ARSENAL	IL5210021833 US Army		1 RODMAN AVE ROCK ISLAND, IL, 612995000
HIGH / NO	NO	YE / 05/21/2007	NO STATUS
ROCKFORD POWER MACHINERY	ILD001756675		2401 11TH ST ROCKFORD, IL, 611047289
HIGH / NO	NO	YE / 11/22/1999	YE / 05/15/2000
ROCKWOOD PIGMENTS N A INC	PAD002391548		1525 WOOD ST EASTON, PA, 18042-1497
HIGH / NO	NO	YE / 09/30/2003	NO STATUS
ROCKWOOL PLANT - PUEBLO	COD073405961		600 OLD SMELTER RD PUEBLO, CO, 810033341
HIGH / YES / 12/16/2002	YES / 12/16/2002	YE / 10/27/1999	YE / 10/27/1999
ROCKY FLATS ENV TECH SITE-US DOE	CO7890010526 Dept. of Energy		10808 HWY 93 16 MILES NW OF DENVE R, GOLDEN, CO, 80403
HIGH / YES / 03/12/1997	YES / 03/14/2007	YE / 09/22/1998	YE / 09/22/1998
ROCKY MOUNTAIN ARSENAL - ARMY	CO5210020769 US Army		U S ARMY- 72ND AVE & QUEBEC ST , COMMERCE CITY, CO, 80022
HIGH / YES / 06/11/1996	NO	YE / 05/23/2000	YE / 06/06/2000
ROCKY MOUNTAIN STEEL MILLS	COD007057961		2100 S FREEWAY , PUEBLO, CO, 81004
HIGH / NO	NO	YE / 09/26/2003	YE / 10/12/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
ROEBUCK DISPOSAL LLC	SCD981467616		301 RAILROAD STREET ROEBUCK, SC, 29376					
HIGH	YES	09/30/2008	NO		YE	08/13/1996	YE	08/13/1996
ROGER CORP ELASTOMER COMPONENT	CTD018884833		730 WINDHAM ROAD SOUTH WINDHAM, CT, 06266					
HIGH	NO		NO		YE	04/21/2004	YE	04/21/2004
ROGERS CORP	CTD001141167		1 TECHNOLOGY DR ROGERS, CT, 06263					
HIGH	NO		NO		YE	04/21/2004	YE	04/21/2004
ROGERS DELINTED COTTONSEED CO	TXD980873160		US HIGHWAY 77 ROBSTOWN, TX, 78380					
HIGH	NO		NO		YE	04/18/2005	IN	04/18/2005
ROHM & HAAS CHEMICALS	PAD002292068		200 ROUTE 413 BRISTOL, PA, 19007					
HIGH	NO		NO		YE	09/30/2005	IN	08/09/1995
ROHM AND HAAS CHEMICALS LLC	OHD045566098		10 S ELECTRIC STREET WEST ALEXANDRIA, OH, 45381					
HIGH	YES	08/01/2003	YES	08/01/2003	YE	11/09/2000	YE	11/15/2000
ROHM AND HAAS CHEMICALS LLC	PAD077883346		5000 RICHMOND ST PHILADELPHIA, PA, 19477-0904					
HIGH	NO		NO		YE	06/07/2005	NO STATUS	
ROHM AND HAAS CHEMICALS LLC	OHD000724138		2000 WEST STREET CINCINNATI, OH, 452153431					
HIGH	NO		NO		YE	09/30/2003	YE	09/30/2003
ROHM AND HAAS COMPANY	PAD075485995		727 NORRISTOWN RD SPRING HOUSE, PA, 19477					
HIGH	NO		YES	11/16/1994	YE	09/25/2002	YE	09/26/2002
ROHM AND HAAS COMPANY	TND058660390		730 DALE AVENUE KNOXVILLE, TN, 37921					
HIGH	NO		NO		YE	08/23/2000	YE	08/23/2000
ROHM AND HAAS LOUISVILLE PLANT	KYD006390017		4300 CAMPGROUND RD , LOUISVILLE, KY, 40216					
MEDIUM	NO		NO		YE	03/27/1996	YE	09/18/2008
ROHM AND HAAS TEXAS INC	TXD065096273		1900 TIDAL RD DEER PARK, TX, 77536					
HIGH	YES	02/27/2006	YES	02/27/2006	YE	10/01/2002	YE	10/01/2002
ROLLS-ROYCE CORP	IND000806836		2355 S TIBBS AVE , INDIANAPOLIS, IN, 46241					
HIGH	NO		NO		YE	09/02/2003	YE	09/02/2003
ROMIC ENVIRONMENTAL TECHNOLOGIES CORP.	CAD009452657		2081 BAY ROAD EAST PALO ALTO, CA, 943031316					
HIGH	NO		NO		YE	03/29/2001	YE	01/16/2008
ROSEDALE LANSCAPE DEPOT	MDD981041601		8355 PULASKI HWY ROSEDALE, MD, 21237					
HIGH	YES	03/24/2003	YES	03/24/2003	YE	02/25/2000	YE	02/25/2000
ROSS INCINERATION SERVICES INC	OHD048415665		36790 GILES ROAD GRAFTON, OH, 440449586					
HIGH	NO		NO		YE	12/20/2001	YE	12/22/2000
ROSWELL COMPRESSOR STATION, NO. 9	NMD986676955		6381 NORTH MAIN STREET ROSWELL, NM, 88201					
HIGH	NO		NO		YE	06/01/2002	NO STATUS	
ROY METAL FINISHING CO INC	SCD003341849		112 CONESTEE RD CONESTEE, SC, 29636					
HIGH	YES	03/27/2006	YES	09/28/2006	YE	06/20/1997	YE	06/20/1997
RUGGED LINER INC	MID058816927		951 AIKEN ST OWOSSO, MI, 48867					
MEDIUM	YES	09/28/2007	NO		YE	08/25/2006	YE	08/04/2006
S.D. WARREN COMPANY	MED042141408		89 CUMBERLAND STREET WESTBROOK, ME, 040981597					
MEDIUM	YES	10/31/2005	YES	11/17/2005	YE	09/20/1999	YE	08/23/2000
SABIC INNOVATIVE PLASTICS MT VERNON ILLC	IND006376362		1LEXAN LN MOUNT VERNON, IN, 47620					
HIGH	YES	09/11/1997	YES	04/01/2002	YE	03/13/2000	YE	03/13/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
SABIC US INNOVATIVE PLASTICS LLC	WVD088911854		RT. 892 - DUPONT ROAD , WASHINGTON, WV, 26181
HIGH	NO		YES	09/22/2008	YE	09/15/2003	YE	05/21/2003
SAFETY - KLEEN SYSTEMS INC	FLD000776716		19200 PEACHLAND BLVD PORT CHARLOTTE, FL, 339482166
MEDIUM	YES	02/03/2003	YES	04/29/2004	YE	06/30/2006	YE	06/30/2006
SAFETY KLEEN CORP	PAD987266673		INDUSTRIAL PARK RD SAYRE, PA, 18840
HIGH	YES	08/31/1998	YES	08/31/1998	YE	12/30/1999	YE	03/13/2001
SAFETY KLEEN CORP 2-058-011	MDD000737395		12164 TECH RD SILVER SPRING, MD, 20904
HIGH	NO		NO		YE	05/22/2002	YE	02/05/2003
SAFETY KLEEN CORP 2-180-01	PAD084872043		98 SECOND ST WILKES-BARRE, PA, 18705
HIGH	YES	09/10/1996	YES	09/10/1996	YE	10/13/1999	YE	11/03/1999
SAFETY KLEEN CORP 5 100 01	WID045130713		113 OAKRIDGE DR LOT 7 , NORTH PRAIRIE, WI, 53153
LOW	YES	10/04/2006	YES	10/04/2006	YE	10/04/2006	YE	10/04/2006
SAFETY KLEEN CORP BURNSVILLE	MND000686188		1401 CLIFF RD BURNSVILLE, MN, 55337
MEDIUM	YES	08/16/2006	YES	08/16/2006	YE	08/16/2006	YE	08/16/2006
SAFETY KLEEN CORPORATION 7-148	ORD092895481		11843 SE HWY 212 CLACKAMAS, OR, 97015
HIGH	YES	11/12/2002	YES	11/12/2002	YE	09/25/2002	YE	09/25/2002
SAFETY KLEEN REEDLEY RECYCLE CENTER	CAD093459485		1000 S. I STREET REEDLEY, CA, 93654
HIGH	YES	12/21/2007	NO		YE	09/09/2002	YE	09/28/2004
SAFETY KLEEN SYSTEMS CORP	CTD001156009		39 COMMUNITY AVE EXT PLAINFIELD, CT, 06374
HIGH	YES	09/30/2004	YES	09/30/2004	YE	08/26/2002	YE	08/26/2002
SAFETY KLEEN SYSTEMS INC	CTD000845982		24 BRIXTON STREET WEST HARTFORD, CT, 06110
MEDIUM	YES	06/07/2006	YES	07/16/2008	YE	09/15/2003	YE	09/15/2003
SAFETY KLEEN SYSTEMS INC	WID000668822		CORNER WAUKESHON & ELIZABETH SHAWANO, WI, 54166
HIGH	YES	04/20/1999	YES	11/12/2001	YE	04/02/2001	YE	04/02/2001
SAFETY KLEEN SYSTEMS INC	MID981000359		700 ZIMMERMAN BLVD MASON, MI, 48854
HIGH	YES	05/28/1996	YES	04/25/1996	YE	05/28/1998	YE	05/28/1998
SAFETY KLEEN SYSTEMS INC	CTD980667927		11 TIPPING DR LOT 4 BRANFORD, CT, 06405
LOW	YES	07/13/2005	YES	07/16/2008	YE	10/22/2003	YE	10/22/2003
SAFETY KLEEN SYSTEMS INC LEXINGTON	SCD077995488		130A FRONTAGE RD LEXINGTON, SC, 29072
HIGH	NO		NO		YE	03/28/2003	YE	09/10/2003
SAFETY-KLEEN CORP	ILD093862811		14249 VFW RD PEKIN, IL, 61554
HIGH	YES	12/07/1995	YES	12/07/1995	YE	12/08/1995	YE	12/08/1995
SAFETY-KLEEN CORP	ILD000805929		306 CAMPUS DR ARLINGTON HEIGHTS, IL, 60004
HIGH	YES	09/20/2006	YES	12/05/2006	YE	05/14/1999	YE	05/14/1999
SAFETY-KLEEN CORP	MED980667810		86 US HIGHWAY 202 LEEDS, ME, 04263
MEDIUM	YES	02/05/2004	NO		YE	11/03/2005	YE	11/03/2005
SAFETY-KLEEN CORP 1-183-08 OB	IDD000712026		514 E 45TH ST GARDEN CITY, ID, 83714
HIGH	YES	07/03/1995	YES	01/23/1998	YE	12/07/1999	YE	12/07/1999
SAFETY-KLEEN CORP 1-183-28 POC	IDD991281270		2610 GARRETT WY POCATELLO, ID, 83201
HIGH	YES	10/22/1993	YES	10/25/1994	YE	12/07/1999	YE	12/07/1999
SAFETY-KLEEN CORP 3-013-01 HAPEVILLE	GAD000823070		3440 LANG AVE HAPEVILLE, GA, 30354
HIGH	NO		NO		YE	09/23/1996	YE	09/29/2003

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
SAFETY-KLEEN CORP 5-065-01	NED000687186		5150 S ELK DRIVE GRAND ISLAND, NE, 68803					
HIGH	YES	12/22/1997	YES	05/18/2000	YE	04/29/2005	YE	04/29/2005
SAFETY-KLEEN CORP CONGERS 2-118-01	NYD000708164		68 N HARRISON AVE CONGERS, NY, 109201946					
HIGH	YES	11/23/1998	YES	11/23/1998	YE	11/30/1999	YE	11/30/1999
SAFETY-KLEEN CORP NORCROSS	GAD980842777		4800 S OLD PEACHTREE ROAD NORCROSS, GA, 30071					
HIGH	YES	09/28/2007	YES	09/28/2007	YE	09/13/1996	YE	09/13/1996
SAFETY-KLEEN CORP. (4-075-01C1)	KYD000776724		1592 WOLOHAN DRIVE ASHLAND, KY, 41101					
HIGH	YES	07/31/2006	YES	07/31/2006	YE	03/19/1996	YE	03/19/1996
SAFETY-KLEEN ENVIROSYSTEMS CO.	NJD002153922		600 DOREMUS AVENUE NEWARK, NJ, 07105					
HIGH	YES	10/22/2003	NO		YE	09/27/2001	YE	09/21/2005
SAFETY-KLEEN SYSTEMS	NJD002182897		SYLVAN STREET LINDEN, NJ, 07036					
HIGH	NO		NO		YE	09/30/2004	NO STATUS	
SAFETY-KLEEN SYSTEMS INC	MOD000669069		734 NW BYPASS 66 SPRINGFIELD, MO, 65802					
MEDIUM	YES	09/25/2007	YES	04/15/2008	YE	09/30/1999	YE	09/30/1999
SAFETY-KLEEN SYSTEMS INC	KYD053348108		3700 LAGRANGE RD , SMITHFIELD, KY, 40068					
HIGH	NO		NO		YE	08/10/2001	YE	08/10/2001
SAFETY-KLEEN SYSTEMS INC	ILD000805911		1500 E VILLA ST ELGIN, IL, 601208110					
HIGH	YES	07/26/1996	YES	03/07/1997	YE	03/23/1993	YE	03/23/1993
SAFETY-KLEEN SYSTEMS INC	PAD086673407		1606 PITTSBURGH AVE ERIE, PA, 16505-4826					
HIGH	YES	05/18/1998	YES	05/18/1998	YE	08/22/2002	YE	08/22/2002
SAFETY-KLEEN SYSTEMS INC	IND077042034		601 RILEY RD EAST CHICAGO, IN, 46312					
MEDIUM	YES	06/23/2004	YES	06/23/2004	YE	07/29/1999	YE	07/29/1999
SAFETY-KLEEN SYSTEMS INC	RID084802842		167 MILL STREET CRANSTON, RI, 02905					
MEDIUM	YES	09/25/2007	YES	09/25/2007	YE	03/04/2002	YE	09/27/2001
SAFETY-KLEEN SYSTEMS INC	VTD000791699		23 WEST SECOND ST , BARRE, VT, 05641					
HIGH	YES	02/28/1995	YES	02/28/1995	YE	07/29/1999	YE	07/29/1999
SAFETY-KLEEN SYSTEMS INC	WID981187297		2100 BADGER RD KAUKAUNA, WI, 54130					
LOW	YES	10/04/2006	YES	10/04/2006	YE	09/26/2006	YE	09/26/2006
SAFETY-KLEEN SYSTEMS INC GARDEN CITY	GAD000776781		5217 AUGUSTA ROAD GARDEN CITY, GA, 31408					
HIGH	YES	05/31/1995	YES	09/25/2008	YE	02/01/2000	YE	11/01/1999
SAFETY-KLEEN SYSTEMS INC - CLOQUET	MND000686170		1302 18TH ST CLOQUET, MN, 55720					
HIGH	YES	01/17/1991	YES	08/11/1994	YE	03/15/1996	YE	03/15/1996
SAFETY-KLEEN SYSTEMS INC - MADISON	WID980896633		2325 DANIELS ST MADISON, WI, 53718					
MEDIUM	YES	09/12/2001	YES	09/12/2001	YE	12/09/1999	YE	11/14/2000
SAFETY-KLEEN SYSTEMS INC LA CROSSE	WID980896641		2109 WARD AVE LA CROSSE, WI, 54601					
MEDIUM	YES	04/01/2003	YES	03/10/2004	YE	03/02/2004	YE	12/22/2000
SAFETY-KLEEN SYSTEMS INC WAUKESHA	WID981097769		2200 S WEST AVE WAUKESHA, WI, 53189					
MEDIUM	YES	11/02/2005	YES	02/14/2006	YE	12/09/1999	YE	11/14/2000
SAFETY-KLEEN SYSTEMS, INC	VAD981043011		1200 WEST HUNDRED ROAD , CHESTER, VA, 23831					
HIGH	NO		NO		YE	03/10/1999	YE	03/10/1999
SAFETY-KLEEN SYSTEMS, INC	MAD060095569		90 RABBIT RD SALISBURY, MA, 01952					
MEDIUM	NO		NO		YE	02/27/2007	YE	02/27/2007

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
SAFETY-KLEEN SYSTEMS, INC	MAD000846006		128 ELM ST BRIDGEWATER, MA, 02324					
MEDIUM	NO		NO		YE	12/27/2006	YE	12/27/2006
SAFETY-KLEEN SYSTEMS, INC	NMD980698849		4210A HAWKINS RD FARMINGTON, NM, 87401					
LOW	YES	03/10/2006	YES	03/10/2006	YE	03/10/2006	YE	03/10/2006
SAFETY-KLEEN SYSTEMS, INC	MAD096287354		224 EAST MAIN ST WEST BROOKFIELD, MA, 01585					
HIGH	YES	09/25/2007	YES	09/25/2007	YE	08/24/2000	YE	08/24/2000
SAFETY-KLEEN SYSTEMS, INC	MAD088978143		50A BRIGHAM MARLBOROUGH, MA, 01752					
LOW	NO		NO		YE	09/26/2007	YE	09/26/2007
SAFETY-KLEEN SYSTEMS, INC	NMD000804294		2720 GIRARD NE ALBUQUERQUE, NM, 87107					
LOW	YES	02/17/2006	YES	02/17/2006	YE	02/17/2006	YE	02/17/2006
SAFETY-KLEEN SYSTEMS, INC.	CAT000613976		2120 SOUTH YALE ST SANTA ANA, CA, 92704					
MEDIUM	NO		NO		YE	05/17/2000	YE	07/07/2003
SAFETY-KLEEN SYSTEMS, INC.	CAT000613943		5750 COMMERCE BLVD ROHNERT PARK, CA, 94928					
MEDIUM	NO		NO		YE	09/25/2002	YE	09/25/2002
SAFETY-KLEEN SYSTEMS, INC.	CAT000613893		10625 HICKSON ST UNIT A EL MONTE, CA, 91731					
MEDIUM	NO		NO		YE	05/16/2000	YE	09/29/2004
SAFT AMERICA INC	GAD063152573		711 GIL HARBIN INDUSTRIAL BLVD , VALDOSTA, GA, 31601					
HIGH	YES	08/15/2001	NO		YE	08/05/2003	YE	09/19/2001
SALTIRE INDUSTRIAL INC	TND002591311		SCHRADER LANE DICKSON, TN, 37055					
HIGH	NO		NO		YE	03/07/2005	YE	03/07/2005
SANDIA NATIONAL LABORATORIES / NM	NM5890110518	Dept. of Energy	1515 EUBANK BLVD. SE MS1117, ALBUQUERQUE, NM, 87123					
HIGH	NO		NO		YE	06/29/2001	IN	01/25/1996
SANITARY DASH MFG CO INC	CTD001153840		929 RIVERSIDE DR NORTH GROSVENORDALE, CT, 06255					
HIGH	NO		NO		YE	09/04/2001	YE	08/13/2001
SANMINA SCI CORPORATION	NHD046312559		7 MANCHESTER RD & 2 TREASURE LN, DERRY, NH, 03038					
HIGH	YES	09/01/2007	YES	09/01/2007	YE	09/25/2007	YE	09/25/2007
SANTA CLARITA L L C	CAD064573108		22116 WEST SOLEDAD CANYON RD SAUGUS, CA, 91350					
HIGH	NO		NO		YE	09/23/2008	NO	06/09/1998
SAPA EXTRUSIONS INC	PAD096262522		53 POTTSVILLE ST CRESSONA, PA, 17929					
HIGH	NO		NO		YE	11/21/2002	YE	11/21/2002
SARTOMER CO INC	PAD042259374		610 S BOLMAR ST WEST CHESTER, PA, 19382					
HIGH	NO		NO		YE	05/20/1999	YE	05/20/1999
SC JOHNSON & SON INC (WAXDALE)	WID006091425		8311 16TH ST SITE A STURTEVANT, WI, 53403					
HIGH	YES	02/11/1997	YES	07/02/2002	YE	08/23/2000	YE	08/23/2000
SCHENECTADY INTERNATIONAL INC	NYD002070100		CONGRESS ST SCHENECTADY, NY, 12303					
MEDIUM	YES	05/15/1998	NO		YE	09/04/2003	YE	09/30/2003
SCHERING CORPORATION - UNION, NJ	NJD001317601		1011 MORRIS AVENUE MAILSTOP U-13-1-19, UNION, NJ, 07083					
HIGH	NO		NO		YE	03/12/2001	YE	09/23/2004
SCHICK MFG INC	CTD052704335		10 LEIGHTON ROAD MILFORD, CT, 06460					
HIGH	NO		NO		YE	09/16/2003	IN	09/29/1999
SCHRADER- BRIDGEPORT INTERNATIONAL, INC.	VAD082881970		205 FRAZIER ROAD ALTAVISTA, VA, 24517					
HIGH	YES	09/21/1996	YES	08/01/2000	YE	08/23/2002	YE	07/18/2003

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
SCIO POTTERY COMPANY	OHD004465084		38500 CRIMM RD SCIO, OH, 43988					
HIGH	YES	05/30/2006	YES	09/06/2006	YE	03/29/2007	YE	06/30/2008
SCOTT AFB	IL7570024177	US Air Force	375 CES/CEV 702 HANGER RD SCOTT AFB, IL, 622255035					
HIGH	NO		NO		YE	05/21/2007	YE	09/01/2006
SCOVILL FASTENERS INC	GAD003480530		1802 SCOVILL DR. CLARKESVILLE, GA, 30523					
MEDIUM	NO		NO		YE	08/25/1997	YE	08/25/1997
SDI MANAGEMENT COMPANY	MED001096791		291 NORTH STREET SUITE 2 SACO, ME, 040720890					
HIGH	NO		NO		YE	09/29/1999	YE	09/29/1999
SEAGATE TECHNOLOGY (FORMERLY IMPRIMIS)	NED072901945		11615 I ST OMAHA, NE, 68137					
HIGH	YES	08/15/1997	YES	04/16/1999	YE	12/09/1999	YE	12/09/1999
SEASIDE PARK LANDFILL	CTD000651927		SEASIDE PARK BARNUM BLVD BRIDGEPORT, CT, 06604					
HIGH	NO		NO		YE	09/28/2001	YE	09/28/2001
SEASON ALL INDUSTRIES INC	PAD008964868		ROUTE 119 S INDIANA, PA, 15701					
HIGH	NO		NO		YE	05/07/2004	NO STATUS	
SECHAN LIMESTONE INDS INC	PAD002860377		2925 NEW CASTLE RD PORTERSVILLE, PA, 16051					
HIGH	NO		NO		YE	06/14/2001	YE	06/14/2001
SECO PRODUCTS	MOD068549492		OLD HWY 100 E WASHINGTON, MO, 63090					
HIGH	YES	05/12/2008	NO		YE	07/25/2005	YE	07/25/2005
SEEKONK MFG CO INC	MAD001202258		PERRIN AVE SEEKONK, MA, 02771					
HIGH	NO		NO		YE	03/04/2002	YE	07/03/2002
SEITZINGER LLC-FKA SEITZINGER INC OP FAC	GAD990675118		900 JOSEPH E LOWERY BLVD , ATLANTA, GA, 30318					
MEDIUM	YES	06/10/2002	YES	04/18/2006	YE	10/14/2005	YE	10/14/2005
SENSIENT COLORS INC	PAD002917466		2529 MAIN ST BIRDSBORO, PA, 19508					
HIGH	YES	03/19/2007	YES	03/19/2007	YE	08/22/2002	YE	06/16/2003
SERVICE CHEMICAL SITE	CAT000612333		1341 E MAYWOOD AVE SANTA ANA, CA, 92705					
HIGH	NO		NO		YE	07/26/2005	NO	05/04/2000
SEVERSTAL SPARROWS POINT LLC	MDD053945432		1430 SPARROWS POINT BLVD BALTIMORE, MD, 21219					
HIGH	NO		NO		YE	09/07/2005	IN	02/29/1996
SEVERSTAL NORTH AMERICA INC	MID087738431		4001 MILLER RD DEARBORN, MI, 48120					
HIGH	NO		NO		YE	02/08/2005	YE	02/08/2005
SEVERSTAL WARREN INC	OHD060409521		999 PINE AVE SE WARREN, OH, 444836528					
MEDIUM	NO		NO		YE	03/30/2005	NO STATUS	
SEVERSTAL WHEELING INC - FOLLANSBEE	WVD004319539		1851 MAIN ST , FOLLANSBEE, WV, 26037					
HIGH	NO		NO		YE	09/22/2005	IN	03/16/1999
SHELL CHEMICAL YABUCOA, INC	PRD090074071		ROUTE 901 KM 2.7 CAMINO NUEVO WARD, YABUCOA, PR, 00767					
HIGH	NO		NO		YE	09/28/2005	YE	09/28/2005
SHELL GUAM TERMINAL	GUT000010009		CHALAN TENJO VISTA , PITI, GU, 96915					
MEDIUM	NO		NO		YE	07/10/2007	YE	07/10/2007
SHELL LUBRICANTS	WVD057634776		1 MILE S ST RT 2 , NEWELL, WV, 26050					
HIGH	NO		NO		YE	09/30/2003	YE	03/29/2007
SHELL OIL COMPANY	TXD067285973		5900 HIGHWAY 225 DEER PARK, TX, 77536					
HIGH	YES	08/16/2007	NO		YE	01/13/2000	YE	01/13/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
SHELL OIL PRODUCTS US - CARSON TERMINAL	CAD066676123		20945 S. WILMINGTON AENUE CARSON, CA, 90810
HIGH / NO	NO	YE / 09/26/2003	NO / 03/09/2001
SHELL OIL PRODUCTS US, MARTINEZ REFINERY	CAD009164021		3485 PACHECO BOULEVARD MARTINEZ, CA, 94553
MEDIUM / NO	NO	YE / 09/13/2001	YE / 03/09/2001
SHELL OPUS PUGET SOUND REFINERY	WAD009276197		8505 S TEXAS RD ANACORTES, WA, 982219643
HIGH / NO	NO	YE / 01/22/2002	YE / 01/22/2002
SHENANGO INC	PAD004337465		200 NEVILLE RD PITTSBURGH, PA, 15225-1620
HIGH / NO	NO	YE / 02/24/2005	IN / 09/21/2000
SHERWIN WILLIAMS CO	ILD005456439		11541 S CHAMPLAIN AVE CHICAGO, IL, 60628
HIGH / YES / 01/22/2007	NO	YE / 08/25/2004	YE / 08/25/2004
SHERWIN WILLIAMS CO	KSD007163355		1700 W 4TH COFFEYVILLE, KS, 67337
HIGH / YES / 09/28/2006	YES / 09/30/2008	YE / 09/30/2003	YE / 09/07/2000
SHERWOOD FOREST PROPERTIES LTD	NYD000824466		BUFFALO AVE NIAGARA FALLS, NY, 143032158
HIGH / NO	NO	YE / 09/21/2006	YE / 09/21/2006
SHORT JOURNEY CENTER SITE	NCD981476955		2323 CLEVELAND RD , SMITHFIELD, NC, 27577
HIGH / NO	NO	YE / 08/27/2008	YE / 08/27/2008
SI GROUP INC	NYD002070118		1000 MAIN STREET ROTTERDAM JUNCTION, NY, 12150
HIGH / NO	NO	YE / 06/30/2003	YE / 09/25/2002
SIBLEY CO	CTD001442417		95 BRIDGE ST HADDAM, CT, 064380068
HIGH / NO	NO	YE / 04/15/2004	NO / 09/11/1995
SIEMENS ENERGY & AUTOMATION INC	SCD078065117		1320 OLD GEORGIA RD ROEBUCK, SC, 29376
HIGH / NO	NO	YE / 09/26/2000	YE / 09/25/2008
SIERRA ARMY DEPOT	CA5210020843 US Army		AMSTA-SI-GM-BSE BLDG 75, HERLONG, CA, 96113
HIGH / NO	NO	YE / 05/03/2004	YE / 05/03/2005
SIGNAL ENERGY HOLDINGS CORPORATION	GAD051011344		7982 HUEY RD DOUGLASVILLE, GA, 30134
HIGH / NO	NO	YE / 09/15/2000	YE / 09/27/2002
SIGNATURE ALUMINUM INC	PAD004329520		93 WERNER RD BLDG A, GREENVILLE, PA, 16125-9499
HIGH / YES / 08/16/2000	YES / 08/16/2000	YE / 05/19/2000	YE / 05/19/2000
SIKORSKY AIRCRAFT CORP	CTD001449784		6900 MAIN STREET STRATFORD, CT, 066159129
HIGH / NO	NO	YE / 06/06/2001	YE / 09/28/2001
SIKORSKY AIRCRAFT CORP	CTD001449735		1210 SOUTH AVE BRIDGEPORT, CT, 06604
HIGH / NO	NO	YE / 11/12/1999	YE / 11/12/1999
SIMMONDS PRECISION CO - OPERATIVE IND	NJD096873500		100 OAKDALE RD CHESTER, NJ, 079302221
HIGH / NO	NO	NO STATUS	NO STATUS
SIMONDS INDUSTRIES INC	OHD018221853		641 HELLER DR NEWCOMERSTOWN, OH, 43832
MEDIUM / NO	NO	NO STATUS	NO STATUS
SINCLAIR CASPER REFINING COMPANY	WYD048743009		5700 EAST HIGHWAY 20/26 CASPER, WY, 82609
HIGH / NO	NO	YE / 09/16/2005	YE / 09/30/2004
SINCLAIR KANSAS CITY PRODUCTS TERMINAL	KSD091347898		3401 FAIRBANKS AVE , KANSAS CITY, KS, 66106
HIGH / NO	NO	YE / 10/05/2004	YE / 09/21/2004
SINCLAIR TULSA REFINERY CO	OKD990750960		902 W 25TH ST , TULSA, OK, 74107
HIGH / NO	NO	YE / 05/17/2001	YE / 05/17/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
SINCLAIR WYOMING REFINERY	WYD079959185		100 E. LINCOLN HWY. SINCLAIR, WY, 82334
HIGH / NO	NO	YE / 09/16/2005	YE / 09/08/2004
SINGER FURNITURE CO PLT 33 & 4	NCD000604322		904 VIRGINIA ST SW LENOIR, NC, 28645
HIGH / NO	NO	YE / 11/15/2004	IN / 11/15/2004
SKF USA INC	PAD004344172		1000 LOGAN BLVD ALTOONA, PA, 166024096
HIGH / NO	NO	YE / 07/26/2004	YE / 07/31/2008
SLOSS INDUSTRIES CORPORATION BIRMINGHAM	ALD000828848		3500 35TH AVENUE NORTH , BIRMINGHAM, AL, 352072918
LOW / NO	NO	YE / 09/30/2005	NO / 09/30/2005
SMR TECHNOLOGIES INC	WVD980555395		93 NETTIE FENWICK ROAD , FENWICK, WV, 26202
HIGH / YES / 08/04/2004	YES / 08/04/2004	YE / 04/10/2001	YE / 04/10/2001
SMURFIT - STONE CONTAINER ENTERPRISES IN	FLD004056230		600 N 8TH ST FERNANDINA BEACH, FL, 320343319
HIGH / YES / 05/24/2004	YES / 05/24/2004	YE / 09/26/2002	YE / 09/23/2004
SMURFIT STONE CONTAINER CORP	FLD982080129		1 S EVERITT AVE PANAMA CITY, FL, 324016900
HIGH / NO	NO	YE / 09/30/2004	YE / 09/30/2004
SO-GREEN CORP	GAD991275124		HIGHLAND AVE TIFTON, GA, 31794
HIGH / NO	NO	YE / 09/30/2002	YE / 09/30/2002
SOLAR TURBINES - KEARNY MESA FACILITY	CAT000626549		4200 RUFFIN ROAD SAN DIEGO, CA, 92123
LOW / NO	NO	YE / 07/18/2005	YE / 09/14/2007
SOLITE, LLC	VAD042755082		STATE ROUTE 652 ARVONIA, VA, 23004
HIGH / NO	NO	YE / 09/26/2005	YE / 09/29/2006
SOLUTIA INC	TXD001700806		MORTESEN & FM 2917 ALVIN, TX, 77512
HIGH / YES / 02/12/2007	YES / 02/12/2007	YE / 02/28/2003	YE / 09/12/2001
SOLUTIA INC	MAD001114818		730 WORCESTER ST SPRINGFIELD, MA, 011511089
HIGH / YES / 09/30/2008	NO	YE / 09/20/2004	YE / 09/20/2004
SOLUTIA INC	FLD071951966		3000 OLD CHEMSTRAND RD US HWY CANTONMENT, FL, 32533
HIGH / NO	NO	YE / 09/30/1997	YE / 09/29/2003
SOLUTIA INC - JOHN F QUEENY PLANT	MOD004954111		201 RUSSELL BLVD ST LOUIS, MO, 63104
HIGH / NO	NO	YE / 09/30/2002	YE / 10/05/2004
SOLUTIA INC WG KRUMMRICH PLANT	ILD000802702		500 MONSANTO AVE SAUGET, IL, 622061137
HIGH / YES / 02/26/2008	NO	YE / 05/26/2004	YE / 05/26/2004
SOLUTIA INC.	NJD001700707		170 ROUTE 130 SOUTH P.O. BOX 309, BRIDGEPORT, NJ, 08014
HIGH / NO	NO	YE / 05/29/2003	YE / 09/23/2005
SOLUTIA NITRO SITE	WVD039990965		1 MONSANTO ROAD , NITRO, WV, 25143
HIGH / NO	NO	YE / 09/07/2004	IN / 08/20/1996
SOLVAY ADVANCED POLYMERS LLC	OHD981529688		17005 ST RT 7 MARIETTA, OH, 45750
MEDIUM / YES / 11/22/1999	YES / 04/18/2006	YE / 03/18/1999	YE / 03/18/1999
SOLVAY SOLEXIS, INC.	NJD980753875		10 LEONARD LANE THOROFARE, NJ, 08086
HIGH / YES / 05/21/2004	NO	YE / 06/30/2003	NO STATUS
SOLVENT RECOVERY LLC	MOD000610766		716 MULBERRY ST KANSAS CITY, MO, 641011226
HIGH / NO	NO	YE / 09/30/2003	YE / 10/05/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
SOLVENTS & PETROLEUM SERVICE, INC.	NYD013277454		DREWERTON ROAD SYRACUSE, NY, 13208
SOMERS INDUSTRIAL FINISHING CORP	CTD062202791		19 FIELD RD SOMERS, CT, 06071
SOMERSET REFINERY INC., THE	KYD089227227		501 REFINERY RD , SOMERSET, KY, 42502
SONNEBORN INC	PAD004388500		100 SONNEBORN LN PETROLIA, PA, 16050
SONOCO FLEXIBLE PACKAGING	IND040299828		6502 S US 31N EDINBURGH, IN, 46124
SOUTH CAMPUS	FLR000049718		9751 UNIVERSAL BLVD ORLANDO, FL, 328198703
SOUTHDOWN INC	CTD980515290		0 CROSS ST BRISTOL, CT, 06010
SOUTHERN WOOD PIEDMONT CO	FLD004053450		900 CENTER ST N BALDWIN, FL, 322341114
SOUTHERN WOOD PIEDMONT CO,	GAD067560870		1745 CONNALLY DR EAST POINT, GA, 30344
SOUTHERN WOOD PIEDMONT CO.	GAD051034387		1650 NIXON RD AUGUSTA, GA, 30906
SOUTHERN WOOD PIEDMONT COMPANY	TND003327400		400 WEST 33RD STREET CHATTANOOGA, TN, 37410
SOUTHERN WOOD PIEDMONT COMPANY	SCD049690001		591 SPRINGFIELD RD SPARTANBURG, SC, 29303
SOUTHINGTON MANUFACTURING FAC	CTD001149277		AIRCRAFT RD SOUTHINGTON, CT, 06489
SOUTHLAND CORP	NJD092225721		ALPHANO RD GREAT MEADOWS, NJ, 07838
SOUTHWIRE COPPER DIVISION	GAD000814541		372 CENTRAL HIGH RD CARROLLTON, GA, 30117
SOUTNIGTON TOWN LANDFILL	CTD000844308		DEPAOLO DRIVE SOUTHINGTON, CT, 06489
SPARTECH TOWNSEND	IAD005277231		4400 VANDALIA RD PLEASANT HILL, IA, 50327
SPARTON ENGINEERED PROD	ILD006304489		RTE 50 WEST FLORA, IL, 62839
SPARTON TECHNOLOGIES	NMD083212332		9621 COORS NW ALBUQUERQUE, NM, 87114
SPECIFICATIONS PLATING INC	CTD001174580		740 SEAVIEW AVE BRIDGEPORT, CT, 06607
SPECTRUM CONTROL	PAD990823858		1593 MT JOY ST ELIZABETHTOWN, PA, 17022

NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
MEDIUM	YES	03/14/2006	YES	06/09/2006	YE	09/18/2001	YE	09/10/2002
HIGH	NO		NO		YE	11/24/1998	NO	09/05/1996
HIGH	NO		NO		YE	09/15/2004	YE	09/15/2004
HIGH	NO		NO		YE	09/25/2003	YE	09/29/2005
HIGH	YES	07/17/2007	YES	07/17/2007	YE	04/20/2007	YE	04/20/2007
MEDIUM	NO		NO		YE	09/27/1999	NO	09/27/1999
MEDIUM	YES	12/07/1996	YES	12/07/1996	YE	08/08/1996	YE	08/08/1996
MEDIUM	NO		NO		YE	09/13/2007	YE	09/13/2007
HIGH	NO		NO		YE	09/20/1996	YE	09/30/1999
HIGH	NO		NO		YE	09/15/1997	YE	09/30/1999
HIGH	NO		NO		YE	09/30/1999	YE	09/30/1999
HIGH	NO		NO		YE	08/20/2004	YE	09/21/2005
HIGH	NO		NO		YE	09/22/2003	IN	05/05/1999
HIGH	YES	03/16/2007	YES	03/16/2007	YE	06/05/2003	YE	06/05/2003
HIGH	NO		NO		YE	08/15/2005	YE	08/15/2005
HIGH	NO		NO		YE	09/28/2001	IN	09/28/2001
HIGH	NO		NO		YE	09/10/2001	YE	08/31/2001
HIGH	NO		NO		YE	05/21/2007	YE	06/02/2008
HIGH	YES	03/03/2000	NO		YE	06/29/2001	YE	06/29/2001
HIGH	NO		NO		IN	01/19/2000	YE	09/30/2008
HIGH	YES	04/09/2001	YES	04/09/2001	YE	09/21/2000	YE	09/21/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
SPIROL INTERNATIONAL CORP	CTD001140862		30 ROCK AVENUE DANIELSON, CT, 06239					
HIGH	NO		NO		YE	09/29/2003	YE	10/04/2005
SPORTING GOODS PROPERTIES INC	CTD001453216		615 ASYLUM ST BRIDGEPORT, CT, 06610					
HIGH	NO		NO		YE	03/28/2002	YE	09/26/2005
SPRING GROVE RESOURCE RECOVERY	OHD000816629		4879 SPRING GROVE CINCINNATI, OH, 45232					
LOW	NO		NO		YE	07/09/2004	YE	08/06/2008
SPS TECHNOLOGIES	PAD000000554		301 HIGHLAND AVE JENKINTOWN, PA, 19046					
HIGH	NO		NO		YE	12/06/2000	YE	12/06/2000
SQUARE D CO	NJD986579449		90 US HWY 130 PLANT 1, BORDENTOWN, NJ, 08505					
HIGH	NO		NO		YE	09/29/1997	YE	05/19/2005
SQUARE D COMPANY	CAD050746775		1060 E THIRD ST BEAUMONT, CA, 92223					
LOW	YES	03/01/1995	YES	06/27/2000	YE	05/17/2000	YE	05/17/2000
SSA CONTAINERS INC	WAD009252891		3320 LINCOLN AVE E TACOMA, WA, 98421					
HIGH	NO		NO		YE	09/28/2005	YE	09/29/2005
ST CHARLES METAL FINISHING CO	MOD041881699		1300 OLIVE ST ST CHARLES, MO, 633010822					
HIGH	YES	04/10/1995	YES	05/07/1996	YE	02/04/2000	YE	02/04/2000
ST MARKS POWDER INC	FLD047096524		US HWY 98 & SR 363 SAINT MARKS, FL, 32355					
HIGH	YES	01/16/2007	NO		YE	07/20/2001	YE	07/20/2001
ST MARYS CEMENT	MID094553419		9333 DEARBORN ST DETROIT, MI, 48209					
LOW	NO		NO		YE	06/30/2003	YE	06/30/2003
ST. MARYS REFINING COMPANY, INC.	WVD004337135		201 BARKWILL STREET SAINT MARYS, WV, 26170					
HIGH	NO		NO		YE	09/26/2003	YE	08/01/2005
STANDARD T CHEMICAL CO INC	NJD011394467		1312 ELIZABETH AVE LINDEN, NJ, 07036					
HIGH	YES	11/18/2005	YES	11/18/2005	YE	05/24/2001	YE	05/24/2001
STARK CERAMICS	OHD004461711		600 W CHURCH ST EAST CANTON, OH, 44730					
HIGH	NO		NO		YE	05/13/1999	YE	05/13/1999
STATE STREET LANDFILL (DOUGLAS CO LF)	NET320010234		12608 STATE STREET OMAHA, NE, 68142					
HIGH	YES	08/19/2008	YES	08/19/2008	YE	09/30/2002	YE	09/30/2002
STAUFFER MANAGEMENT COMPANY	NYD004859955		JORDAN ROAD SKANEATELES FALLS, NY, 13153					
HIGH	YES	12/06/2001	NO		YE	09/28/2007	YE	09/30/2005
STAUFFER MANAGEMENT COMPANY LLC	CAD076941103		2112 EAST 223RD STREET CARSON, CA, 90745					
HIGH	NO		NO		YE	05/14/2008	YE	04/16/2008
STEEL ABRASIVES INC	OHD091831313		2727 SYMMES RD HAMILTON, OH, 45014					
HIGH	NO		NO		YE	09/26/2008	NO STATUS	
STEEL DYNAMICS ROANOKE BAR DIVISION	VAD003122553		102 WESTSIDE BOULEVARD, N. W. , ROANOKE, VA, 24017					
HIGH	NO		NO		YE	04/25/2005	IN	12/05/2000
STEELCOTE MFG CO	MOD006275036		1 STEELCOAT SQ ST LOUIS, MO, 63103					
HIGH	YES	09/29/1995	YES	09/29/1995	YE	03/29/2002	IN	10/12/2000
STELLA JONES CORPORATION	WAD053823019		6520 188TH ST NE ARLINGTON, WA, 98223					
HIGH	NO		NO		YE	12/14/2004	NO	12/14/2004
STERLING CASKET HARDWARE CO.INC.	VAD000020115		14430 ENTERPRISE ROAD ABINGDON, VA, 24210					
HIGH	NO		NO		YE	10/01/2002	YE	10/01/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
STERLING FIBERS INC	FLD057231821		1801 CYANAMID RD MILTON, FL, 325712757
MEDIUM / YES / 09/22/2008	NO	YE / 03/14/2008	YE / 06/22/2006
STEWART WARNER SOUTHWIND CORP	IND005213715		1514 DROVER ST INDIANAPOLIS, IN, 46221
HIGH / YES / 07/31/2008	YES / 07/31/2008	YE / 06/30/2005	YE / 06/30/2008
STONERIDGE FARMS INC	FLD004059085		STATE ROAD 209A GREEN COVE SPRINGS, FL, 32043
HIGH / NO	NO	YE / 07/11/2003	IN / 09/30/1997
STRATFORD ARMY ENGINE PLANT	CTD001181502	US Army	550 MAIN STREET STRATFORD, CT, 06615
HIGH / NO	NO	YE / 09/16/2003	NO / 08/26/1996
STRATOS LIGHTWAVE	ILD005092135		7444 W WILSON AVE HARWOOD HTS, IL, 607064549
HIGH / YES / 08/23/1996	YES / 10/31/2001	YE / 09/24/1999	YE / 09/24/1999
STRUCTURAL METALS INC	TXD008119414		STEEL MILL DR SEGUIN, TX, 78155
HIGH / YES / 02/06/2006	YES / 02/06/2006	YE / 11/06/2001	YE / 01/13/2000
SUMMIT CORP OF AMERICA	CTD002496909		1430 WATERBURY ROAD THOMASTON, CT, 06787
HIGH / NO	NO	YE / 12/06/2004	IN / 07/05/2000
SUN SCHUYLKILL RIVER TANK FARM	PAD980555312		70TH & ESSINGTON AVE PHILADELPHIA, PA, 19153
HIGH / NO	NO	YE / 08/26/2003	YE / 08/25/2003
SUNCOR ENERGY (USA) INC - WEST PLANT	COD060627189		5801 BRIGHTON BLVD , COMMERCE CITY, CO, 80022
HIGH / NO	NO	YE / 07/14/2003	YE / 09/18/2001
SUNCOR ENERGY (USA) INC EAST PLANT	COD000109975		5800 BRIGHTON BLVD COMMERCE CITY, CO, 80022
HIGH / NO	NO	YE / 07/14/2003	YE / 09/19/2001
SUNOCO CHEMICAL	OHD005108477		1019 HAVERHILL / OHIO FURNANCE HAVERHILL, OH, 456360180
MEDIUM / NO	NO	YE / 01/29/2001	YE / 08/13/2002
SUNOCO INC (R&M) MARCUS HOOK REFINERY	PAD980550594		100 GREEN ST MARCUS HOOK, PA, 19061
HIGH / NO	NO	YE / 01/02/2003	YE / 01/06/2003
SUNOCO INC FRANKFORD PLT	PAD002312791		MARGARET & BERMUDA ST PHILADELPHIA, PA, 19137
HIGH / NO	NO	YE / 01/06/2003	YE / 09/29/2004
SUNOCO INC R&S GIRARD PT	PAD049791098		3144 PASSYUNK AVE PHILADELPHIA, PA, 19145-5299
HIGH / NO	NO	YE / 04/06/2002	YE / 04/06/2002
SUNOCO PARTNERS MARKETING &TERMINALS,LP	VAD048565279		10315 BALLS FORD ROAD MANASSAS, VA, 20109
HIGH / NO	NO	YE / 11/12/1999	YE / 08/25/2005
SUNOCO POINT BREEZE	PAD002289700		3144 PASSYUNK AVE PHILADELPHIA, PA, 19145
HIGH / NO	NO	YE / 01/06/2003	IN / 01/02/2003
SUNOCO, INC. (R&M)	OKD058078775		1700 SOUTH UNION TULSA, OK, 74107
HIGH / NO	NO	YE / 06/06/2001	YE / 06/06/2001
SUNOCO, INC. (R&M) EAGLE POINT FACILITY	NJD990753162		ROUTE 130 & I-295 WESTVILLE, NJ, 08093
HIGH / NO	NO	YE / 08/19/2005	NO STATUS
SUPERIOR TUBE CO	PAD002353407		3900 GERMANTOWN PIKE COLLEGEVILLE, PA, 19426-3112
HIGH / YES / 12/22/1998	YES / 12/03/2002	YE / 07/02/2002	YE / 07/03/2002
SUSQUEHANNA STEEL MILTON PLT	PAD050917186		230 LOWER MARKET ST MILTON, PA, 17847
HIGH / NO	NO	YE / 09/14/1999	YE / 09/14/1999
SWIFT M & SONS INC	CTD001139054		10 LOVE LN HARTFORD, CT, 06141
HIGH / NO	NO	YE / 12/08/2000	YE / 12/08/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
SYBRON CHEMICALS INC.	NJD002339406		200 BIRMINGHAM ROAD BIRMINGHAM, NJ, 08011					
HIGH	NO		NO		YE	06/29/2004	YE	04/18/2005
SYNGENTA CROP PROTECTION, INC.	LAD053783445		3905 HWY 75 ST. GABRIEL, LA, 70776					
HIGH	NO		NO		YE	09/17/1999	YE	09/17/1999
SYNTEX LYONS GROUNDWATER CLEANUP PROJECT	COD981551286		15211 N DAKOTA RIDGE RD LYONS, CO, 80540					
HIGH	YES	08/12/1988	YES	10/31/1988	YE	08/29/2000	YE	08/29/2000
SYNTHETIC PROD CO DIV OF PLASTIC SPECI	CTD000844365		375 BARNUM AVE STRATFORD, CT, 06497					
HIGH	NO		NO		YE	08/25/2003	YE	08/25/2003
T R W SULLIVAN FACILITY	MOD094390416		300 RAMSEY ST SULLIVAN, MO, 63080					
HIGH	YES	04/10/2002	NO		YE	09/30/2005	YE	09/27/2007
T&S BRASS & BRONZE WORKS INC	SCD002038545		2 SADDLEBACK COVE RD TRAVELERS REST, SC, 29690					
HIGH	YES	01/24/2008	YES	07/08/2008	YE	09/25/1998	YE	09/26/2000
T-THERMAL, INC.	PAD069006419		1 BROOK RD CONSHOHOCKEN, PA, 19428					
HIGH	YES	09/29/1994	YES	09/29/1994	YE	08/22/2002	YE	08/22/2002
TALMA FASTENER CORP	IND057389355		6768 N TALMA RD TALMA, IN, 46975					
HIGH	NO		NO		YE	08/20/2008	YE	08/20/2008
TALON INC	PAD980550149		LIBERTY ST EXTENSION MEADVILLE, PA, 16335					
HIGH	NO		NO		YE	09/20/2002	YE	09/20/2002
TALON INC PLANT 7	PAD045297066		1305 S MAIN ST MEADVILLE, PA, 16335					
HIGH	NO		NO		YE	09/23/2002	IN	03/30/2006
TAPI PUERTO RICO INC	PRD090613357		CARR #3 KM 143.0 GUAYAMA, PR, 00785					
MEDIUM	NO		NO		YE	09/18/2007	NO STATUS	
TECHALLOY CO. INC.	CAD059277137		2500 A STREET PERRIS, CA, 92570					
MEDIUM	YES	05/10/1995	NO		YE	06/07/2000	YE	06/07/2000
TECHALLOY INC	ILD005178975		6509 OLSON RD P O BOX 423, UNION, IL, 60180					
HIGH	YES	09/30/1999	YES	08/27/2002	YE	12/13/2001	YE	09/30/1999
TECHNI COAT INC	TXD982293912		301 NE 6TH FORT WORTH, TX, 76106					
HIGH	YES	02/28/2006	YES	02/28/2006	YE	04/08/2005	YE	04/08/2005
TECUMSEH REDEVELOPMENT INC	NYD002134880		2600 HAMBURG TNPK RTE 5 LACKAWANNA, NY, 14218					
HIGH	NO		NO		NO STATUS		NO STATUS	
TECUMSEH REDEVELOPMENT INC	PAD004344222		RIDERS AREA IRON ST, JOHNSTOWN, PA, 15901-1610					
HIGH	NO		NO		YE	11/16/2006	YE	11/16/2006
TECUMSEH REDEVELOPMENT INC	PAD003053758		100 MAYNARD ST WILLIAMSPORT, PA, 17701					
HIGH	NO		NO		YE	04/12/1999	YE	04/12/1999
TEKNICIRCUITS INC	CTD053707741		84 SHELTER ROCK RD DANBURY, CT, 06810					
HIGH	NO		NO		YE	09/15/2003	YE	09/25/2002
TELAIR INTERNATIONAL	CAD008383127		3303 OLD CONEJO RD NEWBURY PARK, CA, 91320					
HIGH	NO		NO		YE	05/16/2000	YE	05/16/2000
TELEDYNE CONTINENTAL MOTORS, BATTERY PRO	CAD008386641		840 WEST BROCKTON AVENUE REDLANDS, CA, 92374					
HIGH	NO		NO		YE	05/15/2000	YE	05/15/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
TELEDYNE MONARCH RUBBER PLANTS 2 AND 5	OHD000821348		ST RTE 43 N HARTVILLE, OH, 44632
HIGH / YES / 05/18/2005	YES / 01/09/2006	YE / 08/27/2003	YE / 08/27/2003
TELEDYNE RYAN ELECTRONICS	CAD990833014		8650 BALBOA AVE SAN DIEGO, CA, 92123
LOW / NO	NO	YE / 03/10/2005	YE / 09/19/2008
TELEDYNE VEHICLE SYSTEMS	MID006407597		76 S GETTY ST MUSKEGON, MI, 49442
HIGH / NO	NO	YE / 07/07/2005	YE / 07/07/2005
TELEX COMMUNICATIONS INC	NED089569024		8601 E CORNHUSKER HWY LINCOLN, NE, 68507
HIGH / YES / 11/12/2003	YES / 11/12/2003	YE / 08/04/2000	YE / 08/04/2000
TENNECO AUTOMOTIVE OPERATING COMPANY INC	NED007263619		121 MERIDIAN AVE COZAD, NE, 69130
HIGH / NO	NO	YE / 09/09/2002	YE / 08/01/2002
TESORO ALASKA KENAI REFINERY	AKD048679682		54741 TESORO ROAD , KENAI, AK, 99611
HIGH / YES / 09/29/1995	YES / 02/08/2001	YE / 07/28/2003	YE / 08/12/2004
TESORO HAWAII CORPORATION REFINERY	HID056786395		91-325 KOMOHANA ST KAPOLEI, HI, 96707
MEDIUM / YES / 08/01/2003	YES / 08/01/2003	YE / 08/30/2006	YE / 08/30/2006
TESORO REFINING AND MARKETING CO LA REFI	CAD041520644		2101 E PACIFIC COAST HIGHWAY WILMINGTON, CA, 90744
HIGH / NO	NO	YE / 03/28/2002	NO / 03/09/2001
TESORO REFINING AND MARKETING COMPANY	NDD006175467		900 OLD RED TRAIL NE MANDAN, ND, 58554
HIGH / YES / 09/13/2000	YES / 10/10/2002	YE / 08/06/1996	YE / 08/06/1996
TESORO REFINING AND MARKETING COMPANY	UTD000826362		474 WEST 900 NORTH SALT LAKE CITY, UT, 84103
HIGH / YES / 01/06/2006	YES / 01/06/2006	YE / 11/08/2000	YE / 11/08/2000
TETRA MICRONUTRIENTS	NED000610550		71025 569TH AVE FAIRBURY, NE, 68352
HIGH / YES / 10/15/2007	NO	YE / 09/12/2002	YE / 09/28/2000
TEXANA TANK CAR & MANUFACTURING LTD	TXD043195221		290 COUNTY ROAD 1223 NASH, TX, 75569
HIGH / YES / 02/28/2006	YES / 02/28/2006	YE / 04/22/2003	YE / 09/27/2002
TEXAS ELECTRIC COOPERATIVES INC	TXD041468836		BEVIL LOOP RD 2.5 MI E OF JASPER, TX, 75951
MEDIUM / YES / 02/06/2007	YES / 02/06/2007	YE / 08/25/2003	YE / 06/06/2005
TEXAS HYDRAULICS INC	TXD988019568		6613 N 19TH ST WACO, TX, 76708
HIGH / YES / 08/01/2006	YES / 08/01/2006	YE / 03/21/2005	YE / 03/21/2005
TEXAS TANK CAR WORKS INC	TXD027002112		600 N BAZE STREET SAN ANGELO, TX, 76902
HIGH / YES / 08/08/2006	YES / 08/08/2006	YE / 03/06/2006	YE / 03/06/2006
TEXTRON AUTOMOTIVE INTERIORS	NHD980913321		WATSON RD CARDINAL LANDFILL REMEDIATION, FARMINGTON, NH, 03835
HIGH / NO	NO	NO STATUS	IN / 08/19/2008
TEXTRON INC	MID006030357		1085 W SHERMAN BLVD MUSKEGON, MI, 49441
HIGH / NO	NO	YE / 12/31/2007	YE / 12/31/2007
THE BOEING COMPANY - CANOGA FACILITY	CAD074103771		6633 CANOGA AVENUE CANOGA PARK, CA, 91303
MEDIUM / NO	NO	YE / 07/24/2003	YE / 07/24/2003
THE BOEING COMPANY - NASA AREA	CA1800090010 NASA		5800 WOOLSEY CANYON ROAD SIMI VALLEY, CA, 93063
HIGH / NO	NO	YE / 09/29/2003	IN / 04/04/2000
THE BOEING COMPANY - SSFL 1,2,3,4	CAD093365435		5800 WOOLSEY CANYON ROAD SIMI VALLEY, CA, 93063
HIGH / NO	NO	YE / 09/29/2003	IN / 04/04/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
THE BOEING COMPANY - SSFL RMHF	CA3890090001	Dept. of Energy	5800 WOOLSEY CANYON ROAD SIMI VALLEY, CA, 93063					
HIGH	NO		NO		YE	09/29/2003	IN	04/04/2000
THE COLONELS FACTORY OUTLET OF AR INC	ARD980621288		720 S WOODS W MEMPHIS, AR, 72301					
MEDIUM	YES	09/08/2004	YES	09/08/2004	YE	09/08/2004	YE	09/30/2005
THE COLONELS FACTORY OUTLET OF ARK INC	ARD035663301		804 S WOODS ST W MEMPHIS, AR, 72301					
MEDIUM	YES	09/08/2004	YES	09/08/2004	YE	09/08/2004	YE	09/30/2005
THE DOW CHEMICAL COMPANY	MID005380258		4868 WILDER RD BAY CITY, MI, 48706					
HIGH	NO		NO		YE	03/13/2007	YE	03/13/2007
THE DOW CHEMICAL COMPANY	MID000724724		34 BUILDING MIDLAND, MI, 48667					
HIGH	NO		NO		IN	05/29/1998	YE	09/30/2003
THE DOW CHEMICAL COMPANY	CAD076528678		901 LOVERIDGE ROAD PITTSBURG, CA, 94565					
HIGH	NO		NO		YE	09/23/2003	YE	09/23/2005
THE DOW CHEMICAL COMPANY	GAD045929643		1468 PROSSER DRIVE S.E. DALTON, GA, 30721					
HIGH	NO		NO		YE	08/25/1997	YE	08/25/1997
THE DOW CHEMICAL COMPANY	TXD000017756		550 BATTLEGROUND RD LA PORTE, TX, 77571					
HIGH	YES	02/23/2006	YES	02/23/2006	YE	08/30/2002	YE	12/18/2003
THE DOW CHEMICAL COMPANY	TXD008092793		2301 N BRAZOSPORT BLVD STE B1226 FREEPORT, TX, 77541					
HIGH	YES	02/27/2007	NO		YE	12/30/2004	YE	03/22/2005
THE DOW CHEMICAL COMPANY 2005	LAD008187080		P.O. BOX 150 PLAQUEMINE, LA, 70765					
HIGH	NO		NO		YE	01/07/2000	YE	01/07/2000
THE ENSIGN-BICKFORD COMPANY	UTD041310962		8305 S HWY 6 SPANISH FORK, UT, 84660					
HIGH	NO		NO		YE	09/17/2004	YE	09/24/2001
THE LUBRIZOL CORPORATION	TXD041067638		41 TIDAL RD DEER PARK, TX, 77536					
HIGH	NO		NO		YE	04/23/2003	YE	04/29/2004
THE OBRIEN CORP.	CAD005130455		450 E GRAND AVE UNIT A SOUTH SAN FRANCISCO, CA, 94080					
MEDIUM	YES	09/25/2008	NO		YE	09/29/2000	YE	09/27/2004
THE PREMCOR REFINING GROUP INC	TXD008090409		1801 S GULFWAY DR PORT ARTHUR, TX, 77640					
HIGH	NO		NO		YE	02/28/2003	YE	02/28/2003
THE PROCTER & GAMBLE PAPER PRODUCTS CO	PAD014391874		ROUTE 87 MEHOOPANY, PA, 18629					
HIGH	NO		NO		YE	10/13/1999	YE	10/13/1999
THE SCOTTS COMPANY	OHD990834483		14111 SCOTTSLAWN ROAD MARYSVILLE, OH, 43041					
HIGH	YES	08/22/2007	NO		YE	12/20/2004	YE	04/16/2002
THE UNIVERSITY OF VIRGINIA	VAD000820712		515 EDGEMONT ROAD CHARLOTTESVILLE, VA, 22901					
HIGH	YES	03/01/2004	YES	03/01/2004	YE	10/04/2001	YE	06/06/2002
THOMAS & BETTS CORP	PAD002498699		PARK AVE & RIDGE RD PERKASIE, PA, 18944					
HIGH	NO		NO		YE	09/14/2006	YE	08/10/2007
THOMAS & BETTS FACILITY FORMER	MOD048835961		1525 WOODSON RD OVERLAND, MO, 63114					
LOW	YES	10/07/1997	YES	07/01/1998	YE	10/22/1999	YE	10/22/1999
THOMAS INDUSTRIES INC	KYD041165960		US HWY 231 SOUTH BEAVER DAM, KY, 42320					
HIGH	NO		NO		YE	08/26/2002	YE	09/11/2008
THOMAS STEEL STRIP	OHD077755213		DELAWARE AVENUE NW WARREN, OH, 444852699					
HIGH	NO		NO		YE	06/21/2001	YE	03/20/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
THOMPSON TOWN OF SANITARY LANDFILL	CTD000769729		PASAY RD NORTH GROSVENORDALE, CT, 06255
HIGH / NO	NO	YE / 08/25/2003	YE / 09/26/2001
THOMSON INC	OHD043736644		24200 US RTE 23 S CIRCLEVILLE, OH, 431139002
HIGH / NO	NO	YE / 09/26/2005	NO STATUS
THYSSEN KRUPP WAUPACA PLTS 2 & 3	WID006133441		1955 BRUNNER DR , WAUPACA, WI, 54981
MEDIUM / YES / 07/21/1999	YES / 09/13/2002	YE / 04/02/2001	YE / 04/02/2001
TICONA POLYMERS INC	TXD008113441		HIGHWAY 77 2 MI S OF BISHOP, TX, 78343
HIGH / YES / 08/17/2006	YES / 08/17/2006	YE / 01/20/2000	YE / 01/20/2000
TIMBER WHOLESALERS INC	MND066536988		RTE 1 WILLMAR, MN, 56201
MEDIUM / YES / 08/16/2006	YES / 08/16/2006	YE / 08/16/2006	YE / 08/16/2006
TIMEX CORP	CTD001165208		PARK RD EXT MIDDLEBURY, CT, 06762
HIGH / YES / 05/03/2000	YES / 01/14/2003	YE / 09/17/2002	YE / 09/17/2002
TIN INC	TXD000821199		600 A STREET DIBOLL, TX, 75941
HIGH / YES / 08/07/2008	YES / 08/07/2008	YE / 01/11/2002	YE / 09/18/2002
TINKER AIR FORCE BASE	OK1571724391 US Air Force		7701 ARNOLD STREET, SUITE 204, TINKER AFB, OK, 73145
HIGH / NO	NO	YE / 11/16/2000	NO / 11/16/2000
TM CORPUS CHRISTI SERVICES LLC	TXR000001016		6901 A GREENWOOD RD CORPUS CHRISTI, TX, 78415
HIGH / YES / 05/12/2008	YES / 05/12/2008	YE / 04/16/2008	YE / 04/16/2008
TOOELE ARMY DEPOT	UT3213820894 US Army		SJMTE-CS-EO TOOELE ARMY DEPOT, UT, 84074
HIGH / NO	NO	YE / 03/22/1999	YE / 04/01/2003
TOPOCK COMPRESSOR STATION	CAT080011729		15 MI E NEEDLES ON I 40 NEEDLES, CA, 92363
LOW / NO	NO	NO STATUS	YE / 09/19/2008
TOPPAN PHOTOMASKS INC	CTD001184324		4 FINANCE DRIVE DANBURY, CT, 06810
HIGH / YES / 04/26/2006	YES / 04/26/2006	YE / 09/29/1999	YE / 09/29/1999
TORRINGTON LANDFILL	CTD991289513		OLD DUMP RD TORRINGTON, CT, 06790
HIGH / NO	NO	IN / 04/13/2000	YE / 04/13/2000
TOSCO CORP AVON REF	CAD000072751		SOLANO WAY/WATERFRONT RD MARTINEZ (E OF), CA, 94553
HIGH / NO	NO	YE / 02/10/2003	YE / 09/24/2004
TOSCO CORP BAKERSFIELD REF	CAD000072769		6500 REFINERY AVE BAKERSFIELD, CA, 93308
HIGH / NO	NO	YE / 09/27/2002	YE / 09/29/2003
TOTAL PETROCHEMICALS USA INC	TXD008085185		201 W DODGE ST BRYAN, TX, 77801
HIGH / NO	NO	NO STATUS	YE / 04/01/2005
TOWSON UNIVERSITY	MDD050793926		8400 YORK RD ADMIN BLDG RM 103 TOWSON, MD, 21204
HIGH / YES / 04/28/1998	YES / 07/03/2000	YE / 03/11/1999	YE / 03/11/1999
TOXGON CORP SEATTLE	WAD061669644		631 S 96TH ST SEATTLE, WA, 981084914
HIGH / YES / 08/08/2002	YES / 04/10/2003	YE / 09/04/2002	YE / 09/04/2002
TR MILLER MILL COMPANY INC	ALD008161416		215 DEER STREET , BREWTON, AL, 36426
HIGH / YES / 09/30/2008	NO	YE / 09/30/1999	YE / 09/30/1999
TRAK MICROWAVE CORPORATION	FLD004093621		4726 EISENHOWER BLVD TAMPA, FL, 336346391
MEDIUM / YES / 05/20/2001	YES / 08/16/2006	YE / 08/16/2006	YE / 08/16/2006
TRANE CO	WID006161368		1700 HORTON ST LA CROSSE, WI, 54601
MEDIUM / NO	NO	YE / 09/17/2008	YE / 09/17/2008

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
TRANS-GLOBAL SOLUTIONS INC	TXD089792121		BLOCK & LEE ST PORT NECHES, TX, 77651
HIGH / YES / 02/08/2007	YES / 02/08/2007	YE / 09/01/2004	YE / 06/29/2004
TRANSIGN LLC	MID006007967		3777 AIRPORT RD WATERFORD, MI, 48329
LOW / NO	NO	YE / 08/25/2008	YE / 08/25/2008
TRANSTECHNOLOGY CORP SPACE ORD SYS DIV	CAD067776484		25977 SAND CANYON ROAD CANYON COUNTRY, CA, 91351
HIGH / YES / 08/30/1987	YES / 05/17/1993	YE / 08/11/2000	YE / 08/11/2000
TRC SPENT CATHODE STORAGE PILE	WVD988766127		ROUTE 2, SOUTH , RAVENSWOOD, WV, 26164
HIGH / NO	NO	YE / 07/02/2002	YE / 07/02/2002
TRI-STATE STEEL DRUM, INC	GAD033842543		400 JULIAN RD GRAYSVILLE, GA, 30726
HIGH / NO	NO	YE / 09/28/2005	YE / 02/25/2008
TRIAD INTERNATIONAL MAINT CORP	FLD004073177		102 SE ACADEMIC AVE LAKE CITY, FL, 320252002
HIGH / NO	NO	YE / 07/02/1997	YE / 03/14/2008
TRINITY HIGHWAY PRODUCTS LLC	UTD041075896		950 WEST 400 SOUTH CENTERVILLE, UT, 84037
HIGH / YES / 12/05/1996	YES / 05/23/2002	YE / 08/02/2001	YE / 08/02/2001
TRIUMVIRATE ENVIRONMENTAL, (NYC) LLC	NYD077444263		42-14 19TH AVENUE ASTORIA, NY, 11105
HIGH / YES / 11/07/2007	YES / 03/27/2008	YE / 09/30/2003	YE / 09/28/2005
TRONOX LLC	ILD020367561		2 WASHINGTON AVE MADISON, IL, 62060
HIGH / YES / 05/17/1996	YES / 05/22/2007	YE / 06/26/1997	YE / 06/26/1997
TRONOX LLC	MSD081387730		HIGHWAY 11 SOUTH MERIDIAN, MS, 39301
HIGH / NO	NO	YE / 09/28/2001	YE / 09/28/2001
TRONOX LLC	NVD008290330		8000 LAKE MEAD PKWY , HENDERSON, NV, 890156619
HIGH / YES / 12/14/2006	NO	YE / 09/27/2004	YE / 07/19/2005
TRONOX LLC	MOD007129406		2800 W HIGH ST , SPRINGFIELD, MO, 65803
HIGH / YES / 09/25/2002	YES / 03/26/2004	YE / 09/30/2003	YE / 09/28/2001
TRONOX LLC	TXD057111403		155 BUCHANAN RD TEXARKANA, TX, 75501
HIGH / NO	NO	YE / 03/20/2003	YE / 03/20/2003
TRONOX LLC KANSAS CITY FACILITY	MOD007128978		2300 OAKLAND , KANSAS CITY, MO, 64126
HIGH / NO	NO	YE / 09/30/2003	YE / 09/30/2003
TRONOX PIGMENTS (SAVANNAH) INC	GAD003282803		1 KERR-MCGEE ROAD , SAVANNAH, GA, 31402
HIGH / NO	NO	NO STATUS	NO STATUS
TRW AUTOMOTIVE US DANVILLE VALVE	PAD003037934		601 MARKET ST DANVILLE, PA, 17821
HIGH / NO	NO	YE / 09/30/2002	YE / 09/30/2002
TVA POWER SERVICE CENTER	AL2640090005		HWY 133N NEAR WILSON DAM MUSCLE SHOALS, AL, 356621010
HIGH / NO	NO	YE / 09/22/2003	YE / 09/06/2002
TXU GENERATION COMPANY LP	TXD020332078		FM 56 4.5 MI FROM GLEN ROSE, TX, 76043
HIGH / YES / 02/09/2006	YES / 02/09/2006	YE / 01/28/2000	YE / 01/28/2000
TYCO ELECTRONICS CORP BLDG 64	PAD041421223		10709 SUSQUEHANNA TRAIL RD 2 BOX 248B, GLEN ROCK, PA, 173279550
HIGH / YES / 09/30/1991	YES / 09/30/1991	YE / 07/03/2002	YE / 07/03/2002
TYCO SAFETY PRODUCTS - ANSUL STANTON ST	WID006125215		ONE STANTON ST MARINETTE, WI, 54143
HIGH / YES / 04/29/2008	NO	YE / 09/12/2005	IN / 02/29/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
U S ARMY FORT MCCOY	WI3210020563	US Army	FORT MCCOY SPARTA, WI, 546565000
HIGH / YES / 09/29/1997	NO	YE / 12/20/2001	YE / 09/02/2003
U S DEPT OF ENERGY - KANSAS CITY PLANT	MO9890010524	Dept. of Energy	2000 E 95TH ST KANSAS CITY, MO, 641313095
HIGH / YES / 09/29/2006	YES / 09/29/2006	YE / 07/24/2001	YE / 08/03/2001
U S NAVAL ACADEMY	MD0170022602	US Navy	194 KING GEORGE ST ANNAPOLIS, MD, 214025006
HIGH / NO	NO	YE / 09/15/2003	YE / 09/27/2002
U S STEEL CORP FAIRLESS WORKS	PAD002375376		60 ROEBLING RD USX INTERIOR RD N 133 & E 58, FAIRLESS HILLS, PA, 19030
HIGH / NO	NO	YE / 04/16/2004	IN / 08/10/1995
U.S. ARMY GARRISON FORT KNOX	KY6210020479	US Army	US HWY 31 WEST FORT KNOX, KY, 40121
MEDIUM / NO	NO	YE / 09/29/2006	YE / 09/29/2006
U.S. ARMY GARRISON, FORT A.P. HILL	VA2210020416	US Army	19952 NORTH RANGE ROAD FORT A.P. HILL, VA, 22427
HIGH / NO	NO	YE / 07/29/2003	YE / 09/28/2004
U.S. ARMY-WATERVLIET ARSENAL	NY7213820940	US Army	BUFFINGTON STREET AMSTA-WV-IMP -E, WATERVLIET, NY, 1121894000
HIGH / NO	NO	YE / 09/30/2003	YE / 09/28/2005
U.S. DEPARTMENT OF ENERGY, WEST VALLEY D	NYD980779540	Dept. of Energy	ROCK SPRINGS ROAD WEST VALLEY, NY, 141719799
HIGH / NO	NO	YE / 09/30/1999	YE / 09/30/1999
U.S. NNSA/DOE LOS ALAMOS NATIONAL LAB.	NM0890010515	Dept. of Energy	PO BOX 1663, MS K490 LOS ALAMOS, NM, 87545
HIGH / NO	NO	IN / 05/14/1996	IN / 07/29/1997
UGN INC	KYD054272554		33605 HIGHWAY 1247 SOMERSET, KY, 42502
MEDIUM / YES / 01/10/2002	YES / 01/10/2002	YE / 06/25/2001	YE / 06/25/2001
UNILEVER BESTFOODS	NJD000692327		TAYLORTOWN ROAD MONTVILLE, NJ, 07632
HIGH / NO	NO	YE / 09/30/2005	NO STATUS
UNION CARBIDE CARIBE LLC	PRD980594618		HWY#127 KM 17.3 PENUELAS, PR, 00624
HIGH / NO	NO	YE / 09/30/2003	YE / 09/30/2003
UNION CARBIDE CORP WOODBINE	GAD981235294		5954 HARRIETTS BLUFF RD , WOODBINE, GA, 31569
LOW / YES / 02/14/2006	NO	YE / 09/25/2001	YE / 09/25/2001
UNION CARBIDE CORP. - TECHNICAL CENTER	WVD060682291		3200 KANAWHA TURNPIKE SOUTH CHARLESTON, WV, 25303
HIGH / NO	NO	YE / 05/22/2003	YE / 08/25/2005
UNION CARBIDE CORPORATION	TXD000461533		3301 5TH AVE S TEXAS CITY, TX, 77592
MEDIUM / YES / 07/29/2008	NO	YE / 04/21/2005	IN / 04/02/2007
UNION CARBIDE CORPORATION	TXD041515420		7501 STATE HIGHWAY 185 N SEADRIFT, TX, 77983
MEDIUM / YES / 07/28/2008	NO	YE / 01/13/2000	YE / 01/13/2000
UNION CARBIDE CORPORATION	TXD008114092		HIGHWAY 48 2.5 MILES EAST OF H BROWNSVILLE, TX, 78521
HIGH / YES / 01/10/2006	YES / 01/10/2006	YE / 01/13/2000	YE / 01/13/2000
UNION CARBIDE CORPORATION	WVD005005483		437 MACCORKLE AVENUE SOUTH CHARLESTON, WV, 25303
HIGH / NO	NO	YE / 08/25/2005	YE / 08/25/2005
UNION FOUNDRY COMPANY	ALD047158266		1501 WEST 17TH STREET , ANNISTON, AL, 36201
MEDIUM / YES / 10/27/2006	YES / 10/27/2006	YE / 05/22/2006	YE / 05/22/2006
UNION PACIFIC RAILROAD	NED000829754		9TH & CASS 12TH & WEBSTER?, OMAHA, NE, 68179
HIGH / YES / 09/27/2007	NO	YE / 09/15/2008	YE / 07/24/2006

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
UNION PACIFIC RAILROAD COMPANY	TXD000820266		4910 LIBERTY ROAD HOUSTON, TX, 77026					
HIGH	NO		NO		YE	07/29/2004	YE	07/29/2004
UNION PACIFIC ROSEVILLE	CAD000628255		9451 ATKINSON ST ROSEVILLE, CA, 95747					
HIGH	NO		NO		YE	08/11/2000	YE	05/09/2008
UNION PACIFIC SACRAMENTO YARD	CAD073772030		501 JIBBOOM ST SACRAMENTO, CA, 95814					
HIGH	NO		NO		YE	01/09/2004	YE	03/26/2008
UNITANK TERMINAL SERVICE	PAD087098653		ALLEGHENY AVE & DELAWARE RIVE PHILADELPHIA, PA, 19134					
HIGH	NO		NO		YE	03/22/2004	NO STATUS	
UNITED TECHNOLOGIES CORPORATION	CAD001705235		600 METCALF ROAD SAN JOSE, CA, 95138					
HIGH	NO		NO		YE	09/16/2003	YE	09/16/2003
UNITED TECHNOLOGIES CORPORATION - PRATT	FLD001447952		17900 BEE LINE HWY SR 710, JUPITER, FL, 334786414					
HIGH	YES	03/06/2007	YES	09/09/2008	YE	09/29/2000	YE	09/29/2000
UNIV OF IL MAIN CAMPUS	ILD041544081		101 S GREGORY ST URBANA, IL, 61801					
HIGH	YES	03/29/2006	YES	05/21/2007	YE	09/27/2000	YE	09/27/2000
UNIVAR USA INC	WAD009236811		4515 WISCONSIN AVE E SPOKANE, WA, 99212					
HIGH	YES	08/24/1994	YES	09/27/1994	YE	03/18/1999	YE	03/18/1999
UNIVAR USA INC	ORD009227398		3950 NW YEON AVE PORTLAND, OR, 97210					
HIGH	YES	09/29/2006	NO		YE	07/15/2002	YE	06/12/2003
UNIVAR USA INC	PAD061779815		6000 CASTEEL DR CORAOPOLIS, PA, 15108					
HIGH	NO		NO		YE	06/21/1999	YE	06/21/1999
UNIVAR USA INC	NED000809483		3002 F ST OMAHA, NE, 681071599					
HIGH	YES	06/01/1998	YES	06/01/1998	YE	12/09/1999	YE	12/09/1999
UNIVAR USA INC	IAT200010916		CASH & SILVER STS BURLINGTON, IA, 52601					
HIGH	NO		NO		YE	07/10/2003	YE	10/05/2004
UNIVAR USA INC	NED986375327		4120 BUCKINGHAM PLACE OMAHA, NE, 68107					
HIGH	YES	06/16/2005	YES	02/16/2007	YE	02/16/2001	YE	02/16/2001
UNIVAR USA INC - SOUTH BEND	IND016627333		59865 MARKET ST SOUTH BEND, IN, 466144026					
HIGH	NO		NO		YE	09/11/2003	YE	08/25/2004
UNIVAR USA INC.	VAD003111416		825 FISHER ST MARTINSVILLE, VA, 24115					
MEDIUM	NO		NO		YE	09/15/2008	YE	09/15/2008
UNIVAR USA INC.- SAN JOSE	CAD010925576		2256 JUNCTION AVENUE SAN JOSE, CA, 95131					
HIGH	YES	09/18/1991	YES	07/15/1993	YE	12/28/2000	YE	12/28/2000
UNIVERSAL ALUMINUM EXTRUSION CORP	NJD046554655		CANELE DR OFF DELILAH RD EGG HARBOR TWP, NJ, 08232					
HIGH	NO		NO		YE	08/06/2007	NO STATUS	
UNIVERSAL PROPULSION CO INC (UPCO)	AZD980814479		25401 N CENTRAL AVE , PHOENIX, AZ, 85085					
LOW	NO		NO		YE	09/22/2008	NO STATUS	
UNIVERSITY OF ALASKA FAIRBANKS	AKD048679567		TANANA DRIVE , FAIRBANKS, AK, 99775					
HIGH	YES	03/18/2003	YES	03/18/2003	YE	03/17/2003	YE	03/17/2003
UNIVERSITY OF FLORIDA	FLD000823393		SURGE AREA DRIVE BLDG 831, GAINESVILLE, FL, 32611					
MEDIUM	NO		NO		IN	09/30/1997	NO	09/30/1997
UNIVERSITY OF GEORGIA	GAD073460941		WILL HUNTER RD ATHENS, GA, 30602					
HIGH	NO		NO		YE	09/28/1999	YE	02/25/2008

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
UNIVERSITY OF MARYLAND	MDD980829873		REGENTS DRIVE COLLEGE PARK, MD, 20742
HIGH NO	NO	YE 05/04/1999	YE 02/01/2001
UNIVERSITY OF MICHIGAN	MIR000001834		8501 BECK RD BELLEVILLE, MI, 48111
MEDIUM YES 09/21/2006	YES 10/20/2004	YE 09/21/2006	YE 07/11/2005
UPRR LARAMIE WY TIMBER TREATING PLANT	WYD061112470		2736 FORT SANDERS DRIVE LARAMIE, WY, 82070
HIGH YES 06/18/1999	YES 09/20/2001	YE 12/23/2003	YE 12/23/2003
URETECH INTERNATIONAL INC	OHD043642958		21200 LUCKEY RD LUCKEY, OH, 43443
HIGH NO	NO	YE 09/29/2006	NO STATUS
US AIR FORCE MELROSE RANGE	NM5572124456 US Air Force		25M W OF CANNON AFB MELROSE, NM, 88124
MEDIUM NO	NO	YE 03/22/2007	YE 03/22/2007
US AIR FORCE PLANT #3 MCDONNELL DOUGLAS	OK9570000001 US Air Force		2000 N MEMORIAL DR TULSA, OK, 74115
HIGH YES 09/24/1998	YES 10/06/1998	YE 11/16/2000	YE 11/16/2000
US AIR FORCE PLANT - PJKS	CO7570090038 US Air Force		12257 S. WADSWORTH BLVD LITTLETON, CO, 80125
HIGH NO	NO	YE 10/01/2001	YE 09/27/2002
US ARMY BADGER AMMUNITION PLT	WI9210020054 US Army		2 BADGER RD BARABOO, WI, 53913
HIGH NO	NO	YE 02/12/2002	YE 01/31/2000
US ARMY ENGINEER PROVING GROUND	VA1210000906 US Army		7500 BACKLICK RD , SPRINGFIELD, VA, 22015
MEDIUM NO	NO	NO STATUS	NO STATUS
US ARMY FORT POLK	LA0214022725 US Army		1647 23RD ST BLDG 2516 , FT POLK, LA, 71459
HIGH NO	NO	YE 03/28/2002	YE 03/28/2002
US ARMY GARRISON FORT BELVOIR	VA7213720082 US Army		9430 JACKSON LOOP SUITE 107 FORT BELVOIR, VA, 22060
HIGH NO	NO	NO STATUS	NO STATUS
US ARMY HQ I CORPS & FORT LEWIS	WA9214053465 US Army		HQI CORPS AFZH DEQ BLDG 9673 FT LEWIS, WA, 984335000
HIGH NO	NO	YE 09/29/2005	YE 09/29/2005
US ARMY IND ARMY AMMO PLT	IN9210020443 US Army		11450 HWY 62 CHARLESTOWN, IN, 47111
HIGH YES 01/01/1995	YES 07/11/2008	YE 09/14/2004	NO STATUS
US CERAMIC TILE CO (LAUFEN)	OHD077752566		10233 SANDYVILLE RD SE EAST SPARTA, OH, 44626
HIGH NO	NO	NO STATUS	IN 12/10/1999
US DEPARTMENT OF ENERGY	TX4890110527 Dept. of Energy		955 FM 2373 PANHANDLE, TX, 79068
HIGH NO	NO	YE 08/29/2005	YE 08/29/2005
US DEPARTMENT OF THE AIR FORCE	TX8571524091 US Air Force		9801 REESE BLVD LUBBOCK, TX, 79407
HIGH YES 08/11/2006	YES 08/11/2006	YE 02/02/2000	YE 02/02/2000
US DEPARTMENT OF THE AIR FORCE	TX2571524105 US Air Force		251 FOURTH ST 47 CES CEVC DEL RIO, TX, 78843
HIGH NO	NO	YE 05/24/2005	IN 06/27/1996
US DEPARTMENT OF THE AIR FORCE	TX2571724333 US Air Force		KELLY AFB SAN ANTONIO, TX, 78241
HIGH YES 08/22/2008	NO	YE 07/27/2004	YE 07/27/2004
US DEPARTMENT OF THE AIR FORCE	TX3571524161 US Air Force		231 9TH AVE BLDG 1402 82 CES CEV SHEPPARD AFB, TX, 76311
HIGH YES 02/26/2007	YES 02/26/2007	YE 08/29/2003	YE 08/29/2003
US DEPARTMENT OF THE AIR FORCE	TX3571924643 US Air Force		710 3RD ST DYESS AFB, TX, 79607
HIGH YES 08/10/2006	YES 08/10/2006	YE 01/20/2000	YE 01/20/2000
US DEPARTMENT OF THE AIR FORCE	TX6570024939 US Air Force		300 DRMO CIR BLDG 3050 KELLY AFB SAN ANTONIO, TX, 78226
HIGH YES 02/10/2006	YES 02/10/2006	YE 08/28/2002	YE 07/27/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion	Date	HE Controlled / Date / GW Controlled / Date
US DEPARTMENT OF THE ARMY	TX7213821831	US Army	US HIGHWAY 82 W TEXARKANA, TX, 75501
HIGH / YES / 08/15/2006	NO		YE / 04/29/2004 / YE / 04/29/2004
US DEPARTMENT OF THE ARMY	TX8214020424	US Army	4213 S 77TH ST BLDG 1348 FORT HOOD, TX, 76544
HIGH / YES / 02/15/2007	YES	02/15/2007	YE / 02/10/2000 / YE / 02/10/2000
US DEPARTMENT OF THE ARMY	TX4213720101	US Army	1733 PLEASONTON RD BIGGS ARMY AIRFI EL PASO, TX, 79916
HIGH / NO	NO		YE / 08/30/2002 / YE / 01/25/2000
US DEPARTMENT OF THE NAVY	TX3170024738	US Navy	SW 202 5 MI E CHASE FIELD BEEVILLE, TX, 78103
HIGH / YES / 08/10/2006	YES	08/10/2006	YE / 01/20/2000 / YE / 01/20/2000
US DEPARTMENT OF THE NAVY	TX0571924042	US Navy	CARSWELL AFB BLDG 1215 FORT WORTH, TX, 76127
HIGH / YES / 07/21/2006	YES	07/21/2006	YE / 08/30/2002 / YE / 08/30/2002
US DEPT OF ENERGY HANFORD FACILITY	WA7890008967	Dept. of Energy	HANFORD FACILITY RICHLAND, WA, 99352
HIGH / NO	NO		YE / 08/10/2000 / NO / 07/06/2000
US DEPT/DEFENSE	MID099113128		28900 SELFRIDGE AVE SELFRIDGE ANGB, MI, 48045
HIGH / NO	NO		YE / 09/29/2004 / NO STATUS
US DOD USAF ROBINS AIR FORCE BASE	GA1570024330	US Air Force	775 MACON ST ROBINS AFB, GA, 310982201
HIGH / YES / 09/29/2006	YES	09/24/2007	YE / 01/18/2005 / YE / 09/24/1998
US DOE WASTE ISOLATION PILOT PLANT	NM4890139088	Dept. of Energy	32 MILES SOUTHEAST OF CARLSBAD , JAL HIGHWAY, CARLSBAD, NM, 88220
LOW / NO	NO		YE / 03/20/2007 / YE / 03/20/2007
US ECOLOGY INC	ILD045063450		13279 350 E ST P O BOX 158, SHEFFIELD, IL, 61361
HIGH / YES / 10/19/1990	YES	08/07/2000	YE / 01/06/2000 / YE / 01/06/2000
US ECOLOGY NEVADA	NVT330010000		11 MILES S OF BEATTY HWY 95 , BEATTY, NV, 89003
LOW / NO	NO		YE / 05/26/1999 / YE / 05/26/1999
US ECOLOGY TEXAS INC	TXD069452340		3277 COUNTY ROAD 69 ROBSTOWN, TX, 78380
HIGH / YES / 02/28/2006	YES	02/28/2006	YE / 01/31/2000 / YE / 01/31/2000
US ENERGY DEPT KNOLLS ATOMIC POWER LAB	CT6890113792	Dept. of Energy	1900 DAY HILL RD WINDSOR, CT, 06095
HIGH / YES / 07/20/2006	YES	07/20/2006	YE / 08/19/1999 / YE / 08/19/1999
US NAMEPLATE CO	IAD054758958		HWY 30 W MOUNT VERNON, IA, 52314
HIGH / NO	NO		YE / 09/26/2002 / YE / 09/29/2004
US NASA / LOCKHEED MARTIN	LA4800014587	NASA	13800 OLD GENTILLY ROAD NEW ORLEANS, LA, 70129
HIGH / NO	NO		YE / 03/30/2001 / YE / 09/20/2001
US NAVAL SUPPORT ACTIVITY CRANE DIV	IN5170023498	US Navy	300 HWY 361 BLDG 3260 CODE PRCR4, CRANE, IN, 475225009
HIGH / NO	NO		YE / 09/01/2005 / IN / 08/28/1997
US NAVY, LONG BEACH NAVAL SHIPYARD	CA6170023109	US Navy	LONG BEACH NAVAL SHIPYARD LONG BEACH, CA, 90822
HIGH / NO	NO		YE / 03/09/2001 / YE / 08/19/2003
US PIPE AND FOUNDRY CO LLC	ALD004017869		2023 SAINT LOUIS AVENUE , BESSEMER, AL, 35020
LOW / YES / 10/22/2004	YES	01/21/2005	YE / 09/10/2001 / YE / 09/10/2001
US STEEL - GARY WORKS	IND005444062		1 N BROADWAY GARY, IN, 46402
HIGH / NO	NO		YE / 09/27/2005 / NO STATUS
US STEEL FAIRFIELD WORKS	ALD002904506		5700 VALLEY ROAD , FAIRFIELD, AL, 35064
HIGH / NO	NO		YE / 09/23/2005 / IN / 09/23/2005
US STEEL TUBULAR PRODUCTS INC	TXD007323397		6866 US HIGHWAY 259 S LONE STAR, TX, 75668
HIGH / YES / 08/22/2008	YES	08/22/2008	YE / 08/05/2004 / YE / 12/21/2004

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address	NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
USADACENFB	NM4213720101	US Army	9509 HAWK ROAD MCGREGOR RANGE CAMP, NM, 88342									
				HIGH	NO		NO		YE	06/29/2001	YE	12/13/2002
USAF VANCE AFB	OK4571524095	US Air Force	246 BROWN PARKWAY SUITE 230, VANCE AFB, OK, 737055621									
				HIGH	NO		NO		YE	06/06/2001	YE	06/06/2001
USAF - DAVIS MONTHAN AFB	AZ4570024055	US Air Force	HEADQUARTERS 836TH TAC DAVIS MONTHAN AFB, AZ, 85707									
				HIGH	YES	09/22/2008	NO		YE	09/27/2001	YE	09/27/2001
USAF - NELLIS AIR FORCE BASE (NAFB)	NV7570024110	US Air Force	4340 GRISSOM AVE STE 101 NELLIS AFB, NV, 89191									
				HIGH	NO		NO		YE	05/26/1999	YE	05/26/1999
USAF 96 CEG/CEV	FL8570024366	US Air Force	501 DELEON ST SUITE 101 EGLIN AFB, FL, 325425105									
				HIGH	YES	11/27/2000	NO		YE	12/12/2001	YE	12/12/2001
USAF AFRPA MYRTLE BEACH	SC7570024821	US Air Force	1048 AERODROME BLVD MYRTLE BEACH, SC, 29577									
				HIGH	NO		NO		YE	08/30/2002	YE	09/30/2004
USAF DETACHMENT 1 15TH AIR BASE WING	TT9570090002	US Air Force	JOHNSTON ATOLL PACIFIC OCEAN, TT, 96588									
				HIGH	NO		NO		YE	07/07/2000	YE	05/13/1999
USAF-CHARLESTON AIR FORCE BASE	SC3570024460	US Air Force	437 ABG DEEV CHARLESTON AFB, SC, 29404									
				HIGH	NO		NO		YE	08/26/2002	YE	06/30/2003
USAF-SHAW AIR FORCE BASE	SC7570024466	US Air Force	345 CULLEN ST SHAW AFB, SC, 29152									
				HIGH	NO		NO		YE	09/10/2001	YE	09/10/2001
USAR COMBINED ARMS CTR & FT LEAVENWORTH	KS4213720499	US Army	853 W WAREHOUSE RD HW STORAGE FAC, FORT LEAVENWORTH, KS, 660271361									
				HIGH	NO		NO		NO STATUS		YE	12/11/2006
USATC & FORT JACKSON	SC3210020449	US Army	BLDG 1916 OFF EWELL RD FORT JACKSON, SC, 29207									
				HIGH	NO		NO		YE	09/29/2000	YE	09/29/2000
USCG SUPPORT CENTER ELIZABETH CITY	NC2690308232	Dept. of Trans.	1664 WEEKSVILLE ROAD NC HWY 34 SOUTH, ELIZABETH CITY, NC, 27909									
				HIGH	NO		NO		YE	08/31/2005	YE	07/18/2006
USDHS CG INTEGRATD SUPPRT COMMAND KODIAK	AK9690330742	Dept. of Trans.	ANTON LARSON BAY RD AND REZANOF HWY, KODIAK, AK, 99619									
				HIGH	NO		NO		YE	07/28/2003	IN	08/12/2004
USDLA DRMO GUAM	GU6170027316	US Navy	SUMAY DRIVE DRMO NAVACTS AGANA, GU, 96932									
				HIGH	NO		NO		YE	09/17/2001	YE	09/17/2001
USDOD - USAF 18 ASOG DET 1 OLA	FL8572128587	US Air Force	29 SOUTH BLVD AVON PARK, FL, 338259381									
				HIGH	NO		NO		YE	06/03/2003	YE	06/03/2003
USDOE PINELLAS PLANT - MARTIN MARIETTA	FL6890090008	Dept. of Energy	7887 BRYAN DAIRY RD LARGO, FL, 337771444									
				HIGH	NO		NO		YE	09/09/2003	YE	09/16/2002
USMC AIR STATION TUSTIN	CA9170090022	US Marines	MCAS TUSTIN TUSTIN, CA, 92710									
				HIGH	NO		NO		YE	02/13/2003	YE	07/30/2003
USN - MAYPORT	FL9170024260	US Navy	B 2021 BON HOMME RICHARD ST NAVAL STATION MAYPORT, MAYPORT, FL, 32228									
				HIGH	NO		NO		YE	09/09/1997	YE	09/04/2001
USS LEAD REFINERY INC	IND047030226		5300 KENNEDY AVE EAST CHICAGO, IN, 46312									
				HIGH	NO		NO		YE	09/30/2004	NO STATUS	

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
USS-POSCO INDUSTRIES	CAD009150194		900 LOVERIDGE ROAD PITTSBURG, CA, 94565					
HIGH	YES	09/26/2002	YES	03/04/2005	YE	04/18/2000	YE	04/18/2000
UTC PRATT & WHITNEY	CTD003935905		400 AIRCRAFT ROAD MIDDLETOWN, CT, 064575733					
HIGH	NO		NO		YE	07/25/2005	YE	06/04/2007
UTILITY MANUFACTURING CO	MAD001116078		2443 BOSTON RD WILBRAHAM, MA, 01095					
HIGH	NO		NO		YE	09/26/2001	YE	09/26/2001
UVONICS CO INC	OHD081313744		2162 MCKINLEY AVE COLUMBUS, OH, 43204					
HIGH	YES	08/02/2006	YES	08/02/2006	YE	08/02/2006	YE	08/02/2006
VALBRUNA SLATER STAINLESS INC	IND005447537		2400 W TAYLOR ST FT WAYNE, IN, 46802					
HIGH	NO		NO		NO	10/11/2000	NO	10/11/2000
VALERO REFINING CO OKLA DBA VALERO ARDM	OKD057705972		HWY 142 BYPASS ARDMORE, OK, 73401					
HIGH	NO		NO		YE	01/11/2001	IN	01/11/2001
VALERO ST. CHARLES REFINERY	LAD000225862		14902 RIVER ROAD NORCO, LA, 70079					
HIGH	NO		NO		YE	06/25/2004	YE	06/30/2004
VALLEY CORES	OHD981956618		1800 AND 1/2 ALLEN AVE SE CANTON, OH, 44709					
HIGH	NO		NO		YE	03/30/2006	YE	03/30/2006
VALLEY PLATING	CAD055556062		3872 EL CAJON CENTRAL VALLEY, CA, 96019					
HIGH	YES	08/18/2006	YES	08/18/2006	YE	08/11/2000	YE	08/11/2000
VALMONT INDUSTRIES INC	NED007267214		7002 N 288TH ST VALLEY, NE, 68064					
MEDIUM	YES	09/17/2008	YES	09/17/2008	YE	09/22/2003	YE	05/27/2003
VALSPAR CORP THE	ILD081040107		1330 S KILBOURN AVE CHICAGO, IL, 60623					
HIGH	YES	04/12/1996	YES	11/23/1998	YE	11/23/1998	YE	11/23/1998
VANDENBERG AIR FORCE BASE	CA9570025149	US Air Force	1515 ICELAND AVENUE RM. 181-C, VANDENBERG AFB, CA, 93437					
HIGH	NO		NO		YE	11/12/2002	NO	12/28/2000
VANDERBILT CHEMICAL CORPORATION	CTD001181205		31 TAYLOR AVE BETHEL, CT, 06801					
HIGH	NO		NO		YE	09/20/2004	NO	05/09/1997
VARIAN N M R INSTRUMENTS	CAD009120817		3120 HANSEN WY PALO ALTO, CA, 943041030					
MEDIUM	YES	01/05/1995	YES	08/21/1997	YE	08/11/2000	YE	08/11/2000
VARLEY PRODUCTS CO	ILD982635534		1 N RAILROAD CRYSTAL LAKE, IL, 60014					
HIGH	YES	09/27/2007	YES	09/27/2007	YE	12/07/1999	YE	12/07/1999
VDOT CULPEPER DISTRICT COMPLEX	VAD980715064		1601 ORANGE ROAD CULPEPER, VA, 22701					
LOW	NO		NO		YE	09/28/2006	IN	09/21/2006
VELSICOL CHEMICAL	TND007024664		1199 WARFORD STREET MEMPHIS, TN, 38108					
HIGH	NO		YES	02/09/2000	NO	09/30/1996	NO	09/30/1996
VELSICOL CHEMICAL CORP.	TND061314803		4902 CENTRAL AVENUE CHATTANOOGA, TN, 37410					
HIGH	NO		NO		YE	08/24/2000	YE	09/29/2000
VEOLIA ES TECHNICAL SOLUTIONS LLC	GAD096629282		5371 COOK ROAD MORROW, GA, 30260					
HIGH	YES	03/14/2003	NO		YE	09/20/2002	YE	09/20/2002
VEOLIA ES TECHNICAL SOLUTIONS LLC	CAD008302903		1704 W 1ST ST AZUSA, CA, 91702					
HIGH	NO		NO		YE	03/29/2002	YE	07/11/2005
VEOLIA ES TECHNICAL SOLUTIONS LLC	NJD002454544		125 FACTORY LANE MIDDLESEX, NJ, 08846					
HIGH	NO		NO		YE	09/29/2004	YE	09/30/2005

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
VERNAY LABORATORIES INC	OHD004243002		875 DAYTON STREET YELLOW SPRINGS, OH, 45387
HIGH / NO	NO	YE / 09/26/2008	YE / 09/26/2008
VERTELLUS SPECIALTIES INC. (WAS REILLY)	UTD009087644		2555 SOUTH INDUSTRIAL PARKWAY , PROVO, UT, 84605
HIGH / NO	NO	YE / 09/27/2005	IN / 09/16/1996
VIASYSTEMS TECH CORP LLC	VAD066000993		4500 LABURNUM AVE RICHMOND, VA, 23231
HIGH / YES / 09/24/1996	YES / 07/10/1997	YE / 03/31/2000	YE / 08/24/2004
VICKERY ENVIRONMENTAL INC	OHD020273819		3956 STATE ROUTE 412 VICKERY, OH, 43464
HIGH / NO	NO	YE / 09/27/2002	YE / 03/31/2004
VIRGINIA EMER FUEL STORAGE FAC	VAD988193223		JUNCTION VA RTS 641 & 199 YORKTOWN, VA, 23690
HIGH / YES / 04/15/1996	YES / 05/01/2002	YE / 11/05/1999	YE / 11/05/1999
VIRGINIA INDUSTRIES INC	CTD001164334		30 KNOTTER DR CHESHIRE, CT, 06410
HIGH / NO	NO	YE / 05/23/2000	YE / 10/23/2003
VISHAY SPRAGUE INC	MED077469864		1754 MAIN STREET SANFORD, ME, 04073
HIGH / YES / 10/01/2007	NO	YE / 01/29/2008	YE / 09/30/2008
VISHAY VITRAMON INC	CTD001186212		10 MAIN ST RTE 25 MONROE, CT, 06468
HIGH / NO	NO	YE / 07/25/2005	YE / 09/09/2005
VISION PROPERTIES BLUE ISLAND	ILD005109525		128TH & KEDZIE AVE BLUE ISLAND, IL, 60406
HIGH / NO	NO	YE / 05/09/2003	YE / 09/28/2004
VOGEL DISPOSAL SRVC	PAD005820691		421 HARTMANN RD EVANS CITY, PA, 16033
HIGH / NO	NO	YE / 09/20/2002	YE / 09/20/2002
VOLUNTEER ARMY AMMUNITION PLANT	TN6210020933	US Army	8395 HICKORY VALLEY ROAD CHATTANOOGA, TN, 37421
LOW / NO	NO	YE / 09/15/2005	YE / 09/15/2005
VON ROLL USA INC	NYD052987096		200 VON ROLL DR SCHENECTADY, NY, 123062442
HIGH / NO	NO	YE / 09/30/2005	YE / 09/29/2006
VOUGHT AIRCRAFT INDUSTRIES INC	GAD078106846		90 HIGHWAY 22 WEST MILLEDGEVILLE, GA, 31061
LOW / YES / 02/19/2001	NO	YE / 09/29/2006	YE / 09/13/2007
VOUGHT AIRCRAFT INDUSTRIES INC	FLD043117522		1801 SE AIRPORT RD STUART, FL, 349964012
HIGH / YES / 09/25/1997	YES / 09/18/2006	YE / 09/30/1998	YE / 09/30/1998
VOUGHT AIRCRAFT INDUSTRIES INC	TX6170022770	US Navy	9314 W JEFFERSON BLVD DALLAS, TX, 75211
HIGH / NO	NO	YE / 04/15/2005	YE / 09/24/2002
W M W I - METRO RECYCLING & DISPOSAL	WID098547854		10712 S 124TH ST FRANKLIN, WI, 53132
HIGH / YES / 04/19/1991	YES / 04/19/1991	YE / 06/23/1988	YE / 06/23/1988
W M W I - OMEGA HILLS LF	WID000808568		N96 W12730 COUNTY LINE RD GERMANTOWN, WI, 53022
HIGH / YES / 09/20/1993	YES / 09/27/1995	YE / 09/09/2002	YE / 09/09/2002
W.R. GRACE & CO. - CONN	MDD074933961		7500 GRACE DRIVE COLUMBIA, MD, 210444098
HIGH / YES / 09/14/2006	NO	YE / 06/13/2001	YE / 06/13/2001
WABTEC MOTIVEPOWER	IDD980976831		4600 APPLE ST , BOISE, ID, 83716
HIGH / YES / 04/05/2007	YES / 04/05/2007	YE / 04/18/2006	YE / 04/18/2006
WACKER CHEMICAL CORP	MID075400671		3301 SUTTON RD ADRIAN, MI, 49221
HIGH / YES / 11/02/2007	NO	YE / 09/27/2007	YE / 09/14/2007
WAH CHANG	ORD050955848		1600 OLD SALEM RD NE ALBANY, OR, 97321
HIGH / YES / 06/01/1993	YES / 07/01/1993	YE / 03/12/2002	YE / 03/12/2002

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
WALD LLC	KYD980600043		1 MI OFF HWY 10 E OF HWY 1449 MAYSVILLE, KY, 41056					
HIGH	YES	05/31/2006	YES	05/31/2006	YE	08/24/1998	YE	08/24/1998
WALTON & LONSBURY INC	MAD001197755		78 NORTH AVE ATTLEBORO, MA, 02703					
HIGH	NO		NO		YE	05/19/2006	YE	09/30/2008
WAMPUS MILFORD ASSOCIATES LLC	CTD001453232		80 WAMPUS LN MILFORD, CT, 06460					
HIGH	NO		NO		NO	08/26/1996	YE	09/10/2002
WARD LEONARD ELECTRIC CO	CTD058865072		401 WATERTOWN ROAD , THOMASTON, CT, 06787					
HIGH	NO		NO		YE	09/28/2001	YE	09/29/2000
WARING PRODUCTS A CTS COMPANY	CTD001157049		283 MAIN ST NEW HARTFORD, CT, 06057					
HIGH	NO		NO		YE	06/21/2001	YE	03/18/2002
WARNER LAMBERT COMPANY LLC	MID006013643		188 HOWARD AVE HOLLAND, MI, 49424					
MEDIUM	NO		NO		YE	11/13/2003	YE	09/21/2004
WARRENDALE PLATING CO	PAD004386629		MARS VALENCIA ROAD MARS, PA, 16046					
HIGH	YES	03/27/2001	YES	03/27/2001	YE	07/21/2000	YE	07/21/2000
WASHINGTON DULLES INTERNATIONAL AIRPORT	VA6690500909		STONECROFT ROAD DULLES, VA, 20166					
MEDIUM	NO		NO		YE	04/09/2008	NO STATUS	
WASHTENAW INDUSTRIAL FACILITY LLC	MID980795512		232 MONROE ST SALINE, MI, 48176					
HIGH	NO		NO		YE	09/25/2008	NO STATUS	
WATERBURY CO INC	CTD001165695		64 AVENUE OF INDUSTRY WATERBURY, CT, 06705					
HIGH	YES	04/18/2006	NO		YE	08/02/1999	YE	08/02/1999
WATERBURY ROLLING MILLS	CTD001164607		240 EAST AURORA STREET WATERBURY, CT, 06708					
HIGH	NO		NO		YE	09/26/2005	YE	08/18/2008
WATERTOWN TOWN OF SANITARY LANDFILL	CTD991289398		OLD BAIRD RD WATERTOWN, CT, 06795					
HIGH	NO		NO		YE	09/20/2005	NO	07/18/1995
WAYNE DIV DRESSER EQUIP GROUP	MDD044147098		124 W COLLEGE AVE SALISBURY, MD, 21804					
HIGH	NO		NO		YE	06/04/2004	YE	09/27/2004
WEST COUNTY LANDFILL, INC	CAD041844002		FOOT OF PARR BLVD RICHMOND, CA, 94801					
HIGH	YES	03/25/2008	NO		YE	12/28/2000	YE	06/13/2002
WESTERN BERKS COMM LDFL & RECYC CTR LLC	PAD000443705		455 POPLAR NECK RD CUMRU TWP, BIRDSBORO, PA, 19508					
HIGH	NO		NO		YE	04/16/2003	YE	04/16/2003
WESTERN NY NUCLEAR SERVICE CENTER	NYD986905545		10282 ROCK SPRINGS RD ASHFORD, NY, 14171					
HIGH	NO		NO		YE	09/28/1999	YE	09/28/1999
WESTERN REFINING COMPANY LP	TXD007399637		6500 TROWBRIDGE ROAD EL PASO, TX, 79905					
HIGH	YES	02/26/2007	YES	08/20/2008	YE	08/11/2004	YE	08/26/2003
WESTERN REFINING SOUTHWEST INC.-GALLUP	NMD000333211		I-40, EXIT 39 - 17 MILES EAST OF GAL LUP, NEW MEXICO, JAMESTOWN, NM, 87347					
HIGH	NO		NO		YE	06/27/2001	YE	05/27/2003
WESTERN REFINING YORKTOWN, INC.	VAD050990357		2201 GOODWIN NECK ROAD YORKTOWN, VA, 23692					
HIGH	YES	03/31/2004	NO		YE	09/25/2002	YE	09/21/2007
WESTERN SLOPE REFINING COMPANY	COD067315390		2 MI W OF FRUITA ON HWY 6/50 FRUITA, CO, 81521					
HIGH	YES	09/09/2002	YES	09/09/2002	YE	06/28/2000	YE	06/28/2000

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS / Remedy Decision / Date	Construction Completion / Date	HE Controlled / Date	GW Controlled / Date
WESTERN ZIRCONIUM	UTD092024934		10,000 WEST 900 SOUTH OGDEN, UT, 84404
HIGH / NO	NO	YE / 09/08/2005	IN / 09/16/1996
WESTINGHOUSE ELECTRIC CORPORATION	CTD001183078		1421 STATE STREET BRIDGEPORT, CT, 066052032
HIGH / YES / 12/22/2005	YES / 08/14/2007	YE / 09/27/2001	YE / 09/26/2001
WESTLAKE VINYLS COMPANY, LP.	LAD003913449		36045 HIGHWAY 30 GEISMAR, LA, 70734
HIGH / NO	NO	YE / 12/13/2004	YE / 03/30/2001
WESTVACO CORP	MDD048005839		11101 JOHNS HOPKINS ROAD LAUREL, MD, 20810
HIGH / YES / 02/28/2003	YES / 02/28/2003	YE / 07/18/2001	YE / 08/16/2002
WEYERHAEUSER CO-TREATING PLANT	ARD067671313		377 SOUTH TREATING PLANT ROAD DEQUEEN, AR, 71832
HIGH / YES / 05/19/1992	YES / 04/16/2001	YE / 04/16/2001	YE / 04/16/2001
WHEELABRATOR CORP LANDFILL	VAD000063669		3 ABRASIVE AVE BEDFORD, VA, 24523
HIGH / NO	NO	YE / 11/26/2001	YE / 11/26/2001
WHELAND FOUNDRY, DIV OF NORTH AMERICAN R	TND987778495		SAINT ELMO AVENUE CHATTANOOGA, TN, 37408
HIGH / YES / 09/29/1993	YES / 09/29/1997	YE / 06/19/1998	YE / 09/26/2006
WHIRLPOOL CORP	MID005477773		201 UPTON DRIVE SAINT JOSEPH, MI, 49085
HIGH / YES / 11/28/2000	YES / 12/27/2002	YE / 02/27/2001	YE / 02/27/2001
WHITE LION HOLDINGS LLC	TXD000449397		221 SCOTT ROAD ROSENBERG, TX, 77471
HIGH / YES / 04/25/2008	YES / 04/25/2008	YE / 01/13/2000	YE / 01/13/2000
WHITE MOP WRINGER	NYD002076214		RIVERSIDE DR FULTONVILLE, NY, 12072
HIGH / YES / 01/07/2000	YES / 01/07/2000	YE / 09/30/1999	YE / 09/30/1999
WHITE SANDS MISSILE RANGE	NM2750211235	US Army	U.S. HIGHWAY 70 WHITE SANDS MISSILE RANGE, NM, 880025048
HIGH / NO	NO	YE / 04/11/2001	IN / 11/19/1997
WHITING & DAVIS CO	MAD001195700		23 WEST BACON ST PLAINVILLE, MA, 02762
HIGH / NO	NO	YE / 09/10/2002	YE / 09/10/2002
WHYCO FINISHING TECHNOLOGIES LLC	CTD001450154		670 WATERBURY ROAD THOMASTON, CT, 06787
HIGH / NO	NO	YE / 11/10/1999	NO / 04/08/2002
WILLIAM C MEREDITH CO INC	GAD003323805		2335 LAWRENCE ST EAST POINT, GA, 30344
HIGH / YES / 02/11/1993	NO	YE / 09/30/2005	IN / 09/30/2005
WILLIAMS PETROLEUM SVCS LLC/FORMER AUGUS	KSD007235138		215 OAK AUGUSTA, KS, 67010
MEDIUM / NO	NO	IN / 07/11/2003	IN / 07/11/2003
WILSON JONES CO	VAD003124989		1000 ALLVIEW DR , CROZET, VA, 22932
HIGH / NO	NO	YE / 10/03/2002	IN / 08/21/2001
WINDSOR BLOOMFIELD SAN LANDFILL	CTD991289133		HUCKLEBERRY RD WINDSOR, CT, 06095
HIGH / NO	NO	YE / 09/29/2003	YE / 02/23/2002
WJ SMITH WOOD PRESERVING COMPANY	TXD066368879		1700 W MORTON ST DENISON, TX, 75020
HIGH / YES / 08/31/2007	YES / 08/31/2007	YE / 03/11/2008	IN / 03/11/2008
WOLF LAKE TERMINALS INC	IND054101415		3200 SHEFFIELD AVE HAMMOND, IN, 46327
HIGH / YES / 01/12/2004	YES / 03/09/2004	YE / 11/07/2001	YE / 11/07/2001
WOLVERINE BRASS INC/TRW INC	SCD990704470		2951 HWY 501 E CONWAY, SC, 29526
HIGH / YES / 09/13/2007	YES / 09/30/2008	YE / 09/12/2001	YE / 09/12/2001

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address
NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
WOLVERINE TUBE INC	ALD053363776		2100 MARKET STREET NE , DECATUR, AL, 356092202					
HIGH	YES	09/30/1999	YES	09/29/2000	YE	09/27/1997	YE	09/29/2000
WOOD INDUSTRIES PA 1299	TXD027070655		11373 SOUTHTON RD SAN ANTONIO, TX, 78223					
HIGH	NO		NO		YE	03/15/2005	YE	03/15/2005
WOOD PRESERVERS, INC.	VAD003113750		15939 HISTORY LAND HIGHWAY WARSAW, VA, 22572					
HIGH	NO		NO		YE	10/01/2002	YE	10/01/2002
WOODBURY BOX CO INC	GAD981270416		205 MAIN ST , WOODBURY, GA, 30293					
MEDIUM	NO		YES	09/14/2006	YE	09/05/1997	YE	07/30/1999
WOODSTOCK, CITY OF	ILD005471503		555 WHEELER ST WOODSTOCK, IL, 60098					
HIGH	YES	07/15/2005	YES	07/15/2005	YE	03/01/2006	YE	09/25/2007
WORLD RESOURCES COMPANY	AZD980735500		8113 W SHERMAN ST TOLLESON, AZ, 85353-3309					
MEDIUM	NO		NO		NO STATUS		YE	03/29/2007
WORTHINGTON STEEL CO.	PAD002324978		45 N MOREHALL RD MALVERN, PA, 19355					
HIGH	NO		NO		YE	10/03/2002	YE	10/03/2002
WOTEN AVIATION SERVICES INC	CAD085595551		25980 NEIGHBORS BLVD AT ARPT RIPLEY, CA, 92272					
HIGH	YES	09/07/2006	NO		YE	06/09/2004	YE	07/14/2004
WRB REFINING LLC	TXD980626774		W SPUR 119 BORGER, TX, 79007					
HIGH	NO		NO		YE	08/03/2004	YE	03/24/2006
WRR ENVIRONMENTAL SERVICES CO INC	WID990829475		5200 RYDER RD , EAU CLAIRE, WI, 54701					
HIGH	NO		NO		YE	07/14/2004	NO STATUS	
WYETH HOLDINGS CORP	NJD002349009		4201 QUAKERBRIDGE RD PRINCETON JCT, NJ, 085505205					
HIGH	YES	01/01/1996	YES	07/01/1996	YE	03/29/2001	YE	03/30/2001
WYETH PHARMACEUTICALS	NYD054065909		NORTH MIDDLETOWN RD PEARL RIVER, NY, 10965					
HIGH	YES	09/30/2008	YES	09/30/2008	YE	05/25/2001	YE	09/26/2003
WYMAN-GORDON COMPANY	MAD001128032		244 WORCESTER ST NORTH GRAFTON, MA, 01536					
HIGH	NO		NO		YE	09/27/2005	YE	09/30/2008
WYNNEWOOD REFINING COMPANY	OKD000396549		906 SOUTH POWELL WYNNEWOOD, OK, 73098					
HIGH	NO		NO		YE	05/17/2001	YE	05/17/2001
XCEL ENERGY-CHESTNUT HW STORAGE FACILITY	MND000826206		1518 CHESTNUT AVE N , MINNEAPOLIS, MN, 55403					
MEDIUM	YES	04/29/2008	YES	04/29/2008	YE	08/16/2006	YE	08/16/2006
XEROX ATLANTA CRC FACILITY	GAD010103232		6077 FULTON INDUSTRIAL BLVD ATLANTA, GA, 30336					
MEDIUM	YES	07/12/2007	YES	07/12/2007	YE	09/22/1997	YE	09/22/1997
XEROX CORP CHICAGO PARTS REHAB	ILD096786009		100 WINDSOR DR OAK BROOK, IL, 60521					
HIGH	YES	09/21/2006	YES	12/05/2006	YE	09/24/1999	YE	09/24/1999
XEROX CORPORATION	NYD002211324		800 PHILLIPS ROAD (205-99F) WEBSTER, NY, 14580					
HIGH	NO		NO		YE	09/30/2003	YE	09/29/2000
YALE SECURITY INC.	TND095050019		100 YALE AVENUE LENOIR CITY, TN, 37771					
HIGH	NO		NO		YE	09/16/1996	YE	09/24/2002
YELLOWSTONE CODY REFINERY	WYD006230189		1 MI N OF CODY , CODY, WY, 82414					
HIGH	NO		NO		YE	09/16/2005	YE	10/07/2004
YKK SNAP FASTENERS AMERICA INC.	KYD044914356		302 FACTORY STREET LAWRENCEBURG, KY, 40342					
HIGH	NO		NO		YE	06/24/1996	YE	06/24/1996

Facilities on the RCRA 2008 GPRA Corrective Action Baseline

Report run on: November 4, 2008 - 9:05 AM

Facility Name	Facility ID	Dept.	Address

NCAPS	Remedy Decision	Date	Construction Completion	Date	HE Controlled	Date	GW Controlled	Date
YORK CASKET HARDWARE			GAD003265030		506 MALTBIE ST LAWRENCEVILLE, GA, 300454554			
HIGH	NO		NO		YE	03/18/1996	YE	09/19/2002
ZECCO INC			MAD052924495		345 WEST MAIN ST NORTHBORO, MA, 01532			
LOW	YES	09/30/2008	YES	09/30/2008	YE	06/27/2007	YE	06/27/2007
ZENECA INC			MAD051505477		333 MAIN ST DIGHTON, MA, 02715			
HIGH	NO		NO		YE	09/29/2005	NO STATUS	
ZION SITE 1 PHASE B LANDFILL			ILD980700728		701 GREEN BAY RD-B ZION, IL, 60099			
HIGH	YES	06/27/1991	YES	06/27/1991	YE	09/15/1996	YE	09/15/1996

*** End of Report ***

ENCLOSURE 6

UNITED STATES ENVIRONMENTAL PROTECTION AGENCY
REGION 4
ATLANTA FEDERAL CENTER
61 FORSYTH STREET
ATLANTA, GEORGIA 30303-8960

MAR 0 2 2006

4WD-RPB

CERTIFIED MAIL
RETURN RECEIPT REQUESTED

Mr. Charles A. Jones
Plant Manager
Sloss Industries Corporation
P.O. Box 5327
3500 35th Avenue North
Birmingham, Alabama 33618

SUBJ: Technical Comments on Technical Documents
Sloss Industries, Inc.
Birmingham, Alabama
ALD 000 828 848

Dear Mr. Jones:

The U. S. Environmental Protection Agency (EPA) has reviewed RFI Reports and the Environmental Indicator Report data to determine data gaps for assessing releases to all media. The following reports were reviewed:

1) Consolidated Overview of Environmental Data in Support of the Environmental Indicator Determination (COEDAEID) Report dated July 2005
2) RFI Coke Manufacturing Plant Report dated November 27, 2000
3) Phase II RCRA Facility Investigation (RFI) Report Land Disposal Areas and BTF and Sewers Report dated January 17, 2003
4) RFI Chemical Manufacturing Plant dated January 28, 2003

EPA is also resubmitting to Sloss revised comments dated March 17, 2004, for the Phase II RCRA Facility Investigation (RFI) Report Land Disposal Areas and BTF and Sewers Report dated January 17, 2003.

EPA has also reevaluated recommendations for SWMU Investigations detailed in the RFI Coke Manufacturing Plant Report dated November 27, 2000. The revised comments reflect new

10955691

Internet Address (URL) • http://www.epa.gov
Recycled/Recyclable • Printed with Vegetable Oil Based Inks on Recycled Paper (Minimum 30% Postconsumer)

Specific recommendations regarding the Biological Treatment Facility (BTF), Sewers, and Landfill Areas, Coke Plant, and former Chemical Plant at Sloss Industries and in offsite residential areas are also enclosed.

EPA does not request that Sloss revise and resubmit all reports herein commented on. Instead, as discussed previously, it is EPA's expectation that Sloss incorporate these comments and recommendations into all future reports and documents, including the facility wide report. The comments/recommendations will also be used in determining whether future Environmental Indicator (EI) goals are achieved (i.e., CA400 and CA550).

EPA suggests that a meeting take place to further discuss these comments/recommendations and to outline a multi-year approach to future activities required at the facility. Sloss will be contacted for a suggested time and location for this meeting once there has been sufficient time to review these comments/recommendations.

If you have any questions concerning this matter, please contact Robert Morris at (404) 562-8470.

Sincerely,

for Paul H. Butler

Jon D. Johnston
Chief, RCRA Programs Branch
Waste Management Division

Enclosure

cc: Jim Henry, Sloss Industries
Daniel Grucza, Walter Industries, Inc.
Kelly Moody, CH2M Hill
William G. Hardy, ADEM
Chip Crockett, ADEM
Jeff Anderson, ADEM

However, EPA endorses the proposal to collect background soil samples from undisturbed locations unaffected by Sloss Industries or from similar industries. The background soil locations must also be unaffected by other facilities that produce coke or smelting iron ore or store coal or from an area where there has been no aerial deposition of PAHs or metals. The facility should compare the concentrations of back ground metals and PAHs with the concentrations of metals and PAHs found in coal fines and waste byproducts to smelting and coking processes. The calibration curve for analyses of individual PAH compounds must fall within the Region 9 residential preliminary remediation goals. The facility should provide a map with the location of the background soil samples and a description of the soils in the area.

b. Sloss stated that in Alabama the average background arsenic concentrations range from .8 mg/kg to 11 mg/kg with a state wide average concentration of 4.7 mg/kg. The soil samples collected for background SB-1 through SB-6 were collected from 0-2 feet in depth. Arsenic was detected at SB-1 at a concentration of (11 mg/kg), SB-2 (16 mg/kg), SB-3 (14 mg/kg and 21 mg/kg), SB-4 (13 mg/kg), SB-5 (6 mg/kg), and SB-6 (7.6 mg/kg). Concentrations of arsenic decrease with depth at SB-5 from 0-2 feet (6 mg/kg), 2-4 feet (3.1 mg/kg), and increase at 4-6 feet to (5.5 mg/kg). The facility stated that SB-1 through SB-3 were collected in soils above the Hartselle Formation and SB-4 through SB-6 were collected in soil above the Red Mountain Formation. This suggests that arsenic concentration on the west side of the Opossum Valley Fault are not representative of soils on the east side of the fault which overlie the Conasauga Limestone. While this is true, it's important to point out that samples SB-1 through SB-3 may have been impacted by site activities. Arsenic concentrations decrease with depth at SB-1 from 11 mg/kg at 0-2 feet to 7.2 mg/kg from 8-10 feet, to 4.3 mg/kg from 14 to 16 feet. One would expect higher concentrations of arsenic to be near the surface if impacted by aerial deposition or placement of waste material.

While background samples were not collected in soils overlying the Conasauga Limestone soil sampling data collected across the site at SWMUs overlying the Conasauga Limestone indicate that arsenic levels approaching the average for the state can been seen at depth except in areas where arsenic has been released from site waste management activities. For example, if the arsenic levels are examined for deep soils overlying the Conasauga Limestone one would expect the arsenic found in residual clays would be indicative of or approximating background. Soils sampled around the following SWMUs with corresponding sampling depths and concentrations of arsenic are: SWMU #13 (19-21 feet) (2.8 mg/kg), SWMU #14 (18-20 feet) (4.8 mg/kg), SWMU #15 (20-23 feet) (7.5 mg/kg), SWMU #17 (18-20 feet) (11J mg/kg), SWMU #18 (20-22 feet) (2.6J mg/kg), SWMU#19 (18-20 feet) (4.9J mg/kg), SWMU #1B (12-14 feet) (9 mg/kg), SWMU #26 (13-15 feet) (3.3 mg/kg), SWMU #27 (10-12 feet) (4.8 mg/kg), SWMU #29 (12-13 feet) (2.9 mg/kg), SWMU #31 (6-8 feet) (5.2 mg/kg), SWMU #36 (8-10 feet) (6.7 mg/kg), SWMU#38 (18-20 feet) (1.8 mg/kg), and SWMU #4 (18-20 feet) (3 mg/kg). From this data of 14 SWMUs the average arsenic concentrations taken in deep samples, presumably unaffected by waste management activities on the surface, are about 5.02 mg/kg.

At offsite sample location OSS #4 on the east side of the Opossum Valley Fault in soils overlying the Conasauga Limestone the lowest arsenic level detected was at a concentration of 6.7 mg/kg. This is an arsenic level approaching background. In offsite soils on the south side of

South Side of Sloss East of 31st Way North-Shuttlesworth Drive

iii) Additional surficial soil samples are warranted in the vicinity of OSS #3 and OSS #6. Analyze for PAHs and arsenic. Take a deep sample at OSS #3 to determine if the arsenic and PAHs decrease in concentration.

iv) Additional surficial soil samples in the vicinity of OSS #9 and OSS #11 are warranted. Analyze for PAHs and arsenic. OSS #9 detected arsenic at (49 mg/kg), BAA (1.1 mg/kg), BAP (1.3 mg/kg), and BBF (1.6 mg/kg). OSS #11 detected arsenic at (36 mg/kg) and BAP (.075 mg/kg). Define the scope and extent of PAHs.

v) Additional surficial soil samples should be taken around Calloway Elementary School and analyzed for arsenic and PAHs. OSS#4 detected BAP (.24 mg/kg).

Comment #3: Harrimon Park Soil Sampling

Sloss sampled the Harrimon Park neighborhood surficial soils and identified arsenic and PAHs in samples OSE #1- OSE #8 and in OSES #1 - OSES #3. Arsenic ranged from 20 mg/kg to 42 mg/kg with highest concentration at OSE #3. In addition, PAHs were detected in concentrations that were less than an order of magnitude above the Region 9 residential PRGs. Soil sample OSE #2 detected BAP at a concentration of .44 mg/kg. The residential PRG for BAP is (.062 mg/kg). Soil sample OSES #3 detected the PAHs, BAA (.57 mg/kg), BAP (.55 mg/kg), and BBF (.94 mg/kg).

Sloss should take additional samples to assess the scope and extent of arsenic contamination in the Harrimon Park area as arsenic concentrations are from 4 to 8 times the background concentrations. Samples should also be taken in Harrimon Park to establish if the arsenic levels increase across the school grounds and decrease in concentration with depth. The PAHs in this area are low relatively speaking less than an order of magnitude above the residential PRGs . However, additional assessment is warranted at OSES #3 and OSE #2 to define the scope and extent of the PAH compounds.

Comment #4: Riggins School Soil Sampling

Sloss took offsite soil samples in the residential areas on the west side of the facility. The arsenic concentrations ranged from 9.1 mg/kg to 16 mg/kg. The PAH compounds were also relatively low and less than an order of magnitude above the Region 9 residential risk based concentrations. The highest concentrations of PAH compounds were in the play ground of the Riggins Elementary School. The school is no longer in use but the school may be reused some day. Soil sample OSW #8 detected arsenic at 16 mg/kg and the PAHs BAA (5.4 mg/kg), BAP (6.2 mg/kg), BBF (6.5 mg/kg) which are 1 to 2 orders of magnitude above the residential PRGs. Additional surficial soil samples are warranted around the playground and school. Soil samples should also be taken at depth at OSW #8 where the highest concentration of PAH compounds were detected to determine if the contamination increases with depth.

Sloss installed three groundwater monitoring wells offsite to assess the scope and extent of a VOC plume originating from the former Chemical Plant and failed to detect significant groundwater contamination in the shallow bedrock aquifer. EPA agrees that addition groundwater investigations are warranted on the east side of the groundwater divide. The current number and distribution of wells on the east side of shallow groundwater divide has not conclusively determined that there is no shallow groundwater contamination occurring among the wells placed into the weathered bedrock zone of the upper most aquifer. Narrow groundwater plumes maybe be migrating between the existing offsite shallow groundwater wells or to the side of the existing network through shallow fissures in the subaerial karst. Sloss should propose an off-site investigation strategy for the east side of the groundwater divide. Sloss also pointed out that additional shallow bedrock wells would be needed on the south side of the facility to determine if the shallow groundwater divide under the former chemical plant is the local divide in the valley. The facility should install the appropriate wells to determine the extent of the divide and assess the presence of hazardous constituents in the groundwater. Provide a map with the number and locations of shallow groundwater wells.

Comment #10: Annual Water Level Monitoring and Sampling

> Sloss recommends to conduct annual water level monitoring, potentiometric surface mapping, and sampling from all monitoring wells at the facility (possibly more frequently for select wells and surface water bodies) to obtain a groundwater data set sufficient to assess stabilization of the groundwater contaminant plume(s).

EPA recommends that the facility conduct annual water level monitoring, potentiometric surface mapping, and sampling from all monitoring wells at the facility. Ground water monitoring should be conducted quarterly at wells that monitor distinct groundwater contaminant plumes at the Chemical Plant and in the BTF area. The groundwater data should be used to assess the migration of ground water contamination from the shallow aquifer and from the shallow aquifer into the deep aquifer. Additional wells may be necessary to assess the migration of hazardous constituents from the shallow into the deep aquifer in the Chemical Plant, BTF Areas and Main Plant Areas.

Comment #11: Ecology

> Sloss recommends beginning identification of ecological issues, supplementing existing information, as appropriate.

See EPA comments 13 through 16 in the section entitled: Phase II RCRA Facility Investigation (RFI) Report Land Disposal Areas and BTF and Sewers Report. EPA previously agreed that Sloss did not need to respond to the comments for the above referenced report until the Environmental Indicator Evaluations were completed. Since the EI evaluations have been completed Sloss needs to address all of the attached comments including the revised portions of the comments that are based on the most recent data collection for the Environmental Indicator studies.

Review of the Phase II RCRA Facility Investigation (RFI) Report
Land Disposal Areas and BTF and Sewers Report
Revised EPA Comments
Sloss Industries, Inc., Birmingham, Alabama
EPA ID No. AL000828848

Comment #13: Ecological Study-Sediment

Page 23, 2nd paragraph, Sloss stated that it would use a proposed sediment quality criteria (SQC) for the protection of benthic organisms for acenaphthene (12,600 ug/kg), fluoranthene (91,800 ug/kg), and phenanthrene (10,800 ug/kg). The sediment criteria were normalized using a total organic carbon (TOC) criteria calculated from previous investigations.

Sloss needs to define what is meant by normalizing the concentrations of individual PAHs by using total organic carbon (TOC). What were the individual PAH concentrations prior to normalizing the PAHs?

Comment #14: Ecological Study-Sediment

We recommend that Sloss use the Region 4, sediment screening values for total PAHs at 1.6 mg/kg to determine the need for additional investigation. The ecological screening values for sediments listed in the Ecological Risk Assessment Bulletin-Supplement to RAGs, may be accessed at the Region 4, Waste Management Division web site at the following address: www.epa.gov/region4/waste/ots/ecolbul.htm .

Comment #15: Ecological Study-Sediment in Ditches

Sloss collected sediment samples in site ditches at 500-600 foot intervals and listed the concentrations for total PAHs for the following sediment sampling locations: SD-2 (**753,500 ug/kg**), SD-4 (**628,700 ug/kg**), SD-5 (**117,180 ug/kg**), SD-7 (**103,210 ug/kg**), SD-8 (**84,890 ug/kg**), SD-9 (**93,890 ug/kg**), SD-10 (**26,730 ug/kg**), SD-11 (**64,400 ug/kg**), SD-13 (**33,870 ug/kg**), SD-17 (**27,990 ug/kg**), and SD-20 (**226,600 ug/kg**). Additional sampling is warranted up and down gradient of the following sediment sampling locations because the PAH concentrations exceed the Region 4 screening levels: SD-14 (20,270 ug/kg), SD-16 (12,830 ug/kg), SD-18 (5,470 ug/kg), and SD-19 (15,410 ug/kg).

We also recommend analyzing for total organic carbon in each sample. Sloss did not present the total organic carbon concentrations (TOC) in Tables 4-3 and 4-4, which listed the analytical results of the sediment sampling for SD-7, SD-9, SD-11, SD-12, SD-14, SD-16, SD-18, and SD-20. The facility should also determine background total organic carbon in areas unaffected by Sloss or similar industries. A high concentrations of total organic carbon occur in areas with coal dust which are high in PAHs.

cyanide. Provide a map illustrating the locations of depositional sites and sampling locations. Sloss needs to verify that the appropriate field reconnaissance has been completed to identify sediment deposition sites. Sloss may present any data taken by state or federal organizations from downstream investigations of 5 Mile Creek.

Comment #17: BTF Area Groundwater Flow Direction

Groundwater monitoring data in the BTF Area around SWMUs #38 and #39, indicate that the shallow and deep (regional) groundwater flow are influenced by the 200 foot deep Lafarge Quarry. The bottom of the Lafarge Quarry may be deeper than the normal potentiometric surface of the bedrock aquifer. Consequently, the groundwater of the regional aquifer in the BTF Area is flowing toward the quarry which is the topographic low point for the area. Approximately 1,000 gallons of water per minute is being pumped from the lake at the bottom of the quarry.

During a site visit on July 10, 2003, EPA, Alabama, and Sloss representatives visited the Lafarge Quarry. At the quarry numerous seepages were identified discharging along dipping bedding planes. A potential large spring was also noted to have discharged into the lake in the bottom of the quarry. Deep groundwater samples in the Lafarge Quarry should be acquired from the lake and from seeps and springs in the quarry walls. Specify in the work plan that samples will be taken during the Spring and Fall time of the year. Also give the EPA three weeks notice before sampling of the seeps and springs in the quarry walls.

Provide a map indicating the locations for sampling seeps and springs and at several locations in the lake at the bottom of the Lafarge Quarry. Specify the number of sampling locations and the list of analytes to be analyzed in the groundwater samples.

Also, water samples should be acquired in the deep Southern Ready Mix Quarry which is adjacent to the BTF Area. The facility needs to assess the groundwater in the Southern Ready Mix Quarry for site specific hazardous constituents originating from Sloss. Sloss needs to include accurate water table elevations in the Lafarge Quarry and the Southern Ready Mix Quarry on site potentiometric maps for both shallow and deep aquifers.

Comment #18: Geologic Cross-sections

The idealized geologic cross-sections would be more valuable as an exploration tool if the cross-sections were drawn accurately illustrating the attitude of the bedding dip. Figure 4.3, is the Geologic Cross-section Map that locates cross-section views A-C represented in Figures 4.4-4.6. Figures A and C are drawn roughly along the strike of the bedding as compared with the plan view of the site geology in Figure 4.2. Figure 4.5 is drawn perpendicular to the strike from MW-23 to P-3 and the bedding in the Conasuaga is portrayed as horizontal. Figure 4.2 indicates the bedding is roughly dipping at 30 degrees in the vicinity of the cross-section. Sloss needs to properly illustrate the attitude of the bedding in cross-sections as horizontal cross-sections are misleading. The facility stated that the dominant water bearing zones are in between the limestone and the shale partings which are the bedding planes. The bedding planes and the associated zones of permeability dip at 30 degrees. Since the matrix of the Conasuaga

may be useful for addressing other areas but is useless for assessing impact to groundwater down gradient of SWMU #37. The facility should attempt to install a shallow groundwater monitoring well ***down gradient*** of the BTF Sewer Tar Trap to assess for releases to groundwater. The facility may locate a shallow down gradient well far enough down gradient to be clear of buried lines. The facility may wish to consider hydro vacuum techniques to remove soil to expose buried utilities before installing a shallow well.

Comment #22: SWMU #37-BTF Sewer Tar Trap, Groundwater Data

Groundwater sampling in MW-68S indicated that chloroform and Bis(2-ethylhexyl)phthalate exceeded the PRGs for tap water. The facility presented the analytical results for 5-VOCs, 3-SVOCs, and 4 metals. It is not clear if the groundwater constituents presented in Table 4.2 were the only constituents analyzed. All tables should have a footnote that indicates that the constituents listed were the only analytes targeted for analysis. If these were the only constituents analyzed by the facility, the facility needs to perform a scan for all PAHs in the groundwater and all historical constituents likely to be found in the Tar Trap.

Comment #23: SWMU #37-BTF Sewer Tar Trap Soils

On Page 51, the facility indicated that soil data was not collected because there was no soil only fill material was found at the top of bedrock. The facility could have collected the fill material and analyzed it for all PAHs and all historical constituents likely to be found in the Sewer Tar Trap. The facility could compare so-called background concentrations of the fill with the analytical results of the fill plus contaminant release concentrations. The porous fill would be an excellent reservoir for releases from the Tar Trap. The facility should take fill material samples and analyze for hazardous constituents. Specify the number of soil samples, the depth and illustrate the location of the proposed samples on a map.

Comment #24: Cyanide

Cyanide has been analyzed as (free) cyanide or the cyanide metal. Please explain how cyanide is formed in the coke manufacturing process. Does cyanide occur as a compound or as a metal from the processes at Sloss?

Comment #25: SWMU #13-Biological Treatment Facility (BTF) Equalization Basin and SWMU-21, BTF Emergency Basin, LNAPL Plume

The facility stated that the pre-RCRA waste stream and SWMU #13 and SWMU #21 do not appear to be the source of the Light Nonaqueous Phase Liquid (LNAPL) consisting of VOCs, PAHs, and cyanide detected in MW-6 area. The facility stated that the ABC Coke gas pipeline drip leg is the most likely source and no further action is warranted.

EPA does not agree with Sloss that no further action is warranted at SWMU #13 and MW-6. Table 2-5 from the RFI Report dated February 5, 1999, indicated that PAHs from coal tar were detected above the Region 9 PRGs for tap water in MW-6. For example: in groundwater samples taken on August 4, 1986, in MW-6, total PAHs were detected at

According to the top of bedrock contours (Figure 2-9, BTF Sewers Volume I Report dated February 8, 1999) under SWMU #13, the bedrock slopes towards the northwest while the dip of the bedrock at 30 degrees is to the southeast. The DNAPLs of MW-4a, MW-3 and MW-6 may flow on top of the bedrock-soil surface until fracture is encountered. The DNAPLs may also accumulate in solutionally enlarged crevices in the bedrock or low areas. If the DNAPLs have found their way into the underlying bedrock they would migrate by gravity along bedding planes to the southeast towards the offsite potentiometric low in the Lafarge and Southern Ready Mix Quarries. The potentiometric surface for the regional aquifer in the BTF area is about 70 feet lower (June 13, 2001) than the shallow aquifer water table indicating a vadose zone between the perched aquifer on top of the bedrock and the deep regional aquifer. The MW-11 and MW-12 wells are about 150 feet from MW-4a and for a DNAPL entering in the bedrock at the location of MW-4a and following a bedding plane along a 30 degree dip, MW-12 would have to be at least 75 to 85 feet deep to intercept the same bedding plane. There is always the possibility that a contaminant plume following the dip may be short circuited by a more permeable fracture that bisects the bedding to deeper lower bedding plan. In addition, to intercept a contaminant plume following a permeable bedding plane one has to assume that the bedding uniformly transmits water which is probably never the case in carbonates as there are likely preferential pathways that have been solutionally enlarged.

Sloss Industries needs to install deep groundwater monitoring wells down gradient of MW-4a and MW-6 to assess contaminant migration in the bedrock aquifer. The wells need to target the bedding planes or fractures likely to contain hazardous constituents. The facility should run a geophysical log of all deep wells to determine where groundwater is entering the borehole and the wells should be screened across the water bearing zone. The down hole log should be capable of imaging, amplitude, caliper, ambient HPF Flow, Pumping flow, transmissivity, and tadpole structure plot. Once the water bearing zones area identified Sloss should packer test the zone to determine transmissivity and hydraulic conductivity.

Comment #27: Scope of Proposed Phase III Groundwater Investigations

The facility proposed four groundwater monitoring wells side gradient to MW-26 and down gradient of MW-63. The facility needs to make sure the down gradient wells are installed in the same bedding plane fracture that MW-26 and MW-63 are screened across if in fact they are screened across a bedding plane. The facility will need to take into account the elevation of the up gradient source, account for the dip of the bedding planes and target the screen depth accordingly in the down gradient wells. The facility should include the equipotential lines on the maps with the proposed wells.

Comment #28: SWMU #22-MW-17S Groundwater Monitoring

In addition to the groundwater monitoring wells the facility proposes to monitor, the facility needs to conduct **quarterly** groundwater monitoring at MW-17S to determine if the benzene plume *increases* or *decreases* in concentrations with time. The last sampling event of the groundwater monitoring well located at the facility boundary detected benzene at 15 ug/L and 18 ug/L. The MCL for benzene is 5 ug/L. Previously an offsite well was required to assess

Comment #32: New SWMU-BTF Area Ditches

The ditch system that drains the BTF Area and discharges out the plant outfall is loaded with thick deposits of wastes that contain high concentrations of PAHs and metals (i.e., cyanide, arsenic, copper, antimony, cadmium, and barium). This ditch does not have an official designation as a SWMU or Area of Concern (AOC). It is now designated a new SWMU. The facility may assign a SWMU number to the SWMU.

There are areas of the ditch system that have not as of yet had samples taken. Sediments samples are needed in the following areas of the new SWMU. The facility should analyze sediment samples for PAH constituents and metals. The facility should attempt to calculate the volume of waste in the ditches that will ultimately require removal.

a. Ditch adjacent to SWMU #24 that runs parallel to Summit Street west of the access road into the BTF Area. Take samples at intervals in the ditch along the length of SWMU #24. Samples should be taken in the ditches on both sides of the road.
b. Ditch east of SWMU #24 that parallels the road into the BTF Area. Samples are needed to establish the amount of waste in place.
c. Ditch that runs parallel to Summit Street and east of the road into the BTF Area. Significant accumulations of waste were noted in the ditch during EPA's last site visit. The facility should take transects in wide areas of waste accumulation to assess volume of wastes. Samples should be taken along the ditch from the road towards SD-14.

Former Chemical Plant Groundwater Investigations

Comment #33: Chemical Plant Groundwater Contaminant Plume Evaluation East Side of Groundwater Divide

Groundwater data illustrated in Figure CA750-1 indicates a prominent groundwater mound at the location of the Chemical Plant with groundwater flow directions to the east and to the north. Previous offsite groundwater investigations were conducted to the east of the potentiometric high to assess the scope and extent of a shallow groundwater plume consisting of VOCs and SVOCs originating at the former Chemical Plant. The east side of the potentiometric high were investigated offsite by wells MW-71, MW-72, and MW-73. The only constituents reported in MW-70 and MW-72 were toluene at 18 ug/L and 1.3 ug/L which are not significant hazardous constituents in the shallow groundwater. The facility did not provide the analytical data for MW-69, MW-70, MW-71, and MW-72.

Onsite at MW-51 chlorinated solvents with a specific gravity heavier than water were detected in the shallow groundwater. Two sets of groundwater samples were taken on July 27, 2000 and on April 6, 2001. Tetrachloroethene (PCE) were detected at concentrations of 410 ug/L and 15 ug/L indicating a decrease in concentration over a year between sampling events. Vinyl chloride concentrations also decreased in concentration from 830 ug/L to 810 ug/L. Trichloroethene (TCE) decreased in concentration from 350 ug/L to 39 ug/L. Trans-1,2-

Groundwater data indicates that groundwater is flowing to the north from MW-55 and MW-56. The shallow groundwater plume has not been adequately delineated to the north. Sloss should propose to install two shallow groundwater monitoring wells to the north to delineate the benzene, toluene and chlorobenzene plume. Provide a map with the location of the two wells.

Comment #35: Source Area Investigation for BTEX Plume.

The source of the benzene, chlorobenzene, and toluene is not well understood. There are two large rusty tanks used to store benzene and toluene with a concrete secondary containment system that contains jointed concrete. The joints look like they could have leaked if there had been a release into the secondary containment. This is a potential source of benzene and toluene. These two tanks are within the vicinity of the BTEX and chlorobenzene plume. Sloss must collect soil samples beneath the two tanks at the bedrock soil contact. If benzene and toluene are detected then a shallow groundwater monitoring well must be installed on the north side of the two tanks.

Comment #36: Chemical Plant Deep Aquifer Groundwater Investigation

MW-49D was installed to a depth of 165 feet and is screened from 155 feet to 165 feet in depth. MW-49D is located on the edge of the Chemical Plant on the east side of the shallow groundwater mound. The potentiometric map for the deep aquifer indicates an eastward direction of flow from the eastern side of the Chemical Plant. The groundwater data from MW-49D indicated that vinyl chloride had been detected at a concentration of 18 ug/L, Bis(2-ethylhexyl)phthalate at 23 ug/L. MW-57D also detected PCE at a concentration of 13 ug/L and 1,2 DCE at 80 ug/L. MW-57D is screened at a depth from 164.5 feet to 174.5 feet. The presence of the vinyl chloride, PCE and 1,2 DCE at depth indicates that VOCs have migrated along path of dipping bedding fractures and tension fractures to the regional water table.

Sloss should propose to install a deep groundwater monitoring well in the vicinity of MW-70, MW-71, MW-72 to assess impacts to the deep aquifer from the Chemical Plant. The well should be at least as deep as MW-57D. Provide a map with the location of the deep well.

Coke Plant SWMU and Groundwater Investigations

Comment #37: Coke Plant Groundwater Contamination Plume

Sloss reported that shallow groundwater contamination exists in MW-58, MW-59, and MW-60. The groundwater contamination origin is from the Coke Plant operations. At MW-58 the following hazardous constituents were detected from the 4/28/05 sampling event: Acenaphthene (93 ug/L) (*tap water standard*-37 ug/L), dibenzofuran (130 ug/L) (12.16 ug/L), fluorene (130 ug/L) (24 ug/L), benzene 100 ug/L) (*MCL* 5 ug/L), Bis (2-ethylhexyl)phthalate (61 ug/L) (6 ug/L),1-methylnaphthalene (380 ug/L) (.620 ug/L) 2-methylnaphthalene (540 ug/L) (.620 ug/L) and naphthalene (19,000 ug/L) (.62 ug/L).

impacted soils around SWMU #7 and the pipe trench. The top of bedrock contour map Figure 4.7 dated December 13, 2001, will need to be updated to determine if the PAHs present at the top of bedrock are migrating along low areas.

Comment #39: SWMU #10 Coal Tar Decanter No. 3 and 4 Coke Batteries and SWMU #11 Coal Tar Decanter No. 5 Coke Batteries

SWMU #10 and SWMU #11 are coal tar decanters that have been in operation since 1919. The conclusion of the RFI Coke Manufacturing Plant Report dated November 27, 2000, for SWMU #10 and SWMU #11 by Sloss was no further action based on the risk assessment and the area at SWMU #11 is covered by asphalt. The EPA does not agree that there should be no further action. We agree that if the area is covered by asphalt there are no plausible exposures. The purpose of the investigation is to delineate the source area in the soils for groundwater contamination. Further investigations are not to be predicated on a risk assessment at the point of exposure. The facility must define the scope and extent of soil impacts once a release has been assessed. Impacted soils may a potential source for groundwater contamination. The facility stated that it would install a groundwater monitoring well (MW-60) to assess impacts to groundwater from SWMU #10 and SWMU #11.

SWMU #10, Coal Tar Decanter, was investigated and the following hazardous constituents were detected in the soil at 10-SL-001 from 2-4 feet, BAA (3 mg/kg), BAP (2.7 mg/kg), BBF (3.4 mg/kg), BKF (1 mg/kg), I(1,2,3-cd)P (2.4 mg/kg), naphthalene (160 mg/kg), 2-methylnaphthalene (23 mg/kg), dibenzofuran (4.9 mg/kg), benzene (4.4 mg/kg), ethylbenzene (2.1 mg/kg), total xylenes (6.7 mg/kg), and toluene (4.4 mg/kg).

SWMU #11, Coal Tar Decanter 11-SL-002 from 2-4 feet, BAA (130 mg/kg), BAP (86 mg/kg), BBF (120 mg/kg), BKF (21 mg/kg), I(1,2,3-cd)P (58 mg/kg), naphthalene (82 mg/kg), 2-methylnaphthalene (19 mg/kg), dibenzofuran (95 mg/kg), benzene (83 mg/kg), fluorene (300 mg/kg), fluoranthene (800 mg/kg), phenanthrene (900 mg/kg), pyrene (490 mg/kg).

Sloss should take additional soil samples around SWMU #10 and SWMU #11 to define the scope and extent of releases to soil. The facility had taken only two soil borings at each SWMU. Releases were confirmed at both SWMUs. Sloss must propose a sufficient number of samples taken at the bed rock soil contact to determine if coal tar is migrating along the surface of the bedrock.

Comment #40: Groundwater Monitoring MW-60 for the SWMU #10 Coal Tar Decanter for No. 3 and 4 Coke Batteries and SWMU #11 Coal Tar Decanter No. 5 Coke Batteries

MW-60 was installed in what was believed to be in the down gradient direction from SWMU #10 and SWMU #11 to assess impacts to groundwater. On page 30 of the Phase II RFI Report dated February 28, 2001, the facility stated that MW-60 was upgradient of SWMU #10 and SWMU #11. The potentiometric data for MW-60 in the COEDAEID indicated that the well was installed on the north side of a narrow groundwater high that forms a divide in shallow aquifer with groundwater flowing to the north-northeast. On the opposite side of the divide groundwater flows to the southeast. The groundwater contours on Figure 1-9 of the COEDAEID,

is in the down gradient direction of groundwater flow. Groundwater contamination was detected at MW-58; Acenaphthene (93 ug/L) (*tap water standard*-37 ug/L), dibenzofuran (130 ug/L) (12.16 ug/L), fluorene (130 ug/L) (24 ug/L), benzene 100 ug/L) (*MCL* 5 ug/L), Bis (2-ethylhexyl)phthalate (61 ug/L) (6 ug/L),1-methylnaphthalene (380 ug/L) (.620 ug/L) 2-methylnaphthalene (540 ug/L) (.620 ug/L) and naphthalene (19,000 ug/L) (.62 ug/L). Sloss needs to install a well down gradient of MW-58. Specify on a map in the RFI work plan the location of the new well.

Comment #43: SWMU 1A-Quench Tower A, Sumps, Pump Basins, and Settling Basins

During an inspection of SWMU 1A a large crack was observed in the southeast corner of the sump. Soil sample 01A-SL0005 was taken 10 feet from the large crack. PAHs were detected in the soils at 01A-SL0005 collected from 2-4 feet depth with BAA detected at 1.4 mg/kg. Sloss indicated that the water table is 3 feet below the surface and that soil samples were taken from 2-4 feet. The SSL with a DAF of 1 for BAA is .08 mg/kg. Exceeding the DAF of 1indicates that the shallow groundwater could be impacted from BAA.

Sloss should consider the use of a Geoprobe to collect groundwater samples and define the extent of shallow groundwater impacts. Specify the number of Geoprobe groundwater samples to be acquired. Specify that metals, BTEX and SVOCs including PAHs will be analyzed in groundwater samples. The facility should provide a potentiometric map based on the geoprobe sampling around Quench Tower A.

Comment #44: SWMU 2A-Quench Tower A, Sump

A seep from an existing crack which extends along the entire length of the south and east walls of the sump was observed during the visual inspection. PAHs were detected in soil sample 2A-SL0001, collected from 2-4 feet depth, with BAA detected at a concentration of 6.7 mg/kg. The groundwater is shallow at a depth of 3 feet below the ground surface. The SSL with a DAF of 1 is .08 mg/kg. This indicates that the shallow groundwater could be impacted from BAA.

Sloss should consider the use of a Geoprobe to collect groundwater samples and define the extent of shallow groundwater impacts. Specify the number of Geoprobe groundwater samples to be acquired to adequately characterize a shallow groundwater plume. Specify that metals, BTEX and SVOCs including PAHs will be analyzed in groundwater samples.

Comment #45: SWMU 3A-Quench Tower A and Sump

The photographic log indicated a significant horizontal crack on the north wall of the sump with seeps along the length of the wall. The depth of the sump is 12.5 feet. This would be an excellent path way for contaminated water to leave the sump. The facility took a soil sample at 3A-SL0001 at a distance of 10 feet from the wall and detected no impacts to the soil at 6-8 feet. The soil sample should have been taken against the wall. Water leaking through the side of the sump into the soil would have run down the side of the sump wall and followed the foundation of the sump. The facility did not take soil samples on the downgradient side or the east of the sump. There were numerous seepages on the east side of the sump wall. The water

Visibly stained material around SWMU #6 was removed to a depth of 2 feet. No samples had been acquired to determine if the PAHs extended to depth after soil removal. Total petroleum hydrocarbon (TPH) concentrations ranged from 949 mg/kg to 4,172 mg/kg. The facility took background concentrations of soil and determined that the background TPH due to coal material was 77.2 to 97.3 mg/kg. Visibly stained material was excavated to the red clay which was between 1 foot and 2 feet in depth. During the RFI Sloss took one soil sample 06-SL0001 on the north side of SWMU #6 near a pre-excavation sample location that detected a TPH of 1,588 mg/kg. No samples were taken outside the area of excavation with the exception of two background samples taken west of the spill. The samples were 10 and 20 feet from the spill site. The sample was taken in the area of the excavation and must have been from the backfill. The soil sample 06-SL0001 detected PAHs from 0-1 feet. BBF was detected at 6.5J mg/kg, chrysene 4.4J mg/kg, fluoranthene 12J mg/kg, naphthalene 4.3J mg/kg, and pyrene 10J mg/kg. Soil borings at 6-8 feet and 12-14 feet indicated that PAHs were not detected. The facility maintained that the concentrations detected at 0-1 feet were within the range of background.

EPA does not agree that the background samples were background but were taken within a contaminated area. It may be that the background samples were not taken within the spill area. The facility did not take samples around the outside of the edge of the visually impacted area to determine if the diesel may have migrated within the fill on top of the clay. The highest concentration of TPH at 4,172 mg/kg was located on the south side of the SWMU #6. Sloss should conduct confirmatory sampling on the south side of SWMU #6 to determine that the diesel spill did not extend beyond the excavation. The facility should take samples incrementally to bedrock. Specify the number of soil samples and their depths. Provide a map with the location of the soil boring.

Specific recommendations regarding the Biological Treatment Facility (BTF), Sewers, and Landfill Areas, Coke Plant, and former Chemical Plant at Sloss Industries and in offsite residential areas are also enclosed.

EPA does not request that Sloss revise and resubmit all reports herein commented on. Instead, as discussed previously, it is EPA's expectation that Sloss incorporate these comments and recommendations into all future reports and documents, including the facility wide report. The comments/recommendations will also be used in determining whether future Environmental Indicator (EI) goals are achieved (i.e., CA400 and CA550).

EPA suggests that a meeting take place to further discuss these comments/recommendations and to outline a multi-year approach to future activities required at the facility. Sloss will be contacted for a suggested time and location for this meeting once there has been sufficient time to review these comments/recommendations.

If you have any questions concerning this matter, please contact Robert Morris at (404) 562-8470.

Sincerely,

Jon D. Johnston
Chief, RCRA Programs Branch
Waste Management Division

Enclosure

cc: Jim Henry, Sloss Industries
Daniel Grucza, Walter Industries, Inc.
Kelly Moody, CH2M Hill
William G. Hardy, ADEM
Chip Crockett, ADEM
Jeff Anderson, ADEM

Robert Morris
Deployed to MSLF Duty

Lael Butler
060302

Jon D. Johnston
for 060302

ENCLOSURE 7

CH2M HILL
2567 Fairlane Drive
Montgomery, AL 36116-1607
P.O. Box 230548
Montgomery, AL 36123-0548
Tel 334.271.1444
Fax 334.277.5763

CH2MHILL

August 28, 2006

345461.A1.01

Mr. Robert Morris
Waste Division, RCRA Programs Branch
U.S. Environmental Protection Agency, Region 4
61 Forsyth Street
Atlanta, GA 30303-8960

SUBJ: **Response to Comments: Sloss Industries, Inc.–Birmingham, AL**
(ALD 000 828 848)
–July 2005–Consolidated Overview of Environmental Data in Support of the Environmental Indicator Determination (COEDAEID) Report
–November 27, 2000–RFI Coke Manufacturing Plant Report
–January 17, 2003–Phase II RCRA Facility Investigation (RFI) Report Land Disposal Areas and BTF and Sewers Report (including revised March 17, 2004, Comments)
–January 28, 2003–RFI Chemical Manufacturing Plant

Dear Mr. Morris:

On behalf of Sloss Industries, CH2M HILL is providing the following responses to the U.S. Environmental Protection Agency (EPA) comments dated March 2, 2006. Specific comments (by report) as received from EPA are noted below in italicized text, followed by the response to the comment.

As discussed during the July site visit, CH2M HILL is scheduled to complete several activities over the next few months (September/October 2006) before development of the Phase III Resource Conservation and Recovery Act (RCRA) Facility Investigation (RFI) Work Plan. These activities include the following:

- Monitoring well network efficacy assessment to support identification of the wells requiring rehabilitation or redevelopment, selection of wells to be recommended for sampling, and identification of proposed locations and screened intervals for the wells needed to address the existing data gaps
- Site reconnaissance to characterize the current environmental setting, ecological receptors, and potentially complete ecological exposure pathways
- Review of historical information including descriptions of environmental conditions, nature and extent of contaminants, and evaluations of potential ecological risk associated with the facility to identify data gaps that could limit an updated evaluation of ecological risk

- Site reconnaissance and vendor testing of coal tar to determine suitability of using TarGOST for subsurface coal tar delineation. Briefly, TarGOST is a laser-induced fluorescence (LIF) instrument that delineates coal tar and creosote in the subsurface through the fluorescence of the polycyclic aromatic hydrocarbon (PAH) constituents found in these materials. The fluorescence signal is directly proportional to the concentration in the subsurface; typically, the technique focuses on mapping of true non-aqueous phase liquid (NAPL) contamination (≤500 parts per million [ppm] NAPL on soil). TarGOST can be deployed on a variety of platforms, including direct-push and cone penetrometer test (CPT). Onsite mapping of results yields a detailed three-dimensional map of the contaminant distribution, which can be used to direct the project in real-time to address potential data gaps immediately. If it is determined via vendor testing that TarGOST is not a suitable technology for delineating contamination on the Sloss site, more conventional subsurface sampling will be proposed.

Until these activities are complete, many of the responses contained in this document remain general in nature, with the understanding that the EPA's comments will be considered as the Phase III RFI Work Plan is developed. It is our intent that the pending Phase III field activities (to be submitted to EPA for approval with the Phase III RFI Work Plan) will address existing data gaps. Once these data gaps are filled, Sloss will better be able to address the full intent of EPA's technical comments.

Consolidated Overview of Environmental Data in Support of the Environmental Indicator Determination (CH2M HILL, July 2005)

Comment #1: Background Sampling

Sloss proposed to collect background soil samples from undisturbed locations unaffected by the site and where soils have developed through weathering of the Conasauga Limestone for analysis of inorganics and PAHs to assess the natural concentrations in the area. After representative background concentrations of PAHs and metals have been established, additional surface soil samples may be warranted from residential properties that exceed the background concentrations and the risk-based screening levels (RBSLs).

a. Sloss compared all offsite data to background soil borings that had been taken during earlier RFI activities. These are soil borings SB-1 through SB-6. These soil borings are located on Sloss property and are in areas affected by Sloss's industrial activities. For example, the following constituents were detected in Sloss's background soil samples (benzo(a)anthracene (BAA), benzo(a)pyrene (BAP), benzo(b)fluoranthene (BBF), tetrachloroethene (PCE), methylene chloride, and trichloroethene (TCE)). The only background soil samples analyzed for PAHs that were within the quantitative limits were in SB-1. All offsite PAH data were compared to one soil boring SB-1. It is unknown if PAHs exist in soil samples SB-2 through SB-6 because of a quantitative limit flagged "U" was an order of magnitude higher than the PAH compounds detected in SB-1. Sloss used the maximum concentration detected for BAA (33 mg/kg), BAP (40 mg/kg) and BFF (66 mg/kg) as the

background concentration to compare with offsite samples. Sloss stated that the PAH compound BAP was detected in 40 offsite sampling locations and decrease in concentration with distance from the site. Sloss stated that none of the 40 offsite detections of BAP exceeded the highest background concentration of BAP at a concentration of 40 mg/kg. The residential PRG for BAP is .062 mg/kg. The highest offsite concentration of BAP identified is at OSS-14 which listed BAP (5.2 mg/kg) or almost 2 orders of magnitude above the residential PRGs. In addition, other carcinogenic PAHs were also present at elevated concentrations: BAA (3.2 mg/kg) with a residential PRG of .62 mg/kg and BBF (8.5 mg/kg) with residential PRG of .62 mg/kg. It is inappropriate to compare the residential contaminant concentrations to back ground samples collected in impacted areas. Sloss's explanation for the occurrence of BAP is that it is typical in urban environments and some of the BAP is not site related. EPA rejects this explanation given the age of the site, nature and mobility of the waste and raw material management. Background soil sample locations SB-1 through SB-6 are not appropriate locations for back ground soil samples. Sloss must compare PAHs and metals with background soils unaffected by site activities. In all likelihood, the levels of PAHs and metals found in the neighborhoods surrounding Sloss are the result of aerial deposition of coal fines and wastes originating from Sloss Industries.

However, EPA endorses the proposal to collect background soil samples from undisturbed locations unaffected by Sloss Industries or from similar industries. The background soil locations must also be unaffected by other facilities that produce coke or smelting iron ore or store coal or from an area where there has been no aerial deposition of PAHs or metals. The facility should compare the concentrations of back ground metals and PAHs with the concentrations of metals and PAHs found in coal fines and waste byproducts to smelting and coking processes. The calibration curve for analyses of individual PAH compounds must fall within the Region 9 residential preliminary remediation goals. The facility should provide a map with the location of the background soil samples and a description of the soils in the area.

b. Sloss stated that in Alabama the average background arsenic concentrations range from .8 mg/kg to 11 mg/kg with a state wide average concentration of 4.7 mg/kg. The soil samples collected for background SB-1 through SB-6 were collected from 0-2 feet in depth. Arsenic was detected at SB-1 at a concentration of (11 mg/kg), SB-2 (16 mg/kg), SB-3 (14 mg/kg and 21 mg/kg), SB-4 (13 mg/kg), SB-5 (6 mg/kg), and SB-6 (7.6 mg/kg). Concentrations of arsenic decrease with depth at SB-5 from 0-2 feet (6 mg/kg), 2-4 feet (3.1 mg/kg), and increase at 4-6 feet to (5.5 mg/kg). The facility stated that SB-1 through SB-3 were collected in soils above the Hartselle Formation and SB-4 through SB-6 were collected in soil above the Red Mountain Formation. This suggests that arsenic concentration on the west side of the Opossum Valley Fault are not representative of soils on the east side of the fault which overlie the Conasauga Limestone. While this is true, it's important to point out that samples SB-1 through SB-3 may have been impacted by site activities. Arsenic concentrations decrease with depth at SB-1 from 11 mg/kg at 0-2 feet to 7.2 mg/kg from 8-10 feet, to 4.3 mg/kg from 14 to 16 feet. One would expect higher concentrations of arsenic to be near the surface if impacted by aerial deposition or placement of waste material.

While background samples were not collected in soils overlying the Conasauga Limestone soil sampling data collected across the site at SWMUs overlying the Conasauga Limestone indicate that arsenic levels approaching the average for the state can been seen at depth except in areas where arsenic has been released from site waste management activities. For example, if the arsenic levels are examined for deep soils overlying the Conasauga Limestone one would expect the arsenic found in residual clays would be indicative of or approximating background. Soils sampled around the following SWMUs with corresponding sampling depths and concentrations of arsenic are: SWMU #13 (19-21 feet) (2.8 mg/kg), SWMU #14 (18-20 feet) (4.8 mg/kg), SWMU #15 (20-23 feet) (7.5 mg/kg), SWMU #17 (18-20 feet) (11J mg/kg), SWMU #18 (20-22 feet) (2.6J mg/kg), SWMU#19 (18-20 feet) (4.9J mg/kg), SWMU #1B (12-14 feet) (9 mg/kg), SWMU #26 (13-15 feet) (3.3 mg/kg), SWMU #27 (10-12 feet) (4.8 mg/kg), SWMU #29 (12-13 feet) (2.9 mg/kg), SWMU #31 (6-8 feet) (5.2 mg/kg), SWMU #36 (8-10 feet) (6.7 mg/kg), SWMU#38 (18-20 feet) (1.8 mg/kg), and SWMU #4 (18-20 feet) (3 mg/kg). From this data of 14 SWMUs the average arsenic concentrations taken in deep samples, presumably unaffected by waste management activities on the surface, are about 5.02 mg/kg.

At offsite sample location OSS #4 on the east side of the Opossum Valley Fault in soils overlying the Conasauga Limestone the lowest arsenic level detected was at a concentration of 6.7 mg/kg. This is an arsenic level approaching background. In offsite soils on the south side of the facility Arsenic occurs across the south side of the facility in concentrations that range from 20 mg/kg to 49 mg/kg in 19 samples. On the west side of the Opossum Valley Fault surficial soil arsenic concentrations average between 9.1 mg/kg and 16 mg/kg. Onsite arsenic concentrations tends to decrease with depth indicating that the arsenic in the surficial soils are related to site waste management activities or from releases to the air. Sloss should take samples from 4-6 feet in depth or in undisturbed soils in the neighborhoods to determine if the arsenic concentrations decrease with depth. The samples should be acquired at the location of the surficial soil samples.

Response #1

As supported by the guidance document (provided by EPA following the July site visit)–*Guidance for Comparing Background and Chemical Concentrations in Soil for CERCLA Sites* [EPA 540-R-01-003; OSWER 9285.7-41, September 2002], Sloss proposes to collect additional background samples in areas "unaffected" by site operations and where soils have developed through weathering of the Conasauga Limestone for analysis of inorganics and PAHs as part of the pending Phase III RFI field activities. Specific locations will be submitted for EPA approval with the Phase III RFI Work Plan. As noted previously, after representative background concentrations of PAHs and metals have been established, Sloss will determine if additional surface soil samples may be warranted from residential properties that

exceed (2 times) the background concentrations and the risk-based screening levels (RBSLs).

In addition, should any data gaps be identified during the ecological risk review related to surface water and sediment background samples, this also will be presented for EPA's review and approval as part of the Phase III RFI Work Plan.

Comment #2: Additional Offsite Residential Soil Samples

Sloss stated that after representative background concentrations of PAHs and metals have been established, additional surface soil samples may be warranted at residential properties that exceed the background concentrations and the risk-based screening levels (RBSLs).

It is EPA's opinion that additional offsite soil samples are warranted based on exceeding the residential risk based concentrations for individual PAHs and arsenic. At the southern end of Sloss are the coal and coke storage areas where Sloss has not been able to effectively control the migration of dust from leaving the facility. Residential sampling has detected elevated levels of PAHs and metals relative to residential PRGs at surficial sampling locations OSS #3, OSS #6, OSS #7, OSS #10, OSS #13, OSS #14, and OSS #15. A distinct trend appears south of the facility when considering PAHs compounds and metals. Directly across from the coal and coke storage areas in the residential subdivision the following surficial soil samples detected the following constituents: OSS #3-Arsenic (24 mg/kg), BAA (2.8 mg/kg), BAP (4.7 mg/kg), BBF (6.9 mg/kg); OSS #6-Arsenic (39 mg/kg), BAA (.18 mg/kg); OSS #7-Arsenic (35 mg/kg), BAP (.3 mg/kg); OSS.#10-Arsenic (29 mg/kg), BAP (.15 mg/kg); OSS #13-Arsenic (40 mg/kg), BAP (.39 mg/kg), BBF (.55 mg/kg); OSS #14-Arsenic (23 mg/kg), BAA (3.2 mg/kg), BAP (5.2 mg/kg), BBF (8.5 mg/kg); and OSS #15-Arsenic (34 mg/kg), BAA (3.4 mg/kg), BAP (4.4 mg/kg), and BBF (8.3 mg/kg). EPA recommends additional samples are warranted in the following areas:

South Side of Sloss West of 31st Way North-Shuttlesworth Drive
i) Additional surficial soil samples are needed around OSS #10 at the Hudson School. Analyze for PAHs and arsenic.
ii)Additional samples are needed in the blocks around OSS #7, OSS #13, OSS #14, and OSS #15. Analyze for PAHs and arsenic. Take a deep soil boring at OSS#13 to determine if the PAH and arsenic concentration diminish with depth. Define the extent of arsenic and PAH contamination along 35th Avenue in the vicinity of OSS #14 and OSS #15.

South Side of Sloss East of 31st Way North-Shuttlesworth Drive
iii)Additional surficial soil samples are warranted in the vicinity of OSS #3 and OSS #6. Analyze for PAHs and arsenic. Take a deep sample at OSS #3 to determine if the arsenic and PAHs decrease in concentration.
iv) Additional surficial soil samples in the vicinity of OSS #9 and OSS #11 are warranted. Analyze for PAHs and arsenic. OSS #9 detected arsenic at (49 mg/kg), BAA (1.1 mg/kg), BAP (1.3 mg/kg),

and BBF (1.6 mg/kg). OSS #11 detected arsenic at (36 mg/kg) and BAP (.075 mg/kg). Define the scope and extent of PAHs.
v) Additional surficial soil samples should be taken around Calloway Elementary School and analyzed for arsenic and PAHs. OSS#4 detected BAP (.24 mg/kg).

Response #2
Refer to Response #1. Until representative background samples are collected for comparison with the existing offsite soil data, no further offsite soil collection is planned. Once a determination is made that additional offsite soil sampling is warranted, EPA's recommended sampling locations will be considered for further evaluation, if appropriate.

Comment #3: Harrimon Park Soil Sampling

Sloss sampled the Harrimon Park neighborhood surficial soils and identified arsenic and PAHs in samples OSE #1- OSE #8 and in OSES #1 - OSES #3. Arsenic ranged from 20 mg/kg to 42 mg/kg with highest concentration at OSE #3. In addition, PAHs were detected in concentrations that were less than an order of magnitude above the Region 9 residential PRGs. Soil sample OSE #2 detected BAP at a concentration of .44 mg/kg. The residential PRG for BAP is (.062 mg/kg). Soil sample OSES #3 detected the PAHs, BAA (.57 mg/kg), BAP (.55 mg/kg), and BBF (.94 mg/kg).

Sloss should take additional samples to assess the scope and extent of arsenic contamination in the Harrimon Park area as arsenic concentrations are from 4 to 8 times the background concentrations. Samples should also be taken in Harrimon Park to establish if the arsenic levels increase across the school grounds and decrease in concentration with depth. The PAHs in this area are low relatively speaking less than an order of magnitude above the residential PRGs . However, additional assessment is warranted at OSES #3 and OSE #2 to define the scope and extent of the PAH compounds.

Response #3
Refer to Response # 1. Until representative background samples are collected for comparison to the existing offsite soil data, no further offsite soil collection is planned. Once a determination is made that additional offsite soil sampling is warranted, EPA's recommended sampling locations will be considered for further evaluation, if appropriate.

Comment #4: Riggins School Soil Sampling

Sloss took offsite soil samples in the residential areas on the west side of the facility. The arsenic concentrations ranged from 9.1 mg/kg to 16 mg/kg. The PAH compounds were also relatively low and less than an order of magnitude above the Region 9 residential risk based concentrations. The highest concentrations of PAH compounds were in the play ground of the Riggins Elementary

School. The school is no longer in use but the school may be reused some day. Soil sample OSW #8 detected arsenic at 16 mg/kg and the PAHs BAA (5.4 mg/kg), BAP 6.2 mg/kg), BBF (6.5 mg/kg) which are 1 to 2 orders of magnitude above the residential PRGs.

Additional surficial soil samples are warranted around the playground and school. Soil samples should also be taken at depth at OSW #8 where the highest concentration of PAH compounds were detected to determine if the contamination increases with depth.

Response #4

Refer to Response #1. Until representative background samples are collected for comparison with the existing offsite soil data, no further offsite soil collection is planned. Once a determination is made that additional offsite soil sampling is warranted, EPA's recommended sampling locations will be considered for further evaluation, if appropriate.

Comment #5: Air Monitoring Data for Residential Areas

Does Sloss monitor its air emissions from its processes at the facility? Has Sloss detected arsenic and cyanide in its emission gases? Provide air emission data for arsenic, PAHs and cyanide. Determine the deposition rate and deposition concentration of the compounds from air emissions.

Response #5

Sloss' air emissions are subject to local, state, and federal air regulations and are covered by the Major Source Operating Permit issued by the Jefferson County Department of Health Air Pollution Control Program. Applicable regulations specific to coke making include Subpart L-National Emission Standard for Hazardous Air Pollutants for Source Categories and for Coke Oven Batteries, and Subpart CCCCC-National Emission Standards for Hazardous Air Pollutants for Coke Ovens: Pushing, Quenching, and Battery Stacks. Emission rates in permit applications and period compliance reports are based on EPA-developed emission factors for coke making. Sloss has not conducted source testing for arsenic, cyanide, and PAHs in the coke plant emission sources.

Estimates of deposition rates are not available, and would require developing a complex air dispersion model of the Sloss emission points and the emissions from other nearby industries and activities. Jefferson County operates an ambient air quality monitoring station across the street from the Sloss site; these data are available through either the Alabama Department of Environmental Management (ADEM) or Jefferson County. Sloss routinely receives only real-time CO and PM10 data to support the implementation of best operating practices.

If this response does not meet the intent of EPA's question, Sloss requests clarification of the comment.

Comment #6: Arsenic and PAH Contour Map

Sloss did not provide a map of the offsite residential areas that listed the PAH compounds detected at each sampling location. Instead Sloss listed all PAH compounds in Table 4-4. Sloss must provide a surficial soil contour map for arsenic and individual PAHs like BAP, BAA, and BBF for all residential areas sampled.

Response #6
As noted in EPA's March 2, 2006, comment letter, this request will be incorporated into future reports and documents, as appropriate. Once background concentrations of arsenic and PAHs have been established for this urban setting, concentration maps will be developed to denote areas where the target compounds exceed (2 times) background and will be included in future reporting.

Comment #7: Soil Gas Sampling

Sloss recommends collecting soil gas samples around occupied buildings in the Coke Plant that are situated above the groundwater VOC plume to determine the potential impact on indoor air.

EPA endorses collecting soil gas samples around occupied buildings to assess VOC migration from soils and the shallow groundwater contamination plumes. Sloss should provide a soil gas sampling plan describing the method for collecting soil gas. We recommend that Sloss utilize EPA's vapor intrusion guidance entitled: Draft Guidance for Evaluating the Vapor Intrusion to Indoor Air Pathway from Groundwater and soils (Subsurface Vapor Intrusion Guidance) November 2002, EPA 530-0-02-004, to design a vapor intrusion study and implement the methods for collecting and analyzing data.

Response #7
Sloss will complete delineation of the VOC plume in groundwater in the Coke Plant as part of the Phase III RFI field effort. Once the location of the VOC plume in groundwater is identified, representative soil gas sampling locations can be more accurately selected, as necessary, on the basis of groundwater VOC concentrations and depth to groundwater. Prior to the collection of soil gas samples, a soil gas sampling plan will be provided to EPA for review and approval.

Comment #8: Sampling and Analysis Plan

Sloss recommends completing an overall assessment of the efficacy of the existing groundwater monitoring well network and sampling and analysis plan for the site.

EPA endorses an overall assessment of the existing groundwater system. It is recommended that the facility determine if there is adequate groundwater monitoring for all groundwater plumes in the unconsolidated soils of the shallow aquifer and shallow bedrock and in the deep aquifer.

Response #8
Sloss will complete the well efficacy assessment to determine rehabilitation needs and/or the need for additional wells before planning the Phase III field effort. The results of this effort will be incorporated into the Phase III RFI Work Plan for EPA review and approval.

Comment #9: Additional Groundwater Monitoring Wells

Sloss recommends installing additional groundwater monitoring wells in the residential areas to delineate the extent of the offsite groundwater plume and groundwater concentrations near residences.

Sloss installed three groundwater monitoring wells offsite to assess the scope and extent of a VOC plume originating from the former Chemical Plant and failed to detect significant groundwater contamination in the shallow bedrock aquifer. EPA agrees that additional groundwater investigations are warranted on the east side of the groundwater divide. The current number and distribution of wells on the east side of shallow groundwater divide has not conclusively determined that there is no shallow groundwater contamination occurring among the wells placed into the weathered bedrock zone of the upper most aquifer. Narrow groundwater plumes maybe migrating between the existing offsite shallow groundwater wells or to the side of the existing network through shallow fissures in the subaerial karst. Sloss should propose an off-site investigation strategy for the east side of the groundwater divide. Sloss also pointed out that additional shallow bedrock wells would be needed on the south side of the facility to determine if the shallow groundwater divide under the former chemical plant is the local divide in the valley. The facility should install the appropriate wells to determine the extent of the divide and assess the presence of hazardous constituents in the groundwater. Provide a map with the number and locations of shallow groundwater wells.

Response #9
Following completion of the well efficacy assessment (refer to Response #8), Sloss will propose additional wells for installation and monitoring as part of the Phase III RFI Work Plan to be submitted for EPA review and approval.

Comment #10: Annual Water Level Monitoring and Sampling

Sloss recommends to conduct annual water level monitoring, potentiometric surface mapping, and sampling from all monitoring wells at the facility (possibly more frequently for select wells and surface water bodies) to obtain a groundwater data set sufficient to assess stabilization of the groundwater contaminant plume(s).

EPA recommends that the facility conduct annual water level monitoring, potentiometric surface mapping, and sampling from all monitoring wells at the facility. Ground water monitoring should be conducted quarterly at wells that monitor distinct groundwater contaminant plumes at the Chemical Plant and in the BTF area. The groundwater data should be used to assess the migration of ground water contamination from the shallow aquifer and from the shallow aquifer into the deep aquifer. Additional wells may be necessary to assess the migration of hazardous constituents from the shallow into the deep aquifer in the Chemical Plant, BTF Areas and Main Plant Areas.

Response #10
Following completion of the well efficacy assessment (refer to Response #8), Sloss will propose groundwater and surface water monitoring as part of the Phase III RFI Work Plan to be submitted for EPA review and approval.

Comment #11: Ecology

Sloss recommends beginning identification of ecological issues, supplementing existing information, as appropriate.

See EPA comments 13-16 in the section entitled: Phase II RCRA Facility Investigation (RFI) Report Land Disposal Areas and BTF and Sewers Report. EPA previously agreed that Sloss did not need to respond to the comments for the above referenced report until the Environmental Indicator Evaluations were completed. Since the EI evaluations have been completed Sloss needs to address all of the attached comments including the revised portions of the comments that are based on the most recent data collection for the EI studies.

Response #11
CH2M HILL is in the process of reviewing all of the historical ecological investigations and risk screening analyses, along with evaluating the current environmental conditions and potential ecological exposure pathways based on an upcoming site reconnaissance and the current analytical data for all media. The findings of the ecological review, along with recommendations for addressing data gaps necessary for conducting an updated ecological risk assessment, will be incorporated into the Phase III RFI Work Plan for EPA review and approval. EPA

Comments #11 and #13 through #16 will be taken into account during the preparation of the Phase III work plan.

Comment #12: No Further Action Determination for SWMUs

Sloss recommends reviewing the existing data for the purpose of identifying whether future investigative activities or no further action determination is warranted for each solid waste management unit.

EPA endorses this approach to identify which SWMUs should not be retained for future investigations. Sloss needs to ask the following questions:

- *Have samples been collected from below the base of the unit?*
- *Has a second or third, etc., set of samples been collected to assess the extent of release based on the data acquired from the first set of samples?*
- *Have soil samples been taken from the bedrock soil interface?*
- *Do the chemical concentrations exceed the soil screening levels (SSL) for a dilution attenuation factor of 1?*
- *Has the groundwater in the shallow and deep bedrock aquifers down gradient of a SWMU with releases to the soil been adequately assessed?*
- *For a well that are not located near a known SWMU or AOCs and have constituents that are not known in upgradient SWMUs or AOCs what is the likely source area?*

Response #12

As part of the Phase III RFI Work Plan, Sloss will indicate which SWMUs are recommended for further investigation and which require no further action (NFA). EPA's recommended questions will be considered when providing justification for NFA in the Phase III work plan or follow-on reports, as appropriate.

Phase II RCRA Facility Investigation (RFI) Report Land Disposal Areas and BTF and Sewers Report (Arcadis, January 17, 2003)–Revised Comments

Comment #13: Ecological Study-Sediment

Page 23, 2nd paragraph, Sloss stated that it would use a proposed sediment quality criteria (SQC) for the protection of benthic organisms for acenaphthene (12,600 ug/kg), fluoranthene (91,800 ug/kg), and phenanthrene (10,800 ug/kg). The sediment criteria were normalized using a total organic carbon (TOC) criteria calculated from previous investigations.

Sloss needs to define what is meant by normalizing the concentrations of individual PAHs by using total organic carbon (TOC). What were the individual PAH concentrations prior to normalizing the PAHs?

Response #13

As noted in Response #11, CH2M HILL is in the process of reviewing the historical information related to the evaluation of ecological risk at this site. This will include a review of the rationale and process for TOC normalization of sediment screening values. If the normalization process is considered valid, the methodology will be clearly described, along with a presentation of screening values with and without normalization. If normalization is considered inappropriate, then EPA Region 4 sediment screening values for PAHs will be used in the updated assessment of ecological risk.

Comment #14: Ecological Study-Sediment

We recommend that Sloss use the Region 4, sediment screening values for total PAHs at 1.6 mg/kg to determine the need for additional investigation. The ecological screening values for sediments listed in the Ecological Risk Assessment Bulletin-Supplement to RAGs, may be accessed at the Region 4, Waste Management Division web site at the following address:
www.epa.gov/region4/waste/ots/ecolbul.htm .

Response #14

As noted in the comment, EPA Region 4 screening values for sediment will be used in updated ecological risk evaluations for this site. Screening values for individual PAHs, as well as for total PAHs, will be included in assessments of sediment contamination.

Comment #15: Ecological Study-Sediment in Ditches

Sloss collected sediment samples in site ditches at 500-600 foot intervals and listed the concentrations for total PAHs for the following sediment sampling locations: SD-2 (753,500 ug/kg), SD-4 (628,700 ug/kg), SD-5 (117,180 ug/kg), SD-7 (103,210 ug/kg), SD-8 (84,890 ug/kg), SD-9 (93,890 ug/kg), SD-10 (26,730 ug/kg), SD-11 (64,400 ug/kg), SD-13 (33,870 ug/kg), SD-17 (27,990 ug/kg), and SD-20 (226,600 ug/kg). Additional sampling is warranted up and down gradient of the following sediment sampling locations because the PAH concentrations exceed the Region 4 screening levels: SD-14 (20,270 ug/kg), SD-16 (12,830 ug/kg), SD-18 (5,470 ug/kg), and SD-19 (15,410 ug/kg).

We also recommend analyzing for total organic carbon in each sample. Sloss did not present the total organic carbon concentrations (TOC) in Tables 4-3 and 4-4, which listed the analytical results of the sediment sampling for SD-7, SD-9, SD-11, SD-12, SD-14, SD-16, SD-18, and SD-20. The facility should also determine background total organic carbon in areas unaffected by Sloss or similar

industries. A high concentrations of total organic carbon occur in areas with coal dust which are high in PAHs.

Sloss is to reevaluate all of its sediment data in the ditches and compare the data to the Region 4 ecological screening values and present the data in a table format and make recommendations accordingly for additional investigations. The EPA is concerned that sediments are mobile and will migrate offsite into 5 Mile Creek during storm events. Sloss needs to take samples along cross sections in its ditches where samples were previously obtained to determine the volume of PAHs in the ditches. In addition, the wastes deposited in the ditch and within the banks will ultimately need to be removed and properly disposed.

For sediments that exceed 23 mg/kg for total PAHs, a Probable Effects Criteria (PEC) in MacDonald et al, 2000, Region 4 shall require the facility to conduct toxicity testing of the sediments in the ditches.

Response #15

As noted in Response #11, CH2M HILL is in the process of reviewing the historical information related to the evaluation of ecological risk at this site. This review will include the locations of all sediment samples (i.e., onsite ditches and Five Mile Creek), an evaluation of concentrations of PAHs in sediment relative to EPA Region 4 sediment screening values, and a determination of what additional sediment (and ditch bank) sampling may be required to better determine the extent of contamination in affected aquatic systems. Historical sediment TOC data will be identified, and any future sediment samples will be analyzed for TOC.

CH2M HILL has not completed its review of the existing ecological risk information; thus, it would be premature to propose sediment samples for aquatic toxicity testing. Toxicity testing normally is done as part of a baseline ecological risk assessment, yet it appears that evaluations of ecological risk are currently at the screening level stage. Therefore, the determination regarding conducting sediment toxicity tests should be delayed.

Comment #16: Five Mile Creek

Sloss listed the concentrations for total PAHs in the ditches that could potentially discharge via the NPDES Outfall into Five Mile Creek. The concentrations are as follows for the sampling locations: SD-2 (753,500 ug/kg), SD-4 (628,700 ug/kg), SD-5 (117,180 ug/kg), SD-7 (103,210 ug/kg), SD-8 (84,890 ug/kg), SD-9 (93,890 ug/kg), SD-10 (26,730 ug/kg), SD-11 (64,400 ug/kg), SD-12 (ND) Nondetect, SD-13 (33,870 ug/kg), SD-14 (20,270 ug/kg), SD-15 (ND), SD-16 (12,830 ug/kg), SD-17 (27,990 ug/kg), SD-18 (5,470 ug/kg), SD-19 (15,410 ug/kg), SD-20 (226,600 ug/kg), and SD-21 ND.

Additional sediment samples are warranted in 5 Mile Creek based on the concentrations of PAHs and cyanide detected in the site ditches. EPA had requested additional sediment studies and surface water samples be collected during the EI evaluation. Sloss took two sediment samples downstream of the facility in 5 Mile Creek and one sample at the outfall. The most downstream samples was taken 4,000 feet downstream. EPA noted that the substrate for 5 Mile Creek was primarily of cobbles and few areas were noted where fine grain samples could be acquired. Consequently only two samples were collected down stream of the outfall FMCSS #1 with concentrations of PAHs constituents BAA (1.5 mg/kg), BAP (2.1 mg/kg), BBF (2 mg/kg), DBA (.38 mg/kg) and FMCSS #2 BAA (6.2 mg/kg), BAP (9.0 mg/kg), BBF (9.8 mg/kg), DBA (2.2 mg/kg) and IDP (2.3 mg/kg). An outfall sediment sample detected PAH constituents BAA (10 mg/kg), BAP (11.0 mg/kg), BBF (12 mg/kg), DBA (2.7 mg/kg) and IDP (3.9 mg/kg). Sediment samples upstream from Sloss's plant outfall detected similar PAH constituents as in the downstream samples but at lower concentrations. FMCSS #3BAA (.98 mg/kg), BAP (1.1 mg/kg), BBF (1.4 mg/kg), and DBA (.29 mg/kg). FMCSS #4BAA (.77 mg/kg), BAP (.98 mg/kg), BBF (1.1 mg/kg), and DBA (.15 mg/kg). ABC Coke is upstream from Sloss Industries. Based on the data collected at Sloss's outfall and in downstream sediments the PAHs detected in the stream sediments are likely from Sloss Industries.

Five Mile Creek is a fast moving stream that scours its bed and moves sediments downstream preventing sediment from depositing in the 4,000 feet of stream reach investigated. Sloss needs to continue the investigation downstream from the downstream most location sampled and identify likely depositional areas and take samples accordingly. The samples may be taken from sediment bars and flood plain areas. The facility should analyze sediment samples for site specific constituents including but not limited to the PAHs and metals including cyanide. Provide a map illustrating the locations of depositional sites and sampling locations. Sloss needs to verify that the appropriate field reconnaissance has been completed to identify sediment deposition sites. Sloss may present any data taken by state or federal organizations from downstream investigations of 5 Mile Creek.

Response #16

As noted in Response #11, CH2M HILL is in the process of reviewing the historical information related to the evaluation of ecological risk at this site. This review will include the locations of sediment samples in Five Mile Creek. During an upcoming site reconnaissance, CH2M HILL will evaluate potential migration pathways of site-related contaminants, including discharge of sediment from onsite drainage ditches, and identify sediment depositional areas in Five Mile Creek that potentially could be sampled. As discussed during the July 2006 site visit, it is anticipated that other downstream sources into Five Mile Creek will be considered when determining the limits of investigation of the sediments in Five Mile Creek.

Comment #17: BTF Area Groundwater Flow Direction

Groundwater monitoring data in the BTF Area around SWMUs #38 and #39, indicate that the shallow and deep (regional) groundwater flow are influenced by the 200 foot deep Lafarge Quarry.

The bottom of the Lafarge Quarry may be deeper than the normal potentiometric surface of the bedrock aquifer. Consequently, the groundwater of the regional aquifer in the BTF Area is flowing toward the quarry which is the topographic low point for the area. Approximately 1,000 gallons of water per minute is being pumped from the lake at the bottom of the quarry.

During a site visit on July 10, 2003, EPA, Alabama, and Sloss representatives visited the Lafarge Quarry. At the quarry numerous seepages were identified discharging along dipping bedding planes. A potential large spring was also noted to have discharged into the lake in the bottom of the quarry. Deep groundwater samples in the Lafarge Quarry should be acquired from the lake and from seeps and springs in the quarry walls. Specify in the work plan that samples will be taken during the Spring and Fall time of the year. Also give the EPA three weeks notice before sampling of the seeps and springs in the quarry walls.

Provide a map indicating the locations for sampling seeps and springs and at several locations in the lake at the bottom of the Lafarge Quarry. Specify the number of sampling locations and the list of analytes to be analyzed in the groundwater samples.

Also, water samples should be acquired in the deep Southern Ready Mix Quarry which is adjacent to the BTF Area. The facility needs to assess the groundwater in the Southern Ready Mix Quarry for site specific hazardous constituents originating from Sloss. Sloss needs to include accurate water table elevations in the Lafarge Quarry and the Southern Ready Mix Quarry on site potentiometric maps for both shallow and deep aquifers.

Response #17

Provided that permission for sampling can be obtained, recommended sampling of the Lafarge Quarry seeps and lake will be included in the Phase III RFI Work Plan submitted for EPA review and approval. The work plan also will propose installing a staff gauge in the LaFarge Quarry lake to determine the elevation of the surface water in the quarry for use in mapping of the potentiometric surface. If permission to install a staff gauge is not granted, surface water elevations will be estimated and noted as such on the potentiometric surface maps.

Sampling of bedrock seeps along the western wall of the Southern Ready Mix Quarry may be appropriate to assess the potential for migration of contaminants from Sloss toward this quarry. Sampling of seeps along other quarry walls and any surface water in the base of the Southern Ready Mix Quarry is not recommended at this time, because of the proximity and potential for bedrock groundwater to flow from the ABC Coke Facility toward the quarry.

Comment #18: Geologic Cross-sections

The idealized geologic cross-sections would be more valuable as an exploration tool if the cross-sections were drawn accurately illustrating the attitude of the bedding dip. Figure 4.3, is the Geologic Cross-section Map that locates cross-section views A-C represented in Figures 4.4-4.6. Figures A and C are drawn roughly along the strike of the bedding as compared with the plan view of the site geology in Figure 4.2. Figure 4.5 is drawn perpendicular to the strike from MW-23 to P-3 and the bedding in the Conasuaga is portrayed as horizontal. Figure 4.2 indicates the bedding is roughly dipping at 30 degrees in the vicinity of the cross-section. Sloss needs to properly illustrate the attitude of the bedding in cross-sections as horizontal cross-sections are misleading. The facility stated that the dominant water bearing zones are in between the limestone and the shale partings which are the bedding planes. The bedding planes and the associated zones of permeability dip at 30 degrees. Since the matrix of the Conasuaga Limestone is of relatively low permeability to mostly waterless, the groundwater can only migrate through the fractures (i.e., bedding planes and along bisecting joints or faults). For example, some of the groundwater flow velocities in some wells such as P-8 = 500 ft/yr,
MW-17 = 500ft/yr, MW-27 = 700 ft/yr and 1,000 ft/yr, MW-29 = 1,000 ft/yr, and
MW-45 = 2,000-4,000 ft/yr.

The facility must revise the geologic cross-sections to accurately portray the dip of the bedding, locate groundwater monitoring wells along the section line, illustrate the potentiometric surface of both the shallow and deep aquifers, indicate which wells that are contaminated and indicate the wells with the greatest hydraulic conductivity. The facility needs to also draw in the 200 foot deep Lafarge and Southern Ready Mix Quarries in the cross-sections to scale. The facility should make several cross-sections of the deep Conasauga Limestone aquifer through the worst contaminated areas to deep Lafarge and Southern Ready Mix Quarries.

Response #18
Revised cross sections will be developed and incorporated into the Phase III RFI Work Plan and will include the requested information, as appropriate.

Comment #19: SWMU #24-Blast Furnace Emission Control Sludge Waste Pile, Soil Investigation

In the Phase I RFI Report of Land Disposal Areas dated January 1998, soil sample 24-SL0014 exhibited elevated concentrations of the most carcinogenic PAHs [e.g., BAA (63,000 ug/kg), BAP (36,000 ug/kg), BBF (33,000 ug/kg), and I(1,2,3-cd)P (22,000 ug/kg)]. The sample was taken from 0-1 foot below the surface. The facility stated that PAHs may be derived from an upgradient source and are likely from historical practices. A "no further action" recommendation was made by Sloss based on the land use. During the EI evaluation Sloss took a soil sample in the SWMU #24 area at EI #22 with apparently low concentration detected.

We recommend additional soil samples be acquired in the area between SWMU #s 24 and #23 or west of 24-SL0014 to define the scope and extent of soil impacts. The facility should also resample at SL0014 to assess the vertical extent of the high concentrations of PAHs. Sloss is required to assess the scope of impacted surficial soil regardless of use or history.

Response #19
Site conditions at this SWMU will be assessed during CH2M HILL's upcoming ecological survey, after which final surface soil sampling decisions will be made. In addition, Sloss proposes to install one well near the middle of SWMU 24 to assess source potential. Details regarding the final sampling approach will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #20: SWMU #4-Sewer Line (North End)

Figure 6.1, illustrates that SWMU #4 BTF Sewer Line ends at a building located between SWMU #22 and SWMU #24. Figure 3-1 indicates that a drainage ditch originates at the building and flows overland for 300 feet before it discharges into SWMU #22. Sampling has been conducted above the ditch on the edge of SWMU #24, but no samples have been taken in the ditch leading into SWMU #22. Sloss should provide a sampling strategy for the ditch that leads to SWMU #22.

Response #20
The BTF Sewer Line does not end at this building, but turns at an approximate 90-degree angle toward the BTF. SWMU #4 (BTF Sewer Line) discharges directly to SWMU #13 (Equalization Basin). Adjacent to SWMU #4 is SWMU #25 (Storm Water Runoff Sewer), which is an open ditch through the majority of the site that flows underground through a pipe under Summit Drive and through the SWMUs #23 and #24 areas, where it discharges to SWMU #22 (Polishing Pond). There are no buildings in the vicinity of SWMUs #22 or #24. Site maps will be revised to show the direct connection between SWMU #25 and SWMU #22. Sediment sampling along the length of SWMU #25 will be proposed in the Phase III RFI Work Plan.

Comment #21: SWMU #37-BTF Sewer Tar Trap, Groundwater

The bottom of the BTF Sewer Tar Trap is constructed into the bedrock and groundwater was observed seeping into the Tar Trap. A shallow down gradient well (MW-68S) was proposed but instead was placed side gradient due to overhead wiring and underground utilities in the area.

The facility concluded that since no constituents were found in the side gradient well MW-68S, the Tar Trap does not appear to have impacted the groundwater. A side gradient well may be useful for addressing other areas but is useless for assessing impact to groundwater down gradient of SWMU #37. The facility should attempt to install a shallow groundwater monitoring well ***down gradient*** *of*

the BTF Sewer Tar Trap to assess for releases to groundwater. The facility may locate a shallow down gradient well far enough down gradient to be clear of buried lines. The facility may wish to consider hydro vacuum techniques to remove soil to expose buried utilities before installing a shallow well.

Response #21
Sloss proposes to install a monitoring well at the closest downgradient location. Details regarding installation will be included in the Phase III RFI Work Plan to be submitted for EPA review and approval.

Comment #22: SWMU #37-BTF Sewer Tar Trap, Groundwater Data

Groundwater sampling in MW-68S indicated that chloroform and Bis(2-ethylhexyl)phthalate exceeded the PRGs for tap water. The facility presented the analytical results for 5-VOCs, 3-SVOCs, and 4 metals. It is not clear if the groundwater constituents presented in Table 4.2 were the only constituents analyzed. All tables should have a footnote that indicates that the constituents listed were the only analytes targeted for analysis. If these were the only constituents analyzed by the facility, the facility needs to perform a scan for all PAHs in the groundwater and all historical constituents likely to be found in the Tar Trap.

Response #22
All VOCs, SVOCs, and priority pollutant metals were analyzed, but only the compounds detected were summarized in the referenced table. In future reports, a footnote will be included on the tables that clarify whether samples were analyzed for the full analyte list or only for selected compounds.

Comment #23: SWMU #37-BTF Sewer Tar Trap Soils

On Page 51, the facility indicated that soil data was not collected because there was no soil, only fill material was found at the top of bedrock. The facility could have collected the fill material and analyzed it for all PAHs and all historical constituents likely to be found in the Sewer Tar Trap. The facility could compare so-called background concentrations of the fill with the analytical results of the fill plus contaminant release concentrations. The porous fill would be an excellent reservoir for releases from the Tar Trap. The facility should take fill material samples and analyze for hazardous constituents. Specify the number of soil samples, the depth and illustrate the location of the proposed samples on a map.

Response #23
Sloss is evaluating the use of TarGOST to delineate coal tar in this area in lieu of conventional sampling. Site-specific coal tar samples are currently being analyzed by the vendor to determine TarGOST feasibility. Details regarding the final sampling (whether TarGOST or more conventional) methods and monitoring approach will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #24: Cyanide

Cyanide has been analyzed as (free) cyanide or the cyanide metal. Please explain how cyanide is formed in the coke manufacturing process. Does cyanide occur as a compound or as a metal from the processes at Sloss?

Response #24
Free cyanide is produced initially in the coke oven gas, and then iron cyanide complexes can be formed during the flushing liquor gas scrubbing process and subsequent flushing liquor processing steps.

Coke making turns carbon in raw coal into coke, which is used in subsequent iron making processes. In a by-product coke plant, coke is produced by distilling coal in refractory-line, slot-type ovens in the absence of air. Distillation products, in the form of tar and coke oven gas (COG) driven off during the coking process, are collected in mains that run the full length of the battery and are transported to the by-products plant. COG is a complex mixture containing hydrogen, methane, carbon monoxide (CO), carbon dioxide (CO_2), water vapor, oxygen, nitrogen, hydrogen sulfide, cyanide, ammonia, benzene, light oils, tar vapor, naphthalene, PAHs, many other hydrocarbons, and condensed particulate. Before distribution as a fuel gas, the COG is usually processed in a by-products plant where some of the components (e.g., benzene, toluene, xylene, sulfur, ammonia, and tar) are removed and collected for subsequent sale.

Ammonia liquor is used to scrub COG to condense tars and moisture and is recycled at a high rate. The ammonia liquor picks up cyanide during the gas scrubbing process and a portion of the cyanide forms iron-cyanide complexes in the ammonia liquor stream.

Comment #25: SWMU #13-Biological Treatment Facility (BTF) Equalization Basin and SWMU-21, BTF Emergency Basin, LNAPL Plume

The facility stated that the pre-RCRA waste stream and SWMU #13 and SWMU #21 do not *appear to be the source of the Light Nonaqueous Phase Liquid (LNAPL) consisting of VOCs, PAHs, and cyanide detected in MW-6 area. The facility stated that the ABC Coke gas pipeline drip leg is the most likely source and no further action is warranted.*

EPA does not agree with Sloss that no further action is warranted at SWMU #13 and MW-6. Table 2-5 from the RFI Report dated February 5, 1999, indicated that PAHs from coal tar were detected above the Region 9 PRGs for tap water in MW-6. For example: in groundwater samples taken on August 4, 1986, in MW-6, total PAHs were detected at

4,802.4 ug/L. The carcinogenic constituents exceeded the Region 9 PRG for tap water are as follows: BAA (44 ug/L) (PRG .09 ug/L), BBF (53.1 ug/L) (PRG .09 ug/L), BAP (31.4 ug/L) (PRG .009), chrysene (106 ug/L) (PRG 9.2 ug/L), and noncarcinogenic compounds pyrene (570 ug/L) (PRG 180 ug/L), fluorene (332 ug/L) (PRG 240 ug/L), and naphthalene (3,023 ug/L) (PRG 6.2 ug/L).

Sloss did not illustrate the location of the ABC Coke pipeline drip leg in the vicinity of MW-6. The facility stated that the ABC gas pipeline drip leg is located 150 feet to the east of SD-5. The facility needs to provide documentation of a rupture of the ABC Coke pipeline and an accurate location of the pipeline on a map relative to MW-6. Unless Sloss can substantiate its claim that the LNAPLs are related to a release of the ABC Coke Pipeline, then EPA shall consider the presence of LNAPLs near MW-6 related to undocumented historic releases associated with the operations of SWMU #13 at Sloss Industries. The facility indicated the occurrence of the LNAPL could be related to pre-RCRA waste management when the plant wastes were discharged to the Polishing Pond area. In addition, we would like a table listing the hazardous constituents and the concentrations detected in groundwater samples of MW-6. Table 2-5 (February 5, 1999 RFI Report) indicated that BTEX was not analyzed (NA) in 1986. How much LNAPL is standing in MW-6? MW-6 needs to be resampled and all constituents analyzed and reported.

Since the shallow groundwater is flowing to the east or southeast the facility has not adequately defined the scope and extent of the LNAPL pool at MW-6. The facility should advance a soil boring or geoprobe to bedrock southeast of MW-6 to determine if the LNAPL pool is a narrow plume moving between monitoring wells MW-41 and MW-42. Groundwater and soil samples should be acquired at the bedrock soil interface and at the top of the water column. What are the distances of the monitoring wells MW-41, MW-42, and MW-43 from MW-6? SWMU #13 is also very close to the Lafarge Quarry and groundwater may be migrating towards the Lafarge Quarry.

Groundwater samples should also analyze for 1,4 Dioxane a highly soluble additive to chlorinated solvents. The detection limit for 1,4 Dioxane should be below the R9 PRG for tap water at 6.1 ug/L.

Response #25

Sloss will provide documentation of the ABC Coke gas pipeline drip leg, as appropriate, to support the conclusions and sampling in the Phase III RFI Work Plan. Regarding MW-6, a product probe will be used during the facility-wide sampling event to determine the presence of LNAPL. As questioned, the distances of MWs-41, 42, and 42 from MW-6 are approximately 24 feet, 52 feet, and 26 feet, respectively.

As noted below in Response #26, Sloss also is evaluating the use of TarGOST to delineate coal tar in this area. Site-specific coal tar samples currently are being analyzed by the vendor to determine TarGOST feasibility. Details regarding the final sampling (whether TarGOST or more conventional) methods and the monitoring approach will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #26: SWMU #13-Biological Treatment Facility (BTF) Equalization Basin

Groundwater samples from MW-4A detected total VOCs and PAHs at 12,610 mg/kg and 235,300 mg/kg, respectively. The VOCs included 1,1,1 TCA (11,000 ug/kg), benzene at (4,900,000 ug/kg), chlorobenzene (780,000 ug/kg), ethyl benzene (55,000 ug/kg), styrene (64,000 ug/kg), tetrachloroethene (PCE) (40,000 ug/kg), toluene 5,800,000 ug/kg, and xylenes (960,000 ug/kg). The facility concluded that DNAPLs occur at MW-4A. The facility installed MW-11 and MW-12 to assess the scope and extent of the DNAPL Plume. The plume contains both dense nonaqueous phase liquids (DNAPLs) (e.g. PCE and 1,1,1-TCA) and light nonaqueous phase liquids (LNAPL) (e.g. BTEX and styrene). The DNAPL compounds and dissolved phase constituents would tend to sink to the bedrock and follow the bedrock slope and migrate into fractures and bedding planes to the deep regional aquifer. The LNAPLs would tend to follow the potentiometric gradient in the upper most aquifer.

According to the top of bedrock contours (Figure 2-9, BTF Sewers Volume I Report dated February 8, 1999) under SWMU #13, the bedrock slopes towards the northwest while the dip of the bedrock at 30 degrees is to the southeast. The DNAPLs of MW-4a, MW-3 and MW-6 may flow on top of the bedrock-soil surface until fracture is encountered. The DNAPLs may also accumulate in solutionally enlarged crevices in the bedrock or low areas. If the DNAPLs have found their way into the underlying bedrock they would migrate by gravity along bedding planes to the southeast towards the offsite potentiometric low in the Lafarge and Southern Ready Mix Quarries. The potentiometric surface for the regional aquifer in the BTF area is about 70 feet lower (June 13, 2001) than the shallow aquifer water table indicating a vadose zone between the perched aquifer on top of the bedrock and the deep regional aquifer. The MW-11 and MW-12 wells are about 150 feet from MW-4a and for a DNAPL entering in the bedrock at the location of MW-4a and following a bedding plane along a 30 degree dip, MW-12 would have to be at least 75 to 85 feet deep to intercept the same bedding plane. There is always the possibility that a contaminant plume following the dip may be short circuited by a more permeable fracture that bisects the bedding to deeper lower bedding plan. In addition, to intercept a contaminant plume following a permeable bedding plane one has to assume that the bedding uniformly transmits water which is probably never the case in carbonates as there are likely preferential pathways that have been solutionally enlarged.

Sloss Industries needs to install deep groundwater monitoring wells down gradient of MW-4a and MW-6 to assess contaminant migration in the bedrock aquifer. The wells need to target the bedding planes or fractures likely to contain hazardous constituents. The facility should run a geophysical log of all deep wells to determine where groundwater is entering the borehole and the wells should be screened across the water bearing zone. The down hole log should be capable of imaging, amplitude, caliper, ambient HPF Flow, Pumping flow, transmissivity, and tadpole structure plot. Once the water bearing zones area identified Sloss should packer test the zone to determine transmissivity and hydraulic conductivity.

Response #26

Sloss is evaluating the use of TarGOST to delineate coal tar in the subsurface. Site-specific coal tar samples currently are being analyzed by the vendor to determine TarGOST feasibility. In addition, Sloss is proposing a new shallow bedrock well northeast of MW-11. No new deep wells will be recommended until groundwater data from a full round of monitoring well sampling are completed and evaluated and the delineation of the presence of coal tars within this area has been completed. Once the area in which coal tars are present has been better defined, siting of any necessary deep bedrock monitoring wells will be evaluated to more accurately identify bedding planes through which DNAPLs may migrate. Additionally, the potential effectiveness of various borehole geophysical techniques will be evaluated for use in identifying water-bearing zones to be screened. Details about the final sampling (whether TarGOST or more conventional) methods and the monitoring approach will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #27: Scope of Proposed Phase III Groundwater Investigations

The facility proposed four groundwater monitoring wells side gradient to MW-26 and down gradient of MW-63. The facility needs to make sure the down gradient wells are installed in the same bedding plane fracture that MW-26 and MW-63 are screened across if in fact they are screened across a bedding plane. The facility will need to take into account the elevation of the up gradient source, account for the dip of the bedding planes and target the screen depth accordingly in the down gradient wells. The facility should include the equipotential lines on the maps with the proposed wells.

Response #27

The details requested will be provided, along with the proposed additional monitoring wells, in the Phase III RFI Work Plan for EPA review and approval.

Comment #28: SWMU #22-MW-17S Groundwater Monitoring

*In addition to the groundwater monitoring wells the facility proposes to monitor, the facility needs to conduct **quarterly** groundwater monitoring at MW-17S to determine if the benzene plume increases or decreases in concentrations with time. The last sampling event of the groundwater monitoring well located at the facility boundary detected benzene at 15 ug/L and 18 ug/L. The MCL for benzene is 5 ug/L. Previously an offsite well was required to assess the scope and extent of the shallow groundwater contamination at MW-17S, but the facility stated that they could not get a drilling rig across the railroad tracks to drill a well. Consequently, the tract of land across the railroad tracks was therefore inaccessible. We do feel that the land across the rail road tracks is not necessarily inaccessible only inconvenient to access. MW-17 is situated along the edge of SWMU #22. Soil boring have indicated that PAHs saturate the soil to the top of the bedrock. A shallow and deep*

bedrock well cluster is warranted across the railroad tracks and creek to assess releases to the shallow and deep groundwater.

Response #28
As requested, Sloss will initiate quarterly monitoring of MW-17S. The most recent monitoring results (April 2005) indicate that benzene concentrations in well MW-17S are below the detection limits. Quarterly monitoring of MW-17S will further evaluate benzene concentration trends at this location. If quarterly monitoring results indicate that benzene concentrations consistently exceed its MCL, the installation of additional shallow or deep groundwater monitoring wells downgradient of this location will be evaluated to select a suitable and accessible location for further monitoring. Details will be provided in the Phase III RFI Work Plan for EPA review and approval.

It is noted, however, that during the previous field efforts, a review of potential sites for the referenced well cluster indicated the following:

- The CSX railroad tracks are located immediately east of the drainage ditch. This is a high-speed railroad and the well could not be located between the tracks.
- The access road located east of the railroad tracks has power lines on both sides of the road, which are a health and safety hazard for any drill rig.
- The area east of the access road was a wooded, sloped area that was flooded during the time of the field reconnaissance. This area appears to be a discharge area for a nearby industrial facility.

Harrison PK ditch

Comment #29: Drainage Ditch East of the LaFarge Quarry

Drainage ditch water and sediment samples at the southern end of the ditch could not be collected because the ***ditch had been filled*** *in with fill material. The facility should investigate the ditch determine if wastes were left in place. The facility should analyze sediments for cyanide, PAHs and VOCs. Why was the ditch was filled and was it rerouted?*

Response #29
The drainage ditch to the east of the LaFarge Quarry does not drain Sloss property, and therefore, is not recommended for sampling at this time. Surface water to the south of the railroad tracks that enters the Sloss property along Shuttlesworth Drive is collected in a storm water sewer and flows to the south. North of these tracks, surface water drains from Vulcan Materials and the LaFarge Quarry.

The drainage ditch was observed to be filled in with debris (concrete, metal, etc.) from the Vulcan Materials' recycling operation. The ditch has not been rerouted.

Comment #30: SWMU #22-Creosote Soil Plume

Sloss indicated that creosote was collected in saturated clays from a depth of 10 feet at MW-17, MW-18, MW-45, and MW-47 along the edge of SWMU #22. The area saturated with coal tar occurs along a linear distance of 500+ feet. The facility should step out from the monitoring wells and collect soil borings to determine the scope and extent of coal tar/creosote contamination in saturated clays towards 5 Mile Creek. The facility should propose borings every 100 feet along the length of SWMU #22 to 5 Mile Creek and analyze for PAHs, VOCs and metals. Borings should be advanced to bedrock.

Response #30

Sloss is evaluating the use of TarGOST to delineate contamination in this area in lieu of conventional sampling. Site-specific coal tar samples currently are being analyzed by the vendor to determine TarGOST feasibility. Characterization of soils will be completed if coal tar is found to be present. Details about the final sampling approach (whether TarGOST or more conventional methods) will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #31: SWMU #23-Soil Contamination

Soil investigation of SWMU #23 on Sand Mountain has yielded arsenic concentrations at soil boring SBMW24 at 13 mg/kg and 30 mg/kg from depths of 7-9 feet and 14-16 feet. At 19-21 feet the arsenic levels drop to background levels at 3.8 mg/kg. In 1995, the facility had also taken background soil samples in SWMU #23 which detected BAA (33 mg/kg), BAP (40 mg/kg) and BFF (66 mg/kg). The concentration of PAHs constituents are among the highest detected at the facility. Apparently, wastes or product was stored or managed at SWMU #23. On page 48 of the Phase II RFI Report dated June 7, 2002, for SWMU #23 concluded that there is potential unacceptable risk for selected herbivorous species to the sludge at SWMU# 23 and SWMU#39. While the sludge were removed down hill from SWMU #23 at SWMU #24, the facility did not state that sludge were removed from SWMU #23. Additional samples are warranted to assess the scope of the sludge and PAH and arsenic impacted soil. Once impacted soils have been delineated the facility needs to provide isoconcentration maps of the soils that illustrates each PAH constituent and arsenic concentration. Soil samples at SWMU #23 need to profile the soils to assess for PAH and arsenic impacts. Provide a map that illustrates the number and locations for each soil sample.

Response #31

Environmental conditions at this SWMU will be assessed during CH2M HILL's upcoming ecological survey, the results of which will support final soil sampling decisions. As suggested, it is anticipated that one boring and monitoring well will be

installed near the center of the SMWU to assess potential sources for contaminants. Surface soil sampling will be conducted to delineate sludge nature and extent. Details regarding the final sampling approach will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #32: New SWMU-BTF Area Ditches

The ditch system that drains the BTF Area and discharges out the plant outfall is loaded with thick deposits of wastes that contain high concentrations of PAHs and metals (i.e., cyanide, arsenic, copper, antimony, cadmium, and barium). This ditch does not have an official designation as a SWMU or Area of Concern (AOC). It is now designated a new SWMU. The facility may assign a SWMU number to the SWMU.

There are areas of the ditch system that have not as of yet had samples taken. Sediments samples are needed in the following areas of the new SWMU. The facility should analyze sediment samples for PAH constituents and metals. The facility should attempt to calculate the volume of waste in the ditches that will ultimately require removal.

a. *Ditch adjacent to SWMU #24 that runs parallel to Summit Street west of the access road into the BTF Area. Take samples at intervals in the ditch along the length of SWMU #24. Samples should be taken in the ditches on both sides of the road.*
b. *Ditch east of SWMU #24 that parallels the road into the BTF Area. Samples are needed to establish the amount of waste in place.*
c. *Ditch that runs parallel to Summit Street and east of the road into the BTF Area. Significant accumulations of waste were noted in the ditch during EPA's last site visit. The facility should take transects in wide areas of waste accumulation to assess volume of wastes. Samples should be taken along the ditch from the road towards SD-14.*

Response #32

Sloss agrees that additional sediment sampling is necessary to further characterize the effects on the ditches discussed above. Sediment sampling locations will be proposed in the Phase III RFI Work Plan.

Former Chemical Plant Groundwater Investigations

Comment #33: Chemical Plant Groundwater Contaminant Plume Evaluation East Side of Groundwater Divide

Groundwater data illustrated in Figure CA750-1 indicates a prominent groundwater mound at the location of the Chemical Plant with groundwater flow directions to the east and to the north. Previous offsite groundwater investigations were conducted to the east of the potentiometric high to

assess the scope and extent of a shallow groundwater plume consisting of VOCs and SVOCs originating at the former Chemical Plant. The east side of the potentiometric high was investigated offsite by wells MW-71, MW-72, and MW-73. The only constituents reported in MW-70 and MW-72 were toluene at 18 ug/L and 1.3 ug/L which are not significant hazardous constituents in the shallow groundwater. The facility did not provide the analytical data for MW-69, MW-70, MW-71, and MW-72.

Onsite at MW-51 chlorinated solvents with a specific gravity heavier than water were detected in the shallow groundwater. Two sets of groundwater samples were taken on July 27, 2000 and on April 6, 2001. Tetrachloroethene (PCE) were detected at concentrations of 410 ug/L and 15 ug/L indicating a decrease in concentration over a year between sampling events. Vinyl chloride concentrations also decreased in concentration from 830 ug/L to 810 ug/L. Trichloroethene (TCE) decreased in concentration from 350 ug/L to 39 ug/L. Trans-1,2-dichloroethene decreased in concentration from 100 ug/L to 52 ug/L. The decrease in concentration of the hazardous constituents over a year is indicative of plume movement. Concentrations of dissolved iron are relatively high at 13,000 ug/L and may be indicative of a reducing environment. However, there is not a corresponding increase of daughter products from the degradation of PCE and TCE from reductive dechlorination. Sloss stated that the iron and manganese is from degradation of petroleum hydrocarbons and chlorinated solvent plumes. EPA believes the iron and manganese in the groundwater is from rusting metal and from the production of steel and the coking of coal. However, the presence of the iron and manganese may be beneficial towards reductive dechlorination.
The well log from MW-51 indicates that two water bearing zones were encountered in the weathered bedrock from 14.25 feet and 18.25 feet. The groundwater flow in MW-51 is through the weathered bedrock or epikarst. There may be conduit flow in the epikarst given the rapid decrease in concentrations of the VOCs.

MW-50 which is located approximately 300 feet down gradient and across the street from MW-51, detected vinyl chloride at concentrations of 96 ug/L on July 28, 2004 and at 360 ug/L on April 4, 2005, a significant increase in concentration over a period of one year. Well logs indicated that a water bearing cavity with ledges was encountered at a depth from 26 feet to 29 feet. The implications of conduit flow within the epikarst signifies a potentially complex flow regime with rapid ground water flow. This has significant ramifications for the fate and transport of the chlorinated solvents. Groundwater contamination can flow rapidly in the 10s to 1000s of feet per day. Plumes can be difficult to monitor if the monitoring well is not situated along the flow path of the conduit. Plumes can still be concentrated at distance along solutionally enlarged vertical joints in the bedrock.

To investigate the epikarst a geophysical investigation will be required to map the orientation of a conduit flow system for the optimum location of shallow ground water wells. There was no indication noted of significant epikarst development at MW-70, MW-71 or MW-72 on the well logs. Only a weathered bedrock zone was encountered. Sloss must propose an appropriate geophysical method capable of mapping the orientation of solutionally enlarged fractures in the epikarst. It is expected that there will be preferential solution of the limestone along bedding planes and fractures near the

bedrock surface. The groundwater will concentrate along the significant solutionally enlarged fractures. Specify the geophysical methods appropriate to investigating the epikarst and provide a study plan with maps that illustrate the location of the geophysical grid. The grid should include MW-51, MW-50, and the property across Shuttlesworth Drive to the east. The facility should conduct quarterly groundwater monitoring at wells associated with the former Chemical plant to assess plume movement.

Response #33
CH2M HILL currently is investigating potential geophysical methods capable of detecting the type of small-scale solution features present in the shallow bedrock beneath the Sloss facility. To date, no geophysical method has been identified that is likely to successfully identify these features. A summary of the methods evaluated and a recommended geophysical method will be further developed in the Phase III RFI Work Plan.

Comment #34: Chemical Plant Groundwater Contaminant Plume Evaluation North Side of Groundwater Divide

Groundwater monitoring on north side of the potentiometric high has detected significant groundwater contamination in monitoring wells MW-55 and MW-56. MW-55 detected benzene (48,000 ug/L), chlorobenzene (240,000 ug/L), and toluene (81,000 ug/L). MW-56 detected benzene (143,333 ug/L), chlorobenzene (25,000U ug/L), and toluene (130,667 ug/L).

Groundwater data indicates that groundwater is flowing to the north from MW-55 and MW-56. The shallow groundwater plume has not been adequately delineated to the north. Sloss should propose to install two shallow groundwater monitoring wells to the north to delineate the benzene, toluene and chlorobenzene plume. Provide a map with the location of the two wells.

Response #34
Sloss agrees that delineation of the shallow bedrock groundwater plume north of wells MW-55 and MW-56 is incomplete. Sloss proposed to install two downgradient monitoring wells within the shallow bedrock aquifer for further delineation of the contaminant plume in this area. Proposed locations and screened intervals will be presented in the Phase III RFI Work Plan for EPA review and approval.

Comment #35: Source Area Investigation for BTEX Plume.

The source of the benzene, chlorobenzene, and toluene is not well understood. There are two large rusty tanks used to store benzene and toluene with a concrete secondary containment system that contains jointed concrete. The joints look like they could have leaked if there had been a release into the secondary containment. This is a potential source of benzene and toluene. These two tanks are within the vicinity of the BTEX and chlorobenzene plume. Sloss must collect soil samples beneath the

two tanks at the bedrock soil contact. If benzene and toluene are detected then a shallow groundwater monitoring well must be installed on the north side of the two tanks.

Response #35

As requested, Sloss is proposing to collect samples at the referenced tanks to assess source potential. In addition, Sloss proposes to collect additional samples throughout the Chemical Plant area to assist in determining the source of the groundwater plume. Details regarding the proposed sampling will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #36: Chemical Plant Deep Aquifer Groundwater Investigation

MW-49D was installed to a depth of 165 feet and is screened from 155 feet to 165 feet in depth. MW-49D is located on the edge of the Chemical Plant on the east side of the shallow groundwater mound. The potentiometric map for the deep aquifer indicates an eastward direction of flow from the eastern side of the Chemical Plant. The groundwater data from MW-49D indicated that vinyl chloride had been detected at a concentration of 18 ug/L, Bis(2-ethylhexyl)phthalate at 23 ug/L. MW-57D also detected PCE at a concentration of 13 ug/L and 1,2 DCE at 80 ug/L. MW-57D is screened at a depth from 164.5 feet to 174.5 feet. The presence of the vinyl chloride, PCE and 1,2 DCE at depth indicates that VOCs have migrated along path of dipping bedding fractures and tension fractures to the regional water table.

Sloss should propose to install a deep groundwater monitoring well in the vicinity of MW-70, MW-71, MW-72 to assess impacts to the deep aquifer from the Chemical Plant. The well should be at least as deep as MW-57D. Provide a map with the location of the deep well.

Response #36

Sloss agrees that the installation of a deep bedrock monitoring well is warranted in the area near wells MW-70, MW-71, and MW-72 to assess the effects on the deep aquifer by the Chemical Plant groundwater plume. The proposed location and screened interval will be presented in the Phase III RFI Work Plan for EPA review and approval.

Coke Plant SWMU and Groundwater Investigations

Comment #37: Coke Plant Groundwater Contamination Plume

Sloss reported that shallow groundwater contamination exists in MW-58, MW-59, and MW-60. The groundwater contamination origin is from the Coke Plant operations. At MW-58 the following hazardous constituents were detected from the 4/28/05 sampling event: Acenaphthene (93 ug/L) (tap water standard-37 ug/L), dibenzofuran (130 ug/L) (12.16 ug/L), fluorene (130 ug/L) (24 ug/L), benzene 100 ug/L) (MCL 5 ug/L), Bis (2-ethylhexyl)phthalate (61 ug/L) (6 ug/L),1-

methylnaphthalene (380 ug/L) (.620 ug/L) 2-methylnaphthalene (540 ug/L) (.620 ug/L) and naphthalene (19,000 ug/L) (.62 ug/L).

The hazardous constituents in MW-59 are: benzene (1,700 ug/L) (MCL5 ug/L), 2-methylphenol (510 ug/L) (180 ug/L), 3 &4-methylphenol (384 ug/L) (180 ug/L), 4-methylphenol (114 ug/L) (18 ug/L) acenaphthene (52 ug/L) (37 ug/L), dibenzofuran (55 ug/L) (12.16 ug/L), fluorene (130 ug/L) (24 ug/L), and naphthalene (16,000 ug/L) (.62 ug/L), BAP (.31 ug/L) (.2 ug/l).
The hazardous constituents in MW-60 are: Benzene (8,600 ug/L), Dimethylphenol (1,300 ug/L) (180 ug/L), 2-methylphenol (380 ug/L) (180 ug/L), acenaphthene (180 ug/L), dibenzofuran (120 ug/L), and fluorene (100 ug/L).

The Coke manufacturing portion of the plant is situated over the same groundwater divide as the Chemical Plant. The impacted groundwater in MW-58 and MW-59 is located side gradient to the shallow groundwater flow regime that the Chemical Plant is located within. Based on the Figure 1-9 shallow bedrock potentiometric map in the COEDAEID Report dated July 2005, the flow path of the hazardous constituents is to the southeast. Sloss has only a piezometer P-15 downgradient of MW-58 and MW-59.

Sloss should propose two shallow downgradient wells to assess the scope and extent of groundwater contamination identified in MW-58 and MW-59. Provide a map with the proposed locations of two new wells. If possible try to target the wells so as to be along the groundwater flow path from MW-58 and MW-59.

Response #37
Sloss agrees that additional monitoring wells are warranted downgradient of well MW-58 and MW-59 to assess the potential migration of groundwater contaminants. The selection of well locations and screened intervals will be performed following an evaluation of the presence of coal in this area (whether by TarGOST or more conventional methods) to more accurately site the wells in optimal locations for monitoring potential coal tar migration, if necessary, and groundwater plume delineation. Details regarding the well installation activities will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #38: SWMU #7 Coal Tar Collection Sump in No.1 Pump House Source Area Investigation

SWMU #7 is a Coal Tar Collection Sump in No.1 Pump House that was installed through the soil into approximately 2 feet of bedrock. Four pipes lead to the sump and the pipe trench extend towards SWMU #9 Flushing Liquor Decanter Sump. Bedrock is 1.5 feet to 4 feet below the surface in the vicinity of SWMU #7. Soil borings at SWMU #7 from 4-6 feet in depth detected the following constituents PAH and semi-volatile organic compounds (SVOCs) at 07 SB-0001, 2-methylnaphthalene (46 mg/kg), anthracene (30 mg/kg), dibenzofuran (33 mg/kg), fluorene

(52 mg/kg), and naphthalene (200 mg/kg), BAP (24 mg/kg), BAA (29 mg/kg), BBF (23 mg/kg), chrysene 22 mg/kg), fluoranthene (94 mg/kg), phenanthrene (150 mg/kg), and pyrene (75,000 mg/kg). The VOCs benzene (150J ug/kg), xylenes (660J ug/kg), ethylbenzene (240J ug/kg), toluene (320J ug/kg) and styrene (150 ug/kg). MW-59 was installed to assess the groundwater impacts from SWMU #7 Coal tar Collection Sump #1. A soil boring sample from 2 to 4 feet in depth at MW-59 detected BAA (170 mg/kg), BAP (130 mg/kg), BBF (100 mg/kg), BKF (110 mg/kg), I(1,2,3-cd)P (67 mg/kg), naphthalene (1,000 mg/kg), 2-methylnaphthalene (190 mg/kg), 2-4 dimethylnaphthalene (23 mg/kg), dibenzofuran (130 mg/kg). These are some the highest level of PAH concentrations detected at the facility. It is also part of the source area of contamination responsible for groundwater contamination at MW-59.

Additional soil samples need to be taken along the entire length of the pipe trench including the covered portion from SWMU #7 to SWMU #9 to southwest of MW-59 as illustrated in Figure 3.2 of the Phase II RFI Coke and Chemical Manufacturing Plant dated February 28, 2001. The facility needs to determine if PAHs have migrated on top of the bedrock to areas beyond the SWMU #7 and Pipe Trench. Provide a work plan that comprehensively delineates impacted soils around SWMU #7 and the pipe trench. The top of bedrock contour map Figure 4.7 dated December 13, 2001, will need to be updated to determine if the PAHs present at the top of bedrock are migrating along low areas.

Response #38

Sloss is evaluating the use of TarGOST to delineate coal tar contamination in this area in lieu of conventional sampling. Site-specific coal tar samples currently are being analyzed by the vendor to determine TarGOST feasibility. The details about the final sampling approach (whether by TarGOST or more conventional methods) will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #39: SWMU #10 Coal Tar Decanter No. 3 and 4 Coke Batteries and SWMU #11 Coal Tar Decanter No. 5 Coke Batteries

SWMU #10 and SWMU #11 are coal tar decanters that have been in operation since 1919. The conclusion of the RFI Coke Manufacturing Plant Report dated November 27, 2000, for SWMU #10 and SWMU #11 by Sloss was no further action based on the risk assessment and the area at SWMU #11 is covered by asphalt. The EPA does not agree that there should be no further action. We agree that if the area is covered by asphalt there are no plausible exposures. The purpose of the investigation is to delineate the source area in the soils for groundwater contamination. Further investigations are not to be predicated on a risk assessment at the point of exposure. The facility must define the scope and extent of soil impacts once a release has been assessed. Impacted soils may a potential source for groundwater contamination. The facility stated that it would install a groundwater monitoring well (MW-60) to assess impacts to groundwater from SWMU #10 and SWMU #11.

SWMU #10, Coal Tar Decanter, was investigated and the following hazardous constituents were detected in the soil at 10-SL-001 from 2-4 feet, BAA (3 mg/kg), BAP (2.7 mg/kg), BBF (3.4 mg/kg), BKF (1 mg/kg), I(1,2,3-cd)P (2.4 mg/kg), naphthalene (160 mg/kg), 2-methylnaphthalene (23 mg/kg), dibenzofuran (4.9 mg/kg), benzene (4.4 mg/kg), ethylbenzene (2.1 mg/kg), total xylenes (6.7 mg/kg), and toluene (4.4 mg/kg).

SWMU #11, Coal Tar Decanter 11-SL-002 from 2-4 feet, BAA (130 mg/kg), BAP (86 mg/kg), BBF (120 mg/kg), BKF (21 mg/kg), I(1,2,3-cd)P (58 mg/kg), naphthalene (82 mg/kg), 2-methylnaphthalene (19 mg/kg), dibenzofuran (95 mg/kg), benzene (83 mg/kg), fluorene (300 mg/kg), fluoranthene (800 mg/kg), phenanthrene (900 mg/kg), pyrene (490 mg/kg).

Sloss should take additional soil samples around SWMU #10 and SWMU #11 to define the scope and extent of releases to soil. The facility had taken only two soil borings at each SWMU. Releases were confirmed at both SWMUs. Sloss must propose a sufficient number of samples taken at the bed rock soil contact to determine if coal tar is migrating along the surface of the bedrock.

Response #39
Sloss is evaluating the use of TarGOST to delineate coal tar contamination in this area in lieu of conventional sampling. Site-specific coal tar samples currently are being analyzed by the vendor to determine TarGOST feasibility. Details regarding the final sampling approach (whether by TarGOST or more conventional methods) will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #40: Groundwater Monitoring MW-60 for the SWMU #10 Coal Tar Decanter for No. 3 and 4 Coke Batteries and SWMU #11 Coal Tar Decanter No. 5 Coke Batteries

MW-60 was installed in what was believed to be in the down gradient direction from SWMU #10 and SWMU #11 to assess impacts to groundwater. On page 30 of the Phase II RFI Report dated February 28, 2001, the facility stated that MW-60 was upgradient of SWMU #10 and SWMU #11. The potentiometric data for MW-60 in the COEDAEID indicated that the well was installed on the north side of a narrow groundwater high that forms a divide in shallow aquifer with groundwater flowing to the north-northeast. On the opposite side of the divide, groundwater flows to the southeast. The groundwater contours on Figure 1-9 of the COEDAEID, indicate that the groundwater flow path from SWMU #10 and SWMU #11 are parallel to MW-60. MW-60 is approximately 125 feet side gradient to SWMU #10 and SWMU #11. MW-60 may not be adequate for monitoring the groundwater quality associated with SWMU #10 and SWMU #11.

The facility should install a well in the shallow bedrock aquifer to determine the presence of coal tar next to the SWMU #11 Coal Tar Sump.

The groundwater concentrations in MW-60 are: Benzene (8,600 ug/L), dimethylphenol (1,300 ug/L), 2-methylphenol (380 ug/L), acenaphthene (180 ug/L), dibenzofuran (120 ug/L), and fluorene (100

ug/L). The concentrations of benzene are higher in the groundwater than they are in the soils of SWMUs #10 suggesting a different source for groundwater contamination. Sloss should identify the source of groundwater contamination for MW-60 by determining if there are chemicals sewers, sumps, or product storage tanks or product transfer lines that could have leaked and are responsible for the high concentrations of VOCs and SVOCs.

Response #40
See Response #39. Sloss is evaluating the use of TarGOST to delineate coal tar contamination in this area. The need for additional wells in the area will be determined once the coal tar has been delineated (by either TarGOST or more conventional methods). Details about the final sampling approach will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #41: SWMU #5 Coal Storage Area Drain System and New SWMU

SWMU #5 Coal Storage Area Drain System was associated with two large tanks used in the tar distillation process. Associated with the drain area is a tar sump. The SWMU #5 drainage system forms a junction with a 5 foot deep drainage system that extended to SWMU #9 at Number 1 Pump House, a distance of 400 feet. The entire ditch between SWMU #5 and SWMU #9 is a new SWMU. The ditch received coal tar waste and process waste water. The soils along the entire ditch need to be investigated in the next phase of the RFI. Sloss must propose an adequate number of samples to be taken along the length of the ditch. Samples should be acquired below the base of the ditch and at the top of bedrock.

Response #41:
As discussed during the July 2006 site visit, the drainage system identified in this comment will be investigated as part of the existing SWMU (#5 and #9) investigations and will not be called out as a new SMWU. Sloss will propose to collect surficial soil samples at appropriate intervals along the ditch (as requested) for use in the evaluation of ecological or human health risks, as appropriate. However, Sloss is evaluating the use of TarGOST to delineate coal tar impacts in the subsurface in this area in lieu of conventional subsurface sampling. Details regarding the final sampling approach will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #42: SWMU #5 Soil and Groundwater Investigation

Soil samples detected taken at SWMU #5, Coal Storage Area Drain System, detected releases to the underlying soil of PAH and semi-volatile organic compounds (SVOCs). Soil 05-SL-0002 taken at refusal from 15 feet to 17 feet detected, 2-methylnaphthalene (780 ug/kg), anthracene (660 ug/kg), naphthalene (2 mg/kg), BAP (1.7 mg/kg), BAA (2.4 mg/kg), BBF (2.2 mg/kg), Indeno (1,2,3-cd) pyrene (4.1 mg/kg). 05-SL-0005 taken at refusal from 5 to 7 feet detected,

2-methylnaphthalene (7.4 mg/kg), anthracene (<22 mg/kg), naphthalene (51 mg/kg), BAP (7.8 mg/kg), BAA (<22 mg/kg), BBF (6.8 mg/kg), Indeno (1,2,3-cd) pyrene (22 mg/kg). The VOC benzene was detected at (42 ug/kg) in the soil sample.

The facility needs to take a soil boring next to the tar sump even if it means boring a hole through a concrete slab or slant drilling. Soil boring 05-SL0002 is located 30 feet from the sump is too far away to adequately assess releases from the sump. Specify the location of the boring on a map and propose to collect a sample at the base of the sump and at the bedrock. The purpose of the soil boring is to determine if the sump is the source of the groundwater contamination in MW-58.

MW-58 was installed into the shallow bedrock aquifer to assess releases to groundwater at SWMU #5 Coal Storage Drain System. The well location is in the vicinity of 05-SL0002 and is in the down gradient direction of groundwater flow. Groundwater contamination was detected at MW-58; Acenaphthene (93 ug/L) (tap water standard-37 ug/L), dibenzofuran (130 ug/L) (12.16 ug/L), fluorene (130 ug/L) (24 ug/L), benzene 100 ug/L) (MCL 5 ug/L), Bis (2-ethylhexyl)phthalate (61 ug/L) (6 ug/L),1-methylnaphthalene (380 ug/L) (.620 ug/L) 2-methylnaphthalene (540 ug/L) (.620 ug/L) and naphthalene (19,000 ug/L) (.62 ug/L). Sloss needs to install a well down gradient of MW-58. Specify on a map in the RFI work plan the location of the new well.

Response #42

Sloss is evaluating the possible use of TarGOST to delineate coal tar impacts in this area. As suggested, Sloss also will propose to install one well downgradient of MW-58. Details about the proposed sampling and installation activities will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #43: SWMU 1A-Quench Tower A, Sumps, Pump Basins, and Settling Basins

During an inspection of SWMU 1A a large crack was observed in the southeast corner of the sump. Soil sample 01A-SL0005 was taken 10 feet from the large crack. PAHs were detected in the soils at 01A-SL0005 collected from 2-4 feet depth with BAA detected at 1.4 mg/kg. Sloss indicated that the water table is 3 feet below the surface and that soil samples were taken from 2-4 feet. The SSL with a DAF of 1 for BAA is .08 mg/kg. Exceeding the DAF of 1indicates that the shallow groundwater could be impacted from BAA.

Sloss should consider the use of a Geoprobe to collect groundwater samples and define the extent of shallow groundwater impacts. Specify the number of Geoprobe groundwater samples to be acquired. Specify that metals, BTEX and SVOCs including PAHs will be analyzed in groundwater samples. The facility should provide a potentiometric map based on the geoprobe sampling around Quench Tower A.

Response #43
Sloss is proposing to install four or five temporary piezometers to establish groundwater flow direction in this area. After the flow direction is known, one well will be installed downgradient of SWMU 1A. Details regarding the proposed activities will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #44: SWMU 2A-Quench Tower A, Sump

A seep from an existing crack which extends along the entire length of the south and east walls of the sump was observed during the visual inspection. PAHs were detected in soil sample 2A-SL0001, collected from 2-4 feet depth, with BAA detected at a concentration of 6.7 mg/kg. The groundwater is shallow at a depth of 3 feet below the ground surface. The SSL with a DAF of 1 is .08 mg/kg. This indicates that the shallow groundwater could be impacted from BAA.

Sloss should consider the use of a Geoprobe to collect groundwater samples and define the extent of shallow groundwater impacts. Specify the number of Geoprobe groundwater samples to be acquired to adequately characterize a shallow groundwater plume. Specify that metals, BTEX and SVOCs including PAHs will be analyzed in groundwater samples.

Response #44
See Response #43 for the proposed groundwater sampling.

Comment #45: SWMU 3A-Quench Tower A and Sump

The photographic log indicated a significant horizontal crack on the north wall of the sump with seeps along the length of the wall. The depth of the sump is 12.5 feet. This would be an excellent path way for contaminated water to leave the sump. The facility took a soil sample at 3A-SL0001 at a distance of 10 feet from the wall and detected no impacts to the soil at 6-8 feet. The soil sample should have been taken against the wall. Water leaking through the side of the sump into the soil would have run down the side of the sump wall and followed the foundation of the sump. The facility did not take soil samples on the downgradient side or the east of the sump. There were numerous seepages on the east side of the sump wall. The water table was encountered from 7 feet to 9 feet in depth. The facility should take a soil sample on the east side of the sump and take soil samples even with the seepages and at the top of the bedrock.

The facility took a soil sample at 3A-SL0002 at a distance of 5 feet from the wall and detected impacts to the soil at 8-10 feet of arsenic (96 mg/kg) and chromium (70 mg/kg) (hexavalent chromium is 64 mg/kg industrial PRG for the soil). Additional samples should be taken in this area to verify and determine the scope of the arsenic and chromium impacts.

Sloss should consider the use of a Geoprobe to collect groundwater samples and define the extent of shallow groundwater impacts. Specify the number of Geoprobe groundwater samples to be acquired to adequately characterize a shallow groundwater plume. Specify that metals, BTEX and SVOCs including PAHs will be analyzed in groundwater samples.

Response #45

As requested, Sloss will propose additional samples on the north and possibly the east walls to bedrock, using direct push technology. Details about the proposed sampling will be included in the Phase III RFI Work Plan for EPA review and approval. Note that if the well to be installed downgradient of SWMU #1A (see Response #43) indicates affected groundwater during Phase III, then further delineation of the affected groundwater will occur on a facility-wide basis.

Comment #46: SWMU 1B Quench Tower B and Sump

The investigation of Sump 1B indicated significant cracks in the sump walls. Large cracks were noted in the corners at the weir that discharges into Quench Tower B water to its associated sump (SWMU 1B). Cracks were observed to run along the floor of the sump. The facility took two soil borings near the sump. One was 20 feet from the edge of the sump to the northwest and the other was 30 feet due south of the northeast corner. The 01B-SL0005 samples at 6-8 feet was taken at about even with the middle of SWMU 1B and the 9-11 foot level was even with the bottom of the SWMU 1B Sump. Soil samples taken at 01B-SL0005 which is 30 feet from the sump and down the hydrologic gradient detected the following PAHs at a depth of 6-8 feet: anthracene (12 mg/kg), BAP (14 mg/kg), BAA (16 mg/kg), BBF (17 mg/kg), fluorene (20 mg/kg), fluoranthene (52 mg/kg), pyrene (54 mg/kg), dibenzonfuran (11 mg/kg), phenanthrene (70 mg/kg) and naphthalene (30 mg/kg). Sloss should have taken soil borings on the edge of the sumps to bedrock at the locations of the largest cracks. The facility should locate soil boring next to the sumps at the location of cracks and sample the soil to bedrock. In addition, more soil borings are need in the vicinity of 01B-SL0005 to assess the scope of the impact to soil.

The soil screening level (SSL) for naphthalene with a dilution attenuation factor (DAF) of 1 is 4 mg/kg. This indicates that naphthalene at a concentration of 4 mg/kg has the potential to impact groundwater. Naphthalene, a very mobile SVOC, was detected at a 30 mg/kg in the soil. A DAF of 1 should be used because the soil sample was taken 3-5 feet above the bedrock. There is a potential impact to groundwater from naphthalene. The SSL for BAP with a dilution attenuation factor (DAF) of 1 is 0.4 mg/kg. BAP was detected at 14 mg/kg. The SSL for BAA with a dilution attenuation factor (DAF) of 1 is .08 mg/kg. BAA was detected at a concentration of 16 mg/kg. The facility should install a groundwater monitoring well down gradient of SWMU 1B.

Response #46

As requested, Sloss is proposing to collect two samples adjacent to the sump on the southeastern side of SWMU #1B at depths of 4 to 6 ft, 6 to 10 ft, and 12 to 14 ft. In

addition, one well will be installed downgradient of SWMU #1B to 25 ft to enhance facility monitoring well network and delineate the coke plant VOC and SVOC plume. Details about the proposed sampling and well installation will be included in the Phase III RFI Work Plan for EPA review and approval.

Comment #47: SWMU #6-Diesel Spill Area

Visibly stained material around SWMU #6 was removed to a depth of 2 feet. No samples had been acquired to determine if the PAHs extended to depth after soil removal. Total petroleum hydrocarbon (TPH) concentrations ranged from 949 mg/kg to 4,172 mg/kg. The facility took background concentrations of soil and determined that the background TPH due to coal material was 77.2 to 97.3 mg/kg. Visibly stained material was excavated to the red clay which was between 1 foot and 2 feet in depth. During the RFI Sloss took one soil sample 06-SL0001 on the north side of SWMU #6 near a pre-excavation sample location that detected a TPH of 1,588 mg/kg. No samples were taken outside the area of excavation with the exception of two background samples taken west of the spill. The samples were 10 and 20 feet from the spill site. The sample was taken in the area of the excavation and must have been from the backfill. The soil sample 06-SL0001 detected PAHs from 0-1 feet. BBF was detected at 6.5J mg/kg, chrysene 4.4J mg/kg, fluoranthene 12J mg/kg, naphthalene 4.3J mg/kg, and pyrene 10J mg/kg. Soil borings at 6-8 feet and 12-14 feet indicated that PAHs were not detected. The facility maintained that the concentrations detected at 0-1 feet were within the range of background.

EPA does not agree that the background samples were background but were taken within a contaminated area. It may be that the background samples were not taken within the spill area. The facility did not take samples around the outside of the edge of the visually impacted area to determine if the diesel may have migrated within the fill on top of the clay. The highest concentration of TPH at 4,172 mg/kg was located on the south side of the SWMU #6. Sloss should conduct confirmatory sampling on the south side of SWMU #6 to determine that the diesel spill did not extend beyond the excavation. The facility should take samples incrementally to bedrock. Specify the number of soil samples and their depths. Provide a map with the location of the soil boring.

Response #47
As requested, Sloss is proposing to collect confirmatory samples (at the 2- to 4-foot depth) on the southern and western sides of the excavation for analysis of TPH-DRO. Details regarding the proposed sampling will be included in the Phase III RFI Work Plan for EPA review and approval.

As suggested by EPA in its March 2, 2006, comment letter, Sloss is interested in meeting with EPA to further discuss these comments and responses, but more specifically to review the draft Phase III RFI Work Plan, which will be developed upon completion of the activities identified previously. It is anticipated that the activities outlined will be completed by October, with the Draft Phase III RFI Work Plan prepared for discussion in the October or

November timeframe. We will coordinate with EPA on a meeting date as completion of these activities draw near.

If you have any questions regarding the planned preliminary activities, the responses provided to the March 2, 2006, comments, or the project in general, please either call me directly at (334) 271-1445, ext. 317, or call Jim Henry at (205) 808-7920.

Sincerely,

CH2M HILL

Kelly C. Moody, P.E.
Project Manager
mgm06-CR5/039.doc
c: Jim Henry/Sloss Industries
Daniel Grucza/Walter Industries, Inc.
Chip Crockett/ADEM

ENCLOSURE 8

WALTER ENERGY™

WALTER COKE

Soil Sampling/Replacement Briefing

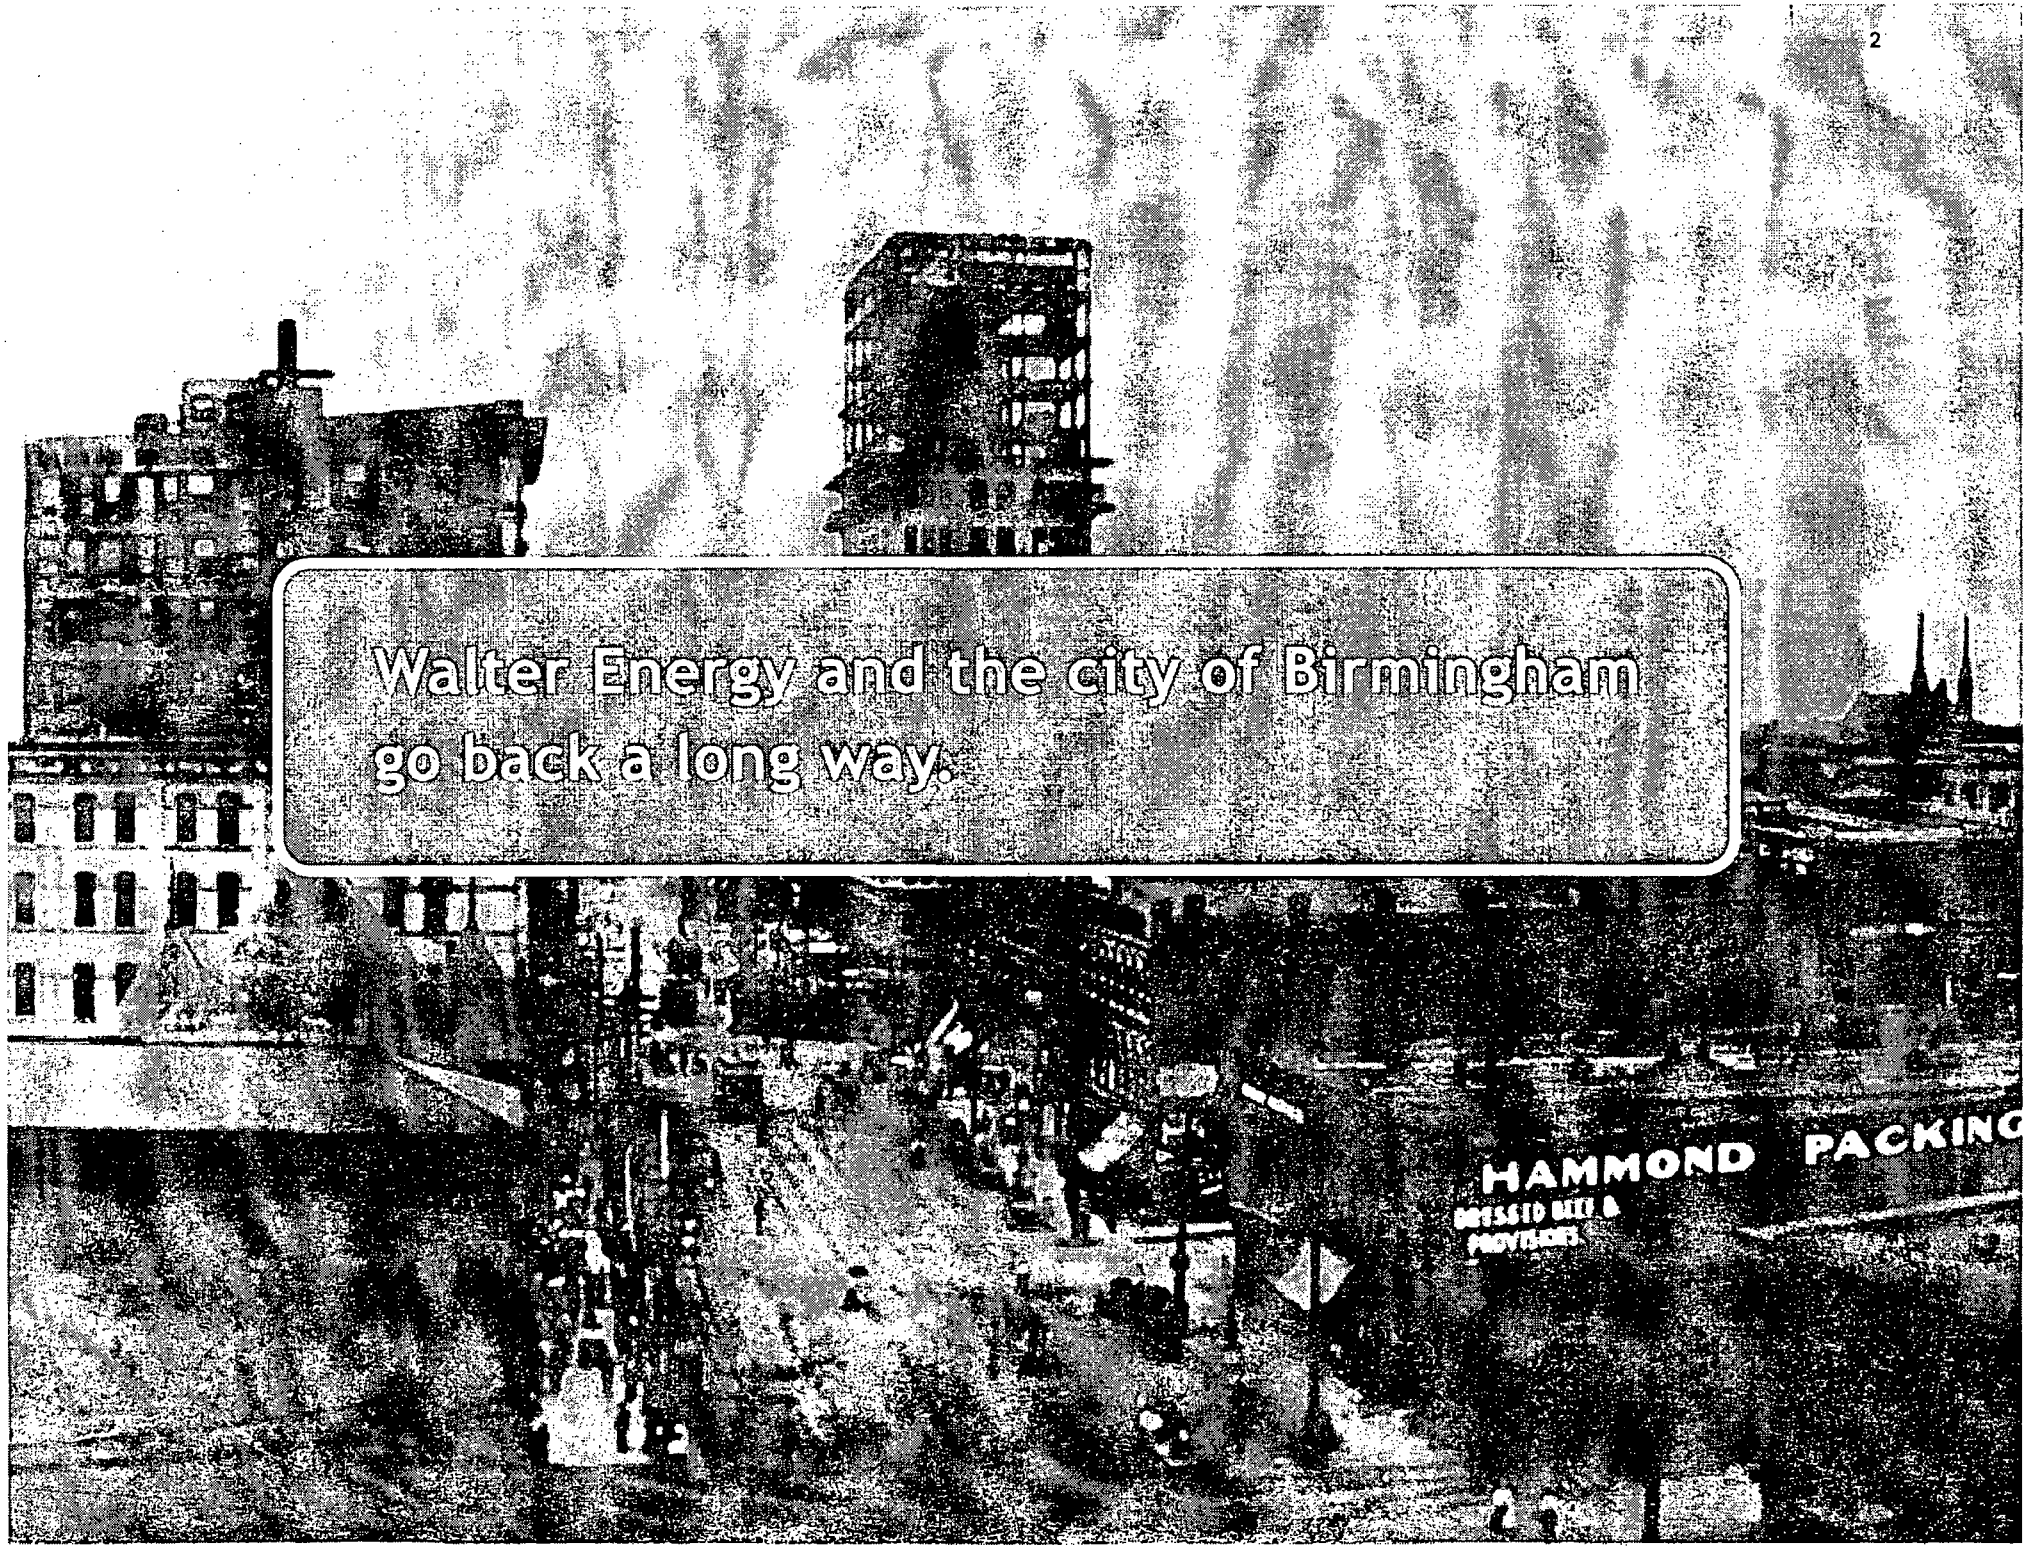

Walter Energy and the city of Birmingham go back a long way.

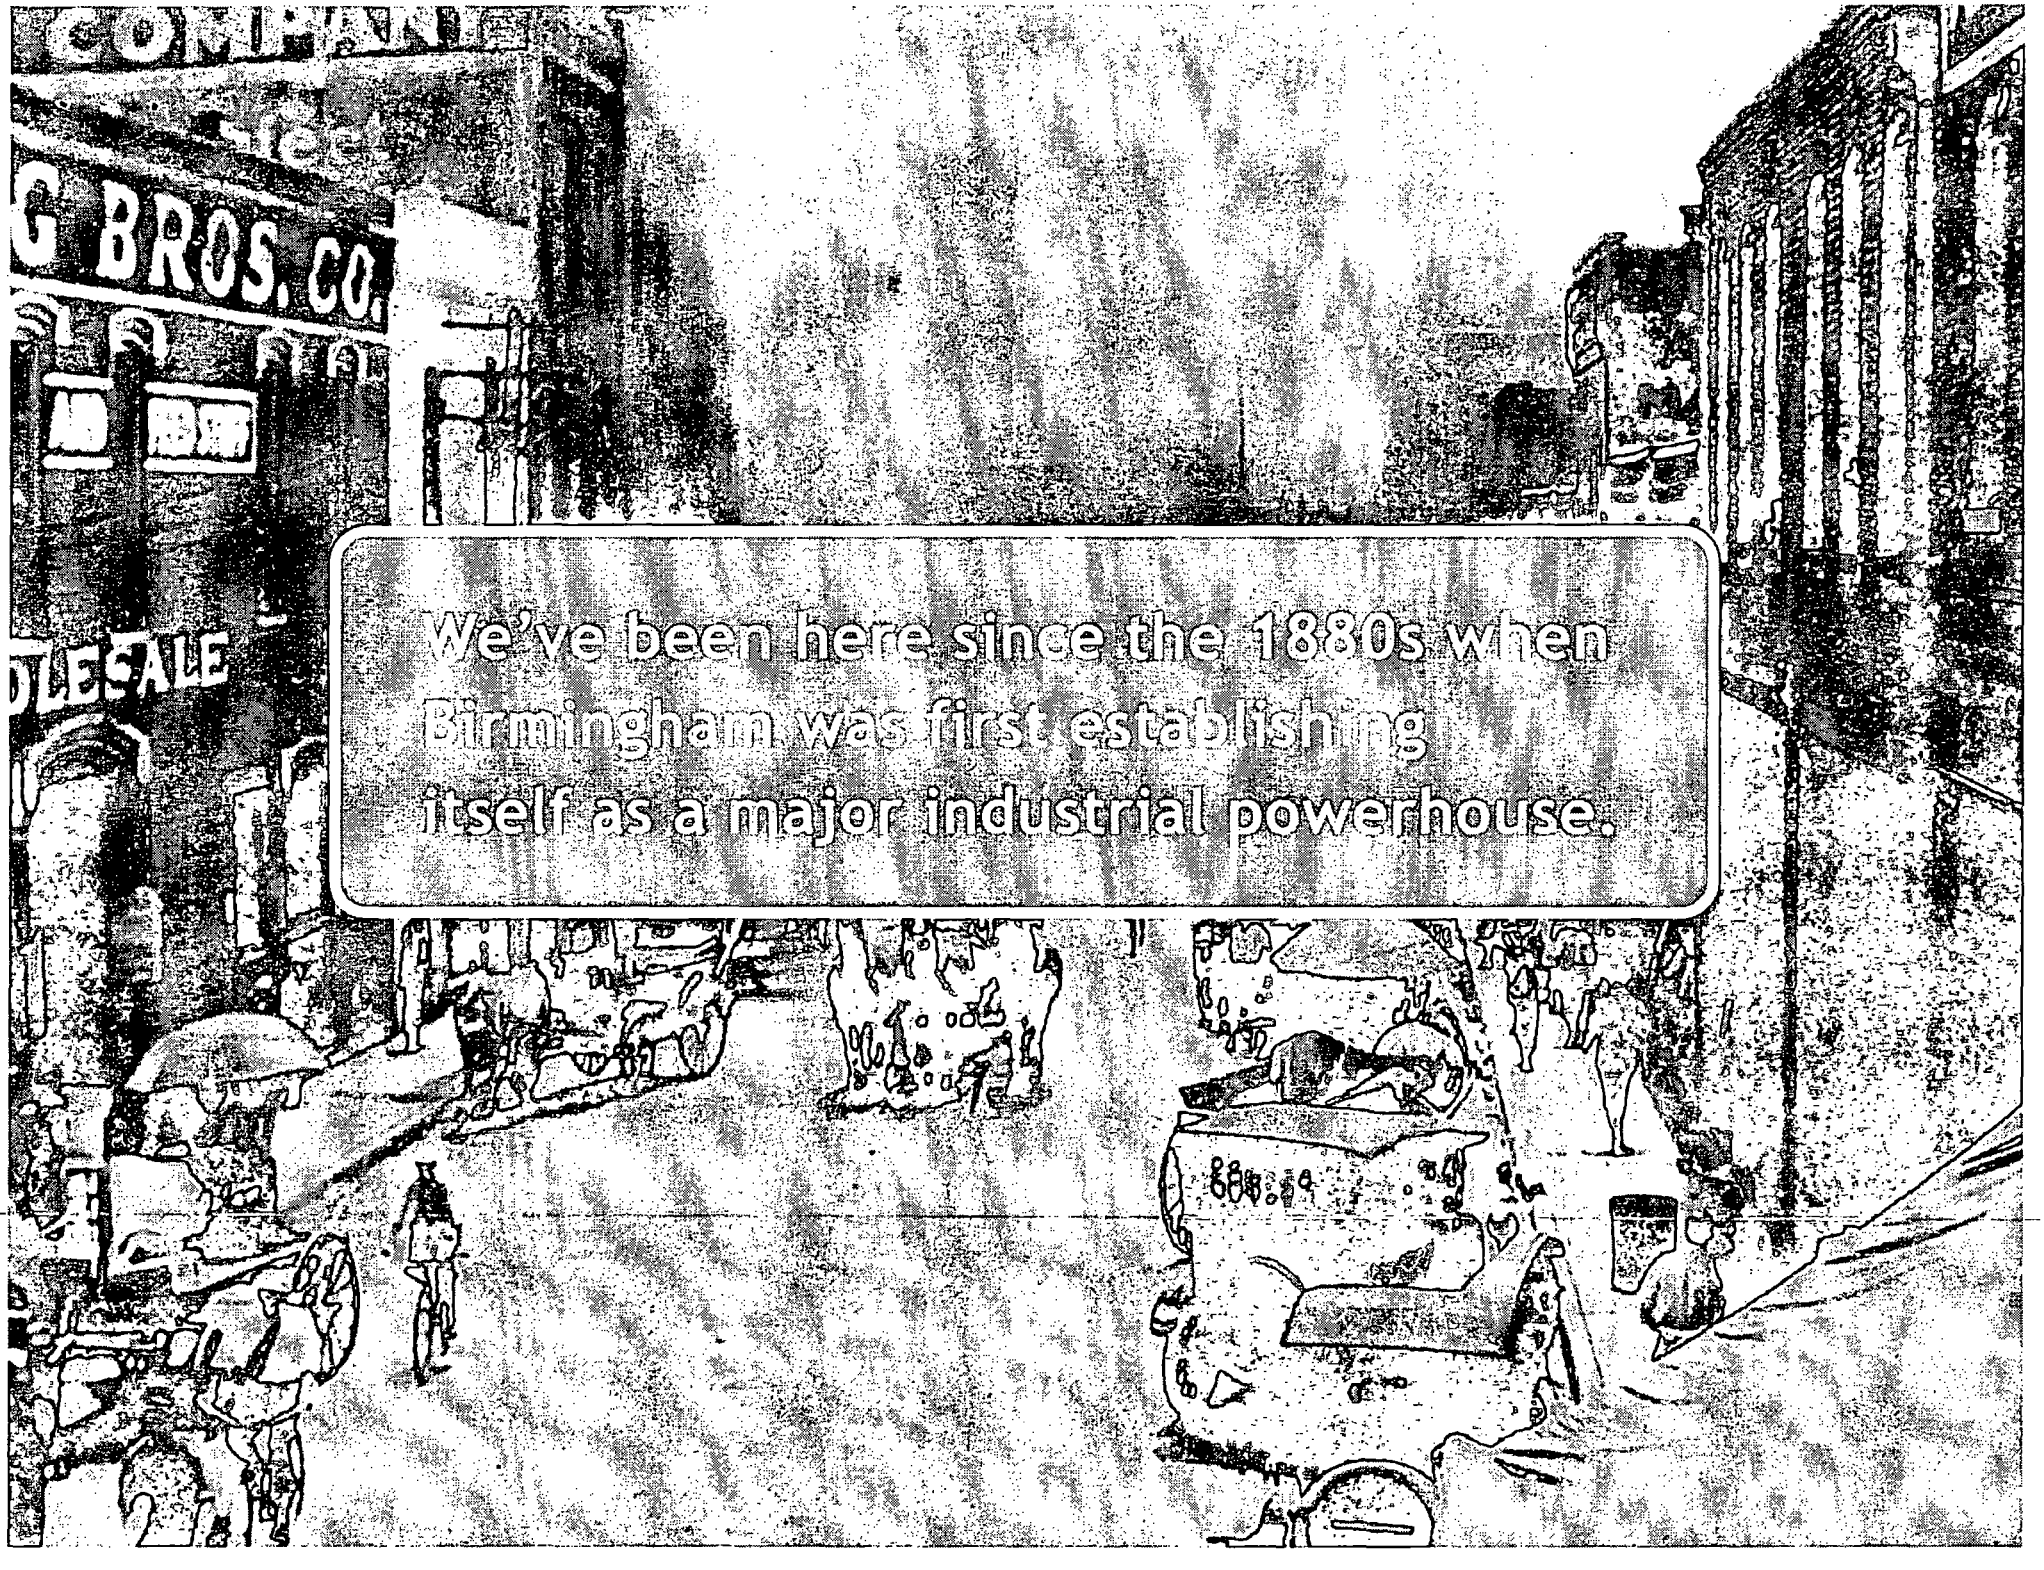
G BROS. CO.
We've been here since the 1880s when
Birmingham was first establishing
itself as a major industrial powerhouse.

It was the huge industries based on iron, coal and steel that gave Birmingham its now famous nickname of "The Magic City."

North Birmingham is a historically industrial area

- In many parts of Birmingham, industry pre-dates residential development

Currently or historically operating in North Birmingham are:

- 8 foundries
- 8 coal/coke byproduct facilities
- 23 scrap/metals processing facilities
- 20 stone and aggregate plants
- 7 auto/truck salvage operations
- 4 chemical facilities
- 3 brick kilns/strip mines

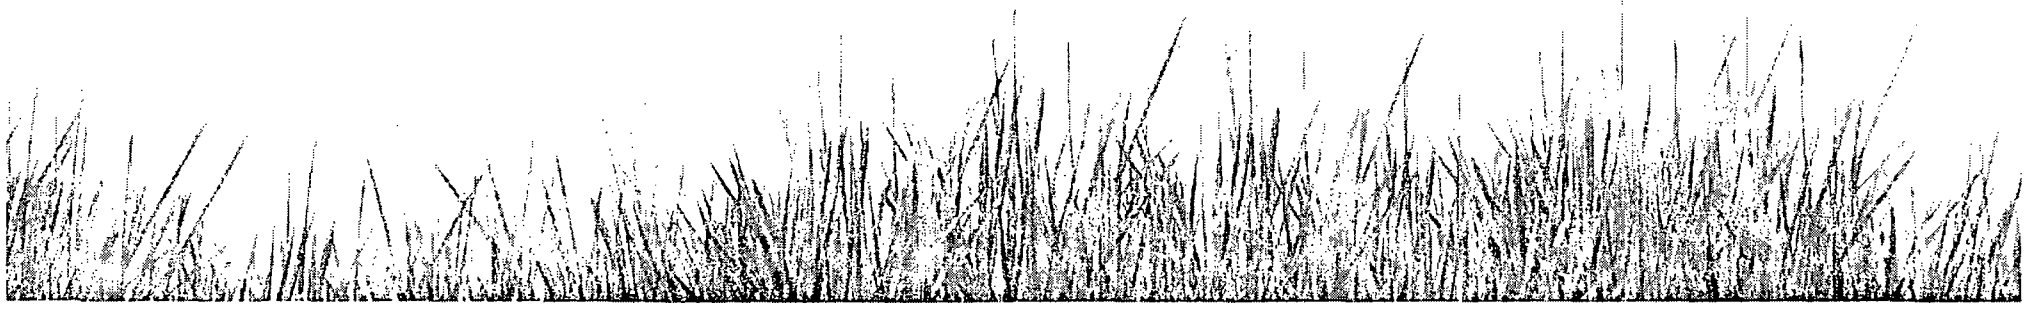

Residential areas quickly began to grow up around the plants that had quickly established themselves here.

WALTER ENERGY™

WALTER COKE

Over the years, these areas later became the neighborhoods such as Fairmont, Collegeville and Harriman Park.

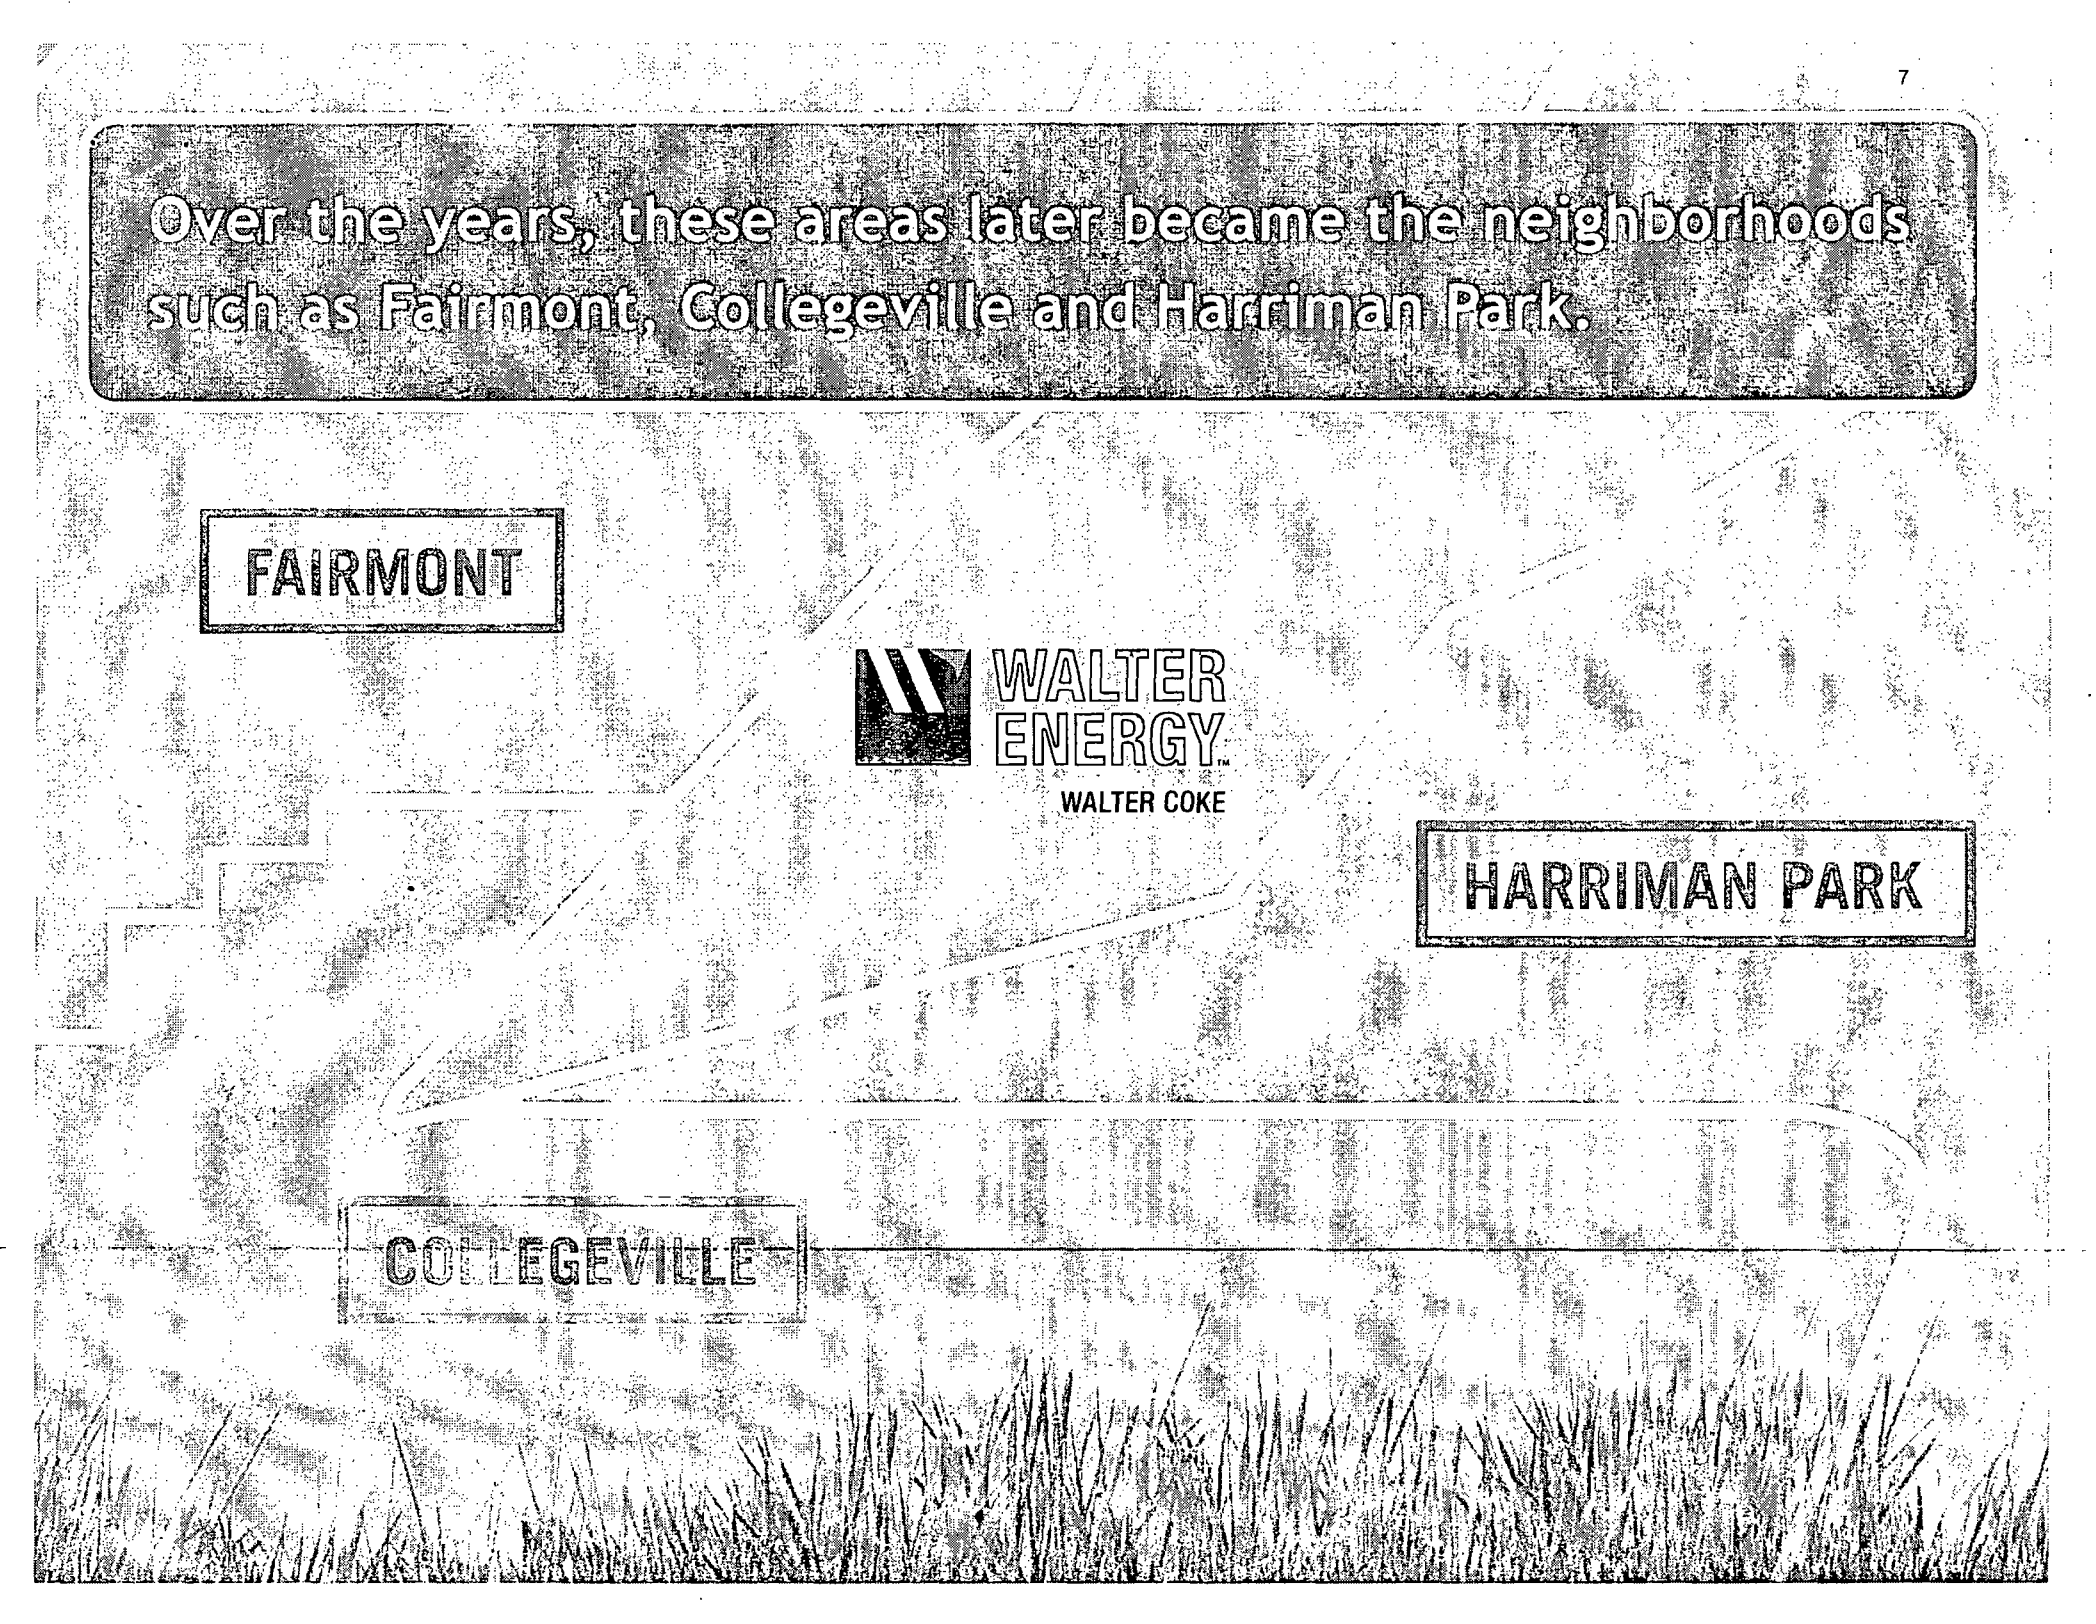

And we're both still here, living side-by-side
as we've done since the very beginning.

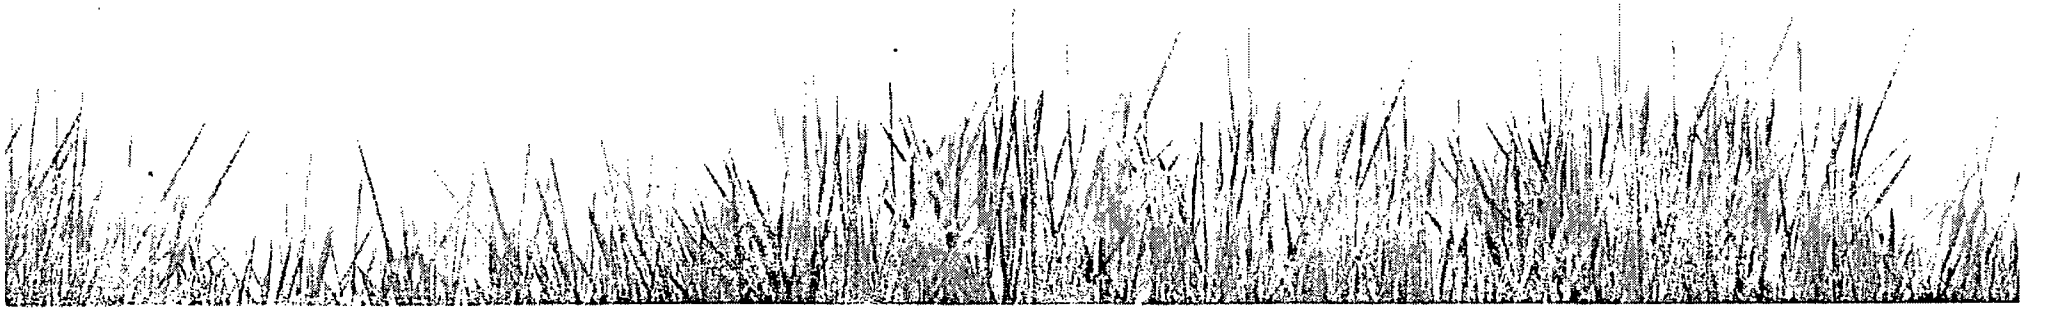

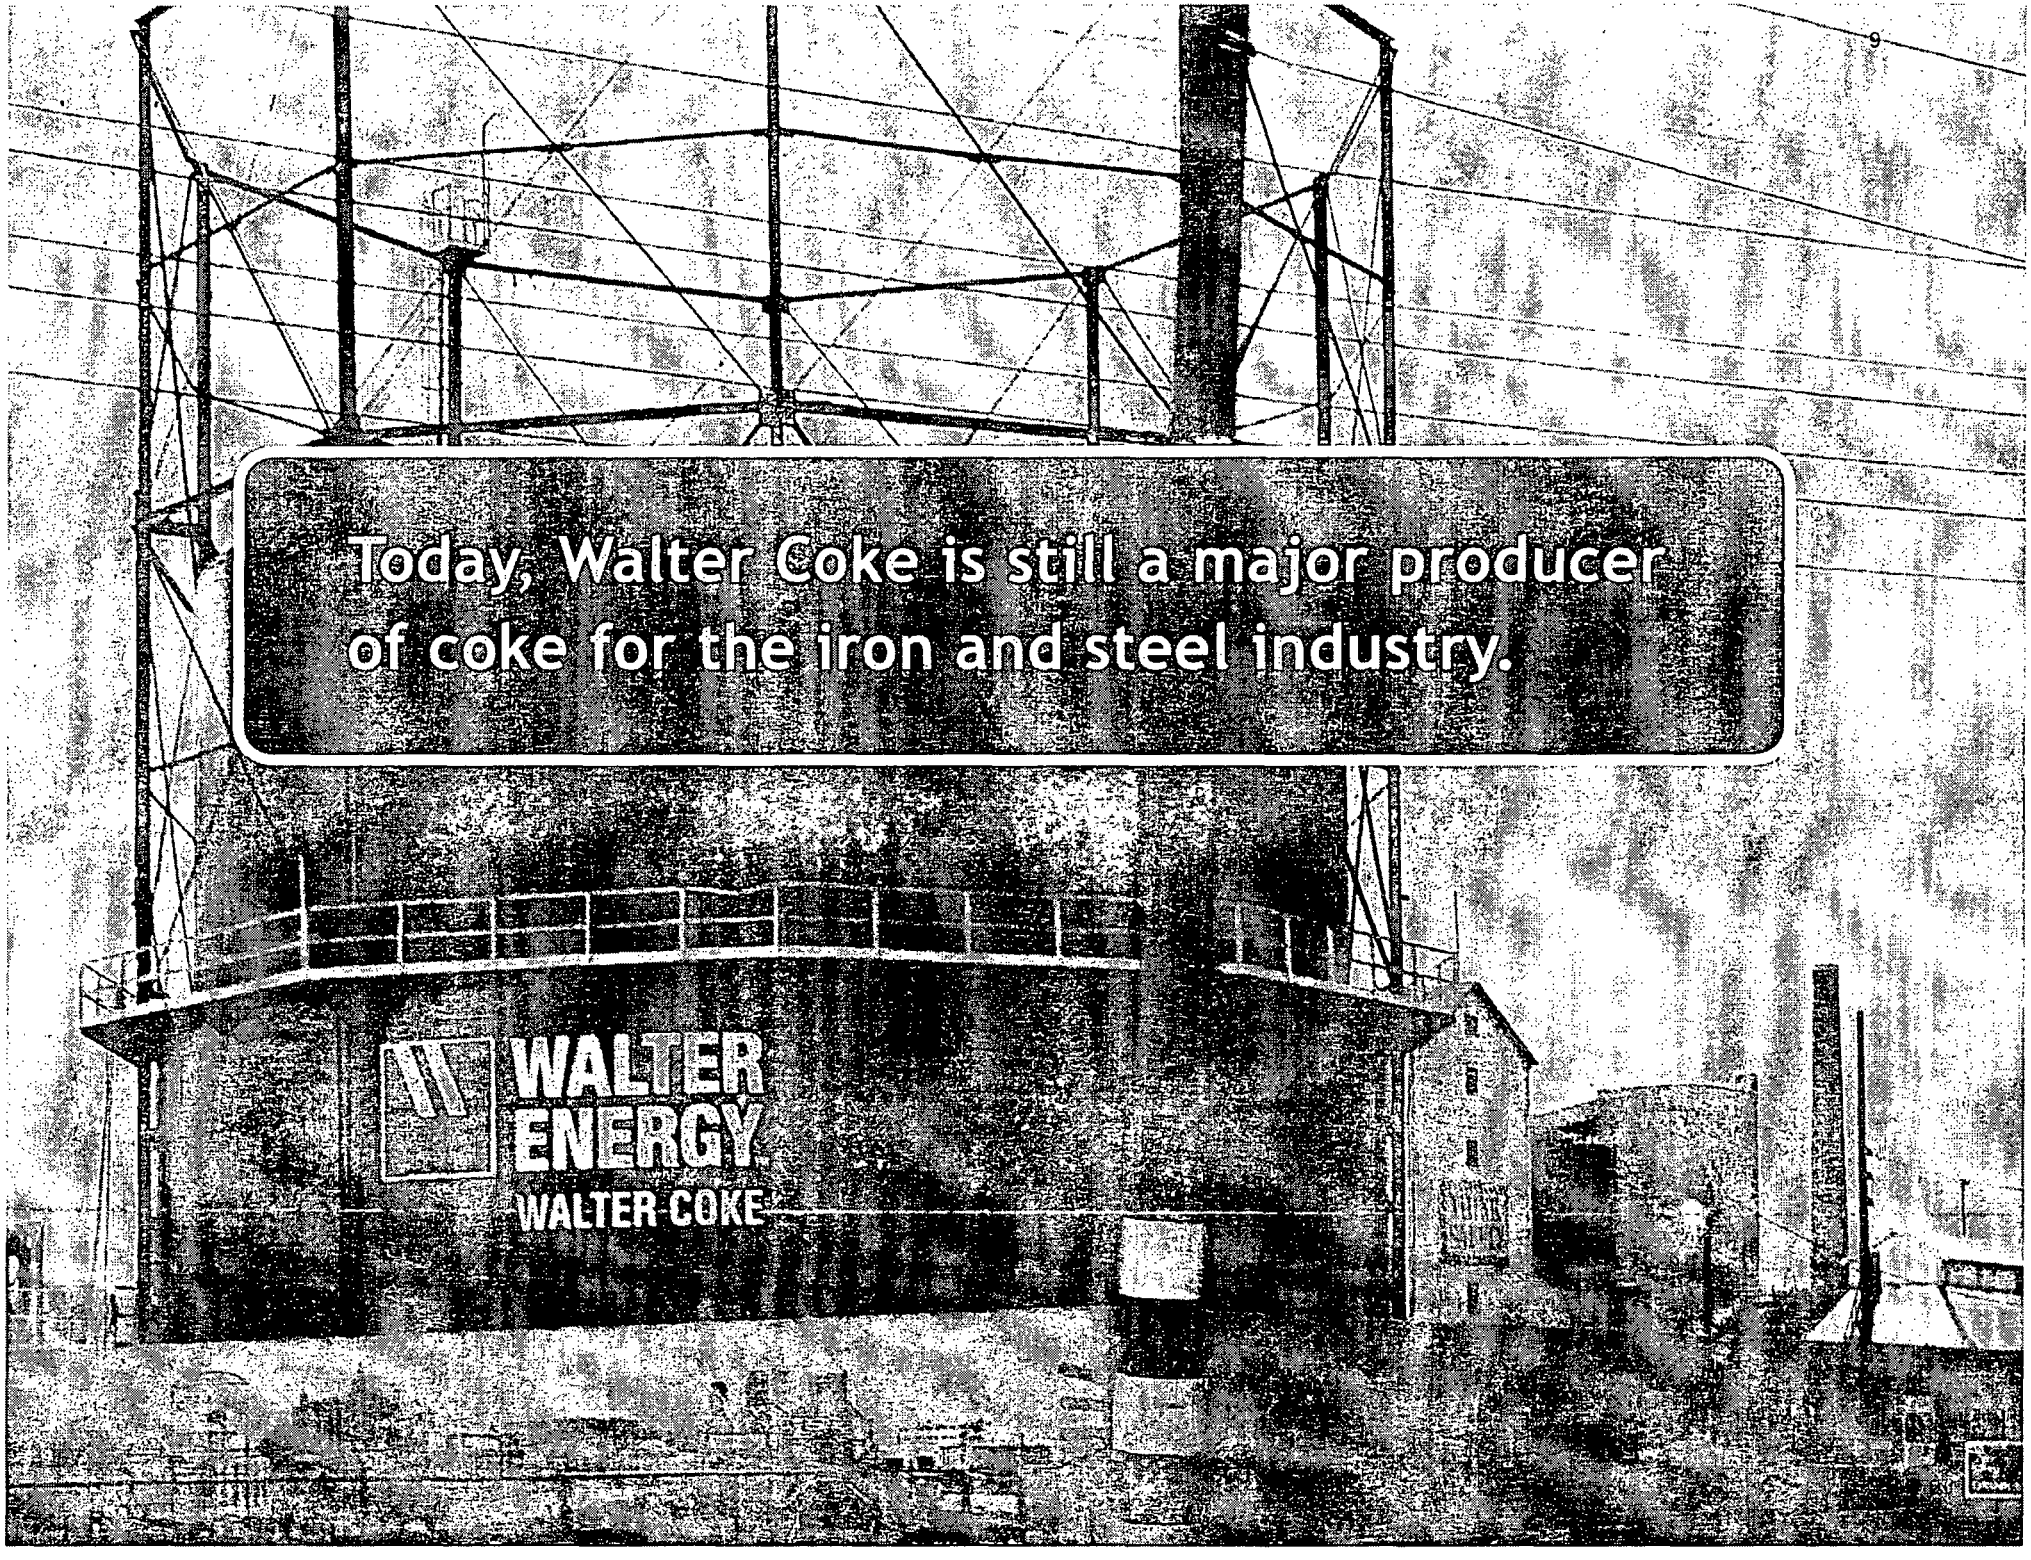
Today, Walter Coke is still a major producer of coke for the iron and steel industry.
WALTER ENERGY
WALTER COKE

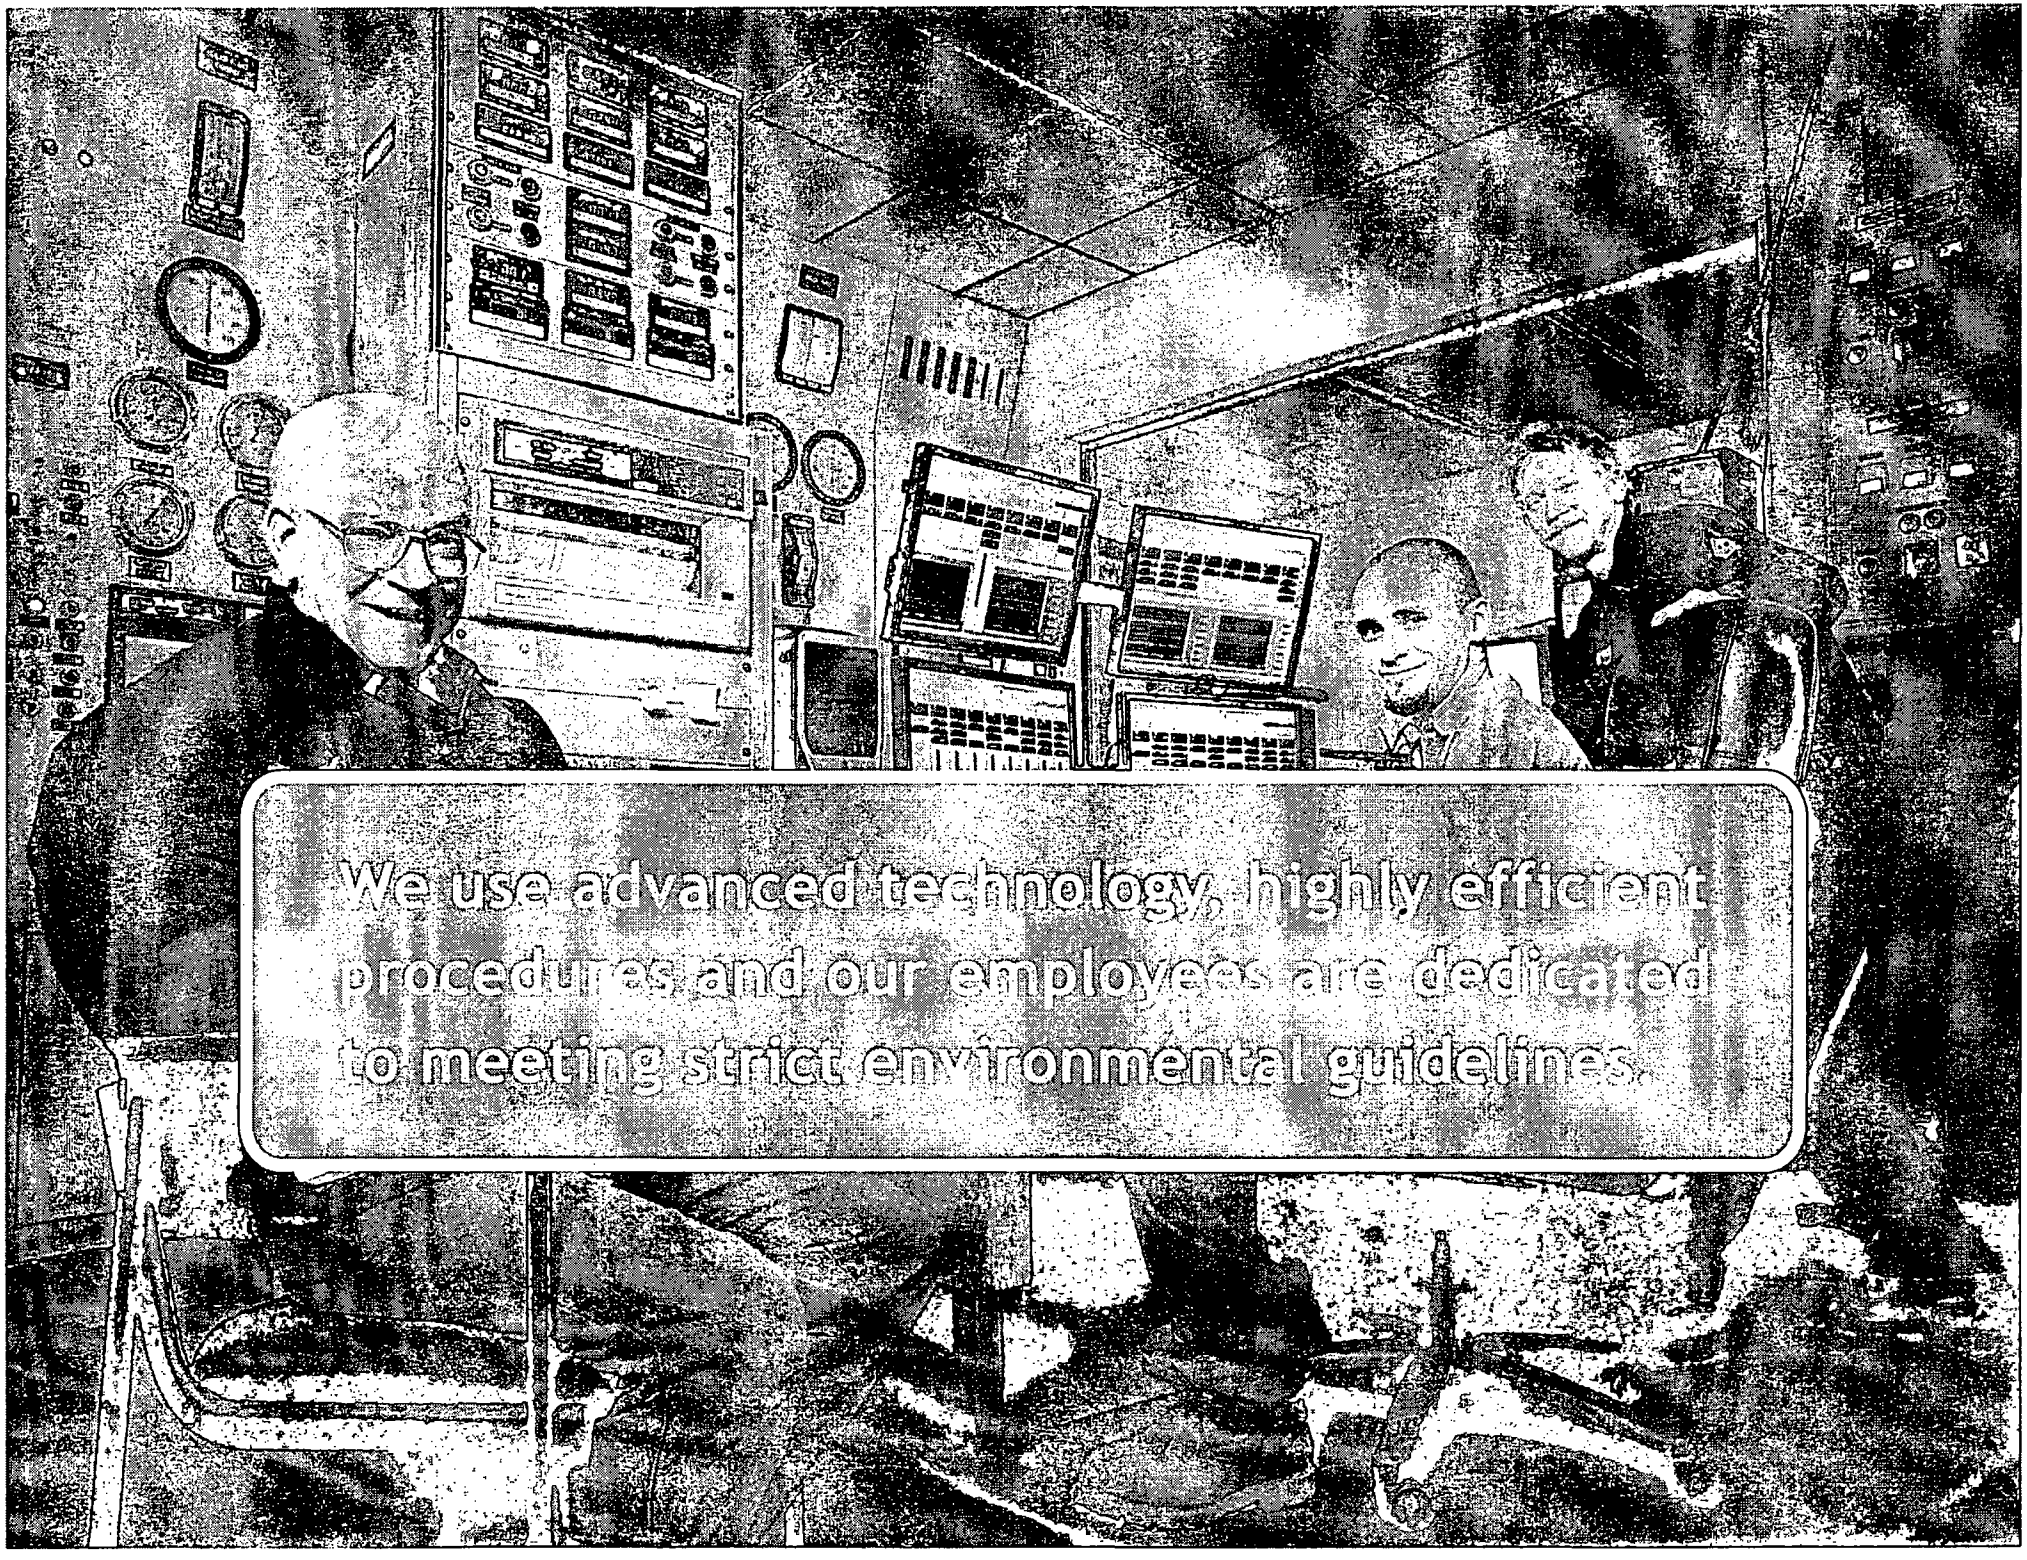
We use advanced technology, highly efficient
procedures and our employees are dedicated
to meeting strict environmental guidelines.

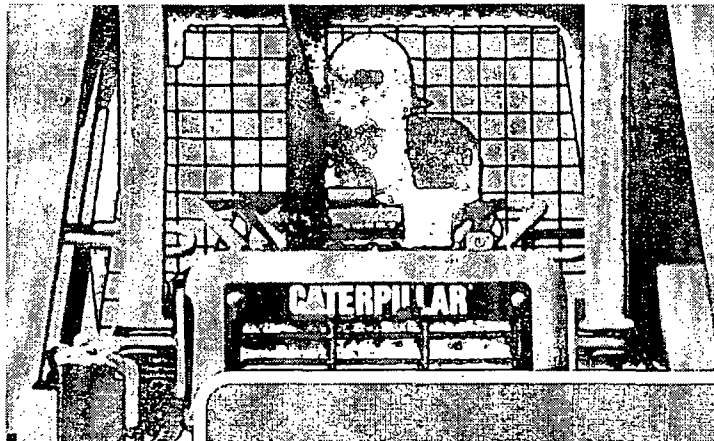

Walter Coke is voluntarily performing sampling and cleanup work in the neighborhoods of Collegeville, Fairmont and Harriman Park, even though we do not believe our Company, or its predecessor, Sloss Industries, was or is responsible for the presence of BaPs or arsenic in local soils.

Timeline

1989-2004

EPA and Walter Coke (formerly Sloss Industries) involved in numerous efforts in field work, reporting, and review of matters relating to environmental regulations related solely to areas inside Walter Coke's plant boundaries. At this time, Sloss was following standard EPA guidelines and implemented multiple projects to make their operations cleaner.

2005

EPA asks Walter Coke to perform what is called an Environmental Indicator (EI) study. This involved taking some samples of soil outside the plant, in Collegeville, Fairmont and Harriman Park, including residences and schools. Walter Coke cooperated, performing the sampling and submitting the report in July 2005.

2?

...spite finding in 2005 that any health impacts due to soil exposure would be insignificant, that concentrations were typical of urban areas, and that no further actions were necessary, EPA asked W.C. to assist it in a more detailed soil investigation in the area, which W.C. agreed to do on a voluntary basis and completed this work in the summer of 2009.

10

EPA reviews sampling from neighborhoods. Discussions and planning begin with Walter Coke on planning for soil removal and replacement. Walter Coke instrumental in formation of Citizens Advisory Panel (CAP) to create and maintain ongoing dialog with Collegeville, Fairmont, Harriman Park communities.

2011

Walter Coke voluntarily performs cleanup at Hudson Elementary and Riggins Alternative schools. Walter Coke submits suggested Work Plan to EPA on further sampling and cleanup initiatives, denying sole responsibility for presence of BaP and Arsenic in the communities concerned.

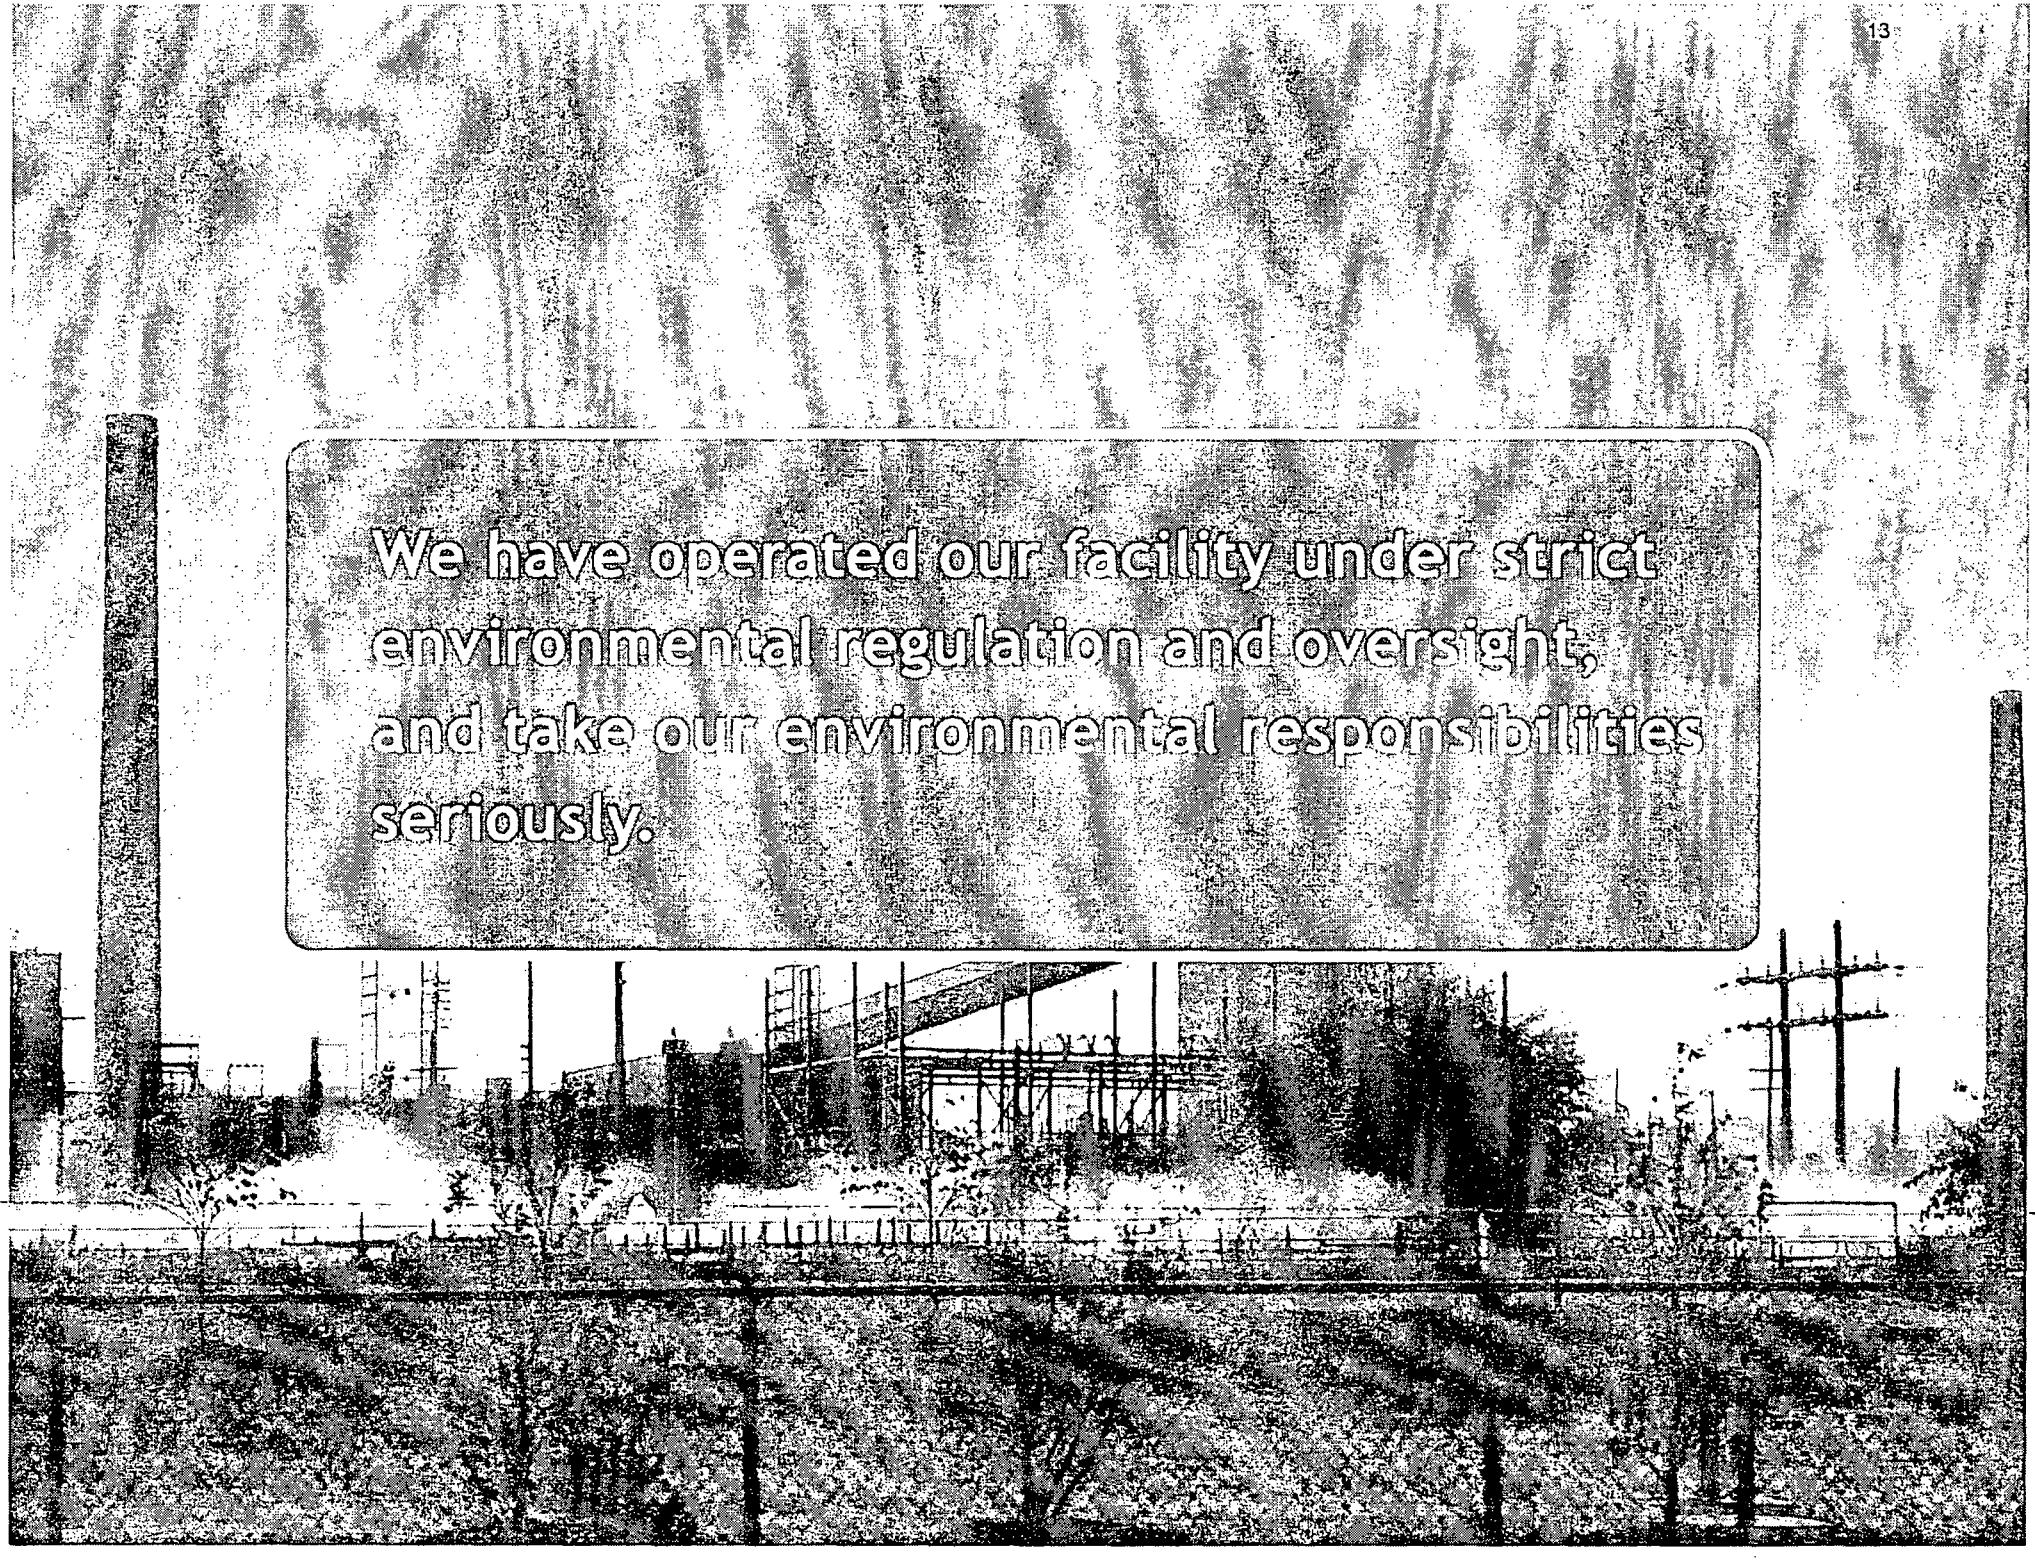
We have operated our facility under strict environmental regulation and oversight, and take our environmental responsibilities seriously.

The substances that are at issue come from many sources in modern life and are not unique to these neighborhoods. In fact, the U.S. EPA determined as recently as 2005 that the levels of contaminants identified in neighborhoods soils were no higher than the range of such contaminants typically found in urban areas.

Source: EPA 2005

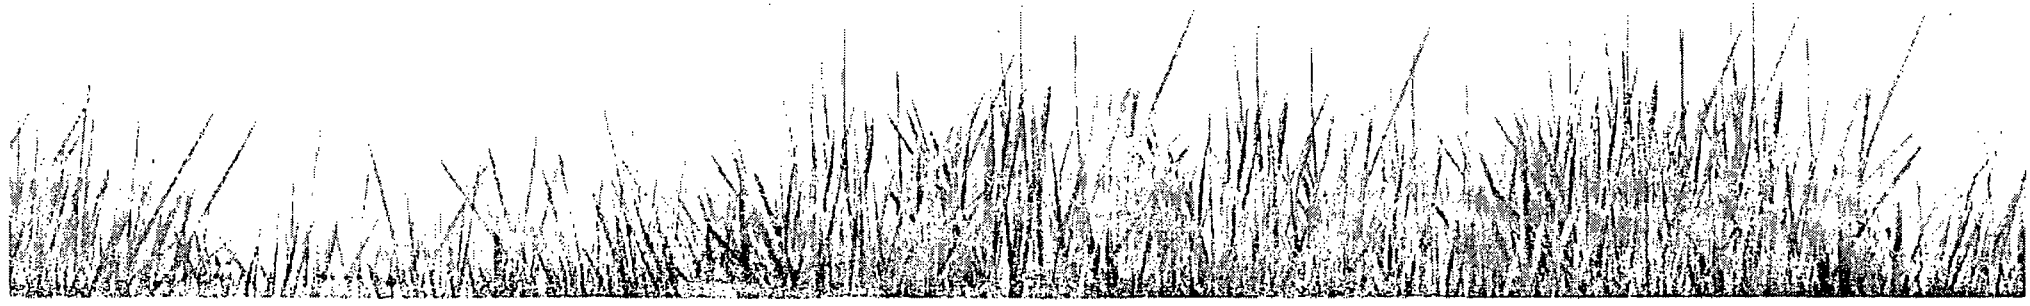

Further, EPA determined at that time that **no further actions were needed** as to off-site surface soils. Walter Coke knows of no information or additional scientific study that would warrant a different conclusion.

Source: EPA 2005

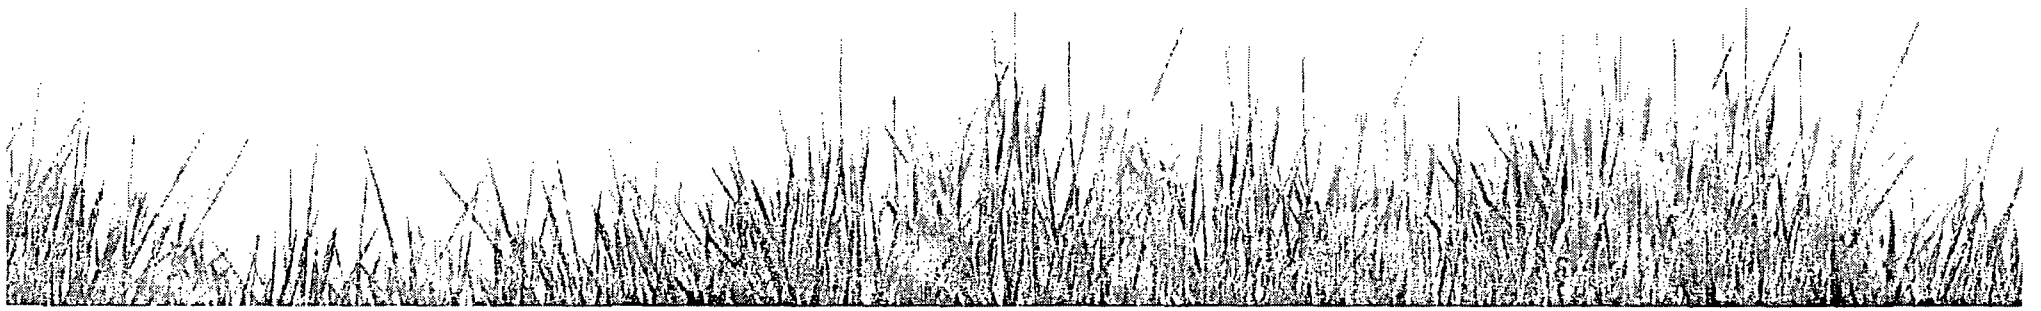

EPA also found at that time that the levels of contaminants found, which are similar to other urban areas in the U.S., posed an "insignificant" potential impact to human health.

Source: EPA 2005

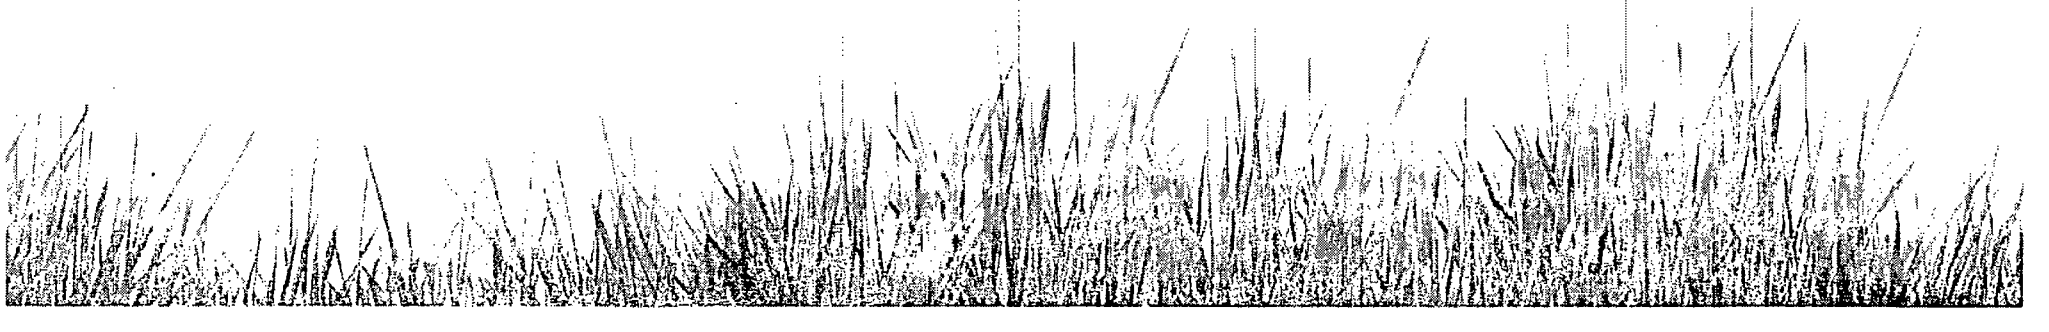

EPA has publicly acknowledged that operations other than Walter Coke may be responsible for contaminants that have been found in the area.

EPA has also stated that non-industrial sources such as car, railroad, and airplane exhaust, residential pesticide use, and other residential activities such as grilling and home heating are potential contributors to the levels of contaminants seen in the neighborhoods.

Source: EPA 2010

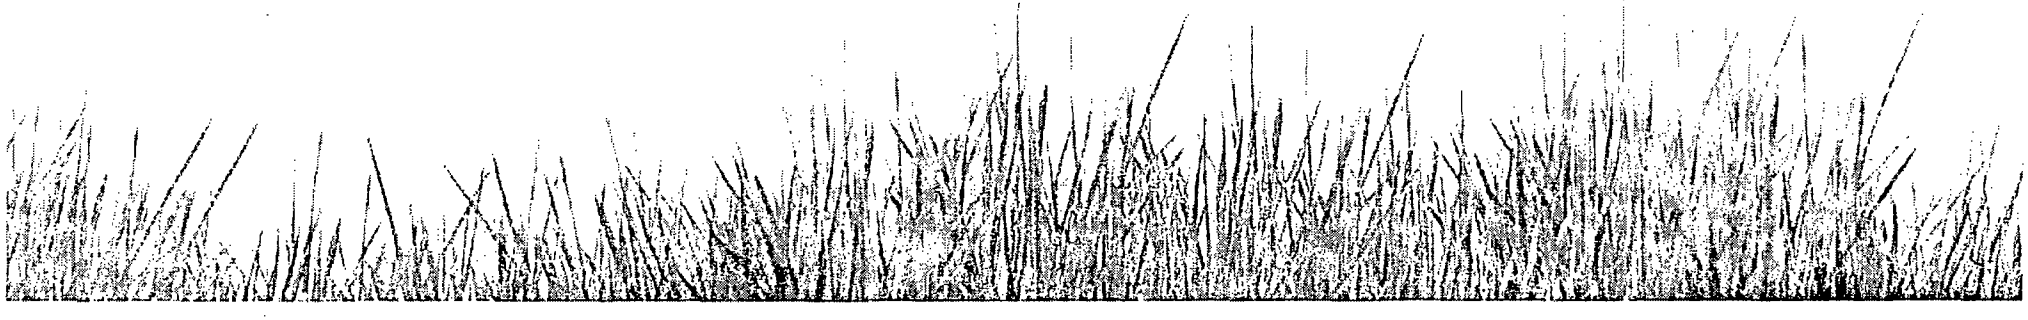

Potential Sources of Arsenic

- Naturally-occurring in Alabama soil
- Wood preservative: pressure-treated utility poles & building lumber (fencing, decking, playground equipment)
- Insecticides, pesticides, herbicides (weed control)
- Industrial operations

Potential Sources of PAHs

Combustion engines: cars, trucks, trains, airplanes

Coal or wood-burning stoves and furnace

Trash burning, open burning (e.g. leaves), burned wood

Outdoor grilling and cooking

Used oil from cars (released on ground)

Roofing materials (tar, shingles), new or broken

Industrial operations

350/30

EPA-defined cleanup levels are based on a "reasonable maximum exposure" scenario for residents which includes daily soil or dust exposure for **350 days** a year, for a duration of **30 years**.

The target excess lifetime cancer risk that EPA has established for cleanup is **1 in 10,000**.

Source: EPA

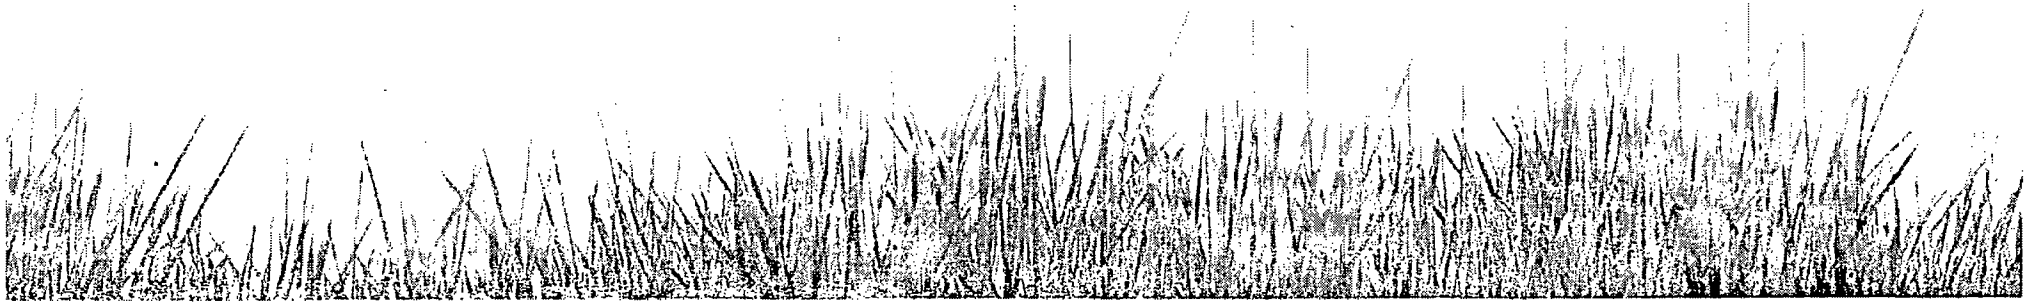

- According to the National Cancer Institute (NCI), in the U.S., men have an almost 50% likelihood of developing cancer sometime in their lifetime, and women have a risk of more than 1 in 3

- NCI estimates that in 2011, almost 1.6 million new cancer cases will be diagnosed in the U.S.
  - More than 25,000 of these cases will be among residents of Alabama.
  - The overwhelming majority of cancer is caused by smoking, heredity, and lifestyle choices concerning nutrition.
  - Only about 2% can be attributed to "environmental pollutants,"
  - Includes car and truck exhaust, home chemical usage, power plant emissions, etc.

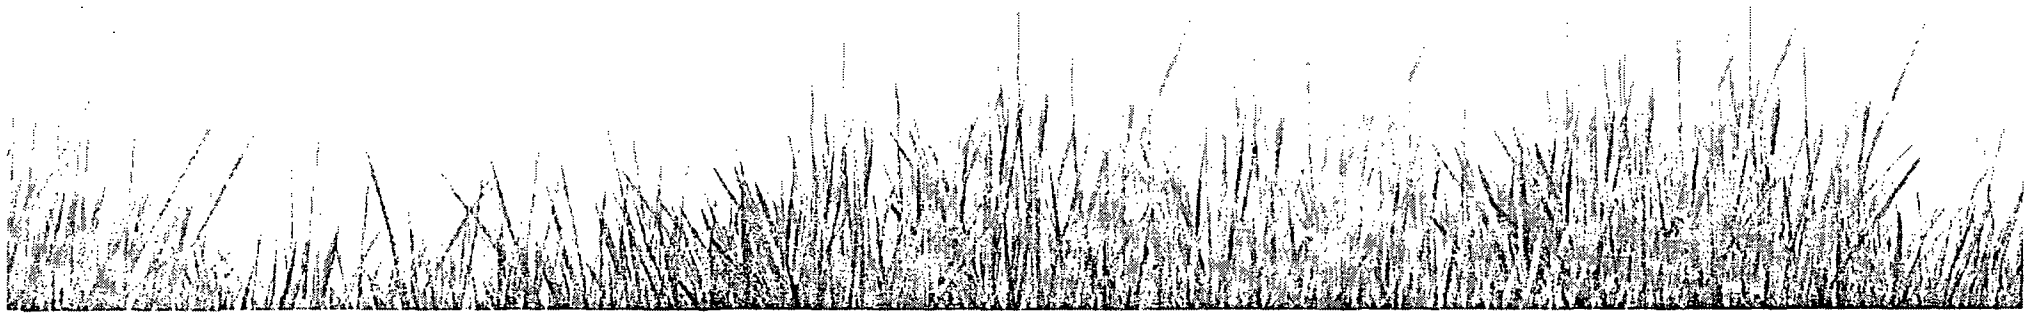

Sampling data compared to cleanup level - BaP TEQ

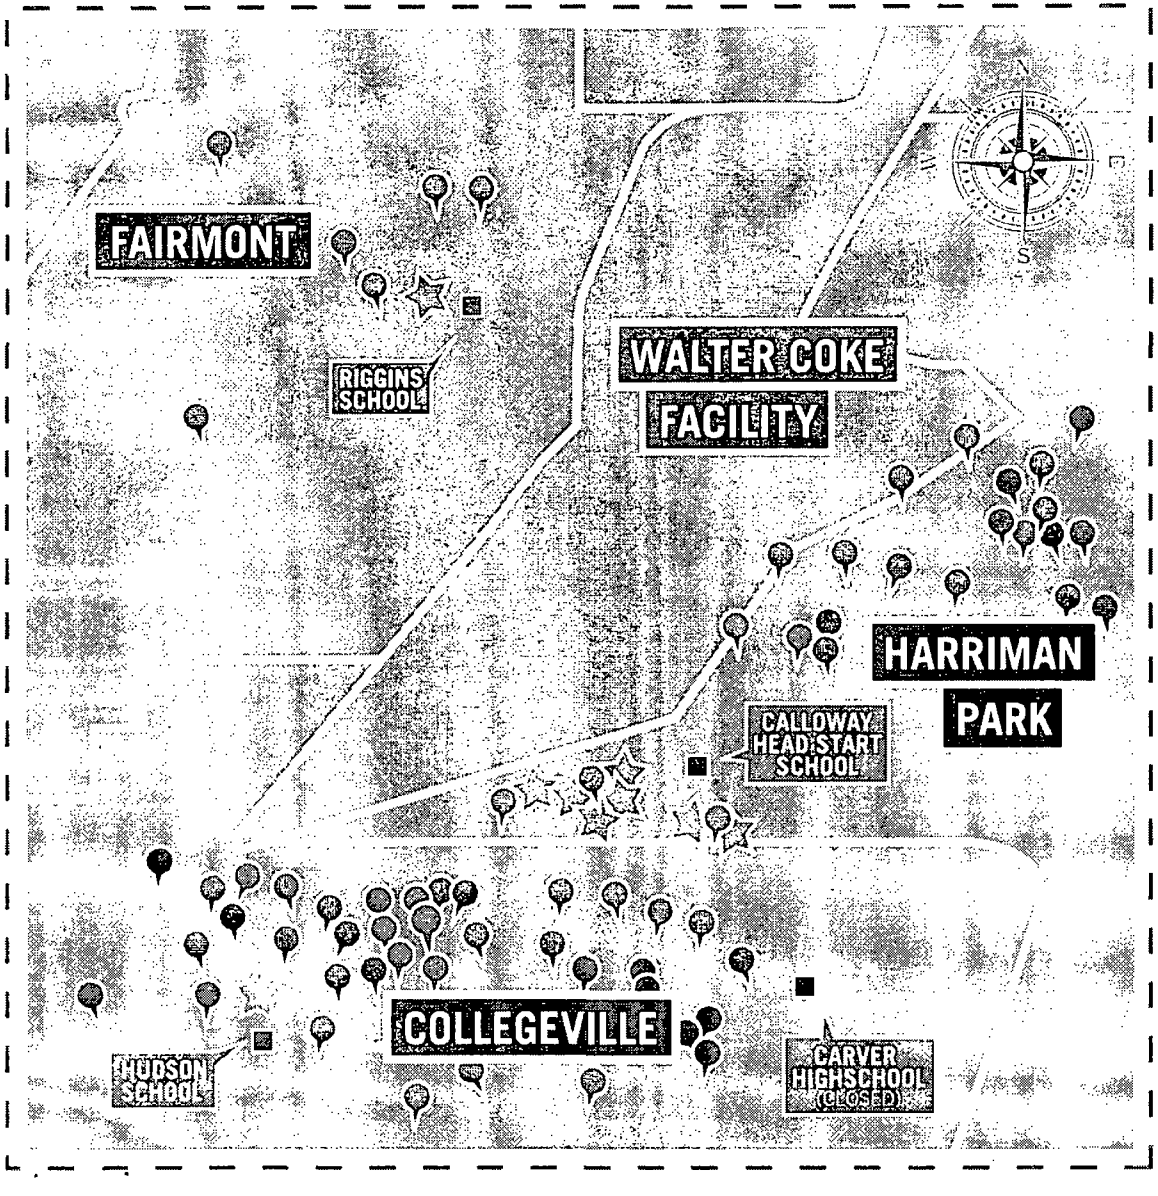

BaP TEQ - Benzo (a) Pyrene Toxic Equivalents

- 235 samples were taken at 75 properties.
- 75% of these samples were found to be below the clean-up levels.
- During sampling, only 23 properties (red dots) have exceeded clean-up levels.

LEGEND

- Below Cleanup Level (1.5 mg/kg)
- Above Cleanup Level (1.5 mg/kg)
- Cleanup Complete (7 residences, 2 schools)

Note: Soil cleanup levels are conservative risk-based values developed by EPA that are health-based. Results above cleanup levels may present a 1 in 10,000 (1×10^{-4}) increased cancer risk over a lifetime.

Community Soil Sampling Conducted by Walter Coke, Inc.

Sampling

These properties were chosen based on a scientific, grid-based format

No correlation has been found between the levels of BaP or Arsenic present, and their distance to the Walter Coke plant

This is only Phase I of the sampling

Phase II is being jointly developed with the EPA

Comparison of

BaP LEVELS

in surface soils sampled

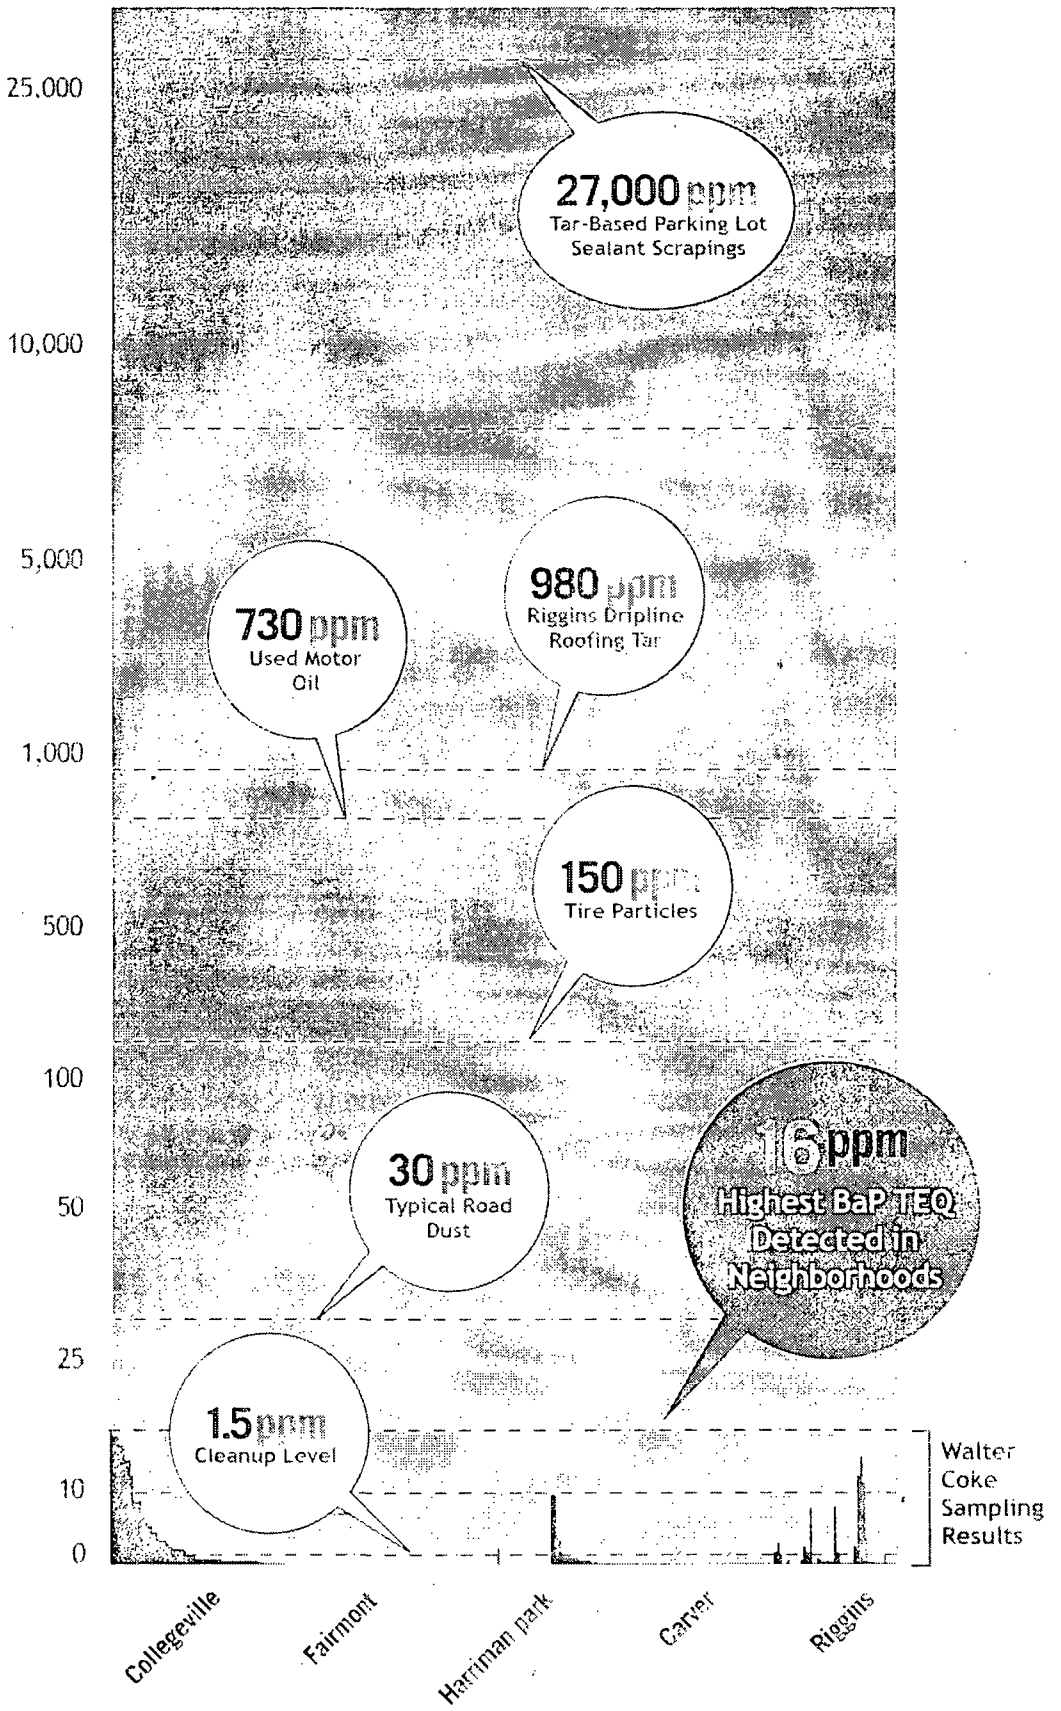

Residential Findings

Materials like slag, asphalt, rubber tires and roofing shingles are being discovered in the residential cleanup.

Hudson K-8 Findings

Some 200 cubic yards of asphalt were found beneath the Hudson soil.

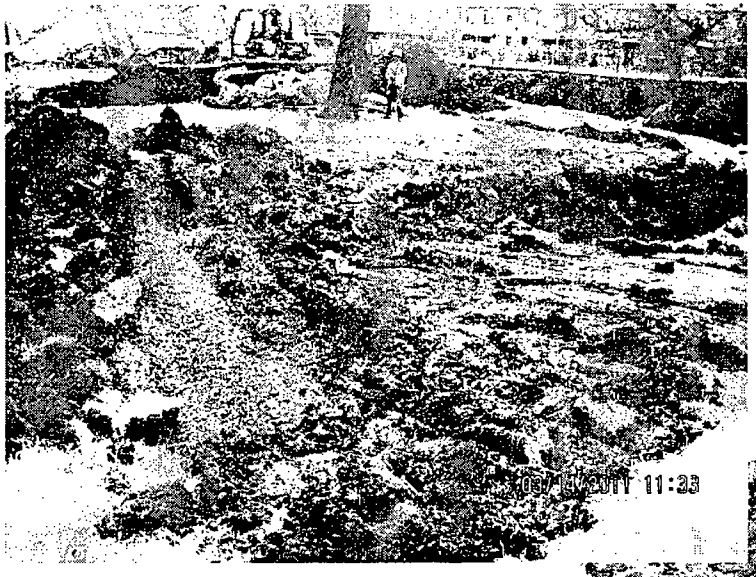

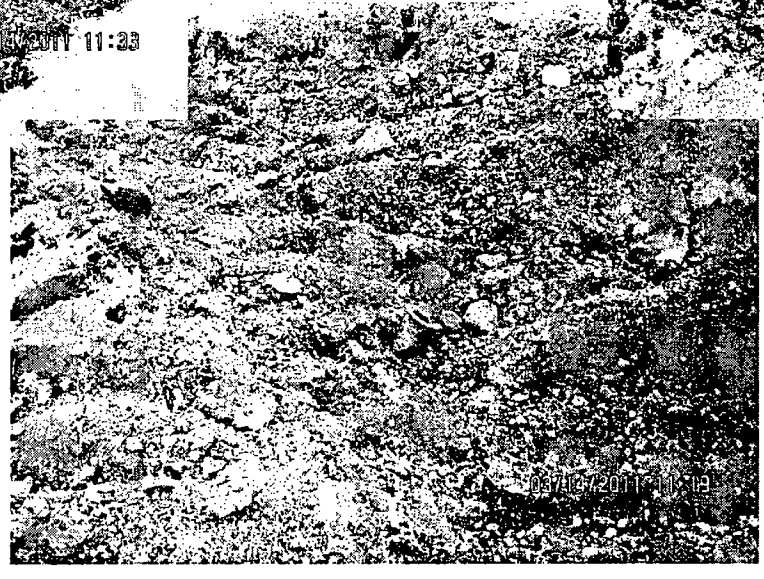

Riggins School Roofing Tar

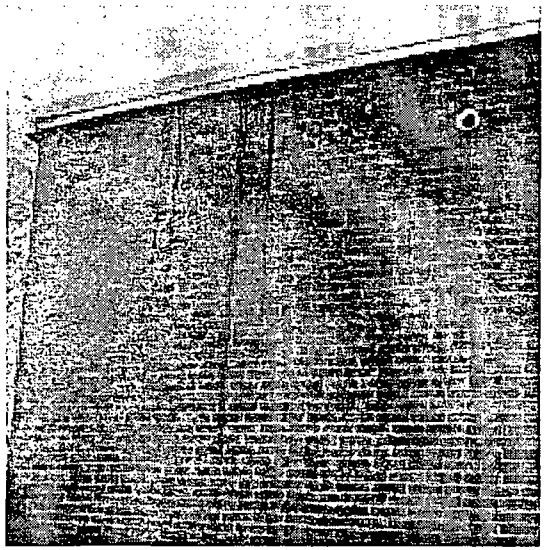

"Tar-sicles"

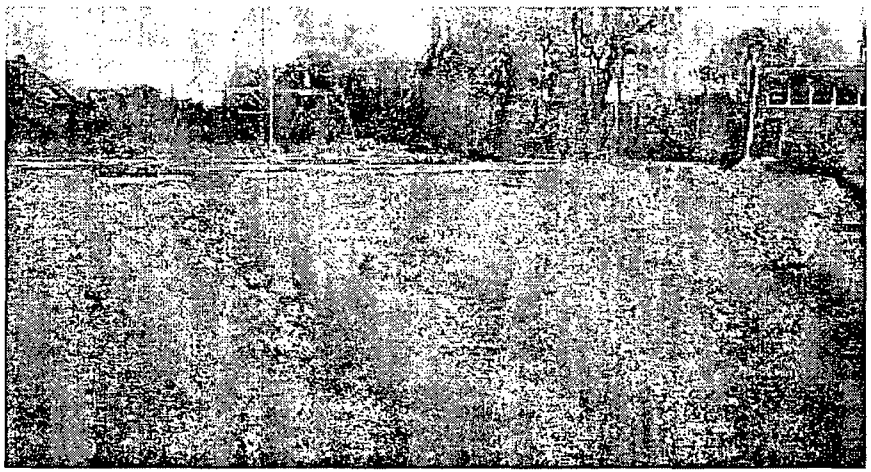

Soil Replacement Area

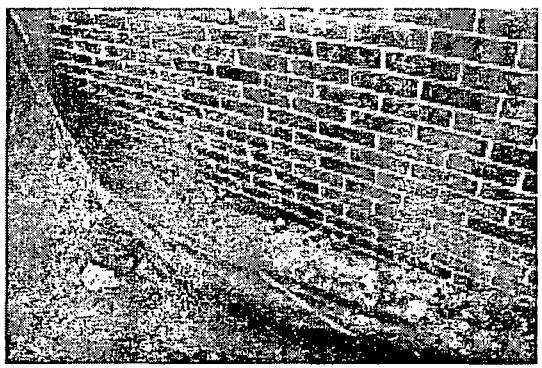

Drip-Line

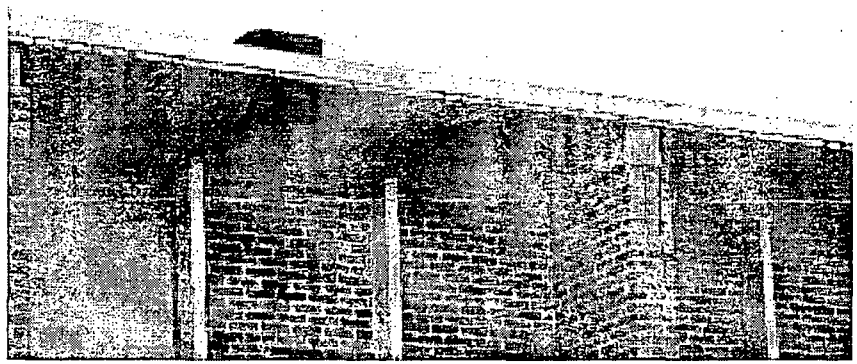

"Tar-sicles"

Comparison of

ARSENIC LEVELS

in surface soils sampled

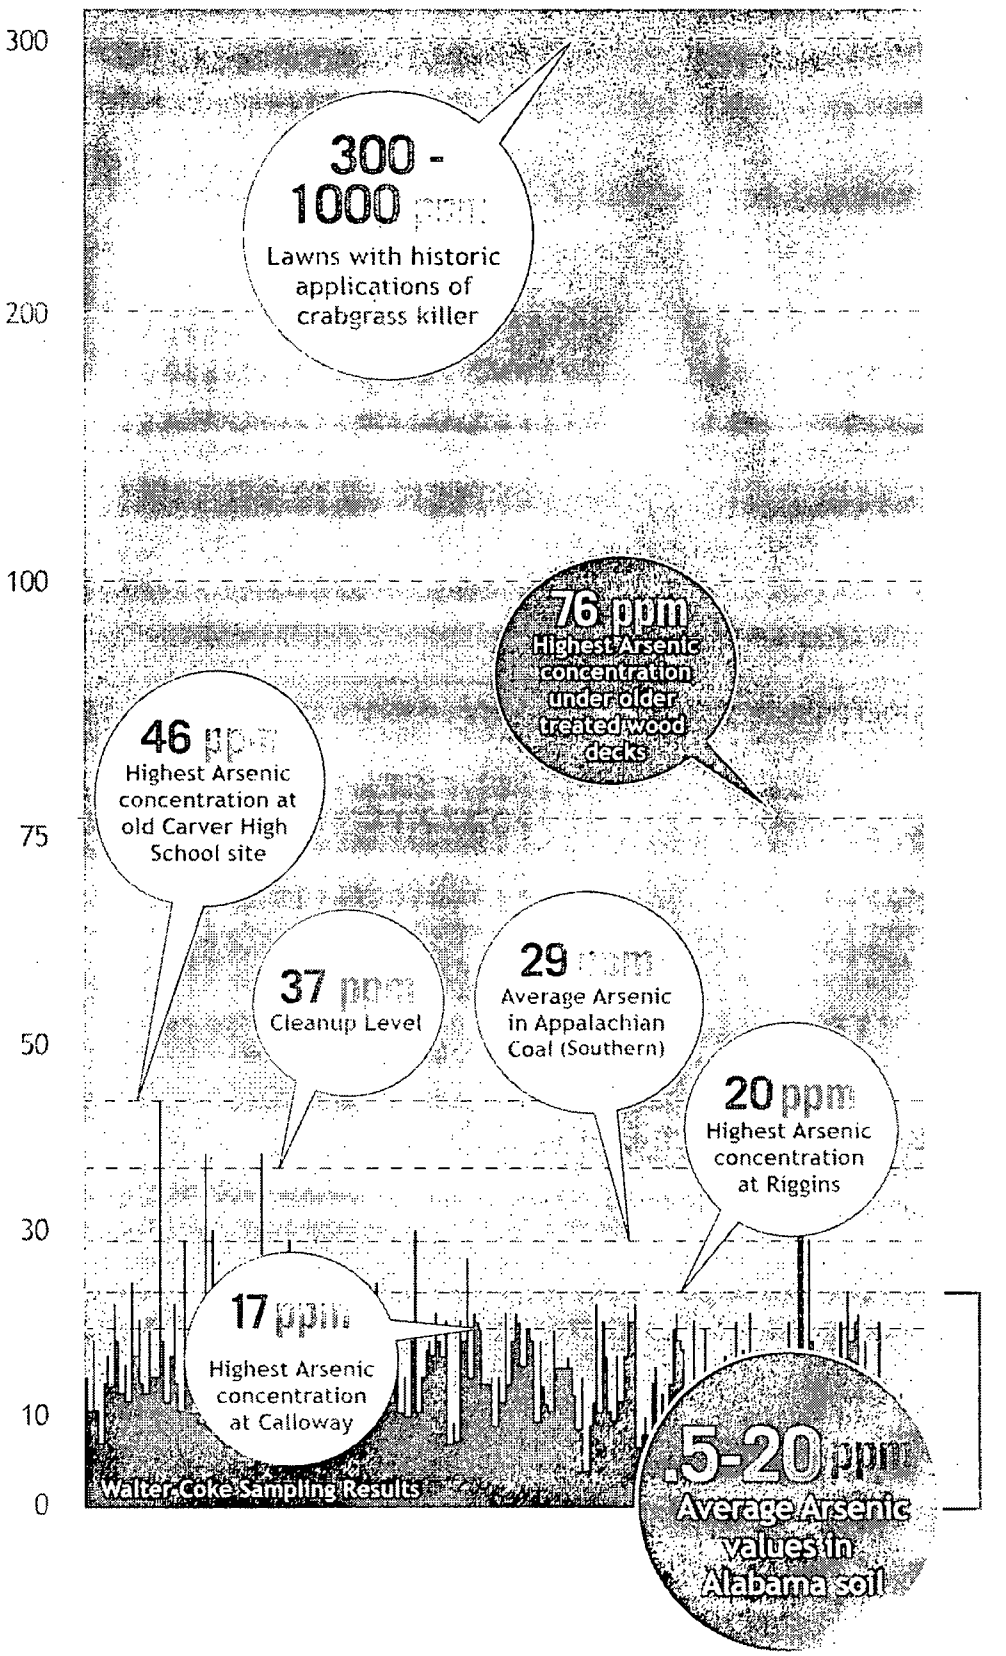

JCDH Air Monitoring Results - BaP

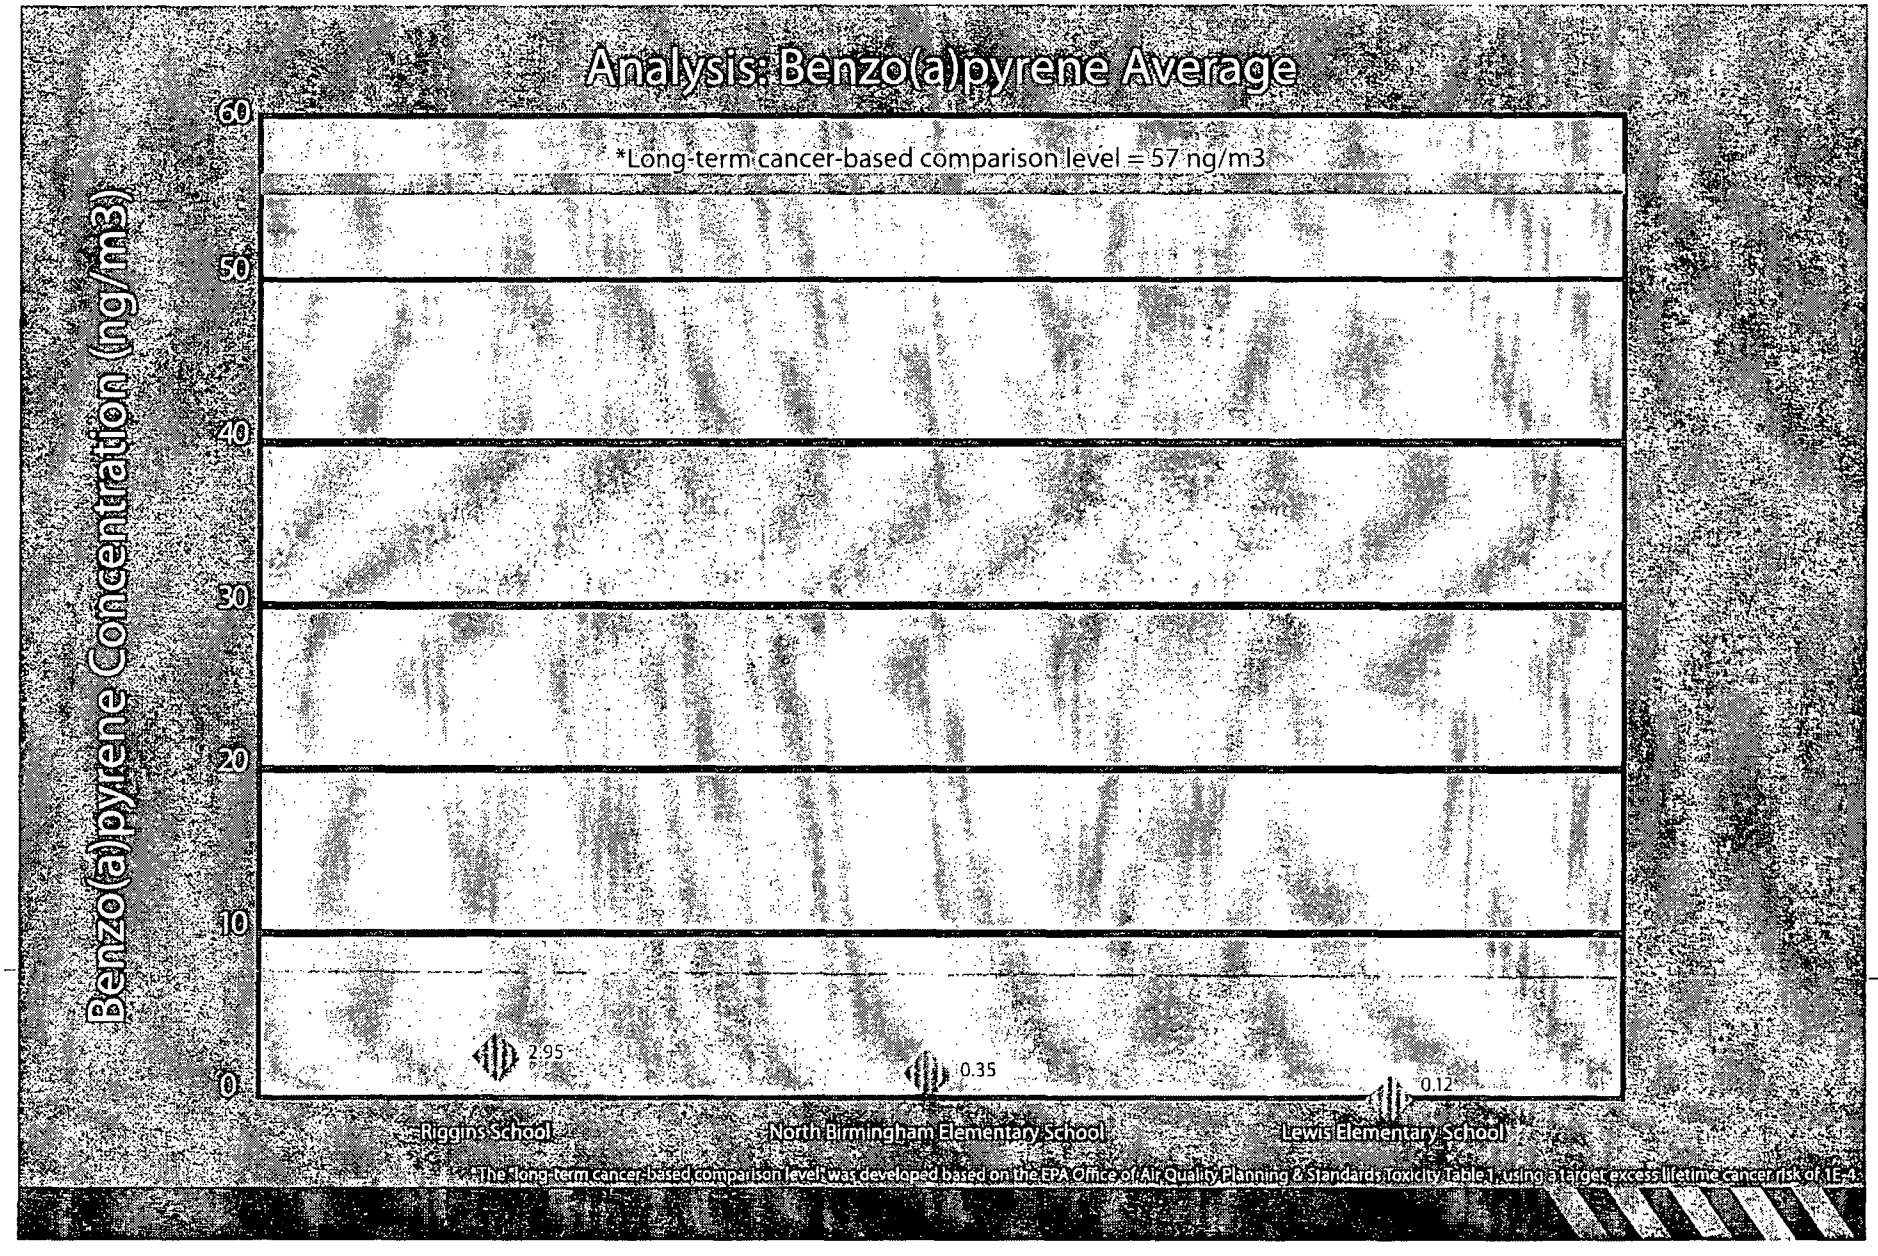

JCDH Air Monitoring Results - Arsenic

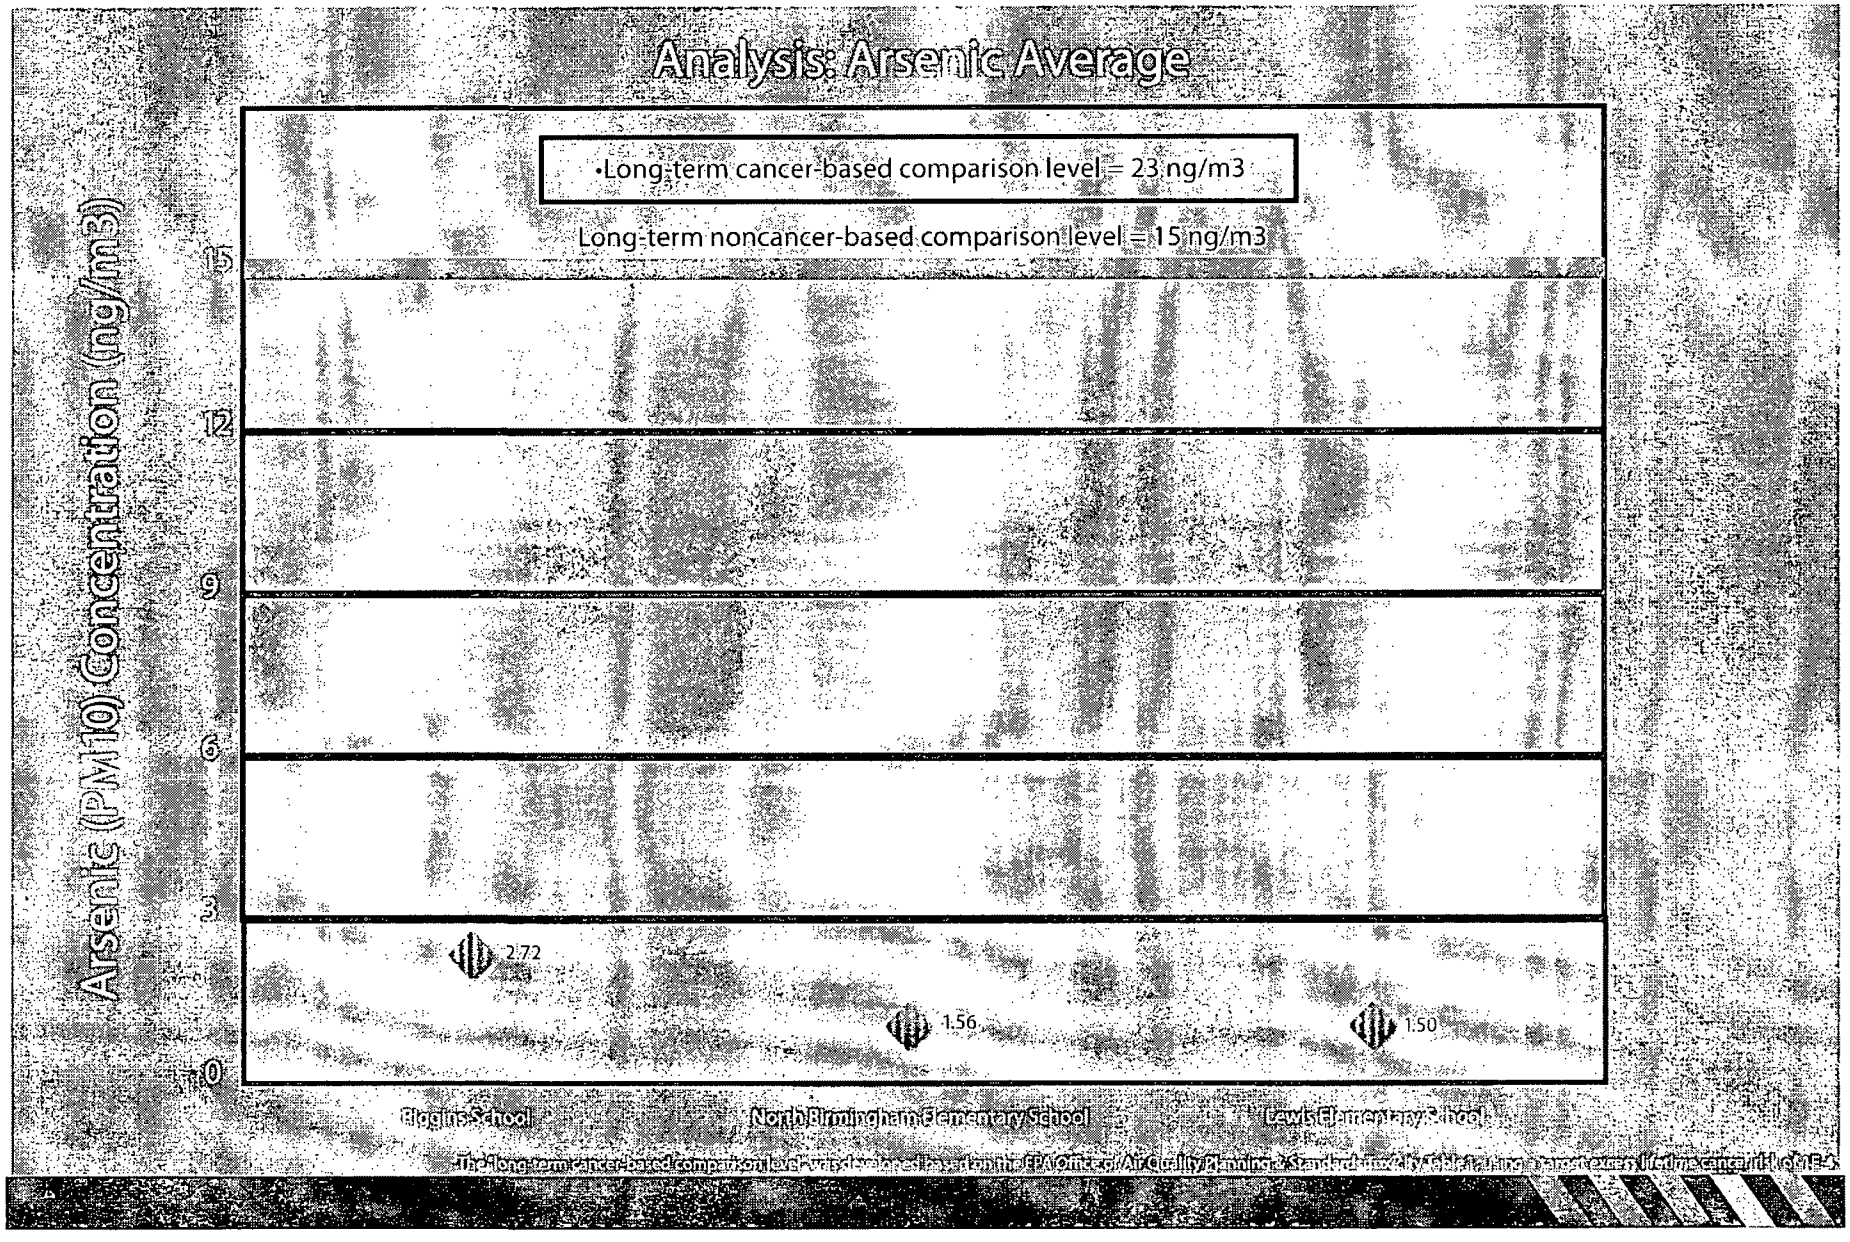

Neighborhood Operations

Dust Prevention

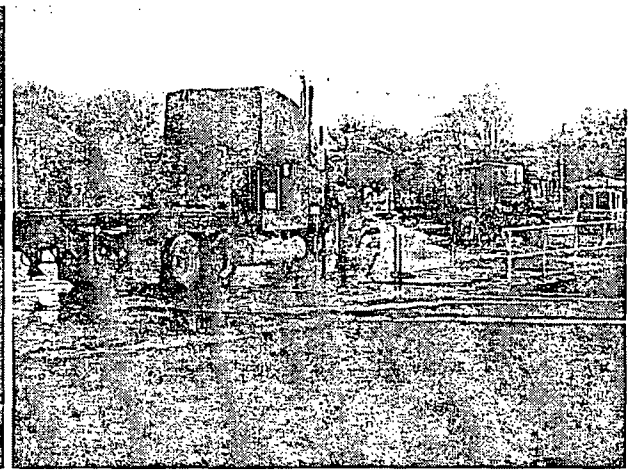

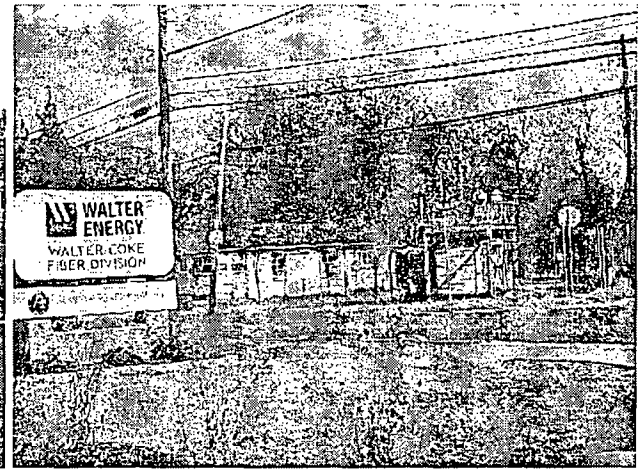

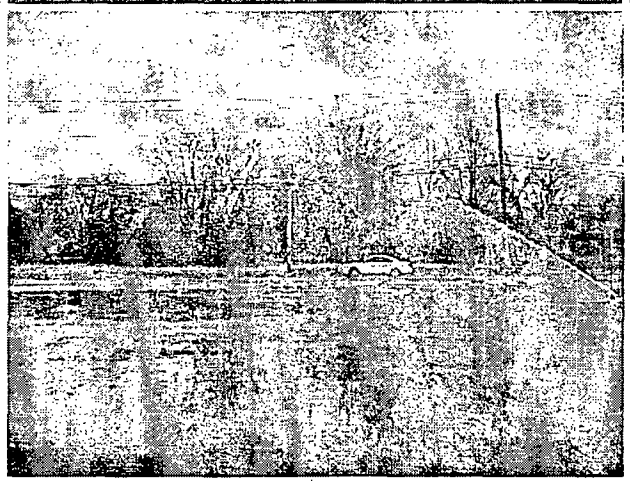

We engage in numerous activities to minimize dust, including:

- Hiring a contract street sweeper
- Spraying the truck gate road
- Washing all truck wheels
- Employing a facility water truck
- Spraying coal fields
- Using the JCDH Air Monitoring station

Above, From Left to Right:

1. Contract Street Sweeper
2. Truck Wheel Wash
3. JCDH Air Monitoring Station

At Left: Truck Gate Road Spray

- We support and provide resources for the following community initiatives:

  - $1 Million in local tornado relief
  - North Birmingham Community Assistance Program/Food Bank Inc.
  - 35th Avenue North railroad tracks improvement
  - City Council District 4 Christmas Donations
  - Harriman Park Holiday Celebration
  - North Birmingham Church of God Homeless Hygiene Program
  - Northside Church of God Fresh Start Summer Youth Camp
  - Northside Church of God Worship Under the Sky
  - Recreational picnic areas for the community
  - Facilitate Collegeville / Fairmont / Harriman Park Citizens Advisory Panel

- Information Line: (855) 892-5837

Media Contact Information

News Media Contact: Dennis Hall

Phone: (205) 481-6905

Email: Dennis.Hall@walterenergy.com

Address: 3500 35th Avenue North

Birmingham, AL 35207

ENCLOSURE 9

Residential Soil Remedial Action–Final Report

Prepared for

Walter Coke, Inc

Birmingham, Alabama

January 2012

CH2MHILL®

4121 Carmichael Rd. Suite 400
Montgomery, AL 36106

Contents

Section **Page**

Acronyms and Abbreviations ..... **iv**

1 Introduction **1-1**

2 Remedial Activities **2-1**

2.1 Pre-work Activities 2-1

2.1.1 Waste Certification and Approval to Dispose of Remediation Waste 2-1

2.1.2 Backfill Sources 2-1

2.2 Remedial Work 2-1

2.2.1 Work Preparation 2-4

2.2.2 Excavation 2-4

2.2.3 Post-excavation Sampling 2-4

2.2.4 Backfill 2-5

2.2.5 Final Property Restoration/Inspection 2-5

2.3 Waste Handling and Disposal 2-5

2.4 Summary 2-6

Appendixes

A: Technical Memorandum Summarizing Debris Sampling and Analysis

B: RAWP Progress Reports

C: Letter to Walter Coke from Jeffery Pallas – December 21, 2011

D: Waste Certification

E: Fill Material Analytical Reports

F: Property Photographs

G: Property Inspection Reports

H: Waste Material (Excavated Soil) Analytical Reports

Table

2-1 Remediation Summary for the 16 Properties Remediated between August 2011 and January 2012 2-2

Figure

1-1 Residential Properties Identified for Remediation in EPA-approved RAWP 1-3

Acronyms and Abbreviations

ADEM	Alabama Department of Environmental Management
BaP TEQ	benzo(a)pyrene toxic equivalents
CERCLA	Comprehensive Environmental Response, Compensation, and Liability Act
EPA	U.S. Environmental Protection Agency
LL-PAH	low-level polycyclic aromatic hydrocarbons
PCB	polychlorinated biphenyl
ppm	parts per million
RAWP	Residential Soil Remedial Action Work Plan
RCRA	Resource Conservation and Recovery Act
SVOC	semivolatile organic compound
TAL	target analyte list
TCL	target compound list
TCLP	toxicity characteristic leaching procedure
VOC	volatile organic compound
yd^3	cubic yards

SECTION 1

Introduction

Walter Coke conducted remedial actions in the Harriman Park and Collegeville neighborhoods in accordance with the Residential Soil Remedial Action Work Plan–Phase 1 (RAWP) (CH2M HILL, May 2011; revised June 2011). The work plan, which was prepared pursuant to agreements reached between Walter Coke and the U.S. Environmental Protection Agency (EPA) Region 4 Resource Conservation and Recovery Act (RCRA) Branch in meetings and conference calls between April 12 and May 17, 2011, was conditionally approved by EPA Region 4 RCRA Branch on June 10, 2011, with modification to the RAWP as submitted on June 23, 2011.

The objective of the work (consistent with the RAWP) is to eliminate potential residential exposure to surface soils with concentrations of arsenic and benzo(a)pyrene toxic equivalents (BaP TEQ) at the 23 properties shown in Figure 1-1. Sampling and analyses conducted in 2009 detected surface soil concentrations that exceeded EPA's established cleanup levels of 37 parts per million (ppm) for arsenic and 1.5 ppm for BaP TEQ. Remedial activities were conducted from August 1, 2011, through January 6, 2012; minor follow-up work was conducted on one of the remediated properties from January 23 through January 25, 2012. The remedial activities were completed in accordance with the approved RAWP and included the following general activities, which are discussed in more detail later in this report:

- Obtaining certification and approval to dispose of the remediation waste (excavated soil)
- Obtaining a source of clean backfill material (soil)
- Obtaining legal access to properties
- Performing pre-excavation inspections and utilities clearances
- Conducting site preparation, including clearing and installation of erosion and sediment control measures
- Performing soil excavation and disposal (at an approved landfill)
- Performing post-excavation sampling at three select properties
- Conducting property restoration and post-construction inspections

The activities were conducted according to the approved RAWP with the following exceptions:

- Of the 23 properties identified for remediation, Walter Coke, with assistance from EPA, was able to gain legal access to, and thereby remediate, 16 of the 23 properties; 7 properties (RAWP Property Nos. 3, 13, 14, 15, 17, 20, and 23) have not been remediated because the respective property owners denied access.
- Property No. 14 (front yard) was pre-selected as one of three yards for post-excavation sampling; however, because access could not be obtained to Property No. 14, Property No. 5 (back yard) was chosen as an alternate yard for conducting post-excavation sampling. As documented in the RAWP, the pre-excavation BaP TEQ concentration for the back yard at Property No. 5 (15 ppm) is equivalent to the pre-excavation BaP TEQ concentration for the front yard at Property No. 14. Therefore, selection of Property No. 5 as an alternative to Property No. 14 met the original criterion for post-excavation sampling at three properties with the highest pre-excavation concentrations.
- Clean topsoil was substituted for clean fill dirt for use at properties with gardens (Property Nos. 4, 6, and 22).

The work completed between August 2011 and January 2012 constitutes final action for the 16 respective properties, as approved by EPA RCRA Branch in the RAWP.

A letter and technical memorandum providing a summary of the types of debris found on residential properties in the Collegeville and Harriman Park neighborhoods during the implementation of the RAWP were provided to EPA on December 19, 2011 (Appendix A). During September 2011 meetings with EPA, Walter Coke shared preliminary information about the debris (roofing tar, asphalt, and other non-Walter Coke materials) being discovered in the soil at the residences that Walter Coke had remediated up to that point. Walter Coke also reiterated to EPA its view that the lack of any pattern to the spatial distribution of BaP TEQ results, the obvious potential alternative sources at locations where BaP TEQ had been found, as well as the "source signatures" for the substances identified in the

community, are all facts inconsistent with the proposition that Walter Coke is responsible for the contaminants EPA seeks to clean up. Because of litigation pending against Walter Coke by some of the residents in North Birmingham, Walter Coke has catalogued the materials found in the soil and subjected a random number of them to laboratory analyses. The significant amount of debris found in the yards and the elevated levels of BaP TEQ in the debris found have only reinforced the view that Walter Coke is not responsible for the contaminants in the soil. In that letter and technical memorandum (Appendix A), Walter Coke also presented analytical data, which previously had been provided to the EPA RCRA staff, from samples taken from the raw material coal piles at Walter Coke's facility. The coal pile data reflect levels of arsenic and BaP TEQ far below those levels found in the neighborhood soils.

Progress reports were submitted by Walter Coke to the EPA RCRA staff on a monthly basis to document the status of the ongoing remedial actions. The progress reports, which provided significant details regarding the activities conducted during each preceding month, are included in Appendix B. This final report, which has been prepared to satisfy the requirements of the RAWP, provides an overall summary of activities completed, with reference to the progress reports and other appendixes for detail.

In light of a letter dated December 21, 2011, from Jeffrey Pallas of EPA's RCRA Branch to Chuck Stewart of Walter Coke, Walter Coke understands that the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) Branch of EPA is assuming responsibility for soil issues beyond the Walter Coke facility boundaries. This letter is included in Appendix C. Accordingly, and based on subsequent conversations Walter Coke representatives have had with the CERCLA staff, Walter Coke is submitting this Final RAWP Report documenting the remediation of the 16 properties to the CERCLA Branch of EPA, with a copy provided to EPA's RCRA Branch.

FIGURE 1-1
Residential Properties Identified for Remediation in EPA-approved RAWP

Residential Soil Remedial Action Final Report
Walter Coke Inc.
Birmingham, Alabama

CH2MHILL

\\HOLLISTER\PROJ\SLOSS\MAPFILES\RESIDENTIAL_SOIL_RA.MXD ZHIRSCH 4/19/2011 14:44:57

SECTION 2

Remedial Activities

This section summarizes the activities conducted to remediate soils at 16 (of 23) properties identified in the RAWP, for which legal access was obtained from the property owner. This section also includes a brief discussion of debris identified during remedial activities and summarizes the waste sampling required by Alabama Department of Environmental Quality (ADEM) before disposal of the excavated soil.

2.1 Pre-work Activities

Before conducting excavation activities at residential properties, approval to dispose of remediation waste (excavated soil) was obtained from ADEM and sources of fill material were identified.

2.1.1 Waste Certification and Approval to Dispose of Remediation Waste

Green Mountain Management and Veolia Star Ridge Landfill were identified as potential waste disposal facilities and a waste profile sheet was submitted to ADEM for approval on July 18, 2011. A certification number assigned by ADEM on July 27, 2011, identified Green Mountain Management as approved for disposal–Waste Profile # 110408, Certification # SW-073113-0053. Veolia Star Ridge Landfill was added to the certification on January 18, 2012. The waste profile sheet and both certification letters from ADEM are located in Appendix D.

2.1.2 Backfill Sources

Two sources were identified for the imported dirt and topsoil used to backfill remediated yards and gardens, respectively. One source was identified for dirt fill at residential yards. Per the approved RAWP, a sample of the material was collected on July 13, 2011, and verified through laboratory analysis of target compound list (TCL) volatile organic compounds (VOCs), TCL semivolatile organic compounds (SVOCs), low-level polycyclic aromatic hydrocarbons (LL-PAHs), target analyte list (TAL) metals, pesticides, herbicides, and polychlorinated biphenyls (PCBs). The results are provided in Appendix E and indicate that the soil was suitable for use as backfill material.

For smaller gardens, commercially available topsoil was used as fill; however, at RAWP No. 4, because of the size of the garden, a bulk source of topsoil was identified. A sample of the topsoil was collected on October 20, 2011, and verified through laboratory analysis of TCL VOCs, TCL SVOCs, LL-PAHs, TAL metals, pesticides, herbicides, and PCBs. The results are provided in Appendix E and indicate that the topsoil was appropriate for use as backfill material.

2.2 Remedial Work

Remedial work activities were conducted for 16 properties from August 1, 2011, through January 6, 2012; minor follow-up work at 1 remediated property was completed from January 23 through January 25, 2012 (Table 2-1). Remedial activities included site preparation, excavation, backfilling, and property restoration. Photographs documenting the general activities at each remediated property are included in Appendix F. In addition to the excavation activities, 3 properties were selected for post-excavation sampling.

General activities conducted at each property are summarized in the following text. Table 2-1 provides additional details regarding completion dates for access agreements, initial property inspections, excavation and restoration, and volume of soil replaced and restoration notes for each property. As mentioned previously, specific remediation details regarding each property also are available in the progress reports (Appendix B) for the period during which work was conducted.

Table 2-1

Remediation Summary for the 16 Properties Remediated between August 2011 - January 2012

Residential Soil Remedial Action - Final Report

Walter Coke, Inc. Birmingham, Alabama

RAWP Property ID	Yard(s) Remediated	Access Agreement Signed	Initial Property Inspection Report Signed	Excavation Begins	Excavation Issues Noted	Volume of Soil Excavated (cubic yard)	Restoration Complete	Restoration Notes	Final Property Inspection Report Signed
1	Front	11/16/11	11/22/11	11/29/11	- Debris encountered[1]	20	12/1/11	- Concrete walkway damaged during excavation was replaced	12/7/11
2	Back Left	10/17/11	11/2/11	11/8/11	- Debris encountered[1] - Clay sewer pipe cracked during excavation was repaired	205	11/23/11	- Right yard used for access was re-leveled & seeded	12/7/11
4	Garden	10/17/11	7/14/11	10/21/11	- None	42	10/27/11	- Bulk topsoil used for fill - Sod was added over topsoil	11/18/11
5	Back	11/16/11	11/29/11	11/30/11	- Debris encountered[1] - Post-excavation sample collected[2], no additional excavation required per the approved RAWP	134	12/5/11	- Yard in adjacent property (left side) used for access was re-leveled and grass seed was lain	1/6/12
6	Garden	7/11/11	7/12/11	8/4/11	- Debris encountered[1]	2	8/4/11	- Topsoil used for fill	8/5/11
7	Front	10/17/11	7/18/11	10/18/11	- None	17	10/21/11	- None	12/7/11
8	Back Left	7/11/11	7/26/11	8/11/11	- Debris encountered in back yard[1] - Post-excavation sample collected[3] in left yard excavation; additional 1 foot of soil was excavated per the approved RAWP	180	8/23/11	- Asphalt driveway damaged during excavation was replaced - Underground power line to shed required re-attachment - Gas line to gas grill removed per owner request & capped	8/30/11
9	Front Left	7/13/11	8/17/11	8/23/11	- None	44	8/31/11	- Previous shrubs in front yards replaced with Hydrangeas per owner request	9/14/11
10	Front	7/11/11 (renter) 7/14/11 (owner)	8/2/11	8/18/11	- Debris encountered[1]	25	8/24/11	- Fence damaged during excavation was repaired	8/25/11
11	Front	8/1/11	8/9/11	8/25/11	- None	37	8/30/11	- None	9/13/11
12	Front	7/11/11	7/15/11	8/2/11	- Water manhole found un-level during excavation was made up-right and level	32	8/5/11	- Previous shrubs replaced with rose bushes per homeowner's request	8/5/11

Table 2-1

Remediation Summary for the 16 Properties Remediated between August 2011 - January 2012

Residential Soil Remedial Action - Final Report

Walter Coke, Inc. Birmingham, Alabama

RAWP Property ID	Yard(s) Remediated	Access Agreement Signed	Initial Property Inspection Report Signed	Excavation Begins	Excavation Issues Noted	Volume of Soil Excavated (cubic yard)	Restoration Complete	Restoration Notes	Final Property Inspection Report Signed
16	Front	11/16/11	11/29/11	12/1/11	- Debris encountered[1] - Cast iron sewer pipe cracked during excavation was repaired	32	12/2/11	- None	1/6/12
18	Front Back	10/17/11	10/28/11	11/21/11	- Debris encountered[1]	116	12/2/11	- Two shrubs nearest street removed & replaced with evergreen shrubs per owner's request - Three trees in back yard removed per owner's request - Attempted, but unable to transplant pecan tree; tree was not moved - Adjacent property & alleyway used for access re-leveled & seeded - Minor follow-up due to ponding noted by owner. Areas with ponding were repaired and regraded	1/25/12
19	Back Right	7/11/11	7/12/11	8/5/11	- Debris encountered[1]	106	8/11/11	- None	8/18/11
21	Front Back	10/17/11	7/12/11	10/24/11	- Debris encountered[1]	150	11/8/11	- None	12/7/11
22	Back Dripline Garden	Approval provided by property owner's private attorney via electronic communication on 8/30/11	8/17/11	9/1/11	- Debris encountered[1] - Post-excavation sample collected[4] from back yard excavation; additional 1 foot of soil was excavated per the approved RAWP	230	10/6/11	- Shed damaged during excavation was repaired - Sod was added over topsoil in garden	Inpsection completed with owner's attorney present on 12/6/11

Notes:

[1] For details of debris encountered, refer to Appendix A - the *Technical Memorandum: Summary of Debris Collected and Analyzed during Implementation of the RAWP Activities* (CH2M HILL, December 2011)

[2] Refer to Appendix B, *Progress Report #6* dated December 16, 2011, for post-excavation sampling results at Property No. 5

[3] Refer to Appendix B, *Progress Report #2* dated August 19, 2011, for post-excavation sampling results at Property No. 8

[4] Refer to Appendix B, *Progress Report #4* dated October 14, 2011, for post-excavation sampling results at Property No. 22

2.2.1 Work Preparation

The following activities were conducted at each property before excavation:

- Signed property access agreements were obtained from property owners and/or residents, as applicable.
- An initial property inspection was conducted and then reviewed with the homeowner and/or resident. The homeowner and/or resident then signed the initial property inspection report agreeing to the initial condition of the property (Appendix G). During this time, the homeowner was given the opportunity to provide specifications for property restoration, if desired.
- Before excavation started, the excavation boundaries for each yard, at each property, were delineated using high-visibility spray paint.
- A utilities clearance was performed before site clearing or removal activities.

2.2.2 Excavation

Once areas were marked and cleared for excavation, excavation work primarily was conducted using a mini-excavator and skid steer. However, hand excavation with shovels was used when areas requiring excavation were relatively small (for example, the garden at Property No. 6) and in the vicinity of buried utilities, along fence lines, tree roots, plants, and other items or structures requiring caution.

Safe work practices were implemented at each property including the following:

- Using a spotter to notify the equipment operator of his proximity to overhead utilities in an effort to avoid striking and damaging them.
- Parking the dump truck on plastic sheeting to capture any potential spillage during loading.
- Covering soils with a tarp once loaded for transportation to the Walter Coke facility for offsite holding in a designated area.
- Covering excavations on a daily basis if the area was not backfilled immediately.
- Placing high-visibility fencing around each excavation area to provide a visual warning to the public, personnel, and/or trespassers.
- Using a water spray to control dust during both excavation and transportation.

As reported previously to EPA with each progress report and discussed briefly in Section 1, during the excavation of soils from 11 of the 16 properties, significant debris was encountered. A detailed summary of the specific debris encountered at each property (Nos. 1, 2, 5, 6, 8, 10, 16, 18, 19, 21, and 22) and the results of sampling conducted to evaluate whether the debris is a source of BaP TEQ are provided in the *Technical Memorandum: Summary of Debris Collected and Analyzed during Implementation of the RAWP Activities* (CH2M HILL, December 2011), which is included in its entirety in Appendix A.

As documented in Appendix A, the debris included material and fragments of material that, from visual observation, appeared to be brick (including red brick and white brick similar to those used in a foundry), concrete, roofing material (including tar paper and shingles), various types of slag, coke, coal, asphalt, clay pipe, glass, metal (including nails, tools, appliance parts, and car parts), rusted iron, plastic, rubber (including tires), vinyl, coated wire, and ceramic. Given that analytical sampling of the debris indicated high concentrations of BaP TEQ and that debris was found in direct contact with surface soil in the residential yards, the debris is a more likely source of the BaP TEQ found in the residential soils than airborne particulate deposition from Walter Coke's raw material piles.

2.2.3 Post-excavation Sampling

Post-excavation sampling was performed at three properties as requested by EPA and designated in the RAWP to document the condition of soils that remained in place beneath the clean backfill. As indicated previously, access

to Property No. 14 was denied by the property owner; therefore, Property No. 5 (back yard) was selected to replace Property No. 14. Sampling results from each of the three properties (Nos. 5, 8, and 22) are included in the progress reports (Appendix B) prepared for EPA, as follows:

- No. 8–Progress Report #2 dated August 19, 2011
- No. 22–Progress Report #4 dated October 14, 2011
- No. 5–Progress Report #6 dated December 16, 2011

As documented in the respective progress reports, based on the results of post-excavation sampling and in accordance with the approved RAWP, an additional 1 foot of soil was excavated from the left side yard of Property No. 8 and also from the back yard of Property No. 22 before each was backfilled. No additional excavation was required at Property No. 5.

2.2.4 Backfill

Backfill was conducted using a mini-excavator and skid steer, except where hand backfill with shovels was deemed more appropriate. Fill dirt and topsoil were tamped using a self-propelled tamping device to encourage compaction.

2.2.5 Final Property Restoration/Inspection

On the basis of discussions with property owners and/or residents and information regarding the pre-excavation condition of the yards as indicated on the property inspection forms, yards and/or gardens were restored per owner/resident specifications. In addition, any items damaged during remedial activities were restored to the satisfaction of the property owner. Damaged items included pipes, walkways, driveways, sheds, and fences.

To document that the property owner and/or residents were pleased with the final restored condition of the property, a final property inspection was performed at all 16 properties. Although attempts were made to conduct the final property inspections within 1 week of completion, several properties were not completed within this timeframe as a result of owner/resident availability (Table 2-1).

During the inspection, the property owner and/or resident was given the opportunity to raise concerns regarding the final restored condition of the property. Any concerns raised by the property owner and/or resident were resolved. The final property inspection report was signed by the property owner and/or resident indicating acceptance of the final restored condition of the property (Appendix G: note that for privacy, actual signatures, phone numbers, and addresses have been redacted [that is, blanked out] from the appendix forms).

2.3 Waste Handling and Disposal

As required by the ADEM Waste Certification # SW-073113-0053, soil was stockpiled at the Walter Coke facility and additional soil testing conducted on every 500 cubic yards (yd^3), maximum, before disposal. Soils stockpiled at the Walter Coke facility were covered with plastic and weighted down while onsite, pending analytical sampling and approval to dispose. The stockpiled soil was analyzed using toxicity characteristic leaching procedure (TCLP) for VOCs, SVOCs, and metals. On the basis of the TCLP results, excavated soil was determined to be nonhazardous and approved for offsite disposal at the authorized solid waste landfills, per the ADEM waste certification. The five stockpile samples collected, along with the final offsite disposal facility, were as follows:

Sample ID	Sample Date	Volume of excavated soil	Disposal Facility
0811_TCLP1_RAWP	19-Aug-11	320 yd^3	Green Mountain Management
1211_TCLP2_RAWP	22-Dec-11	336 yd^3	Veolia Star Ridge Landfill
1211_TCLP3_RAWP	22-Dec-11	209 yd^3	Veolia Star Ridge Landfill
1211_TCLP4_RAWP	22-Dec-11	321 yd^3	Veolia Star Ridge Landfill
1211_TCLP5_RAWP	22-Dec-11	186 yd^3	Veolia Star Ridge Landfill

Analytical results for waste disposal are included in Appendix H.

2.4 Summary

As described in this report, Walter Coke completed remediation of 16 of the 23 properties identified in the approved RAWP. The work completed between August 2011 and January 2012 met the objective of eliminating potential residential exposure to surface soils with concentrations of arsenic and BaP TEQ that exceeded EPA's final cleanup levels; as such, the work completed constitutes final action for the 16 respective properties. Walter Coke previously communicated to EPA in Progress Reports #6 and #7 that remediation of the remaining 7 properties, if legal access eventually is granted for those properties, can be completed during future work that might be conducted by Walter Coke. However, in light of the letter dated December 21, 2011, from Jeffrey Pallas of EPA's RCRA Branch to Chuck Stewart of Walter Coke, Walter Coke understands that the CERCLA Branch of EPA is assuming responsibility for soil issues beyond the Walter Coke facility boundaries and remediation activities for the remaining 7 properties are yet to be determined.

Appendix A
Technical Memorandum Summarizing Debris Sampling and Analysis

TECHNICAL MEMORANDUM

CH2MHILL®

Summary of Debris Collected and Analyzed during Implementation of the RAWP Activities

PREPARED FOR: Walter Coke, Inc.

COPY TO: Kelly Moody/CH2M HILL
Lauri Gorton/CH2M HILL
Barrie Selcoe/CH2M HILL

PREPARED BY: Stephanie Park/CH2M HILL
Angela Barch/CH2M HILL

DATE: December 15, 2011

Introduction

This technical memorandum summarizes the types of debris found on residential properties in the Collegeville and Harriman Park neighborhoods during implementation of the Remedial Action Work Plan (RAWP). The memorandum also summarizes the results of analyses for low-level polycyclic aromatic hydrocarbon (LL-PAH) conducted on a portion of the debris samples.

During excavation activities, CH2M HILL observed and documented debris that was removed along with the upper one- to two- feet of soils on the following 11 properties:

- RAWP No. 1 – front yard – November 29, 2011
- RAWP No. 2 – left and back yards – November 8 through 18, 2011
- RAWP No. 5 – back yard – November 30 through December 1, 2011
- RAWP No. 6 – garden – August 4, 2011
- RAWP No. 8 – back yard – August 11 through 17, 2011
- RAWP No. 10 – front yard – August 18 through 22, 2011
- RAWP No. 16 – front yard – December 1 through December 2, 2011
- RAWP No. 18 – front and back yards – November 21 through 23, 2011
- RAWP No. 19 – back yard – August 5 through 10, 2011
- RAWP No. 21 – back and front yards – October 24 through November 7, 2011
- RAWP No. 22 – back yard and drip line – September 1 through October 3, 2011

Personnel from Walter Coke and CH2M HILL visually examined debris as it was encountered and used field judgments to identify the debris based on these observations and previous experience.

The debris consisted primarily of bricks (red brick and white brick similar to that used in a foundry), concrete, and roofing materials such as tar paper and shingles. To evaluate the potential for the debris to cause or contribute to contaminant concentrations to the residential soils, a select number of the debris material were sampled and analyzed to evaluate LL-PAH composition. The samples were analyzed for LL-PAH analysis, and the result of each sample was used to calculate the benzo(a)pyrene toxic equivalent (BaP TEQ) for comparison with the U.S. Environmental Protection Agency (EPA)-established cleanup level for BaP TEQ, as well as the BaP TEQ concentration of Walter Coke's raw material coal piles.

The remainder of this technical memorandum presents a summary of the debris by property, followed by a summary of the analytical results for those samples submitted for analysis of LL-PAHs.

Debris Summary

The percentage and type of debris observed and removed is summarized by property below. The debris type and percentage were estimated based on visual observation. For the purpose of this memorandum:

- "Slag" was identified as a vitreous glass or metal containing visible vesicles. These materials generally appear to have formed under high heat. The various types of slag were differentiated by physical characteristics such as color, relative density or texture.
- "Coke" was identified as material with a grainy texture, generally light purple in color, with mottling of black, purple and brown.
- "Iron" was identified based on relative weight (i.e. denser than the surrounding material) and a high amount of reddish-brown oxidation.

Note that the debris is categorized further in tabular form if the percentage of debris in the soil was greater than 10% of the volume of material removed, which also coincided with a larger variety of debris.

RAWP No. 1

Debris identified in the front yard at Property No. 1 was located in the upper foot of soil and comprised approximately 4 % of the 20 cubic yards of soil excavated from the front yard. The debris was identified as concrete, plastic, slag, and a metal hand shovel. Photograph 1 shows the debris identified.

RAWP No. 2

Debris identified in the left and back yards at Property No. 2 was located in the upper foot of soil and comprised approximately 30% of the 205 cubic yards of soil excavated from the property. Table 1 summarizes the type of debris and percentages of each type identified in the soils. Photograph 2 shows examples of the debris identified.

RAWP No. 5

Debris identified in the back yard at Property No. 5 was located in the upper foot of soil and comprised approximately 1% of the 134 cubic yards of soil excavated from the back yard. The debris was identified as concrete, brick, coal, slag and glass. Photograph 3 shows the debris identified during excavation.

RAWP No. 6

Debris identified in the garden at Property No. 6 was located from 0 to 2 feet below ground surface (bgs) and comprised approximately 10% of the 2 cubic yards of soil excavated from the garden. The debris was identified as black slag, green slag, grey/black coke and reddish brown iron (Photograph 4).

RAWP No. 8

Debris identified in the backyard at Property No. 8 was located in the upper foot of soil and comprised less than 1% of the 180 cubic yards of soil excavated from the back yard. The debris was identified as roofing shingles, construction paper, and concrete block (Photograph 5).

RAWP No. 10

Debris identified in the front yard at Property No. 10 was located in the upper foot of soil and comprised less than 1% of the 25 cubic yards of soil excavated from the front yard. The debris was identified as red brick, an axe head, and a wrench. Photograph 6 shows an example of the red brick identified.

RAWP No. 16

Debris identified in the front yard at Property No. 16 was located in the upper foot of soil and comprised less than 10% of the 32 cubic yards of soil excavated from the front yard. The debris was identified as rock, brick, coal, and slag. Photograph 7 shows examples of the debris identified.

RAWP No. 18

Debris identified in the front and back yards at Property No. 18 was located in the upper foot of soil and comprised approximately 15% of the 116 cubic yards of soil excavated from the property. Several different types

of debris were found here, and are summarized in Table 1, along with the percentages of each type identified in the soils. Photograph 8 shows examples of the debris identified.

RAWP No. 19

Debris identified in the back yard at Property No. 19 was located in the upper foot of soil and comprised approximately 13% of the 106 cubic yards of soil excavated from the back yard. Table 2 summarizes the type of debris and percentages of each type identified in the soils. Photograph 9 shows examples of the debris identified.

RAWP No. 21

Debris identified in the back and front yards at Property No. 21 was located in the upper foot of soil and comprised approximately 30% of the 150 cubic yards of soil excavated from the property. Table 3 summarizes the type of debris and percentages of each type identified in the soils. Photograph No. 10 shows examples of the debris identified.

RAWP No. 22

Debris identified in the back yard and along the drip line at Property No. 22 was located from 0 to 2 feet bgs in the back yard and in the upper foot of soil along the drip line. The debris comprised approximately 35% of the 230 cubic yards of soil excavated from the property. Table 4 summarizes the type of debris and percentages of each type identified in the soils. Photograph No. 11 shows examples of the debris identified.

Analytical Sampling

To evaluate the potential for debris to contribute concentrations of BaP TEQ to the residential soils, a select number of debris samples were analyzed for LL-PAH analysis via method SW8270D-LL by TestAmerica Laboratories, Inc. in Mobile, Alabama. Specifically, debris samples from RAWP properties 19, 21, and 22 were selected for analysis, as summarized in Tables 2, 3, and 4, respectively

The samples were collected in accordance with EPA *Field Branches Quality System and Technical Procedures* (2009). The debris samples were divided into two separate categories 1) material samples and 2) wipe samples, as described further below. In addition to the debris samples, 3 quality control samples were also collected: 1 wipe blank, 1 plastic bag blank (bags were used to store samples before analysis), and 1 equipment blank on the steel mallet used during the sample preparation process described below.

Material Samples

Material samples were collected from porous materials or those materials with an unknown composition. These items were evaluated to estimate whether their general makeup could have contributed to BaP TEQs in soils. These items include: asphalt, vinyl, slag, roofing materials, tire fragments, coal, material similar to Styrofoam™, insulation, or any unidentified material.

Material samples were collected by placing a minimum volume of each debris sample, 50 grams by weight, into a glass container provided by TestAmerica. If the sample was too large to place into the container and could not be broken up easily by hand, the sample was placed on a clean table covered in aluminum foil and hammered with a steel mallet that was also either covered in aluminum foil or decontaminated between each use. The samples were stored in an iced cooler until they could be shipped to the laboratory.

Wipe Samples

Per EPA protocol SESDPROC-304-R2, wipe samples were collected from materials that are generally non-porous and that could have been potentially contaminated prior to burial and therefore contributed to BaP TEQ concentrations in soils. Items, such as bricks, concrete, clay pipe, ceramic, and metal, whose composition is generally known but may have been in contact with unknown substances (e.g., concrete lined holding area or an industrial conduit), were sampled to evaluate potential contamination on their surfaces.

Wipes used for wipe sampling were provided by TestAmerica and saturated with a solvent appropriate for the given analysis. Disposable templates allowing a 100 square centimeter (cm^2) area to be collected from each wipe sample were prepared using card board and aluminum foil. The template was held over the largest area of the debris sample (note that not all samples comprised a 100 cm^2 area) and beginning in one corner of the template,

the area was wiped in one direction across the area defined by the template. This was repeated until three wipes were used over the area defined by the template. The samples (i.e. wipes) were then stored in an iced cooler until they could be shipped to the laboratory.

Analytical Results

Table 5 summarizes the BaP TEQ concentrations in the samples collected. Material sample results indicate that roofing materials had the highest concentrations of BaP TEQ, with roofing material samples from the three properties ranging from 5,500 milligrams per kilogram (mg/kg) to 10,400 mg/kg compared to the EPA clean-up level for BaP TEQ of 1.5 mg/kg and a Walter Coke raw coal sample concentration of 0.07 mg/kg (Table 6). At these high concentrations, the debris materials represent a potential contributor to the BaP TEQ found in soils in the yards. It is important to note that these are common materials used in residential construction, and as materials age, they degrade and these particles have the ability to be deposited on surface soils. Thus, roofing materials found in these yards may have been either debris that was buried in the yards or from common wear of residential roofing.

The second most common debris type with higher BaP concentrations is slag. From the 6 types of slag sampled, concentrations ranged from 4.8 mg/kg to 8,500 mg/kg. Other debris that were identified as having concentrations of BaP TEQ greater than the EPA residential soils cleanup level of 1.5 mg/kg, are an unidentified fine-grained brittle material, tire fragments, asphalt, and coal.

Wipe samples for certain debris were taken for informational purposes. It is important to recognize that the results from wipe samples are expressed as mg/wipe and mg/liter, and since there are no standard EPA screening levels for wipe samples, it is implied that direct comparison of the wipe sample results to a soil concentration or soil cleanup level cannot be made. Nonetheless, the wipe sample data indicates the presence of PAHs (calculated as BaP TEQ) on each piece of wiped debris, potentially contributing to BaP TEQ concentrations detected in soils.

Conclusion

Given the high concentrations observed in the debris samples, the facts that the debris was found in direct contact with the upper one to two feet of soil in the residential yards and that roofing material commonly is washed from roofs to soils at all properties, CH2M HILL believes that such debris are a more likely source of the BaP TEQ found in the soils than airborne particulate deposition from Walter Coke's raw material coal piles. For comparison and to further support this belief, reference is again made to the calculated BaP TEQ concentration of 0.07 mg/kg from Walter Coke's raw material coal pile sample (Table 6).

ENCLOSURE 10

Walter Energy, Inc.
3000 Riverchase Galleria
Suite 1700
Birmingham, Alabama 35244

www.walterenergy.com

Chuck Stewart
Walter Coke, Inc. - *President & COO*
Walter Minerals, Inc. - *President & COO*
Office: 205 745 2763
efax: 205 776 7966
chuck.stewart@walterenergy.com

September 6, 2011

VIA EMAIL AND U.S. MAIL

Jeffrey T. Pallas
U.S. Environmental Protection Agency
Region 4
61 Forsyth Street
Atlanta, GA 30303

Re: Walter Coke, Inc. Proposal

Dear Jeff:

This letter is to communicate Walter Coke's proposal to move forward on work in the North Birmingham neighborhoods of Collegeville, Fairmont, and Harriman Park. The proposal set out in this letter represents a good faith offer by Walter Coke to perform significant work in these neighborhoods despite our doubts as to Walter Coke's legal responsibility to do so, and despite the mounting evidence that the two contaminants that have been discovered above EPA's cleanup levels are not from Walter Coke's operations. This proposal is a further reflection of the company's ongoing effort to provide a constructive approach to the issues that have arisen.

Below is an Executive Summary of Walter Coke's proposal:

- Walter Coke will agree to conduct sampling beyond that proposed in its work plan, and similar in number to that proposed by EPA.
- Walter Coke will agree to conduct sampling and then will discuss with EPA a separate agreement or work plan covering what cleanup is required.
- EPA will agree to formally, and promptly, contact other parties whose contributions or potential contributions added to the contamination in these three communities.
- Walter Coke is willing to perform sampling in an area that incorporates some, but not all, of EPA's newly-proposed modifications to the previously-agreed boundary.
- EPA or ATSDR will agree to promptly undertake or coordinate an evaluation of health concerns of the community.
- Walter Coke is willing to discuss with EPA whether the correct mechanism for moving forward with this sampling is to continue in the existing framework under which work has been conducted to date or a separate legal agreement/order specifying the proposed sampling program.

10900644

Walter Coke is committing to do more than its part by continuing with a robust sampling program, provided that EPA commits to involving other apparent sources and to arranging for a science-based health study to help address the fears that have been aroused within our community.

As you know, Walter Coke submitted to EPA a proposed RCRA work plan on June 30, 2011 that was consistent with and reflected the sampling approach we had previously discussed with you and your staff. The Company also provided a proposed new RCRA legal agreement that would govern that work and that would provide for substantial investigation and cleanup in the three neighborhoods. On Wednesday, August 24, 2011, EPA shared a draft of its response to this work plan, rejecting the company's proposed sampling methodology and included material changes to that methodology.

During our August 26, 2011 meeting, you requested that I advise you as soon as possible of Walter Coke's position regarding EPA's draft response and proposed new sampling methodology, along with Walter Coke's current position on how it is willing to move forward on a consent basis.

Outlined in this letter are Walter Coke's perspectives and its proposal to move forward. Given the nature of our discussions and recent events, Walter Coke requests that this letter and its attachments be formally placed in EPA's administrative record for this matter. We want to ensure there is no confusion either at EPA or in the public about the basis of Walter Coke's views or what the company is proposing.

Walter Coke's Perspective

Walter Coke is Being Asked to Address Contaminants that are not Reasonably Tied to its Operations: Walter Coke has already far exceeded any obligation it arguably may have with respect to residential area sampling and remediation. To this date, the company has been presented with no compelling evidence whatsoever that it is the source of any of the levels of arsenic and BaP TEQ that have become of concern in the neighborhoods, much less that its operations have resulted in a significant contribution to any of those levels. Likewise, there is nothing in the record to support that any alleged human exposures associated with any demonstrated release from Walter Coke is not "under control," which was the basis of EPA's 2005 request that led to off-site sampling in the first place. Nonetheless, Walter Coke has been willing to take the steps it has so far in an effort to be constructive, and to be a good corporate citizen in the community that it too shares.

Considerable and increasing evidence exists that Walter Coke is not an obvious source, and substantial other apparent sources exist that are more likely to be the cause of impacts but have not been considered much less investigated by EPA. Further, recent events have made abundantly clear that Walter Coke's efforts and the portrayal of those efforts by EPA, the media, and others, have had the effect of focusing substantial adverse attention on Walter Coke to the exclusion of focusing on the reality that there are ubiquitous likely sources in this historically heavily-industrialized area. Unfortunately, EPA has contributed to significantly misleading

beliefs both as to the scale of any potential health concerns and the source of any potential health concerns.

In short, the process to date has resulted in the Agency and the public ignoring what Walter Coke believes are the real issues, and has fed a growing misconception that focusing on Walter Coke operations alone will provide a meaningful accounting for environmental conditions in the area or will address the fears that have been stoked among our neighbors.

The Real Issue is the Overall History of North Birmingham: Whether the existing issues in the neighborhoods of North Birmingham are viewed as a health concern, an environmental justice issue, or from any other environmental perspective, it is clear that making a single facility in the area the focal point is profoundly misleading to the public and unfair to Walter Coke. There is a 125-year history of heavy industrialization in North Birmingham involving scores of facilities that commonly emit BaP and arsenic. There also are other ubiquitous activities and incidents associated with normal life that result in the presence of these substances.

Attached to this letter is an overview of significant alternative potential sources in the area, including no fewer than 76 industrial facilities having emissions profiles consistent with BaP and arsenic, roughly half of which are still operating. Numerous other likely sources exist, such as a recent major tire fire adjacent to one of the areas having the most elevated BaP TEQ concentration, as well as residential activities involving coal combustion, filling in of yards, etc. In fact, as you know, cleanups at schools and residences performed by Walter Coke to date have identified likely sources of the contaminants as a fill (shingles, slag, refractory brick, asphalt), or other property-specific activities (e.g. roofing tar visibly dripping down into soil) that are obviously unrelated to Walter Coke. In light of this information, it would be an abuse of EPA's discretion to fail to consider these alternative sources in its decision-making going forward.

Walter Coke remains ready to participate in efforts to address the three communities in the North Birmingham area, but it is long past time for all parties to acknowledge that it should not be the sole focal point of potential sources. The Company's offer outlined below is based on that reality.

Walter Coke's Position and Offer

Walter Coke's specific positions and the elements of its offer are outlined below.

1. EPA's stated methodology in its recent draft response of "target receptor bias" sampling is not included or reflected in EPA's established sampling protocol or guidance—Guidance on Choosing a Sampling Design for Environmental Data Collection (December 2002). The reference provided by EPA through Karen Knight is a text book, and that text book is referenced in EPA's 2002 Guidance. However, the guidance's reference is only to one of the book's chapters, on composite sampling, and thus does not appear to be applicable to the matter at hand and more importantly does not appear to support EPA's suggested methodology. Further, EPA's stated methodology is inconsistent with EPA's objectives stated in the draft response, and is inconsistent with RCRA's intended purpose of identifying

releases from Walter Coke's facility that might pose unacceptable risk to human health or the environment. As insistent as EPA has been in the past that EPA established sampling guidance must be followed, not only during this project but for all other projects with which Walter Coke and its consultants are familiar, Walter Coke is surprised that EPA suggests such a methodology.

Despite these facts, in an effort to avoid lengthy delays in the work in the communities, Walter Coke will agree to conduct sampling beyond that proposed in its work plan, and similar in number to that outlined by EPA. This agreement comes with conditions, as explained in this letter, none of which is unreasonable or beyond EPA's ability to provide.

2. Just as the current RCRA 3008(h) Order provides, Walter Coke will agree to conduct sampling and then will discuss with EPA a separate agreement or work plan covering what cleanup is required. Little or no delay will result in giving EPA, Walter Coke, the community, and others the ability to review the results before moving forward with an appropriate cleanup.

3. It is essential that EPA formally, and promptly, contact other parties whose contributions or potential contributions to the contamination in these three communities have already been recognized by EPA, at least informally. This EPA contact can take many forms, as you know, but it must result in most or all of the appropriate parties being at the table with the communities and EPA when decisions are being made regarding how to move forward in light of the sampling results.

4. Walter Coke is willing to perform sampling in an area that incorporates some, but not all, of EPA's newly-proposed modifications to the previously-agreed boundary.

5. It is essential that EPA or ATSDR promptly undertake an evaluation of health concerns of the community, so that the community and Walter Coke can know if these communities are experiencing health effects to a greater extent than expected and, if so, what the causes or sources are. Too much has been said or speculated regarding this issue without any actual facts much less science. Given the intensity of concern that has been created, the community deserves to have this issue evaluated, and EPA/ATSDR are the proper bodies to do so.

6. Walter Coke is willing to discuss with EPA whether the correct mechanism for moving forward with this sampling is to continue in the existing framework under which work has been conducted to date or a separate legal agreement/order specifying the proposed sampling program.

A more detailed discussion of these six positions is set out on the following pages.

EPA's "Target Receptor Bias" Proposal is Not Supported by and is Contrary to EPA's Guidance on Choosing a Sample Design for Environmental Data

EPA's proposed "Target Receptor Bias" sampling methodology is nowhere to be found in EPA established sampling guidance. Indeed, we have communicated with many well-known environmental engineers and consultants, none of whom have even heard of it. Some of these environmental engineers and consultants are actually employed by EPA to assist it in many EPA regions around the country to design sampling programs at RCRA and other sites. As you likely are well aware, EPA's latest established sampling design, dated December 2002, includes six types of sampling designs:

- Judgmental
- Simple Random
- Stratified
- Systematic and Grid
- Ranked Set; and
- Adaptive Cluster

EPA's established sampling protocols do not establish nor allow for the "target receptor bias" protocol being suggested by EPA. The reference EPA has provided to Walter Coke as support for such being an established EPA sampling protocol is a textbook. It is true that this textbook is referenced in EPA's December 2002 sample design guidance, but the guidance's reference or incorporation is limited to only one chapter of that textbook—Chapter 25 on composite sampling. The fact that EPA elected not to incorporate any other feature of this textbook into its official guidance means that EPA has elected not to include any other sampling protocol (whether "target receptor bias" or not) from this text.

The closest EPA approved sampling protocol to the one now being proposed by EPA is the "judgmental" one. Indeed, Ms. Knight in her oral explanation of the EPA proposal at the August 26, 2011 meeting used the word "judgmental" several times. Even if EPA's methodology proposal could be called "judgmental", EPA's sampling protocols suggest that judgmental sampling is not a preferred approach and is not appropriate for use in the residential neighborhoods in question. As explained in EPA's 2002 guidance, judgmental sampling is only appropriate:

- when "the objective of the investigation is to screen an area(s) for the presence or absence of contamination at levels of concern, such as risk-based screening levels" but not for established cleanup levels, and "if such contamination is found, follow-up sampling is likely to involve one or more statistical designs" allowed by the guidance; which is exactly what Walter Coke had proposed in its work plan;
- for a small area, which this is not;
- where known activities/contamination have occurred, which is not known in this situation due to the multiple sources including what has been found in the excavation of several residents' yards;

- with an extremely small number of samples, which EPA's proposal clearly is not;
- in small-scale soil investigations, which EPA's proposal is not;
- when the suspected location of the release is known, which is not the case here due to the agreed presence of multiple sources, and;
- when used by a sampling plan designer who has specific academic and professional expertise and knowledge that can be used to validate the sample design, which we respectfully suggest is also missing.

Perhaps as important is the fact that nowhere in EPA's judgmental sampling guidance protocols does it speak to judgmentally biasing samples on the basis of potential or known receptors.

In contrast to the sampling protocol proposed by EPA, Walter Coke's proposed sampling design that EPA has now rejected, and all of Walter Coke's previous sampling designs, is fully compliant with EPA-established sampling protocols, follows EPA's Data Quality Objective process, and is appropriate for the stated objectives. In 2005, Walter Coke used, with EPA's approval, EPA's established Simple Random Sampling. When potential exceedances of screening levels were noted for two constituents from this sampling, Walter Coke, with EPA's approval, followed the Systematic and Grid Sampling protocol in 2009. Even though no pattern was discernable from these results, particularly any pattern consistent with air dispersion of coal pile fines, which is EPA's claimed basis of responsibility, Walter Coke's recent proposed sampling plan used both the Systematic and Grid Sampling protocol, along with the Adaptive Cluster Sampling protocol (referred to in the plan as "adjacent sampling"). EPA and the National Institute of Health recognize these two methods as being particularly appropriate when found contamination is unevenly distributed, which clearly is the case in the neighborhoods.

Walter Coke is not saying that a focus on higher risk populations (e.g. children) is unjustified. However, to merely identify all such higher risk populations and completely abandon well-recognized and EPA-established methods of sampling is not appropriate. The selection of "every other property" as some random "alternate method" similarly follows no scientific principal or EPA sampling approach with which Walter Coke or its experts are familiar. As Regional Administrator Gwendolyn Keyes Fleming recently stated in an interview with CBS42, EPA Administrator Lisa Jackson has instructed her and all EPA Regions to base all decisions on science, and also stated that EPA Region 4 will use science to dictate where to sample next in the three communities in question. Walter Coke's proposed plan is based on science and EPA established sampling protocols, but EPA's is not. We do not wish to fight EPA on this issue, as that would delay the additional investigation Walter Coke has proposed in the neighborhoods, but we are convinced that, even with deference a court will give to EPA, EPA's methodology would not survive challenge.

Despite these conclusions, and without waiving its right to raise these issues at any time in the future, Walter Coke is offering to perform the sampling program on a basis substantially equivalent to EPA's most recent proposal with two exceptions relating to the particulars of the boundary, as discussed further below.

Nature, Extent and Responsibility for Cleanup Will Be Decided Following a Full Review and Evaluation of the Sampling Results

Walter Coke acknowledges that its proposed plan specified a commitment to both sampling and cleanup. However, EPA has rejected that plan and instead seeks to dramatically increase the number of initial sample locations, and to completely change and incorporate a completely unknown methodology for that sampling. Because of the significantly expanded sampling and methodology being suggested by EPA, and in light of the mounting evidence that the contaminants in the neighborhoods are likely the result of sources other than Walter Coke, it no longer makes sense for EPA and Walter Coke to agree now on what kind of cleanup is necessary. Thus, Walter Coke's proposal is that it first complete agreed sampling, fully review and assess the results with EPA and the communities, then address the issue of cleanup in a timely and expeditious fashion.

It is Way Past Time for EPA to Bring Other Potentially Responsible Parties to the Table

We have previously provided you with information and evidence of other potential sources of these contaminants detected in the neighborhoods. Indeed, all of the data and information in our possession strongly support the conclusion that Walter Coke is not a contributor to the contaminants being found in the neighborhoods. If EPA has specific documented evidence to indicate otherwise, we are open to reviewing it, but EPA has provided nothing in that regard, either to us or to others who have asked.

I am enclosing with this letter additional information that will make it even easier on EPA to perform this task. In any event, assuming EPA accepts Walter Coke's offer on the sampling program as described herein, then while that sampling is being conducted, it is essential that EPA take appropriate action to get other potentially responsible parties to the table to discuss any cleanup. EPA has many mechanisms in which this can be done, and thus they are not detailed in this letter. However, bringing these other parties to the cleanup table is a critical condition of Walter Coke agreeing to the radical sampling EPA is proposing. This step is necessary to be equitable to Walter Coke, is consistent with EPA's stated goal to focus on this area from an environmental justice point of view, and is fundamental to holistically addressing the significant amount of concern that now exists in the community.

Boundary

Despite the previous written agreement EPA and Walter Coke had on the boundary within which work would be performed, subject to public comment, EPA now seeks to add four new areas to the boundary. These areas are denominated in the draft EPA response as Areas D, E, F and G. Area D is next to the closed Carver school contains a total of 9 residential properties, and EPA proposes all 9 of these properties be sampled. Areas E, F and G are all outside the southern end of the agreed boundary.

Area D is a prime example of why it makes no sense for Walter Coke to agree in advance to an undefined cleanup. A stormwater ditch runs along the eastern edge of the closed Carver school, which is adjacent to Area D and these 9 residential properties. This stormwater ditch runs from Transport, Ltd. to Area D, and frequently floods the area, depositing silt and sediment on the residential yards in question. Although Walter Coke has not conducted an extensive evaluation, it is Walter Coke's understanding that Transport, Ltd. manages materials that could include the constituents of concern, in addition to a large asphalt surface area from which the constituents of concern could have been transported to Area D via stormwater and flooding. Area D is fairly remote from Walter Coke's operations and outside a boundary which already had a significant buffer added to it. Thus, contaminants discovered in Area D would more likely result from this deposition than from Walter Coke's operations. Notwithstanding these issues, if all other terms can be agreed upon, Walter Coke will consent to modifying the agreed sampling boundary by adding Area D.

However, Walter Coke's offer does not include sampling in Areas E, F, and G. These three areas are very far removed from Walter Coke, beyond what even air modeling would suggest could result in exceedances of arsenic or BaP TEQ. Perhaps more importantly, however, is the existence of significant historical and current industrial activity immediately adjacent to these areas. And, as Walter Coke has informed EPA in previous meetings, also immediately adjacent is a recently-closed facility that is under active RCRA Corrective Action (with the State of Alabama), including groundwater contamination under some of these areas EPA seeks to have Walter Coke sample. The concept of Walter Coke being required to take soil samples above groundwater contaminated by another industrial concern is, frankly, ludicrous. If contamination is discovered in these areas, it would more likely be from those operations, not Walter Coke's.

Health Study

Concern has been expressed, and repeatedly exacerbated by the media and other sources, that residents in the three communities are experiencing disease, including cancer, and deaths at a rate higher than other comparable communities. Without any apparent foundation, explicit links have repeatedly been asserted between Walter Coke's operations and health conditions suffered by residents. Walter Coke is aware that disease incidence rates in the overall population of the United States, particularly in the case of cancer, is well understood, yet the community has been led to believe, sometimes by EPA itself, that diseases or deaths that are occurring are in fact unusual and linked to Walter Coke and perhaps other industries. Such a conclusion or link can only be made after a rigorous health study or evaluation has been conducted which, to Walter Coke's knowledge, has not been performed. Even Regional Administrator Fleming was recently asked about it.

It has become critical to determine if the community is experiencing higher than expected incidence rates of health effects, and, if so, what is their cause. A representative from ATSDR was part of our joint meetings with EPA in 2010, but no ATSDR representative has been part of our meetings since then. It seems to Walter Coke that ATSDR should long ago have been tasked with conducting a health evaluation to address the residents' concerns. While we recognize that ATSDR and EPA are separate government agencies, and that EPA has no direct control over ATSDR, EPA and ATSDR often work hand-in-hand and certainly ATSDR was part of the team in multiple meetings. Indeed, EPA brought an ATSDR representative to community meetings earlier this year to discuss the gardening issue. In any event, Walter Coke strongly believes that an evaluation of these concerns, whether by ATSDR or some other government agency, would be very helpful as cleanup decisions are being made following sampling and, thus, Walter Coke's offer to perform the sampling program we have outlined in this letter is conditioned on a commitment being made for such an evaluation to part of the agreement with Walter Coke. We do not view this request as being controversial in any way.

Mechanism Through Which Sampling Will Be Performed

As previously discussed in this letter, Walter Coke's view is that, in light of EPA's rejection of Walter Coke's work plan and the radical departure EPA has taken to the sampling concepts previously discussed, it is more appropriate to conduct sampling before any decisions or commitments are made regarding the nature, scope, and responsible party participation in any cleanup. Assuming EPA is prepared to accept Walter Coke's offer to conduct the sampling program, the Company is open to discussing doing so through the existing framework under which residential work has been conducted to date or to having the sampling performed via a new agreed order specifying the sampling program. We have not reached our own definitive position on whether a new agreement/order should be entered regarding the sampling, but we wanted to let you know we are interested in pursuing this discussion with you. Advantages and disadvantages likely exist under either option, both for EPA and for Walter Coke.

Walter Coke thanks you for your attention to the issues raised in this letter. We are hopeful that we can reach an agreement on a path forward that properly addresses community concerns. Walter Coke is committing to do more than its part by continuing with a robust sampling program, provided that EPA commits to involving other apparent sources and to arranging for a science-based health study to help address the fears that have been aroused within our community.

Very truly yours,

Chuck Stewart

Chuck Stewart, President

Enclosures

ATTACHMENT

OVERVIEW OF POTENTIAL SOURCE EVALUATION FOR THE NORTH BIRMINGHAM AREA

Introduction

This Overview reflects Walter Coke's efforts to date to evaluate the likelihood that emissions from third-party sources have resulted in arsenic and polyaromatic hydrocarbons (PAHs-BaP TEQ)[1] concentrations identified in soils within the North Birmingham industrial district immediately surrounding Walter Coke. A three part analysis was undertaken as follows:

1. Historical Analysis - investigation of past and currently operating industries that are known to have various types of air and fugitive emissions that contain arsenic and/or BaP TEQ;
2. Forensic Analysis – compare/contrast identified industrial source signatures with collected residential soils data; and
3. Spatial Analysis – mapping of arsenic and BaP TEQ soils concentrations to confirm/deny potential spatial trends indicative of a single source release.

Historical Analysis

The North Birmingham industrial district was first developed in 1886 and rapidly grew into a major hub for the iron and steel industry in the southern United States with peak operations and production occurring in the 1950s[2]. Over this 125 year period, the immediate area surrounding the Walter Coke Facility has had seven (7) documented major industries operating concurrently at various levels of production[3] (see *Figure 1*). The industry categories include:

- Foundries & Kilns [NAICS[4] Codes: 331511, 332911]
- Coal & Coke ByProducts, [NAICS Codes: 324199, 331111]
- Iron/Scrap Metals Processing, [NAICS Codes: 332312, 332313, 332322]
- Stone/Cement/Asphalt Aggregates, [NAICS Codes: 211111, 324121, 327320, 212312, 327331]
- Auto/Truck Salvage, [NAICS Codes: 811111, 336211, 336212]
- Specialty Chemicals, and [NAICS Codes: 424690, 325510, 326291]
- Transloading Terminals. [NAICS Codes: 488490]

In total, the above industry categories comprise 76 unique facilities (point sources) within an area in the immediate vicinity of the three neighborhoods. Such industry categories are known to be associated with both metals and polyaromatic hydrocarbons (*i.e.,* arsenic and BaP TEQ emissions[5]).

---

[1] Reported in benzo(a)pyrene toxicity equivalents (BaP TEQ)
[2] *"The Birmingham District, An Industrial History and Guide"*, Birmingham Historical Society, 1981.
[3] USEPA FRI Database, TRI Database, Sanborn Insurance Maps, USGS, directory of steel and iron works of the United States and Canada (1904), Birmingham News.
[4] NAICS (North American Industry Classification System).
[5] USEPA TRI Database, Handbook of Chemical Technology and Pollution Control, Hocking, 1993.

Figure 1 – Point and Non-Point Source Category Time Line

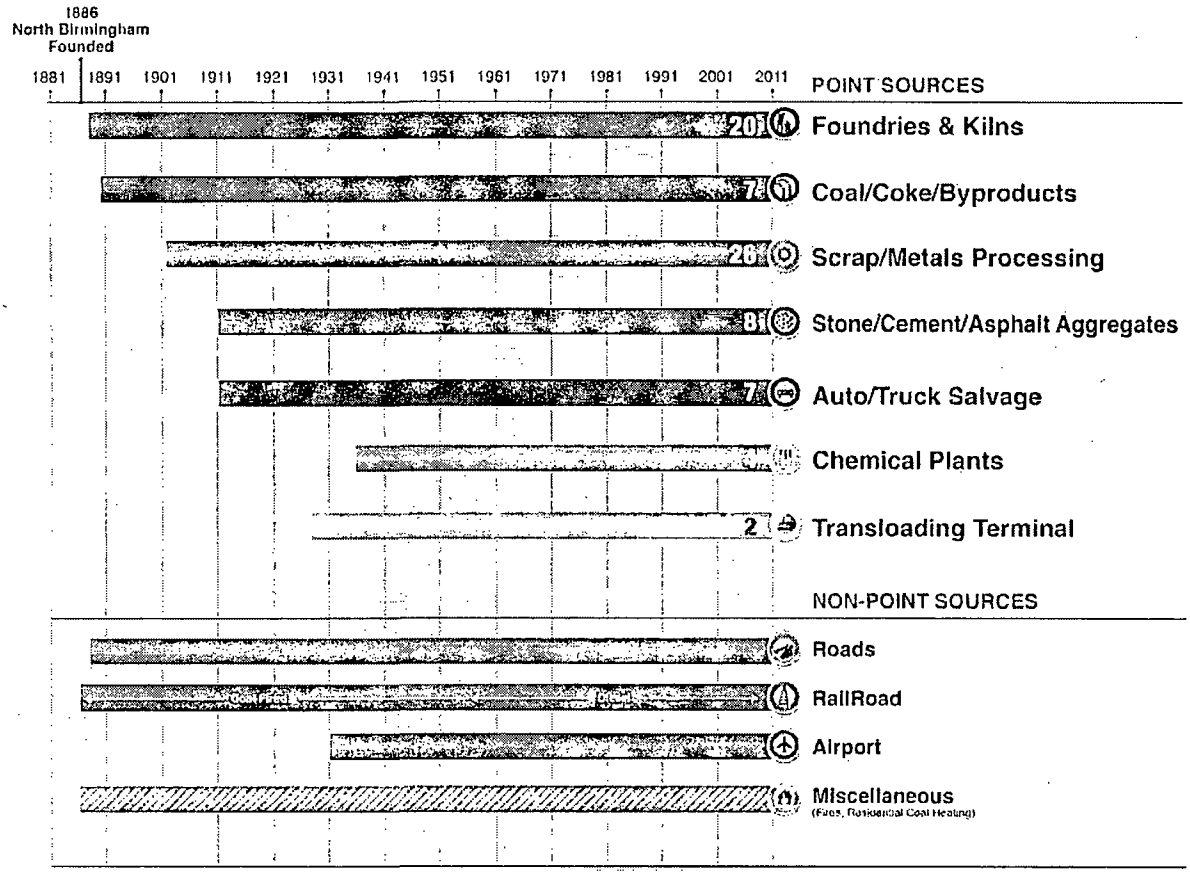

In addition to the above-described point sources, a variety of non-point source emissions of arsenic and BaP TEQ have also been present over the last century. These non-point sources include automobile/truck traffic emissions, railroad (locomotive) emissions, industrial fires, aircraft emissions, and residential sources such as coal burning for heat, treated lumber/wood, random house fires and backyard debris burning[6] (*see Figure 1*). The figure above (*Figure 1*) provides a timeline illustrating the durations of each of these point and non-point sources over the last 125 years.

[6] Aerial Photography: 1941, 48, 56, 60, 67, 70, Birmingham Post Herald, USGS, Monsanto Research Corporation (1979). Source Assessment: Residential Combustion of Coal. Prepared for the Environmental Protection Agency under contract 68-02-1874.

The figure below (*Figure 2*) provides a timeline illustrating the operational duration of each of the identified point source facilities by industrial category. It should be noted that 37 of the identified 76 facilities (approximately 50%) currently operate within the relevant area.

Figure 2 – Industrial Point Source Facility Operations Time Line

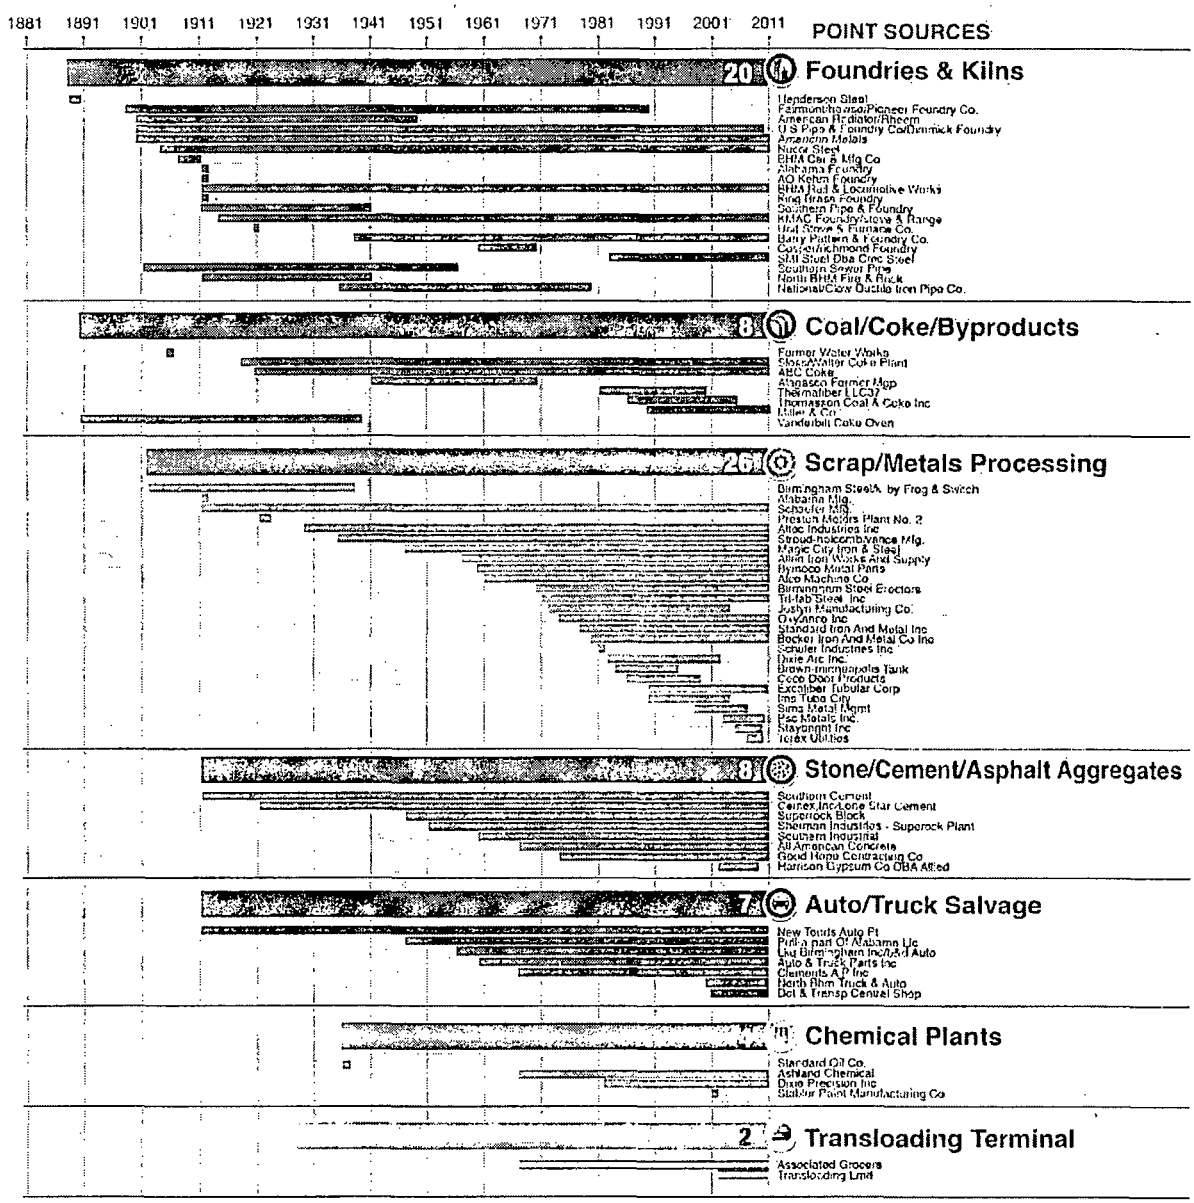

Also, provided is a map that depicts the location of all identified point and non-point sources (*Figure 3*).

Figure 3 – Point and Non-Point Source Location Map

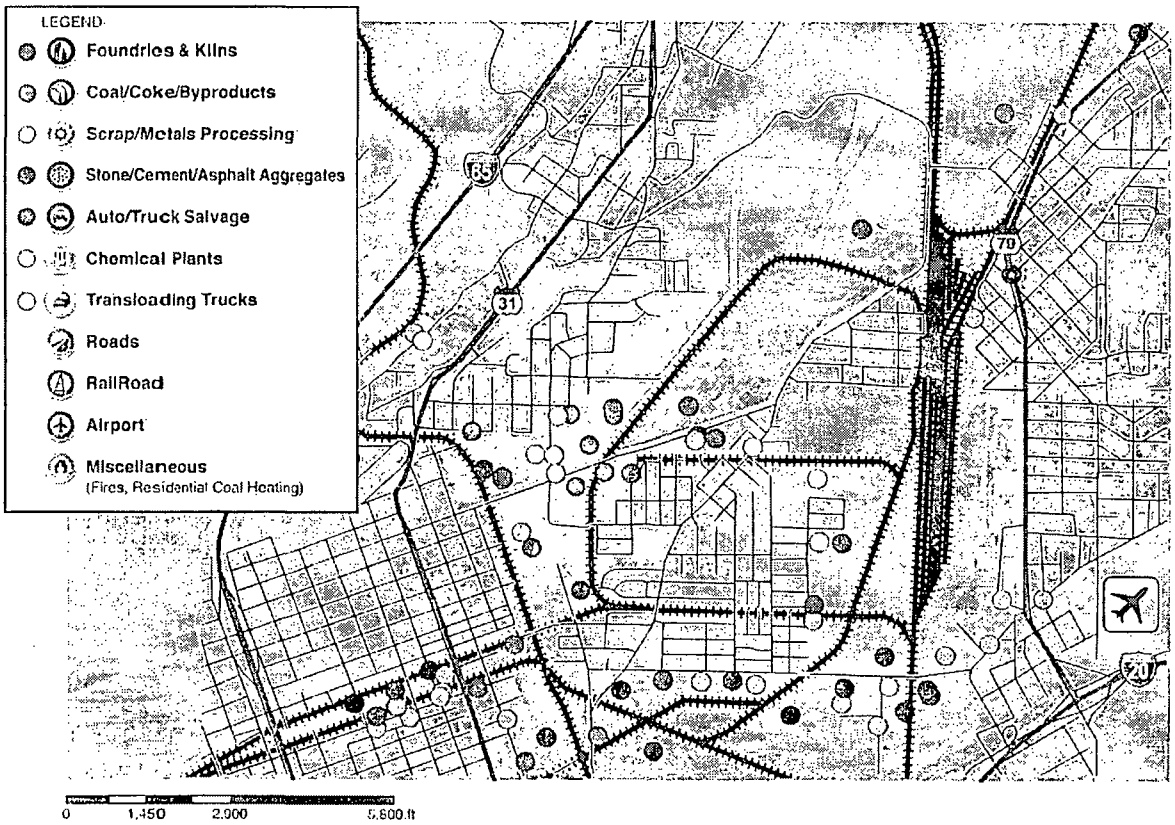

This historical analysis indicates that the above-described point and non-point sources must be considered in reaching any conclusions about the origin of BaP TEQ and arsenic concentrations that have been observed in soil samples from residential and school properties. The following forensic and spatial analyses will further evaluate this aggregation.

Forensic Analysis

To further evaluate the existence of multiple sources of arsenic and BaP TEQ emissions within the area, a preliminary forensic analysis was undertaken. Specifically, the analyte specific ratio of arsenic to benzo(a)pyrene was calculated for a variety of the identified point and non-point sources (including the coke oven emission source) and directly compared to the observed arsenic to benzo(a)pyrene ratio in the available residential soil samples. The goal of this analysis was to determine the degree to which the signature of various potential sources of benzo(a)pyrene and arsenic is consistent with the signature that is present in the residential and school sampling.

Typical ratio signatures for arsenic to benzo(a)pyrene were first calculated for the below listed types of sources utilizing USEPA AP-42 emissions factors[7] (*see Figure 4*).

Figure 4 – Source Signatures (arsenic:benzo(a)pyrene)

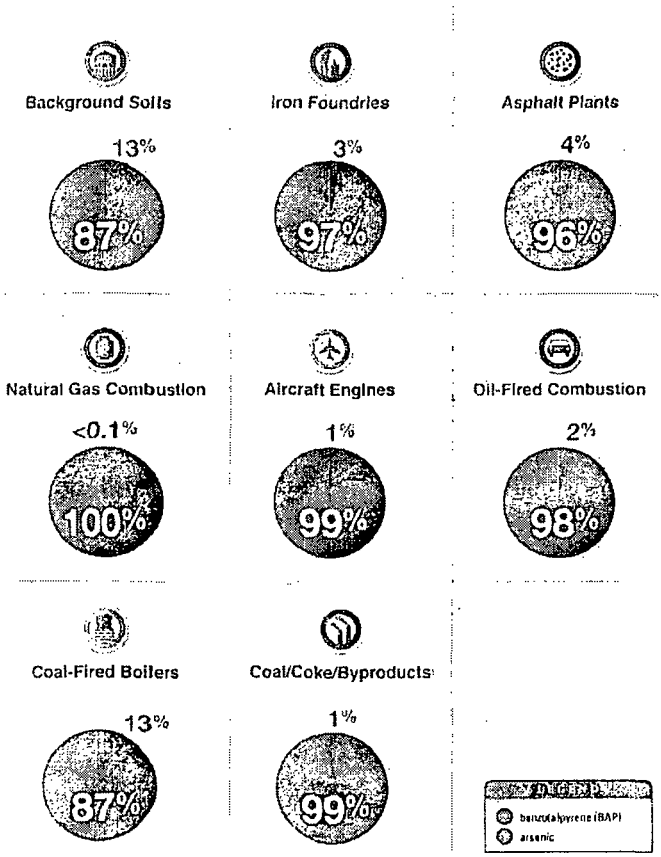

As illustrated in Figure 4, the coke emissions signature is distinctly different than the six other identified sources. Specifically, the coke oven source is dominated by benzo(a)pyrene where the other sources are dominated by arsenic.[8]

Next, the corresponding arsenic to benzo(a)pyrene ratio signatures were calculated for each of the collected residential and school soil samples for direct comparison with the above-illustrated source

[7] U.S. EPA (1998) Compilation of Air Pollutant Emission Factors (AP-42), 2002 emissions inventory report for Walter Coke in support of Jefferson County Department of Health annual emissions reporting requirements.

[8] Walter Coke coal piles are not considered relevant to determining its emissions profile as available information indicates that the coal contains concentrations of arsenic and BaP TEQ significantly below the EPA-determined cleanup criteria for each. There is no evidence suggesting the coal piles have had releases that would explain the elevated contaminant values, much less the spatial distribution of those contaminants, observed in the community.

signatures. The figure below (*Figure 5*) illustrates this comparison with the following key observations noted:

- A substantive majority of the soil sample arsenic-to-benzo(a)pyrene ratios are dominated by arsenic and are similar in pattern to the aircraft engines, oil-fired combustion, iron foundries, asphalt plants, and natural gas combustion source signatures. They are conversely inconsistent with coke emissions.

- Approximately 1% (4 out of 332) samples of the soil sample arsenic-to-benzo(a)pyrene ratios are dominated by benzo(a)pyrene. Importantly, the location of these four samples reflect specific likely benzo(a)pyrene sources other than coke emissions. Specifically, samples were collected from the drip line of an elementary school where the tar roof had recently been repaired/resurfaced, with visible indications of roof tar (coal tar) drips/leakage to the proximal soils in the drip line. It is far more likely that this obvious source accounted for the observed concentrations of benzo(a)pyrene than any hypothesis that air emissions from Walter Coke uniquely impacted this particular location without similarly impacting other locations in the vicinity.

- An area with noted elevated benzo(a)pyrene-dominated ratios was found to be proximal (approximately 250 feet) to a 2005 major tire fire.[9] These highly localized benzo(a)pyrene results are consistent with localized impacts from the combustion of tires.

- Two samples with benzo(a)pyrene-dominated ratios were also found proximal to a recently constructed and paved asphalt parking lot for the Hudson School; asphalt/tar application activities would be an indication of a localized source of benzo(a)pyrene impacts.

[9] "Firefighters battle blaze at site of 3,000 tires", Birmingham News, August 1, 2005.

Figure 5 – Signature Source Comparison to Residential Soils

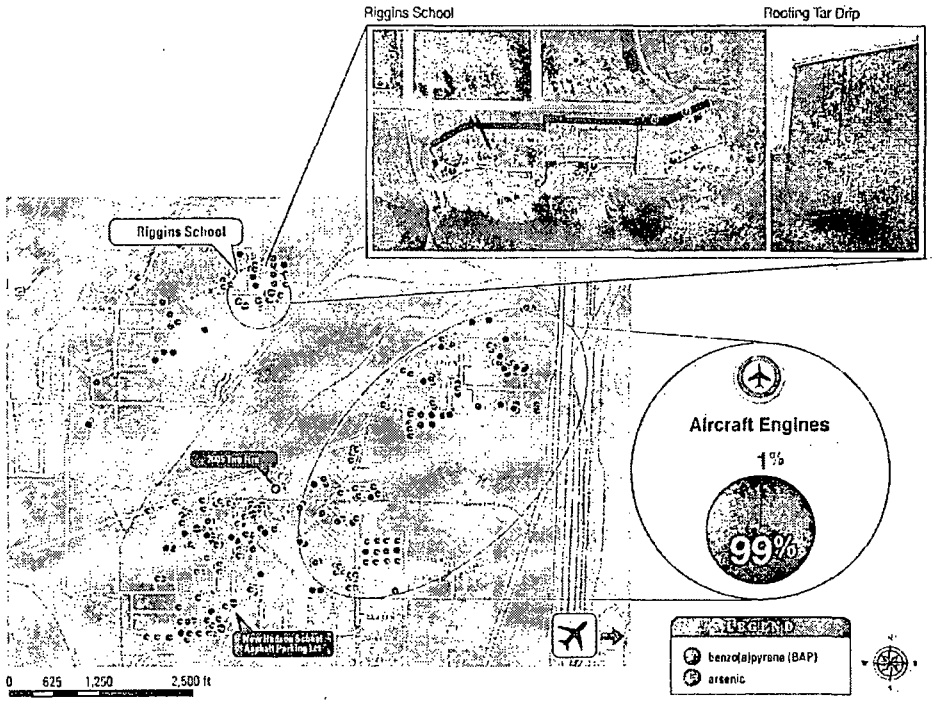

Spatial Analysis

To further investigate the potential of multiple source impacts in the area, soil concentrations of the arsenic and BaP TEQ soil were mapped to assess and evaluate the presence of spatial trends or patterns. Specifically, if the concentrations in the area were the result of a large single source of fugitive emissions, then soil concentrations would be expected to reveal a spatial trend where high concentrations are found proximal to the single source boundary and concentrations would decrease in value with greater distance from the source boundary. However, as illustrated in the Figure below (*Figure 6*), both arsenic and BaP TEQ concentrations display an almost random pattern of areas of high and low concentrations independent of distance from the Walter Coke Facility. Assuming for purposes of discussion only that the concentrations are related to emissions of any kind, this would strongly suggest that multiple point and non-point sources are contributing to and confounding the patterns of observed soil concentrations. Likewise, this pattern suggests that the observed concentrations are likely to relate to some extent to non-emission sources, such as fill used on various properties. To that end, initial yard excavations have revealed obvious fill materials containing items such as slags, refractory bricks, and shingles, thus presenting evidence supporting a conclusion that fill material unrelated to Walter Coke emissions (or any other industrial emissions) accounts for at least some of the observed concentrations.

Figure 6 – Spatial Analysis of Arsenic and BaP TEQ

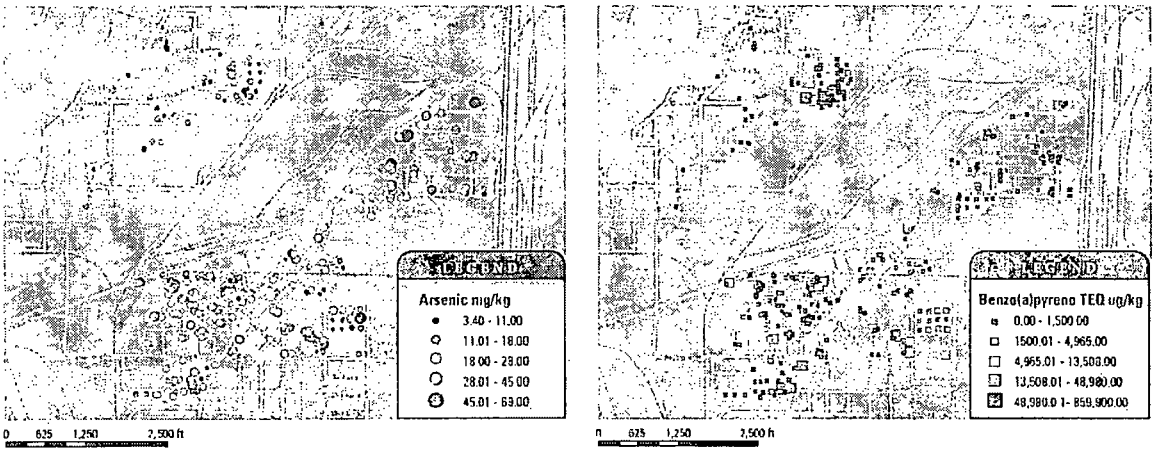

Summary of Findings

In all, when considering the combined findings from the historical, forensic and spatial analyses, it is clear that a variety of both legacy and current industrial point and non-point sources have contributed to the present soil concentrations of arsenic and BaP TEQ in residential soils. More importantly, the combined findings effectively demonstrate that Walter Coke is likely not the source of the observed impacts and could not possibly be the sole source of elevated arsenic and BaP TEQ concentrations in the surrounding community.

ENCLOSURE 11

WALTER COKE

For more information:
Dennis Hall
(205) 481-6905

FOR IMMEDIATE RELEASE
December 23, 2011

WALTER COKE, EPA CONTINUE DIALOG ON COMMUNITY CLEANUP EFFORTS
NEXT STEPS BEING DISCUSSED WITH EPA

BIRMINGHAM, Ala. (December 23, 2011) – The United States Environmental Protection Agency (EPA) has informed Walter Coke that the agency's investigation and cleanup efforts in several North Birmingham neighborhoods will be conducted under EPA's "Superfund" authority, instead of the "RCRA" authority that EPA has been using up until now.

"Walter Coke welcomes this step," said Chuck Stewart, the company's President. "In many ways, EPA's decision reflects an acknowledgment of points that Walter Coke has been making for a long time."

The federal Superfund law, also known as CERCLA, allows EPA to consider bringing additional parties into the cleanup process who may have historically or currently contributed to environmental conditions in the community. Until now, EPA was using a different law, RCRA, which focuses primarily on current facilities having certain permits. Walter Coke has a RCRA permit.

The overall nature and scope of sampling and cleanup efforts are not expected to be materially affected by EPA's decision. Instead, this step relates primarily to the administrative process that EPA will use, including the process for identifying additional potentially liable parties, or PRPs. PRPs include companies with either current or previous industrial operations in the same area that may have contributed to the presence of substances considered to be soil contaminants.

This is the latest development in an ongoing project conducted in coordination between EPA and Walter Coke. Working cooperatively with EPA, Walter has already successfully completed soil replacements at nearly two dozen residential properties in the Collegeville area of North Birmingham. EPA's decision came after a September 6, 2011 Walter Coke proposal to EPA for future conduct of investigations in the area and various information that the company supplied indicating that Walter is likely not the source of contaminants that have been found.

The primary contaminant of concern, Benzo(a)pyrene Toxicity Equivalents, or BaP TEQs, are caused by a wide range of normal industrial and non-industrial activities involving combustion. Common BaP TEQ sources other than industries include automobile engines, coal or wood burning stoves and furnaces, trash and leaf burning, outdoor cooking, and roofing materials.

Walter Coke believes that the elevated levels of BaP TEQ and arsenic that have been detected sporadically in soils in the neighborhoods at levels that EPA considers elevated are very unlikely, as a scientific matter, to be from air emissions from its facility. Walter has nonetheless cooperated with EPA on investigation and cleanup efforts. As that cleanup work has progressed, Walter Coke has discovered far more likely sources present in various residential yards, including buried roofing shingles and other buried industrial fill material that have been shown to have elevated BaP TEQ.

In an another important next step, the Agency for Toxic Substances and Disease Registry (ATSDR) has now initiated a study of health concerns in the Collegeville, Fairmont and Harriman Park communities. Such a study was requested by Walter Coke and also by concerned community leaders.

“We are glad to see the ATSDR will conduct a health study as we and the community have requested,” said Stewart. “We intend to continue being a good neighbor in our community, and we remain fully engaged with the EPA and local citizens to resolve public concerns over environmental issues.”

# # #